

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/MSG23007579/TNY3E2**Date:** 28/07/2023REFERENCE

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	1001883269
Claimant Vehicle No :	FBU52R	Insured Vehicle No :	FBK6700S
Date of Loss:	24/07/2023	Nature of Claim:	TP
		Claim No:	323378

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBU52R	Engine No:	ZDM1262VC013729
Make & Model:	DUCATI MULTISTRADA 1260, 1.3 PIKES PEAK	Chassis No:	ZDMAC00AALB014633
Reg. Date:	24/03/2020 (Man. Year: 2020)	Odometer:	0 km
Colour:	Red		
Engine Capacity:	1262 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	120/70 R17	Rear Tyre Size:	190/55 R17
Front Left Side:	MITAS 5 mm	Rear Left Side:	MITAS 5 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	26/07/2023		
Date Inspected:	26/07/2023	Inspected At:	SG Motor Pte Ltd (HQ) 8 Kaki Bukit Avenue 4, #03-03 Singapore 415875
Estimated Period of Repair:	7.0 days		

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$8,000.00
-\$10,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 28 Jul 2023)	
Parts:	N/A	DUCATI MULTISTRADA 1260 1.3 PIKES PEAK (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBU52R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >