

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/III23004814/TNY3M4-1**Date:** 03/08/2023REFERENCE

Handling Insurer:	India International Insurance Pte Ltd	Policy No:	D23MFL0002582
Claimant Vehicle No :	SLB2743Z	Insured Vehicle No :	SLD6999R
Date of Loss:	05/05/2023	Nature of Claim:	TP
		Claim No:	MFL2023D0004918

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLB2743Z		
Make & Model:	MAZDA 3, 1.5 L 4-DOOR SEDAN SP.6EAT (A)	Engine No:	P520351990
Reg. Date:	31/03/2016 (Man. Year: 2016)	Chassis No:	JM6BM42A8G0335193
Colour:	Red	Odometer:	72346 km
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/45R18	Rear Tyre Size:	215/45R18
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	13,452.48	9,617.60	3,834.88	28.51
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,450.00	2,830.00	1,620.00	36.40
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	17,902.48	12,447.60	5,454.88	30.47
Approved Total (Overridden) (S\$)		9,950.00		
Nett Amount (S\$)	17,902.48	9,950.00	7,952.48	44.42

INSPECTION

Date of Assignment:	31/07/2023	
Date Inspected:	11/05/2023 Inspected At:	KING'S AUTO REPAIR & SERVICE PTE LTD 176 SIN MING DRIVE, #02-10, SIN MING AUTOCARE, SINGAPORE 575721
Estimated Period of Repair:	10.0 days	

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 03 Aug 2023)
Parts:	143	MAZDA 3 1.5 L 4-DOOR SEDAN SP.6EAT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLB2743Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Deformed/Dented	1,128.00 FL	*1,074.80 FL
2	1		*REAR BUMPER RH REVERSE SENSOR 2PCS	Broken/Malfunction (1Pc Only)	386.00 FL	*193.00 FL
3	4		*REAR BUMPER REVERSE SENSOR RETAINER	Broken/Necessary	144.40 FL	*144.40 FL
4	1		*REAR BUMPER REVERSE SENSOR WIRE HARNESS	Broken/Cut	221.00 FL	*221.00 FL
5	1		*REAR BUMPER RH REFLECTOR	Broken/Cracked	52.90 FL	*52.90 FL
6	1		*REAR BUMPER RH TOW COVER	Broken/Missing	25.00 FL	*25.00 FL
7	1		*REAR BUMPER RH SIDE RETAINER	Deformed/Broken	75.60 FL	*75.60 FL
8	1		*REAR BUMPER INNER REINFORCEMENT	Dented/Bent	563.80 FL	*537.30 FL
9	1		*SET REAR BUMPER CLIPS	Broken/Necessary	50.00 FL	*50.00 FL
10	1		*REAR BUMPER RH SIDE SPLASH SHIELD	Deformed/Broken	104.00 FL	*104.00 FL
11	1		*SET REAR BUMPER RH SIDE SPLASH SHIELD CLIPS	Broken/Necessary	40.00 FL	*40.00 FL
12	1		*REAR BOOT LID	Repair	1,004.80 FL	*- FL
13	1		*REAR BOOT CENTRE MAZDA LOGO	Necessary	77.00 FL	*77.00 FL
14	1		*REAR BOOT LH MAZDA 3 EMBLEM	Necessary	55.00 FL	*55.00 FL
15	1		*REAR BOOT RH SKYACTIV EMBLEM	Necessary	66.00 FL	*66.00 FL
16	1		*REAR BOOT RH SIDE LAMP	Grazed/Cut	286.00 FL	*286.00 FL
17	1		*RH TAILLAMP	Broken/Cut	562.00 FL	*562.00 FL
18	1		*RH TAILLAMP PANEL	Buckled	395.00 FL	*295.00 FL
19	1		*REAR END PANEL	Buckled	586.70 FL	*435.70 FL
20	1		*REAR END PANEL TOP GARNISH	Not Necessary	104.00 FL	*- FL
21	1		*REAR RH FENDER	Buckled	1,232.00 FL	*915.00 FL
22	1		*REAR RH FENDER LOWER AIR VENT	Deformed/Broken	71.60 FL	*71.60 FL
23	1		*REAR RH FENDER UNDER SPLASH SHIELD	Deformed	132.60 FL	*132.60 FL
24	1		*SET REAR FENDER UNDER SPLASH SHIELD CLIPS	Necessary	40.00 FL	*40.00 FL
25	1		*REAR RH FENDER INNER SIDE TRIM	Not Necessary	246.00 FL	*- FL
26	1		*SET REAR WINDSCREEN MOULDING	Necessary	107.00 FL	*107.00 FL
27	1		*REAR RH SHOCK ABSORBER	Bent	233.00 FL	*233.00 FL
28	1		*REAR RH SHOCK ABSORBER TOP MOUNTING	Bent/Torn	104.00 FL	*104.00 FL
29	1		*REAR RH LOWER ARM	Bent	245.00 FL	*245.00 FL
30	1		*REAR RH TOP ARM	Bent	181.00 FL	*181.00 FL
31	1		*REAR RH TRAILING ARM	Bent	200.90 FL	*200.90 FL
32	1		*REAR RH KNUCKLE ARM	Bent/Broken	685.00 FL	*422.50 FL
33	1		*REAR RH WHEEL HUB & BEARING	Bent/Noisy	434.00 FL	*245.10 FL
34	1		*REAR RH LOWER CONTROL ARM	Bent	148.00 FL	*148.00 FL
35	1		*REAR STABILIZER BAR	Bent	296.00 FL	*296.00 FL
36	2		*REAR STABILIZER BAR BUSH	Necessary	64.00 FL	*64.00 FL
37	2		*REAR STABILIZER BAR BUSH BRACKET	Bent	72.00 FL	*72.00 FL
38	1		*REAR STABILIZER BAR RH LINK ROD	Bent/Loose	91.50 FL	*91.50 FL
39	1		*REAR LOWER CROSS MEMBER	Bent	872.40 FL	*872.40 FL
40	1		*REAR RH LOWER EXHAUST SILENCER	Bent	1,128.00 FL	*1,024.70 FL
41	4		*REAR RH LOWER EXHAUST SILENCER MOUNTING	Deformed/Cut	136.00 FL	*136.00 FL
42	1		*REAR BUMPER LOWER SKIRTING	Dented/Cut	850.00 FS	*600.00 FS
43	1		*REAR BUMPER LOWER SKIRTING RH EXHAUST CHROME PIPE	Badly Dented/Bent	150.00 FS	*100.00 FS
44	1		*REAR RH SPORT RIM	Dented/Warped	700.00 FS	*700.00 FS

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CUT OUT DAMAGE PORTION, JACK OUT, STRAIGHTEN, PANEL BEATING, WELDING, ALIGN AND RENEW REPLACED PARTS	New	1,600.00	1,000.00
2	TO PUTTY AND RESPRAY PAINTING ON AFFECTED AREAS	New	1,800.00	1,200.00
3	TO REMOVE, REFIX REAR WINDSCREEN GLASS	New	140.00	120.00
4	TO CHECK WIRINGS AND LIGHTINGS	New	50.00	30.00
5	TO REMOVE, REFIX REVERSE SENSORS	New	80.00	60.00
6	TO REMOVE, REFIX ROOF LININGS, REAR SEATS, CARPET AND TRIMS	New	200.00	100.00
7	TO REMOVE, REFIX REAR UNDER CARRIAGES	New	340.00	200.00
8	TO CONDUCT COMPUTERISE WHEEL ALIGNMENT TEST	New	120.00	80.00
9	TO SUPPLIED AND APPLIED ANTI RUST TREATMENTS	New	120.00	40.00
Gross Labour Cost (S\$)			4,450.00	2,830.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >