



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLB 7161U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR BOOTLID	TO REPAIR SEE LABOUR	781.10	-
1	REAR BOOTLID WEATHER STRIP	NOT NECESSARY	185.00	-
1	REAR RH TAILLAMP	CRACKED	391.90	391.90
1	REAR RH TAILLAMP INNER BLACK GASKET	NECESSARY	31.00	31.00
1	REAR RH TAILLAMP INNER PANEL	NOT NECESSARY	374.60	-
1	REAR RH TAILLAMP LOWER BRACKET	BENT	132.10	118.30
1	REAR RH FENDER	NOT NECESSARY	977.70	-
1	REAR BUMPER	CRACKED	581.60	482.20
2	REAR BUMPER SIDE RETAINER L/R	N/S NOT NECESSARY / O/S CRACKED	264.20	116.00
2	REAR BUMPER END SEAL L/R	NECESSARY	375.00	110.20
2	REAR BUMPER REFLECTOR L/R	N/S NOT NECESSARY / O/S CRACKED	282.90	116.00
1	REAR BUMPER REINFORCEMENT	BENT	398.70	398.70
2	REAR BUMPER REINFORCEMENT BRACKET L/R	N/S NOT NECESSARY / O/S BENT	150.20	75.10
1	REAR END PANEL INNER TOP GARNISH	NOT NECESSARY	391.60	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	781.90	-
LESS 25% DISCOUNT			-1,524.88	-459.85
			4,574.62	1,379.55
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET REAR RH TAILLAMP CLIPS (SN)	NECESSARY	30.00	20.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	FAULTY	350.00	200.00
			460.00	250.00
<b><u>LABOUR</u></b>				
TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING AND REWIRE FOR PARKING SENSOR.			120.00	30.00

Report Ref No. CS3/LPC23006499/Tny3e2-1



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE, REINSTALL TOP TRIM, TRIM GARNISH, TRIM LINER.		100.00	60.00
	TO RE-SPRAY PAINTING ON THE CHANGE BODYPARTS, REPAIR PORTION, AND WHERE CONSISTENT TO THE ACCIDENT.		1,200.00	600.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		100.00	30.00
	TO PROVIDE LABOUR TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURES CONSISTENT TO THE ACCIDENT. INCLUSIVE OF THE REPAIR OF REAR BOOTLID AND REAR END PANEL.		1,000.00	500.00
			2,520.00	1,220.00
<b>GRAND TOTAL</b>			<b>7,554.62</b>	<b>2,849.55</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>2,250.00</b>

Report Ref No. CS3/LPC23006499/Tny3e2-1

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

ANG BRYAN TANI

Automotive Assessor / Investigator

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.