

AUTO PERFORMANCE APPRAISAL

APA

VEHICLE SURVEY REPORTS

Muhammad Raihan Bin Abdul Rahim
C/O King's Auto Repair & Service Pte Ltd
176 Sin Ming Drive
Sin Ming AutoCare #02-10
Singapore 575721

1 Reference

Job Reference No : 23/002730
Claim No : -
Claim Type : Third Party
Accident Date : 27/05/2023
Survey Date : 07/06/2023
Survey Report Date : 16/06/2023

2 Particulars Of Vehicle

Vehicle Registration No : SKT3250P
Make & Model : Volkswagen Golf A7 1.4 TSI
Vehicle Registration Date : 29/05/2015
Chassis No : WVVZZZAUZFW185909
Engine No : Blocked
Colour : Grey

3 Condition Of Vehicle And Tyres

<u>Mileage (KM)</u>	<u>Brakes</u>	<u>Steering</u>	<u>Modification</u>
132486	Serviceable	Serviceable	None
<u>Tryes</u>	<u>Make</u>	<u>Size</u>	<u>Balance (MM)</u>
Front RHS	Michelin	225/40ZR18	6
Front LHS	Michelin	225/40ZR18	6
Rear RHS	Michelin	225/40ZR18	6
Rear LHS	Michelin	225/40ZR18	6

4 Description Of Damages

The vehicle sustained damages at rear portion.
(For information of damages please refer to Parts/Labour/Photographs attached)

5 Instruction

This survey was conducted entirely on a "WITHOUT PREJUDICE" basis, and we have not authorised any repair.

AUTO PERFORMANCE APPRAISAL

Annex A

Vehicle Assessment Reports

Ref No : 23/002730

Damage And Repair Cost Adjustment

<u>S/No</u>	<u>Qty</u>	<u>Parts Description</u>	<u>Comments/condition</u>	<u>Workshop Estimate (\$)</u>	<u>Our Assessment (\$)</u>
<u>List Items</u>					
1	1	Rear bumper	Dented/broken	995.70	995.70
2	2	Rear bumper reflector	Broken/cut	124.00	<i>sn</i> 124.00 X
3	1	Rear bumper RH tow cover	Deformed	30.00	<i>sn</i> 30.00 X
4	2	Rear bumper side retainer	Broken	232.00	<i>sn</i> 232.00 X
5	2	Rear bumper corner retainer	Broken	134.00	<i>sn</i> 134.00 X
6	1	Rear bumper inner top centre impact beam	Deformed/broken	126.00	126.00
7	1	Rear bumper inner reinforcement	Dented/bent	421.00	421.00
8	2	Rear number plate lamp	Serviceable/reuse	84.00	-
9	1	Rear end panel	Badly dented/bent	698.20	<i>R</i> 698.20 <i>1245m</i>
10	1	Rear end panel top garnish	Serviceable/reuse	208.00	-
				3,052.90	2,760.90
Less discount 10%				305.29	276.09
Total :				2,747.61	2,484.81
<u>Special Nett Items</u>					
11	1 set	Rear number plate	Cut/grazed	70.00	70.00 <i>451m</i>
12	1	Rear bumper lower diffuser	Broken/dented	650.00	650.00
13	1 set	Reverse sensor	Wire snapped/malfunction	280.00	<i>sn</i> 280.00 X
14	1 set	Rear reverse camera	Malfunction	550.00	<i>sn</i> 550.00 X
15	1 set	Rear windscreen sealant	Necessary	50.00	<i>sn</i> 50.00 X
Total :				1,600.00	1,600.00
Total Spare Parts :				4,347.61	4,084.81

AUTO PERFORMANCE APPRAISAL

Vehicle Assessment Reports

Annex B

Ref No : 23/002730

Damage And Repair Cost Adjustment

<u>Items</u>	<u>Job Description</u>	<u>Workshop Estimate (\$)</u>	<u>Adjusted Costs (\$)</u>
1	To remove, jack out, straighten, panel beating, align and renew replaced parts.	1,000.00	700.00 <i>40d</i>
2	To putty and respray painting on affected areas.	1,200.00	800.00 <i>44d</i>
3	To remove, refix rear upholstery & attachments.	120.00	<i>nn</i> 80.00 <i>X</i>
4	To check wirings and lightings.	50.00	30.00 <i>2d</i>
5	To supplied and applied rust proofing treatments.	100.00	<i>nn</i> 60.00 <i>X</i>
Total Labour :		2,470.00	1,670.00
Total Spare Parts :		4,347.61	4,084.81
Total Labour :		2,470.00	1,670.00
Total Repair Costs :		6,817.61	5,754.81

Assessor's Recommendation

Repairer Estimate :	<u>6,817.61</u>
Our Adjustment :	<u>5,754.81</u>

Remarks

We have thoroughly inspected each and every items on the estimate against the physical damage found on the vehicle. We have listed the breakdown of our finding and our recommendation as per assessment above.

The repairer have agreed to undertake the repair on a lump sum basis of \$4,600.00, with a repair period of *3 days* working days.

Surveyed By:



Lek Boon Hwee
Automobile Appraiser