GARAGE 13 PTE LTD

8 KAKI BUKIT AVE 4 #()3-46 PREMIER@KB SINGAPORE 415875 TEL: 9666 4445

Denise.

PROFORMA INVOICE

To: Twin Full Engineering

Invoice No.

G13/20003

Date

15/09/2020

Vehicle No.

GBJ4890U

No.	Description	Qty	Unit Price	Amount	
1	Repair cost	1	\$ 10,800.00	\$ 10,800.00	
			Total:	\$ 10,800.00	

Payment by cheque should be crossed and made payable to 'Garage 13 Pte Ltd'

Issued By

Authorised Signature



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

Our reference:

20-08-9365

Date:

17/8/2020

c/o Garage 13 Pte Ltd 8 Kaki Bukit Ave 4 #03-46 Premier@KB Singapore 415875

Dear Sirs

RE:

Road Traffic Accident on 29/7/2020

Twin Full Engineering

In accordance with your instructions received in this office or

3/8/2020

, we made arrangements to

examine the vehicle on

3/8/2020

at above-mentioned address. The following data was

recorded:

Vehicle details


Make	Toyota	Registration	GBJ4890U
Model	Dyna	Chassis	JTFAT35Y10K213076
Colour	White	Gearbox	Manual
Odometer	45079km	Paintwork	Good
Steering	In order	Brakes	In order
Condition	Good		

Tyre Depths

Front left	195/75R15	85% BS
Front right	195/75R15	85% BS
Rear left	155R12C	85% BS
Rear right	155R12C	85% BS

Status	REPAIRABLE
Magnitude	Medium
Legal status	Unroadworthy

Impact Direction & Area of Damage:

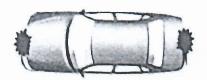

Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of \$10,800.00 and 11 working days for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

Subsidiaries of Impact Analysis Consultant:

[•] Impact Analysis Consulting Pte Ltd. • Impact Analysis Academy Pte Ltd. • IA Racking Solutions Pte Ltd.

[•] IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Our reference

20-08-9365

Date

17/8/2020

Page

2

Section A: Damaged Parts Assessment

Part's Description	Qty	Condition As inspected	Repairer's Estimate	Our Adjustment
List Items:				
Front bumper	1	bent	585.00	585.00
Front bumper crossmember Report	1	bent	685.50	685.50
Front bumper bracket @\$85.00	2	cracked	170.00	170.00
Front radiator grille assy	1	bent/cut	471.20	471.20
Front bumper fog lamp cover @\$65.00	2	deformed	130.00	130.00
Head lamp @\$978.50	2	cracked/holder torn	1957.00	1957.00
Front panel	1	bent/dented	952.80	952.80
Front panel inner	1	repair	758.50	0.00 ×
Front panel emblem "Dyna"	1	necessary	120.00	120.00
Front radiator grille logo	1	necessary	59.50	59.50
Front wiper garnish (white)	1	bent	752.50	752.50 372
ront wiper link	1	damaged	198.50	198.50
ront corner panel rh	1	bent	215.80	215.80 X
ront horn	1	intact	102.40	0.00 X.
ail gate	1	bent/warped	1658.90	1658.90
ail gate TOYOTA logo	1	necessary	300.00	300.00 226.
ail gate sticker "DYNA"	1	necessary	88.00	88.00 4
ail gate lower hinge @\$38.50	4	damaged	154.00	154.00
ail gate lower end panel	1	bent	559.80	559.80
ail gate side lock assy @\$285.00	2	bent/distorted	570.00	570.00
ail lamp @\$255.00	2	refix	510.00	0.00
ear floor panel	1	repair	2541.20	0.00 ×
de board @\$1554.00	2	repair.respray	3108.00	0.00 ×
Su	ıb- Total	cost	16648.60	9628.50
Percentage disc	count:	25%	4162.15	2407.13
Sub-Tot	tal costs	for parts	12486.45	7221.38

8038.80

Subsidiaries of Impact Analysis Consultant:

[•] Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

[●] IA Accounting & Consultancy Pte Ltd ● Infoknights International Services (Philippines) ● IABN Pte Ltd ······· tananidelages com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

		Total costs fo	or parts	14412.05	9146.98	
		Sub- Total		0.00	0.00	
•		•	• -	0.00	0.00	
Parts Repair						
		Sub-Total cost:	s for parts	1925.60	1925.60	
Rear step bar		1	bent-in	220.00	220.00	100.
Wire socket		1	damaged	35.60	35.60 /	
Reverse sensor		1	malfunction	250.00	250.00	100
Tail gate checker pl	ate (galvanized)	1	bent	1300.00	1300.00	500
Tail gate sticker 70k	m/h	1	necessary	20.00	20.00	
Rear number plate		1	bent	50.00	50.00 3	0.
Front number plate	1	1	cut/bent	50.00	50.00	30
Special Nett Items:						
Date	17/8/2020					
Our reference	20-08-9365					

915.60.



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Our reference

20-08-9365

Date

17/8/2020

Page

3

Section B: Labour Cost Calculation

	Но	urly rate	Manhr. Req.	Total
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.	\$	50.00	35	\$ 1,750.00
Putty & Spray painting to adjacent panels. Job allowance. Paint / material.		Sub-con	tract work.	\$ 1,450.00
Apply rust proofing on the adjacent panels.		Sub-cont	tract work.	\$ 150.00
Remove and replace rear bumper reverse sensor & conduct distance safety setting.	\$	45.00	1.7	\$ 76,50
Wiring / bulb checking (inclusive of re-focus / re-adjust on angle of light intensity.)	\$	45.00	1	\$ 45.00
Transfer of existing tailgate mechanism to new tailgate	\$	45.00	2	\$ 90,00
		Total la	bour cost	\$ 3,561.50

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

3055

Subsidiaries of Impact Analysis Consultant:

[•] Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

[•] IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Our reference

20-08-9365

Date

17/8/2020

Section C: Summary Table of Total Repair Cost

Description Damaged Parts Assessment (See section A)		Cost	
		\$9,146.98	
Further discount	20%	\$1,829.40	
Recommended cost of parts		\$7,317.58	(1)
	t Calculation ection B)	\$3,561.50	(2)
Total Repair Cost (Round off to hundred)		\$10,800.00	(1) + (2)

We would recommend a sum of	\$10,800.00	and	11	working days for repair
No further items will be approved	without our expres	sed written agree	ement. Any si	ignificant additional
itams will be subject to a supplem	entary report			

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)

B.Eng. (Hons, NUS)

Diploma.Mechanical Engineering

NTC-2 Automovite Technology

Sr.MIES, Institution of Engineers, Singapore (#20100091)

MATAI, Maryland Association of Traffic Accident Investigators

IAARS, International Association of Accident Reconstruction Specialists

PMC of Singapore Business Advisors & Consultants Council

ACTA certified Trainer, Singapore

Enterprise Singapore - Recognised Certification for Management Consultants

IMI Professional Certificate In Vehicle Accident Damage Assessment (UK)

total: 9999.70 1/8: 8K

[•] Impact Analysis Consulting Pte Ltd. • Impact Analysis Academy Pte Ltd. • IA Racking Solutions Pte Ltd.