


ASSIGNMENT

28 Feb 2027

From: _____ Date: _____
 Estimated Cost: _____
 OB / TP / WS / TP RES / OD RES / EVA / INV / MV
 To inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

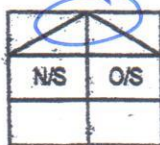

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: _____
 DAC Accident Report: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repair: 12 days Res.: Yes or No
 Lump Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SHC 3299M Yr Regn: 01 March 2019
 Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Hyundai Ioniq C.C. 1580
 Colour: Blue A/C: Insured / Std / NI / NA
 Sp. Reading: 715125 T/Radio: Insured / Std / NI / NA
 Eng No: G4LEJU191395
 C/No: KMHCG51CVKU141426
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / SRim / STD ARim or
 Tyre Size: F: 195 / 65 R15
 R: 11
 BS / DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Westlake
 Front Rear
 R/Bal. 5 mm R/Bal. 8 mm
 L/Bal. 5 mm L/Bal. 5 mm
 D.O.A. 16/06/2024 D.O.I. 19/06/2024
 Survey held at Byroad Loyang
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
 Runt.
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	MSG SLX 8673L
30/28/24	To sick mandate.

Date/Time, File Pass to? ☐ Prel. Report
☐ Final Report

Days Of Repair: _____
 Resurvey No. of Trip: _____

Survey Fee:

Transportation:

S + RS \$

Photos

Others

TOTAL

Add Fee: ☐ Site Insp (\$)
☐ Interview (\$)
☐ Tech. Invs (\$)
☐ Weekend (\$)

Report Format :

Lump Sum / L.B.I. (\$ _____)

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	821R

Vehicle Details

Vehicle No.:	SHC3299A
Vehicle to be Exported:	No
Intended Deregistration Date:	18 Jun 2024
Vehicle Make:	HYUNDAI
Vehicle Model:	AE IONIQ HEV 1.6 DCT
Primary Colour:	Blue
Manufacturing Year:	2018
Engine No.:	G4LEJU191395
Chassis No.:	KMHC851CVKU141426
Maximum Power Output:	103.6 kW (138 bhp)
Open Market Value:	\$24,921.00
Original Registration Date:	01 Mar 2019
First Registration Date:	01 Mar 2019
Transfer Count:	0
Actual ARF Paid:	\$11,890.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	28 Feb 2027
PARF Rebate Amount:	\$8,323.00

Intended COE Rebate Details

COE Expiry Date:	28 Feb 2027
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$20,420.00
COE Rebate Amount:	\$6,882.00
Total Rebate Amount:	\$15,205.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be deregistered once the COE expires, or when it reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 18 Jun 2024

OK

SV STIC 3299A DDA 16/06/2024

Total Purchase cost = 67,694.10

Less PAFB 7,134 = 60,560.10
96

Degree per month = 630.83
x 32

balance life span 32 months = 20,186.56

Add PAFB 7,134 = 27,320.56

Less LTA rebate = 27,320.56 - 15,205.00

Net Value = 12,115.56

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 18-Jun-24

INSURANCE: MSIG

MODEL: HYUNDAI IONIQ

VEHICLE NO.: SHC 3299 A

Description	Qty	List Price	Amount	
Bonnet <i>Replaced</i>	1	\$ 2,253.80	\$ 2,253.80	✓
Bonnet Hinge (RH) <i>BT</i>	1	\$ 118.70	\$ 118.70	✓
Bonnet Moulding <i>HH</i>	1	\$ 41.40	\$ 41.40	X
Bonnet Lock <i>BT</i>	1	\$ 127.30	\$ 127.30	✓
Bonnet Insulator <i>HH</i>	1	\$ 230.10	\$ 230.10	X
Bonnet Insulator Clips <i>HH</i>	1	\$ 15.00	\$ 15.00	X
Bonnet Cable <i>HH</i>	1	\$ 135.60	\$ 135.60	X
Radiator Grille Emblem <i>Est Hec</i>	1	\$ 88.00	\$ 88.00	✓
Radiator Grille NEW MODEL <i>broken 1409.10</i>	1	\$ 1,568.60	\$ 1,568.60	✓
Radiator Grille <i>HS</i>	1	\$ 1,409.10	\$ 1,409.10	X
Flap Assy Active Air Upper, (RH) <i>Socket broken</i>	1	\$ 824.60	\$ 824.60	✓
Flap Assy Active wire <i>HH</i>	1	\$ 765.30	\$ 765.30	X
Front Number Plate garnish <i>broken</i>	1	\$ 188.00	\$ 188.00	✓
Front Bumper Cover <i>torn</i>	1	\$ 481.10	\$ 481.10	✓
Front bumper top cover <i>HH</i>	1	\$ 476.30	\$ 476.30	X
Front Bumper Sponge <i>broken</i>	1	\$ 186.90	\$ 186.90	✓
Front Bumper Reinforcement <i>broken</i>	1	\$ 1,136.70	\$ 1,136.70	✓
Front Bumper Reinforcement ABSORBER (RH) <i>Replaced</i>	1	\$ 186.50	\$ 186.50	✓
Front Bumper Towing Cover <i>SVC</i>	1	\$ 29.00	\$ 29.00	X
Front Bumper Moulding Centre Upper <i>mostly broken</i>	1	\$ 368.50	\$ 368.50	✓

Front Bumper Moulding HH	1	\$ 93.60	\$ 93.60	X
Front Bumper Lower Stiffner HH	1	\$ 285.10	\$ 285.10	X
Front bumper lower grille deformed	1	\$ 365.30	\$ 365.30	✓
front bumper lower grille moulding SVL	1	\$ 127.60	\$ 127.60	X
Front Bumper Lip HH	1	\$ 35.10	\$ 35.10	X
Front Bumper Bracket Top (RH) HH	1	\$ 35.00	\$ 35.00	X
Front Bumper Bracket (RH) HH	1	\$ 28.00	\$ 28.00	X
Front Bumper Retainer Mounting (RH) HH	1	\$ 65.30	\$ 65.30	X
Front Bumper Clips 10 pcs HEC	1	\$ 25.00	\$ 25.00	✓
Front Bumper Grille (RH) cut	1	\$ 186.90	\$ 186.90	✓
Front bumper air duct (RH) HH	1	\$ 153.80	\$ 153.80	X
Day Light , RH monkey broken	1	\$ 642.50	\$ 642.50	✓
Day Light Wire, HH	1	\$ 585.50	\$ 585.50	X
Headlamp Support Panel Assy broken	1	\$ 1,139.30	\$ 1,139.30	✓
Headlamp(RH) broken 2110.30	1	\$ 3,987.30	\$ 3,987.30	✓
Horn Unit (RH) HH	1	\$ 72.80	\$ 72.80	X
Horn Wire HH	1	\$ 386.70	\$ 386.70	X
Radiator Inverter HT	1	\$ 884.80	\$ 884.80	✓
Radiator HT	1	\$ 710.50	\$ 710.50	✓
Radiator fan blower motor assy broken	1	\$ 1,459.60	\$ 1,459.60	✓
Front Fender(RH) Dumb	1	\$ 490.70	\$ 490.70	✓
Front Fender Shield (RH) SVL	1	\$ 164.70	\$ 164.70	X
Aircon Condenser HT	1	\$ 663.60	\$ 663.60	✓
Aircon Suction & Liquid Hose HH	1	\$ 679.60	\$ 679.60	✓
Aircon metal hose - small Dumb	1	\$ 186.50	\$ 186.50	✓
Aircon metal hose - big Dumb	1	\$ 352.10	\$ 352.10	✓
Aircon Discharge Hose HH	1	\$ 148.50	\$ 148.50	X

Aircon Compressor	HH	1	\$ 4,069.80	\$ 4,069.80	X
Front Windscreen Glass	crack	1	\$ 1,558.10	\$ 1,558.10	✓
Front Windscreen Moulding	WLC	1	\$ 157.30	\$ 157.30	✓
Wiper Container ASSY	defunct	1	\$ 385.40	\$ 385.40	✓
Engine Under Cover	HH	1	\$ 469.40	\$ 469.40	X
Dashboard Complete	broken 1474.00	1	\$ 4,724.00	\$ 4,724.00	✓
Passenger Air Bag	activated 1951.20	1	\$ 2,633.00	\$ 2,633.00	✓
Steering Airbag Complete	activated	1	\$ 1,090.90	\$ 1,090.90	✓
Airbag Control Module	HH	1	\$ 1,243.70	\$ 1,243.70	X
Curtain airbag module (RH)	activated	1	\$ 1,344.50	\$ 1,344.50	✓
Knee control airbag module assy	at activated	1	\$ 578.60	\$ 578.60	✓
Air bag Assy - passenger	reported	1	\$ 1,951.20	\$ 1,951.20	X
Steering Angle Assy	HH	1	\$ 786.90	\$ 786.90	X
Sensor Assy Impact -Frt Impact	HH	1	\$ 643.90	\$ 643.90	X
Airbag Sensor (RH)	HH	1	\$ 348.10	\$ 348.10	X
Airbag Frt Seat	activated	1	\$ 1,344.50	\$ 1,344.50	✓
Roof Upholstery lining	SN	1	\$ 1,983.30	\$ 1,983.30	X
Frt Safety Belt(Assy)(RH)	activated	1	\$ 648.90	\$ 648.90	✓
Rear Safety Belt(Assy)(RH)	activated	1	\$ 513.20	\$ 513.20	✓
Rear Safety Belt Garnish Cover(RH)	SVC **	1	\$ 398.00	\$ 398.00	X
SUB TOTAL				\$ 47,915.20	28,312.50
LESS 20%				\$ 9,583.04	22,650.00
DISCOUNTED TOTAL				\$ 38,332.16	
Front Number Plate	broken SN	1	\$ 25.00	\$ 25.00	} 45/-
Front No Plate Trim Cover	broken SN	1	\$ 30.00	\$ 30.00	

COOLANT	SN	1	\$ 45.00	\$ 45.00
Front Fender Advertisement Logo (RH)	SN	1	\$ 100.00	\$ 100.00
Front Windscreen Sealant	SN	1	\$ 46.00	\$ 46.00
Front ERP Sticker	SN	1	\$ 30.00	\$ 30.00
SUB TOTAL				\$ 276.00
Labour Charge				
Panel Beating		1	\$2,600.00	\$2,600.00
Spray Painting Charge		1	\$1,800.00	\$1,800.00
Wiring Charge		1	\$2,000.00	\$2,000.00
Tuff Kote		1	\$300.00	\$300.00
Towing Charge		1	\$80.00	\$80.00
Re-set Frt ABS System		1	\$200.00	\$200.00
Remove/Refix Radiator		1	\$90.00	\$90.00
Remove/Refix Aircon & Refill Gas		1	\$130.00	\$130.00
Remove/Refix Fuse Box		1	\$120.00	\$120.00
Remove/Refix Front Windscreen Glass		1	\$120.00	\$120.00
Remove/Refix Dashboard		1	\$550.00	\$550.00
Remove/Refix Air Bag / Front and Rear Seatbelt		1	\$550.00	\$550.00
Remove/Refix Roof Top Lining		1	\$550.00	\$550.00
Re-programe Air Bag & Safety Belt System		1	\$550.00	\$550.00
Diagnostic & Resetting To Erase Fault Code		1	\$550.00	\$550.00
Diagnostic & Resetting ADAS Optical sensor		1	\$550.00	\$550.00
TOTAL LABOUR				\$10,740.00


ESTIMATE TOTAL		\$ 49,348.16
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. Please send your book value request to: claims_ltr@bifrotauto.com + claims_lts@bifrotauto.com		

19/06/2024 e 1030w
NIA Anbu


24,901.00

4/5 17,000/-

2/5mm 12
days.

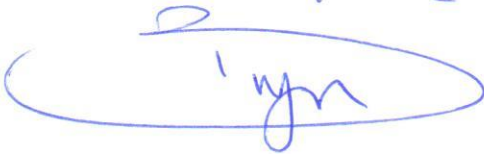

LKK Auto

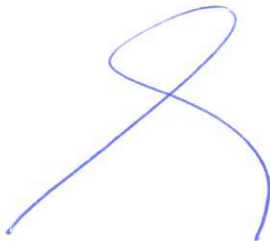

* Provide Book Value

* Repair Limit.

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: