

ASS. REC. BY:

REF:

CS/MSG24060124/Dvh³

ASSIGNMENT

28 Feb 2027

From: _____ Date: _____

Estimated Cost: _____

OD / TP / NS / TP RES / OD RES / EVA / INV / INV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: SLX 8673LPolicy No: 30003110026Claims No: 363329


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

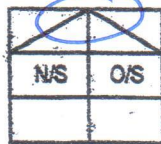

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repair: 12 days Res: Yes or NoLump Sum: 20 % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SHC 3299H Yr Regn: 01 March 2019

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Hyundai 10m2 cc: 1580Colour: Blue A/C: Insured / Std / NI / NASp. Reading: 715125 T/Radio: Insured / Std / NI / NAEng No: G4LEJU191395G/No: KMHCG51CVKU141426

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / SRim / STD ARim orTyre Size: F: 195/65R15R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Westlake

Front

Rear

R/Bal: 5 mm R/Bal: 5 mmL/Bal: 5 mm L/Bal: 5 mmD.O.A: 16/06/2024 D.O.I: 19/06/2024Survey held at: By road WayangDes. of Damages: Front / Rear / O/S / N/S / U/C / Rooftop orBurnt

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>MSG SLX 8673L</u>
<u>30/28/24</u>	<u>To seek mandate.</u>
<u>04/11/24</u>	<u>Trans L/S 17,000/- with 12 days given</u> <u>(Ref. 35,182.88, 6TD)</u>

Date/Time, File Pass to?



Preli. Report

1)



Final Report

Date/Time, File Return to?

2)

Days Of Repair: 12

Resurvey No. of Trip: _____

Add Fee:

Site Insp (\$)

Interview (\$)

Tech. Invs (\$)

Weekend (\$)

Survey Fee:

Transportation:

S+RS \$

Photos

Others

TOTAL

Report Format:

Lump Sum / L.B.I. (\$) _____

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

821R

Vehicle Details

Vehicle No.:

SHC3299A

Vehicle to be Exported:

No

Intended Deregistration Date:

18 Jun 2024

Vehicle Make:

HYUNDAI

Vehicle Model:

AE IONIQ HEV 1.6 DCT

Primary Colour:

Blue

Manufacturing Year:

2018

Engine No.:

G4LEJU191395

Chassis No.:

KMHC851CVKU141426

Maximum Power Output:

103.6 kW (138 bhp)

Open Market Value:

\$24,921.00

Original Registration Date:

01 Mar 2019

First Registration Date:

01 Mar 2019

Transfer Count:

0

Actual ARF Paid:

\$11,890.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

28 Feb 2027

PARF Rebate Amount:

\$8,323.00

Intended COE Rebate Details

COE Expiry Date:

28 Feb 2027

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

8

PQP Paid:

\$20,420.00

COE Rebate Amount:

\$6,882.00

Total Rebate Amount:

\$15,205.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be deregistered once the COE expires, or when it reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 18 Jun 2024

OK

SV STIC 3299A DOA 16/06/2024

Total Purchase cost = 67,694.10

less PAF 7,134 = 60,560.10
96

Degree per month = 630.83
x 32

balance life span 32 months = 20,186.56

Add PAF 7,134 = 27,320.56

less LTA rebate = 27,320.56 - 15,205.00

Net Value = 12,115.56

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 18-Jun-24

INSURANCE: MSIG

MODEL: HYUNDAI IONIQ

VEHICLE NO.: SHC 3299 A

Description	Qty	List Price	Amount	
Bonnet <i>Demol</i>	1	\$ 2,253.80	\$ 2,253.80	✓
Bonnet Hinge (RH) <i>bt</i>	1	\$ 118.70	\$ 118.70	✓
Bonnet Moulding <i>HH</i>	1	\$ 41.40	\$ 41.40	X
Bonnet Lock <i>bt</i>	1	\$ 127.30	\$ 127.30	✓
Bonnet Insulator <i>HH</i>	1	\$ 230.10	\$ 230.10	X
Bonnet Insulator Clips <i>HH</i>	1	\$ 15.00	\$ 15.00	X
Bonnet Cable <i>HH</i>	1	\$ 135.60	\$ 135.60	X
Radiator Grille Emblem <i>Est Hec</i>	1	\$ 88.00	\$ 88.00	✓
Radiator Grille NEW MODEL <i>broken 1409.10</i>	1	\$ 1,568.60	\$ 1,568.60	✓
Radiator Grille <i>HS</i>	1	\$ 1,409.10	\$ 1,409.10	X
Flap Assy Active Air Upper, (RH) <i>Socket broken</i>	1	\$ 824.60	\$ 824.60	✓
Flap Assy Active wire <i>HH</i>	1	\$ 765.30	\$ 765.30	X
Front Number Plate garnish <i>broken</i>	1	\$ 188.00	\$ 188.00	✓
Front Bumper Cover <i>torn</i>	1	\$ 481.10	\$ 481.10	✓
Front bumper top cover <i>HH</i>	1	\$ 476.30	\$ 476.30	X
Front Bumper Sponge <i>broken</i>	1	\$ 186.90	\$ 186.90	✓
Front Bumper Reinforcement <i>broken</i>	1	\$ 1,136.70	\$ 1,136.70	✓
Front Bumper Reinforcement ABSORBER (RH) <i>Demol</i>	1	\$ 186.50	\$ 186.50	✓
Front Bumper Towing Cover <i>src</i>	1	\$ 29.00	\$ 29.00	X
Front Bumper Moulding Centre Upper <i>minor broken</i>	1	\$ 368.50	\$ 368.50	✓

Front Bumper Moulding HH	1	\$ 93.60	\$ 93.60	X
Front Bumper Lower Stiffner HH	1	\$ 285.10	\$ 285.10	X
Front bumper lower grille damaged	1	\$ 365.30	\$ 365.30	✓
front bumper lower grille moulding SVL	1	\$ 127.60	\$ 127.60	X
Front Bumper Lip HH	1	\$ 35.10	\$ 35.10	X
Front Bumper Bracket Top (RH) HH	1	\$ 35.00	\$ 35.00	X
Front Bumper Bracket (RH) HH	1	\$ 28.00	\$ 28.00	X
Front Bumper Retainer Mounting (RH) HH	1	\$ 65.30	\$ 65.30	X
Front Bumper Clips 10 pcs HEC	1	\$ 25.00	\$ 25.00	✓
Front Bumper Grille (RH) cut	1	\$ 186.90	\$ 186.90	✓
Front bumper air duct (RH) HH	1	\$ 153.80	\$ 153.80	X
Day Light , RH mostly broken	1	\$ 642.50	\$ 642.50	✓
Day Light Wire, HH	1	\$ 585.50	\$ 585.50	X
Headlamp Support Panel Assy broken	1	\$ 1,139.30	\$ 1,139.30	✓
Headlamp(RH) broken 2110.30	1	\$ 3,987.30	\$ 3,987.30	✓
Horn Unit (RH) HH	1	\$ 72.80	\$ 72.80	X
Horn Wire HH	1	\$ 386.70	\$ 386.70	X
Radiator Inverter HT	1	\$ 884.80	\$ 884.80	✓
Radiator HT	1	\$ 710.50	\$ 710.50	✓
Radiator fan blower motor assy broken	1	\$ 1,459.60	\$ 1,459.60	✓
Front Fender(RH) Dumb	1	\$ 490.70	\$ 490.70	✓
Front Fender Shield (RH) SVL	1	\$ 164.70	\$ 164.70	X
Aircon Condenser HT	1	\$ 663.60	\$ 663.60	✓
Aircon Suction & Liquid Hose HH	1	\$ 679.60	\$ 679.60	✓
Aircon metal hose - small Dumb	1	\$ 186.50	\$ 186.50	✓
Aircon metal hose - big Dumb	1	\$ 352.10	\$ 352.10	✓
Aircon Discharge Hose HH	1	\$ 148.50	\$ 148.50	X

Aircon Compressor HH	1	\$ 4,069.80	\$ 4,069.80	X
Front Windscreen Glass CRACK	1	\$ 1,558.10	\$ 1,558.10	✓
Front Windscreen Moulding HC	1	\$ 157.30	\$ 157.30	✓
Wiper Container ASSY defunct	1	\$ 385.40	\$ 385.40	✓
Engine Under Cover HH	1	\$ 469.40	\$ 469.40	X
Dashboard Complete broken 1474.00	1	\$ 4,724.00	\$ 4,724.00	✓
Passenger Air Bag activated 1951.20	1	\$ 2,633.00	\$ 2,633.00	✓
Steering Airbag Complete activated	1	\$ 1,090.90	\$ 1,090.90	✓
Airbag Control Module HH	1	\$ 1,243.70	\$ 1,243.70	X
Curtain airbag module (RH) activated	1	\$ 1,344.50	\$ 1,344.50	✓
Knee control airbag module assy & activated	1	\$ 578.60	\$ 578.60	✓
Air bag Assy - passenger reported	1	\$ 1,951.20	\$ 1,951.20	X
Steering Angle Assy HH	1	\$ 786.90	\$ 786.90	X
Sensor Assy Impact -Frt Impact HH	1	\$ 643.90	\$ 643.90	X
Airbag Sensor (RH) HH	1	\$ 348.10	\$ 348.10	X
Airbag Frt Seat activated	1	\$ 1,344.50	\$ 1,344.50	✓
Roof Upholstery lining SV	1	\$ 1,983.30	\$ 1,983.30	X
Frt Safety Belt(Assy)(RH) activated	1	\$ 648.90	\$ 648.90	✓
Rear Safety Belt(Assy)(RH) activated	1	\$ 513.20	\$ 513.20	✓
Rear Safety Belt Garnish Cover(RH) SV **	1	\$ 398.00	\$ 398.00	X
				28,312.50
SUB TOTAL			\$ 47,915.20	
LESS 20%			\$ 9,583.04	22,650.00
DISCOUNTED TOTAL			\$ 38,332.16	
Front Number Plate broken SN	1	\$ 25.00	\$ 25.00	} 451-
Front No Plate Trim Cover broken SN	1	\$ 30.00	\$ 30.00	

COOLANT	SN	1	\$ 45.00	\$ 45.00
Front Fender Advertisement Logo (RH)	SN	1	\$ 100.00	\$ 100.00
Front Windscreen Sealant	SN	1	\$ 46.00	\$ 46.00
Front ERP Sticker	SN	1	\$ 30.00	\$ 30.00
SUB TOTAL				\$ 276.00
Labour Charge				
Panel Beating		1	\$2,600.00	\$2,600.00
Spray Painting Charge		1	\$1,800.00	\$1,800.00
Wiring Charge		1	\$2,000.00	\$2,000.00
Tuff Kote		1	\$300.00	\$300.00
Towing Charge		1	\$80.00	\$80.00
Re-set Frt ABS System		1	\$200.00	\$200.00
Remove/Refix Radiator		1	\$90.00	\$90.00
Remove/Refix Aircon & Refill Gas		1	\$130.00	\$130.00
Remove/Refix Fuse Box		1	\$120.00	\$120.00
Remove/Refix Front Windscreen Glass		1	\$120.00	\$120.00
Remove/Refix Dashboard		1	\$550.00	\$550.00
Remove/Refix Air Bag / Front and Rear Seatbelt		1	\$550.00	\$550.00
Remove/Refix Roof Top Lining		1	\$550.00	\$550.00
Re-programe Air Bag & Safety Belt System		1	\$550.00	\$550.00
Diagnostic & Resetting To Erase Fault Code		1	\$550.00	\$550.00
Diagnostic & Resetting ADAS Optical sensor		1	\$550.00	\$550.00
TOTAL LABOUR				\$10,740.00


ESTIMATE TOTAL		\$ 49,348.16
		52,152.88
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. Please send your book value request to: claims_ltr@bifrostauto.com + claims_lts@bifrostauto.com		

19/06/2024 e 1030w


NIA Anbu

2/5mm 12

10 days.

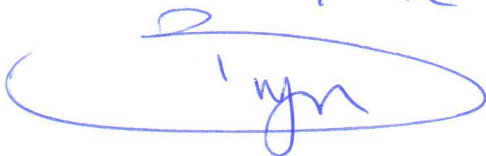

LKK Auto

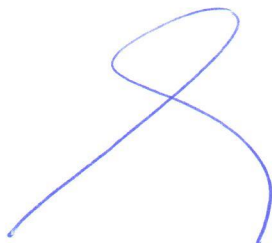

* Trade Book Value

* Repair Limit.

24,901.00

4/5 17,000/-

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: