

# *Tommie Lim Appraisal*

Block 126 Bishan Street 12 #08-147 Singapore 570126  
Handphone No. : +65 97475163 Email : tommie126@yahoo.com.sg  
ROC: 53448442E

## VEHICLE INSPECTION REPORT

To : KANG HOCK LAI  
c/o : INFINITY AUTO 57 PTE LTD  
Blk 3020A, #01-33, Ubi Road 1  
Singapore 408714

## REFERENCE

Ref. no.	: TLA/2024/08/018	3rd party Veh.	: TP357A
Accident on	: 22 Aug 2024	Claim tyre	: Third Party
Assign on	: 27 Aug 2024	Claim number	: To be advice
Inspection on	: 27 Aug 2024	Policy number	: To be advice
Workshop name	: INFINITY AUTO 57 PTE LTD	Finalize on	: 09 Sep 2024
Inspection at	: Blk 3020A, #01-33, Ubi Road 1 Singapore 408714	Final report on	: 10 Sep 2024

## PARTICULARS OF DAMAGED VEHICLE

Vehicle number	: SMM348A	Registration date	: 14 Jun 2019
Make	: HONDA	Body colour	: BLUE
Model	: FREED HYBRID	Engine number	: LEB5611069
Chassis number	: GB71075803	Engine capacity	: 1496 CC
Odometer	: 185515 KM	Transmission	: AUTOMATIC

## PRE-ACCIDENT CONDITION OF VEHICLE (STATIC CHECK ONLY)


Steering	: In order	Paintwork	: Good
Footbrake	: In order	Undercarriage	: Serviceable
Handbrake	: In order	Gen. condition	: Good

## TYRE CONDITION ON VEHICLE

	Make	Size	Tread depth	Type of road wheel
Front N/S	: Fortune	185/65R15	60%	Alloy
Front O/S	: Fortune	185/65R15	60%	Alloy
Rear N/S	: Fortune	185/65R15	70%	Alloy
Rear O/S	: Fortune	185/65R15	70%	Alloy

NOTE: The above percentages represent the estimated remaining life of tyre threads.

## POINT OF IMPACT

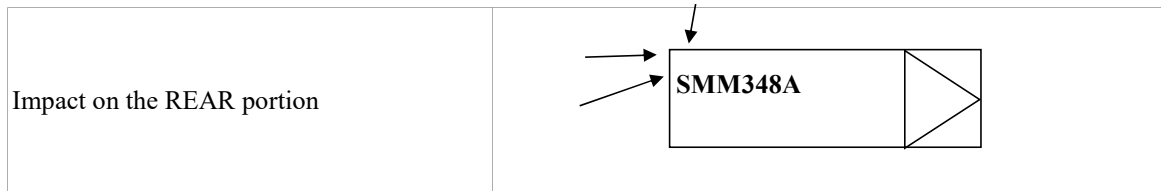

## SYNOPSIS OF DAMAGES RESULTANT FROM THE ACCIDENT

The impact of the collision has damaged/affected the tailgate assy, rear bumper assy, rear n/s taillamp, rear n/s fender, rear end panel and etc...

Please refer to Annex A and Annex B (Appraisalment Schedule) for a detailed account of the damages and photographs taken.

*Note: Reinspection of the vehicle on 28-08-2024 for repair is in progress.*

## RECOMMENDATION

The estimate cost of repair submitted by Messrs INFINITY AUTO 57 PTE LTD as per schedule attached has been revised and scrutinised, and in our opinion, we consider it to be fair and reasonable. The repairers have agreed to undertake the repairs to the owner's satisfaction at our revision. We have not authorised the repairs.

Our adjusted cost of repair is SGD 9,000.00 to carry out the repairs. Please refer to Annex A (Appraisalment Schedule) for a detailed account of the cost estimates.

## REMARKS


We have not authorised the repair. However, for information, under normal circumstances, the repair would takes approximately 10 (Ten) working days to complete.

In accordance to your instruction, we have **NOT AUTHORISED** the repair to the damaged vehicle and the survey was conducted strictly on a "**WITHOUT PREJUDICE**" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

Yours faithfully,

**Tommie Lim Appraisal**

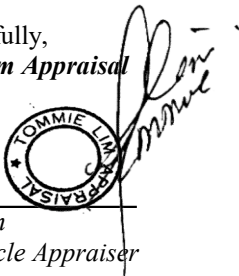

Tommie Lim

Motor Vehicle Appraiser

## APPRAISEMENT SCHEDULE

Registration no : **SMM348A**

Vehicle Model : **HONDA  
FREED HYBRID**

S/N	Qty	Description	Condition	Estimate by Wshop SGD	Adjusted Amt SGD
<b><u>LIST ITEMS</u></b>					
1	1	Rear bumper	Deformed/Cracked	925.30	925.30
2	1	Rear bumper center beam	Repair	139.70	0.00
3	1	Rear bumper reflector	Grazed/Cut	42.80	42.80
4	1	Rear bumper exhaust cover garnish	Deformed/Torn	58.10	58.10
5	1	Rear bumper towing cover	Serviceable	36.80	0.00
6	1	Rear bumper side retainer (upper) LH	Deformed/Cracked	39.70	39.70
7	1	Rear bumper side retainer (lower) LH	Deformed/Cracked	42.30	42.30
8	1	Rear bumper side retainer (upper) RH	Deformed	39.70	39.70
9	1	Rear bumper side retainer (lower) RH	Deformed	42.30	42.30
10	1	Rear bumper inner side garnish LH	Deformed	60.20	60.20
11	1	Rear fender	Repair	990.40	0.00
12	1	Rear fender inner trim	Deformed/Cracked	399.80	399.80
13	1	Rear fender side shield	Serviceable	278.90	0.00
14	1	Rear fender quarter glass moulding	Not Necessary	267.70	0.00
15	1	Rear fender air grille	Serviceable	138.60	0.00
16	1	Tail lamp	Cracked	580.40	580.40
17	1	Tail lamp lower panel	Buckled/Bent	241.10	241.10
18	1	Tail lamp inner panel	Buckled/Bent	210.60	210.60
19	1	Tail gate	Buckled/Bent	1180.60	1180.60
20	1	Tail gate lamp	Cracked	368.40	368.40
21	1	Tail gate logo	Necessary	59.20	59.20
22	1	Tail gate emblem FREED	Necessary	52.30	52.30
23	1	Tail gate outer moulding (chrome)	Deformed/Cracked	370.40	370.40
24	1	Tail gate damper LH	Bent/Leak	120.10	120.10
25	1	Tail gate damper RH	Bent/Leak	120.10	120.10
26	1	Tail gate stopper LH	Serviceable	13.20	0.00
27	1	Tail gate stopper RH	Serviceable	13.20	13.20
28	1	Tail gate inner holder	Serviceable	28.40	0.00
29	1	tail gate weather strip	Deformed/Torn	168.70	168.70
30	1	Tail gate inner trim	Deformed/Cracked	295.30	295.30
31	1	Tail gate top lock	Jammed/Bent	157.60	157.60
32	1	Tail gate lock latch	Serviceable	26.70	0.00
33	1	Tail gate outer switch	Serviceable	171.50	0.00
34	1	Tailgate spoiler	Serviceable	783.50	0.00
35	1	Rear windscreen glass moulding	Necessary	145.70	145.70
36	1	Rear number plate lamp LH	Serviceable	38.60	0.00
37	1	Reverse camera	Malfunction	786.90	786.90
38	1	Rear end panel (outer)	Buckled/Bent	623.70	623.70
39	1	Rear end panel (inner)	Repair	486.30	0.00
40	1	Rear end panel top garnish	Deformed/Cracked	169.30	169.30
<b>Sub-total</b>				10,714.10	7,313.80
<b>Less 20%</b>				2,142.82	1,462.76
<b>Total</b>				8,571.28	5,851.04

## APPRAISEMENT SCHEDULE

Registration no : SMM348A

Vehicle Model : HONDA  
FREED HYBRID

S/N	Qty	Description	Condition	Estimate by Wshop SGD	Adjusted Amt SGD
<b><u>SPECIAL NETT ITEMS</u></b>					
1	1set	Rear bumper clips	Deformed/Cracked	80.00	50.00
2	1set	Rear reverse sensor	Malfunction	300.00	250.00
3	1set	Rear bumper exhaust cover garnish clips	Deformed/Cracked	80.00	50.00
4	2set	Rear fender inner trim clips	Deformed/Cracked	160.00	100.00
5	2set	Rear fender side shield clips	Deformed/Cracked	80.00	60.00
6	1	Rear fender quarter glass sealant	Not Necessary	100.00	0.00
7	1	Rear fender quarter glass sponge	Not Necessary	80.00	0.00
8	1set	Tail gate outer moulding clips	Deformed/Cracked	80.00	50.00
9	1set	Tail gate inner trim clips	Deformed/Cracked	80.00	50.00
10	1set	Tailgate spoiler clips	Deformed/Cracked	80.00	50.00
11	1	Rear windscreen glass sealant	Necessary	100.00	80.00
12	1	Rear windscreen glass sponge	Necessary	80.00	60.00
13	1set	Rear windscreen glass clips	Deformed/Cracked	80.00	50.00
14	1set	Rear end panel top garnish clips	Deformed/Cracked	80.00	50.00
				1,460.00	900.00
<b>TOTAL FOR SPARE PARTS</b>				10,031.28	6,751.04

## APPRAISEMENT SCHEDULE

Registration no : SMM348A

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
<b><u>LABOUR &amp; MISC CHARGES</u></b>					
1		To remove and refit all fittings to tailgate to facilitate the repair		180.00	150.00
2		To remove, renew and refit the reverse sensor to facilitate the repair		80.00	50.00
3		To check the wiring system to facilitate the repair and refit the same		80.00	50.00
4		To remove, renew and refit the rear windscreen glass to facilitate the repair		200.00	180.00
5		To remove, renew and refit the rear quarter glass to facilitate the repair		150.00	0.00
6		To remove and refit upholstery, carpets, and rear fender inner trims to facilitate the repair		300.00	250.00
7		To remove, renew and refit all accident-damaged parts. Cut, weld, panel beat, and straighten all accident damage areas and fit the above same		1,800.00	1,500.00
8		To spray anti-rust on accident-affected panel		150.00	120.00
9		To putty and spray paint on all accident damage parts and other accident-affected areas		1,800.00	1,500.00
10		To remove, renew and refit all fittings to the fuel tank assy to facilitate the repair		100.00	80.00
11		To remove, renew and refit the reverse camera to facilitate the repair		80.00	50.00
12		To remove, renew and refit the video camera to facilitate the repair		80.00	50.00
13		To redo the sealant on the cut and repair panels to facilitate the repair		200.00	160.00
14		To conduct a water leakage test on cut panels or replacement parts		80.00	50.00

## APPRAISEMENT SCHEDULE

Registration no : SMM348A

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
15		Diagnostic & reset fault code to facilitate the repair		300.00	250.00
16		To conduct wheel alignment		100.00	70.00
<b>TOTAL FOR LABOUR AND SPRAY PAINTING</b>				5,680.00	4,510.00

## SUMMARY

Total Parts and Labour Cost of Repair	15,711.28	11,261.04
Less 20% (Lumpsum repair adjustment)		2,252.21
		9,008.83
<b>ADJUSTED PARTS AND LABOUR COST OF REPAIR</b>		<b>9,000.00</b>

Recommended/Final adjusted Lump Sum Amount : \$ **9,000.00**  
 Estimate Repair Duration : **10 Working days**