



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2503602

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 09/06/2025
Reference CD/CTI24090145/Aua3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SNQ 3146M
Insured Veh. SGJ 9639M
Claim No. SNM24D204738
Policy No. DMPCSNA00121002304
Accident Date 22/08/2024
Inspection Date 04/09/2024

Description	Total
Survey Inspection	280.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	280.00
GST (9%)	25.20
Grand Total	305.20

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24090145/Aua3q2(N)	
			Date: 09/06/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SGJ 9639M	Veh. Inspected	SNQ 3146M
	Policy No.	DMPCSNA00121002304	Coverage (\$)	0.00
	Claim No.	SNM24D204738	Excess (\$)	0.00
	Assign From		Assign Date	04/09/2024
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA VOXY HYBRID	c.c	1797
	Engine No.	HIDDEN	Year of Reg.	2024
	Chassis No.	ZWR900140292	Colour	WHITE
	Odometer	6832 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/55 R17	TOYO	6 mm
	L/H Front Tyre	205/55 R17	TOYO	6 mm
	R/H Rear Tyre	205/55 R17	TOYO	6 mm
	L/H Rear Tyre	205/55 R17	TOYO	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	22/08/2024	Inspection Date	04/09/2024
	Survey held at	JL PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNQ 3146M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	SLIDING DOOR RH	DENTED	1,585.00	1,585.00
1	SLIDING DOOR STRIP SENSOR RH	NOT NECESSARY	971.50	-
1	SLIDING DOOR OUTER STRIP RH	NOT NECESSARY	1,300.00	-
1	SLIDING DOOR FRONT INNER LOCK RH	NOT NECESSARY	618.10	-
1	SLIDING DOOR INNER TRIM RH	CRACKED	1,897.40	990.00
1	SLIDING DOOR FRAME WEATHERSTRIP RH	NOT NECESSARY	577.40	-
1	SLIDING DOOR STEP PANEL RH	NOT NECESSARY	633.70	-
1	SLIDING DOOR STEP PANEL GARNISH RH	NOT NECESSARY	498.80	-
1	SLIDING DOOR WEATHERSTRIP RH	NOT NECESSARY	298.00	-
1	SLIDING DOOR BACK INNER LOCK	DAMAGED	524.30	524.30
1	SLIDING DOOR LOWER ROLLER RH	NOT NECESSARY	285.00	-
1	SLIDING DOOR LOCK CATCH RH	NOT NECESSARY	78.00	-
1	SLIDING DOOR LOWER PROTECTOR	DEFORMED	565.00	565.00
	LESS 25% DISCOUNT		-2,458.05	-916.08
			7,374.15	2,748.22
	<u>SPECIAL NETT ITEMS</u>			
1	SET SLIDING DOOR INNER TRIM CLIP RH (SN)	NECESSARY	60.00	30.00
1	STEP PANEL GARNISH CLIP (SN)	NOT NECESSARY	60.00	-
1	DOOR CHROME MOULDING (SPECIAL TYPE) (SN)	NECESSARY	800.00	180.00
1	SET DOOR VISOR (SN)	NECESSARY	300.00	80.00
1	DOOR STICKER AUTO DOOR (SPECAIL TYPE) (SN)	NOT NECESSARY	100.00	-
			1,320.00	290.00
	<u>LABOUR</u>			
	PANEL BEATING ,REMOVAL AND REPLACING PARTS.		1,800.00	250.00
	TO SPRAY PAINT AFFECTED AREA.		800.00	350.00
	TUFF COAT.	NOT NECESSARY	250.00	-
	WIRING CHECK.		150.00	30.00
	TRANFER SLIDING DOOR MECHANISM RH .		80.00	40.00
	REMOVE AND REFIX AND RESET SLIDING DOOR AUTO SYSTEM.	NOT NECESSARY	350.00	-

Report Ref No. CD/CTI24090145/Aua3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & REINSTALL REAR WINDOW GLASS .		60.00	40.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	180.00	-
			3,670.00	710.00
GRAND TOTAL			12,364.15	3,748.22

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,000.00
--	--	--	--	----------

Report Ref No. CD/CT124090145/Aua3q2(N)

ADRIAN LING WAI PING


B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 3146M

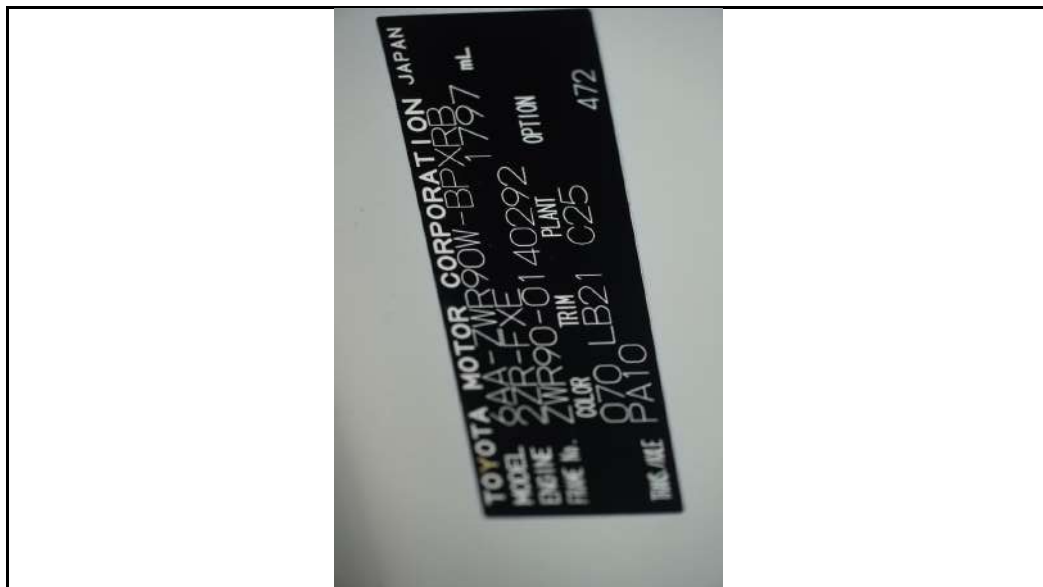



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 2 of 4)

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 3146M





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 3 of 4)

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 3146M





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 4 of 4)

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 3146M



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 3146M





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 4)

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 3146M





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 3 of 4)

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 3146M





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 4 of 4)

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 3146M

