



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. : SAC2401842

INV Date : 13-12-2024

Reference CD/LPC24090251/Uma3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBG 7111G
Insured Veh. GBG 4844U
Claim No. 24/24/24/VC05/029857
Policy No. Z24VC05025398
Accident Date 12/09/2024
Inspection Date 18/09/2024

Description	Amount
Third Party Express Settlement	450.00
Sub-Total	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS LONPAC INSURANCE BHD	Ref:	CD/LPC24090251/Uma3q2
300 BEACH ROAD	Date:	13/12/2024
#17-04/07 THE CONCOURSE SINGAPORE 199555	Code:	LPC2

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	GBG 4844U	Veh. Inspected	GBG 7111G
Policy No.	Z24VC05025398	Coverage	0
Claim No.	24/24/24/VC05/029857	Excess	\$0.00
Assign From	GERALD POH	Assign Date	13/09/2024

2. Vehicle Details

Make & Model	NISSAN CABSTAR 3.0 5M/T ABS 2DR 2WD EURO 5	C.C	2953
Engine No.	ZD30026074N	Year of Reg.	13/10/2017
Chassis No.	JN1SC2F24Z0860219	Colour	WHITE
Odometer	303353 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: NIL		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	195R15	RIVO	6
L/H Front Tyre	195R15	RIVO	6
R/H Rear Tyre	155R13 (D)	DURAMAX	6/6
L/H Rear Tyre	155R13 (D)	DURAMAX	6/6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	12/09/2024	Inspection Date	18/09/2024
Survey held at	WHEELZ 4 YOU 2 PEREIRA ROAD, #07-02, 2CONNECTT@TS		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 7 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO GBG 7111G

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	LH WING MIRROR	TWISTED / BENT	\$303.00	\$303.00
1	LH WING MIRROR COVER	NOT NECESSARY	\$197.00	\$0.00
1	FRONT WIPER PANEL	TO REPAIR SEE LABOUR	\$7,949.00	\$0.00
1	FRONT PANEL	TO REPAIR SEE LABOUR	\$2,008.00	\$0.00
1	FRONT PANEL EMBLEM (CABSTAR)	NECESSARY	\$66.00	\$66.00
2	HEADLAMP @\$727.00	N/S CRACKED / O/S MTG CRACKED	\$1,454.00	\$1,132.00
1	RADIATOR GRILLE	CRACKED	\$799.00	\$481.20
1	RADIATOR GRILLE LOGO	NECESSARY	\$95.00	\$95.00
1	AIR CON BLOWER UNIT	NOT NECESSARY	\$1,218.00	\$0.00
1	AIR CON EVAPORATOR UNIT	NOT NECESSARY	\$1,588.00	\$0.00
1	FRONT BUMPER }	BENT	\$1,254.00	\$1,209.20
1	FRONT BUMPER BRACKET }	BENT	\$368.00	\$0.00
1	FRONT BUMPER REINFORCEMENT	NO SUCH PARTS	\$756.00	\$0.00
1	LH FRONT CORNER PANEL	DENTED	\$567.00	\$302.20
1	LH FRONT STEP PANEL GARNISH	NOT NECESSARY	\$283.00	\$0.00
1	LH FRONT DOOR	TO REPAIR SEE LABOUR	\$2,296.00	\$0.00
1	LH FRONT DOOR TAPE	NOT NECESSARY	\$128.00	\$0.00
1	LH FRONT DOOR HINGE (TOP)	NOT NECESSARY	\$168.00	\$0.00
1	LH FRONT DOOR HINGE (BTM)	NOT NECESSARY	\$168.00	\$0.00
1	LH FRONT DOOR CHECKER	NOT NECESSARY	\$162.00	\$0.00
1	TAILGATE	DENTED / BENT	\$2,099.00	\$1,645.00
4	TAILGATE HINGE @\$145.00	TO REPAIR SEE LABOUR	\$580.00	\$0.00
1	TAILGATE STICKER (NISSAN)	NECESSARY	\$186.00	\$108.60
2	TAILGATE L BRACKET @\$289.00	TO REPAIR SEE LABOUR	\$578.00	\$0.00
2	TAILGATE L BRACKET PIN @\$88.00	NOT NECESSARY	\$176.00	\$0.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	\$3,587.00	\$0.00
2	TAILLAMP @\$268.00	CRACKED	\$536.00	\$416.00
2	TAILLAMP BRACKET @\$156.00	NO SUCH PARTS	\$312.00	\$0.00
1	REAR END PANEL	BENT	\$789.00	\$455.20
2	REAR NUMBER PLATE LAMP @\$186.00	NOT NECESSARY	\$372.00	\$0.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	SPARE TYRE CARRIER	NOT NECESSARY	\$318.00	\$0.00
1	SPARE TYRE FASTENER	NOT NECESSARY	\$165.00	\$0.00
2	REAR CORNER BRACKET @\$175.00	N/S BENT	\$350.00	\$175.00
2	REAR CORNER BRACKET RUBBER @\$40.00	N/S TORN	\$80.00	\$40.00
2	REAR MUD GUARD PANEL @\$449.00 (DENTED)	NOT CONSISTENT WITH THE IMPACT	\$898.00	\$0.00
1	FRONT WINDSCREEN MOULDING	NOT NECESSARY	\$189.00	\$0.00
	LESS 10.00% DISCOUNT		(\$3,304.20)	(\$642.84)
			\$29,737.80	\$5,785.56

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	LH FRONT DOOR COMPANY STICKER (SN)	NECESSARY	\$40.00	\$30.00
1	70KM/HR STICKER (SN)	NECESSARY	\$40.00	\$10.00
1	13 PAX STICKER (SN)	NECESSARY	\$40.00	\$10.00
1	SET REVERSE SENSOR (SN)	DAMAGED	\$250.00	\$200.00
1	TAILGATE RIVET (SN)	NOT NECESSARY	\$80.00	\$0.00
1	FRONT PANEL BODY SEALANT (SN)	NOT NECESSARY	\$80.00	\$0.00
1	REAR FLOOR PANEL BODY SEALANT (SN)	NOT NECESSARY	\$80.00	\$0.00
1	FRONT NUMBER PLATE (SN)	BENT	\$45.00	\$35.00
1	REAR NUMBER PLATE (SN)	BENT	\$45.00	\$35.00
1	FRONT WINDSCREEN INNER SEAL (SN)	NOT NECESSARY	\$80.00	\$0.00
1	FRONT WINDSCREEN SEALANT (SN)	NOT NECESSARY	\$40.00	\$0.00
			\$820.00	\$320.00

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO FOCUS HEADLAMP		\$50.00	\$30.00
	TO REMOVE /REFIX FRONT WINDSCREEN	NOT NECESSARY	\$150.00	\$0.00
	TO REMOVE/REFIX DASHBOARD TO FACILITATE REPAIR	NOT NECESSARY	\$350.00	\$0.00
	TO VACUUM AND TOP UP AIR CON GAS	NOT NECESSARY	\$120.00	\$0.00
	TO REMOVE/REFIX AIR CON EVAPORATOR UNIT AND BLOWER UNIT	NOT NECESSARY	\$350.00	\$0.00
	TO RUSTPROOF ON ACCIDENT DAMAGE AREA		\$250.00	\$50.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO APPLY BODY SEALANT ON CAR JOINTS	NOT NECESSARY	\$250.00	\$0.00
	TO INSTALL REVERSE SENSOR		\$50.00	\$30.00
	TO PANEL BEAT ,CUT OUT/REWELD PANEL .INCLUSIVE OF THE REPAIR OF FRONT WIPER PANEL,FRONT PANEL,LH FRONT DOOR,TAILGATE HINGE ,TAILGATE L BRACKET AND REAR FLOOR PANEL.		\$2,000.00	\$1,000.00
	TO PUTTY AND SPRAY PAINT ON ACCIDENT DAMAGE AREA		\$2,000.00	\$1,200.00
			\$5,570.00	\$2,310.00
GRAND TOTAL			\$36,127.80	\$8,415.56
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			\$6,700.00
Report Ref No: CD/LPC24090251/Uma3q2				

CKS

MARCUS CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of repositibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G




PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G

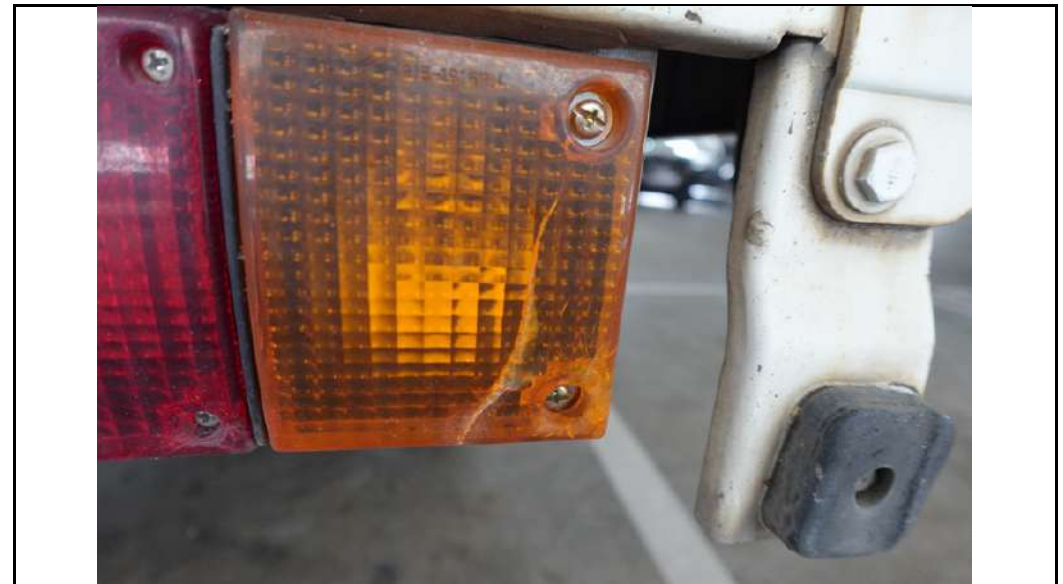

PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G




PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G

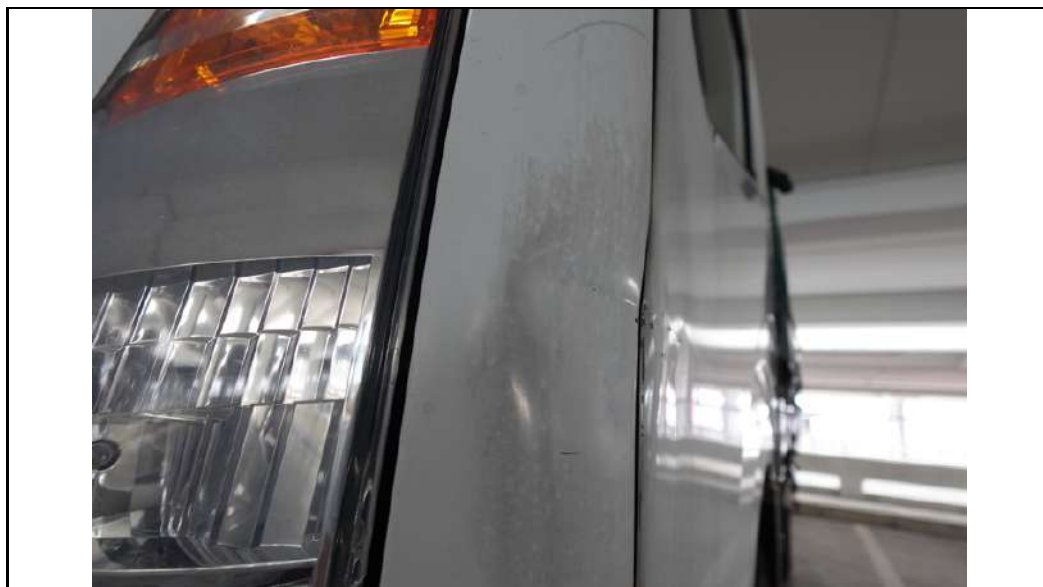

PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G



PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : GBG 7111G

