



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2502105

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 08/04/2025
Reference CD/CTI24090304/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SGH 4004M
Insured Veh. GBJ 7724Y
Claim No. SNM24D205160
Policy No. DMCVSNA00043582403
Accident Date 11/09/2024
Inspection Date 12/09/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24090304/Apa3q2(N)	
			Date: 08/04/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBJ 7724Y	Veh. Inspected	SGH 4004M
	Policy No.	DMCVSNA00043582403	Coverage (\$)	0.00
	Claim No.	SNM24D205160	Excess (\$)	0.00
	Assign From		Assign Date	12/09/2024
2. Vehicle Particulars & Condition				
	Make & Model	NISSAN QASHQAI	c.c	1197
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	SJNFEAJ11U1567279	Colour	PURPLE
	Odometer	149982 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/45 R18	BRIDGESTONE	6 mm
	L/H Front Tyre	215/45 R18	BRIDGESTONE	6 mm
	R/H Rear Tyre	215/45 R18	BRIDGESTONE	6 mm
	L/H Rear Tyre	215/45 R18	BRIDGESTONE	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT & REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	11/09/2024	Inspection Date	12/09/2024
	Survey held at	HD PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGH 4004M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DEFORMED	683.00	683.00
1	FRONT BUMPER TOWING COVER	NOT NECESSARY	34.60	-
2	FRONT BUMPER FOGLAMP COVER @\$75.00	NOT NECESSARY	151.20	-
2	FRONT BUMPER FOGLAMP @\$258.00	CRACKED	516.00	516.00
1	FRONT BUMPER SPONGE (UPPER)	CRACKED	219.00	219.00
1	FRONT BUMPER SPONGE (LOWER)	NOT NECESSARY	135.00	-
1	FRONT BUMPER REINFORCEMENT (UPPER)	DENTED	496.20	496.20
1	FRONT BUMPER REINFORCEMENT (LOWER)	NOT NECESSARY	342.10	-
2	FRONT BUMPER SIDE RETAINER @\$23.50	NOT NECESSARY	47.00	-
2	HEADLAMP (HID) @\$612.20	CRACKED	1,224.40	1,224.40
2	HEADLAMP LOWER BRACKET @\$17.00	NOT NECESSARY	34.00	-
1	FRONT GRILLE C/W CHROME & LOGO	CUT	575.20	575.20
1	FRONT FENDER	NOT NECESSARY	685.40	-
2	FRONT FENDER INNER COWLING @\$108.90	NOT NECESSARY	217.80	-
2	FRONT FENDER ARCED GARNISH @\$541.40	O/S CRACKED	1,082.80	541.40
1	BONNET	DENTED	1,061.30	1,061.30
1	BONNET LOCK	DAMAGED	67.60	67.60
1	BONNET INNER RUBBER	NOT NECESSARY	72.40	-
1	BONNET INSULATOR	NOT NECESSARY	296.70	-
2	BONNET INSULATOR @\$19.40	NOT NECESSARY	38.80	-
2	BONNET HINGE @\$56.10	NOT NECESSARY	112.20	-
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	628.70	-
1	FRONT SUPPORT PANEL TOP COVER GARNISH	CRACKED	219.70	219.70
1	RADIATOR	DENTED	974.60	974.60
1	RADIATOR TOP SUPPORT GARNISH	CRACKED	187.50	187.50
1	RADIATOR LOWER SUPPORT GARNISH	NOT NECESSARY	187.50	-
2	RADIATOR MOUNTING @\$19.60	NECESSARY	39.20	39.20
1	AIR CON CONDENSER	DENTED	879.90	879.90
2	AIR CON CONDENSER SIDE GARNISH @\$38.60	DEFORMED	77.20	77.20
1	AIR CON SUCTION PIPE	NOT NECESSARY	580.00	-

Report Ref No. CD/CTI24090304/Apa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIR CON PRESSURE PIPE	NOT NECESSARY	730.00	-
1	HORN	CRACKED	195.00	195.00
1	OIL COOLER	DENTED	986.40	986.40
1	OIL COOLER PIPE	NOT NECESSARY	397.20	-
1	TURBO COOLER	DENTED	1,246.30	1,246.30
1	TURBO COOLER SIDE AIR GUARD	NOT NECESSARY	1,246.30	-
1	REAR BUMPER	DEFORMED	797.00	797.00
2	REAR BUMPER REFLECTOR @\$62.00	NOT NECESSARY	124.00	-
1	REAR BUMPER TOWING COVER	NOT NECESSARY	19.00	-
2	REAR BUMPER SIDE RETAINER @\$39.00	NOT NECESSARY	78.00	-
1	REAR BUMPER REINFORCEMENT	DENTED	692.00	692.00
2	REAR BUMPER REINFORCEMENT BRACKET @\$142.00	NOT NECESSARY	284.00	-
2	REAR BUMPER LOWER SIDE BRACKET @\$26.00	NOT NECESSARY	52.00	-
1	REAR BUMPER SPONGE	CRACKED	142.00	142.00
2	REAR FENDER INNER COWLING @\$202.00	NOT NECESSARY	404.00	-
2	REAR FENDER ARCED GARNISH @\$540.00	NOT NECESSARY	1,080.00	-
2	REAR FENDER INNER TRIM @\$496.10	NOT NECESSARY	992.20	-
2	TAIL LAMP @\$347.00	NOT NECESSARY	694.00	-
1	TAILGATE	TO REPAIR SEE LABOUR	3,062.60	-
1	TAILGATE LOGO	NECESSARY	53.60	53.60
1	TAILGATE EMBLEM QASHQAI	NECESSARY	95.00	95.00
2	TAILGATE LAMP @\$339.90	NOT NECESSARY	679.80	-
2	TAILGATE NUMBER PLATE LAMP @\$24.40	NOT NECESSARY	48.80	-
1	TAILGATE SWITCH BUTTOM	NOT NECESSARY	73.00	-
2	TAILGATE DAMPER @\$98.00	NOT NECESSARY	196.00	-
1	TAILGATE LOCK CATCH	NOT NECESSARY	35.10	-
1	TAILGATE INNER HOLDER	NOT NECESSARY	20.00	-
1	TAILGATE INNER LOCK	NOT NECESSARY	174.00	-
1	TAILGATE LOCK DETECTOR	NOT NECESSARY	168.70	-
1	TAILGATE INNER TRIM BOARD	NOT NECESSARY	496.50	-
1	TAILGATE WEATHERSTRIP	NOT NECESSARY	167.00	-
1	TAILGATE WINDSCREEN C/W MOULDING	NOT NECESSARY	990.00	-

Report Ref No. CD/CTI24090304/Apa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR END PANEL	DENTED	483.00	483.00
1	REAR END PANEL TOP GARNISH	DEFORMED	69.00	69.00
1	REAR TOOLS SPONGE COMPARTMENT	NOT NECESSARY	194.20	-
1	REAR TOOLS SPONGE COMPARTMENT BOLT	NOT NECESSARY	48.90	-
1	REAR TOOLS COMPARTMENT COVER BOARD (OUTER)	DEFORMED	528.00	528.00
1	REAR TOOLS COMPARTMENT COVER BOARD (INNER)	NOT NECESSARY	572.00	-
1	REVERSE CAMERA	NOT NECESSARY	929.60	-
	LESS 10% DISCOUNT		-3,111.12	-1,304.95
			28,000.08	11,744.55
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	80.00	30.00
1	SET FRONT FENDER INNER COWLING CLIP (SN)	NOT NECESSARY	60.00	-
1	BONNET INSULATOR CLIP (SN)	NOT NECESSARY	80.00	-
1	COOLANT (SN)	NECESSARY	120.00	50.00
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	80.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	80.00	50.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	TAILGATE WINDSCREEN INNER SEAL (SN)	NOT NECESSARY	60.00	-
1	TAILGATE WINDSCREEN SOLAR FILM (SN)	NOT NECESSARY	550.00	-
4	REVERSE SENSOR (SN)	DAMAGED	360.00	300.00
			1,550.00	430.00
	<u>LABOUR</u>			
	PANEL BEATING ,REMOVING AND REPLACING PARTS.INCLUSIVE OF THE REPAIR OF FRONT SUPPORT PANEL .(FRONT)		1,600.00	600.00
	SPRAY PAINTING TO AFFECTED AREA.(FRONT)		1,600.00	400.00
	WIRING CHECK .(FRONT)		120.00	30.00
	REFOCUS HEADLAMP BEAM. (FRONT)	NOT NECESSARY	80.00	-
	REMOVE AND REFIX AIRCON CONDENSOR AND REFILL AIRCON GAS.(FRONT)		120.00	60.00
	REMOVE AND REFIX RADIATOR AND CONDUCT PRESSURE TEST .(FRONT)		80.00	60.00
	REMOVE AND REFIX AIR COOLER AND OIL COOLER. (FRONT)		180.00	60.00

Report Ref No. CD/CTI24090304/Apa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.(FRONT)	NOT NECESSARY	180.00	-
	TO PANEL BEAT, REMOVE AND REPLACE PARTS.INCLUSIVE OF THE REPAIR OF TAILGATE .TAILGATE		1,800.00	600.00
	TO SPRAY PAINT AFFECTED AREA .(REAR)		1,600.00	600.00
	TUFF COAT.(REAR)		250.00	60.00
	TRANSFER TAILGATE MECHANISMS.(REAR)	NOT NECESSARY	80.00	-
	REMOVE AND REFIX TAILGATE WINDSCREEN.(REAR)	NOT NECESSARY	120.00	-
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.(REAR)		80.00	50.00
	REMOVE AND REFIX REAR REVERSE CAMERA.(REAR)	NOT NECESSARY	80.00	-
	REMOVE AND REFIX VIDEO RECORDER .(REAR)		80.00	-
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	180.00	-
			8,230.00	2,520.00
GRAND TOTAL			37,780.08	14,694.55
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				9,000.00

Report Ref No. CD/CTI24090304/Apa3q2(N)

ADRIAN LING WAI PING


B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser


DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

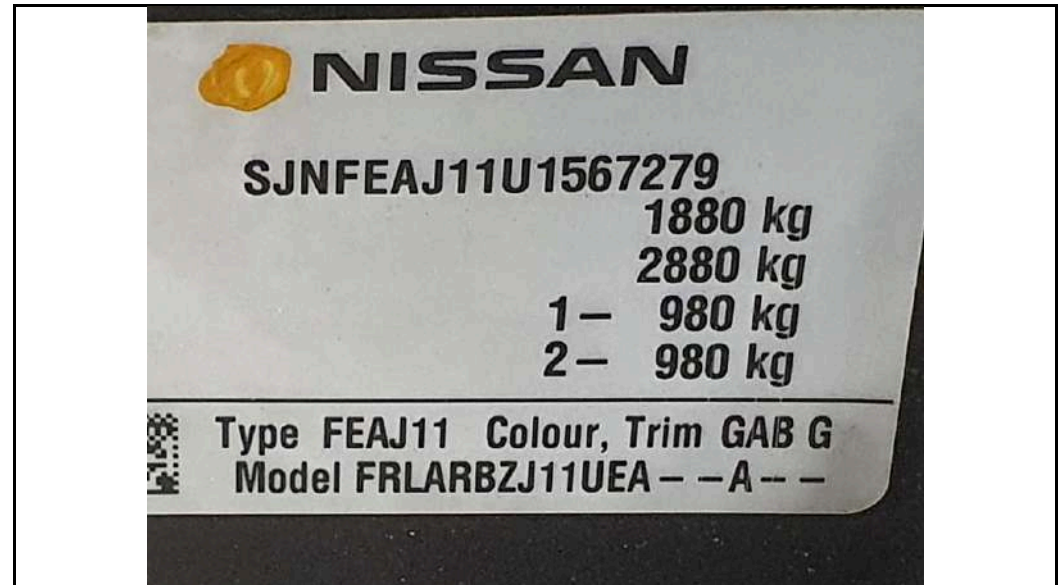


PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

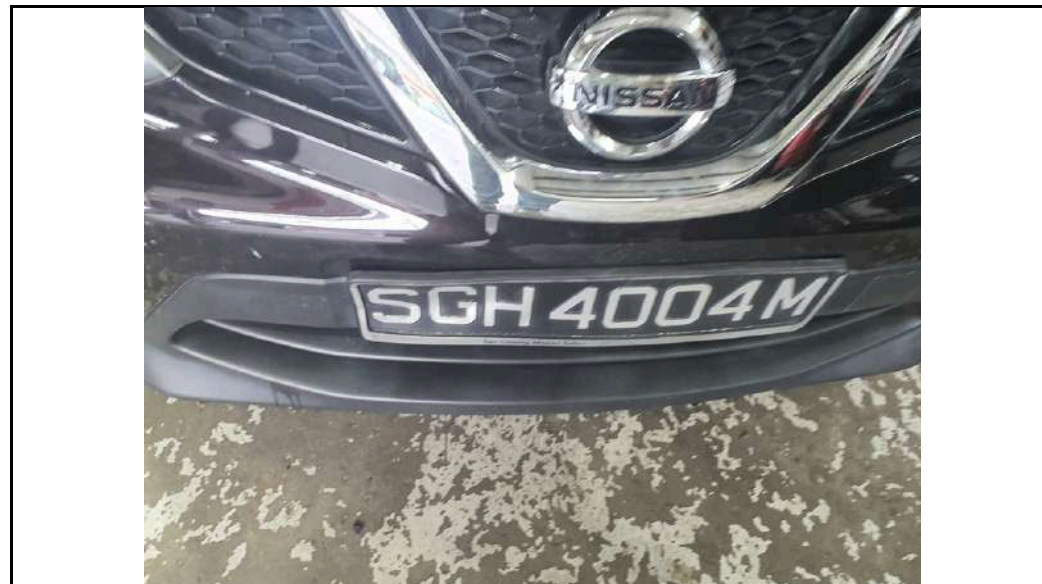

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

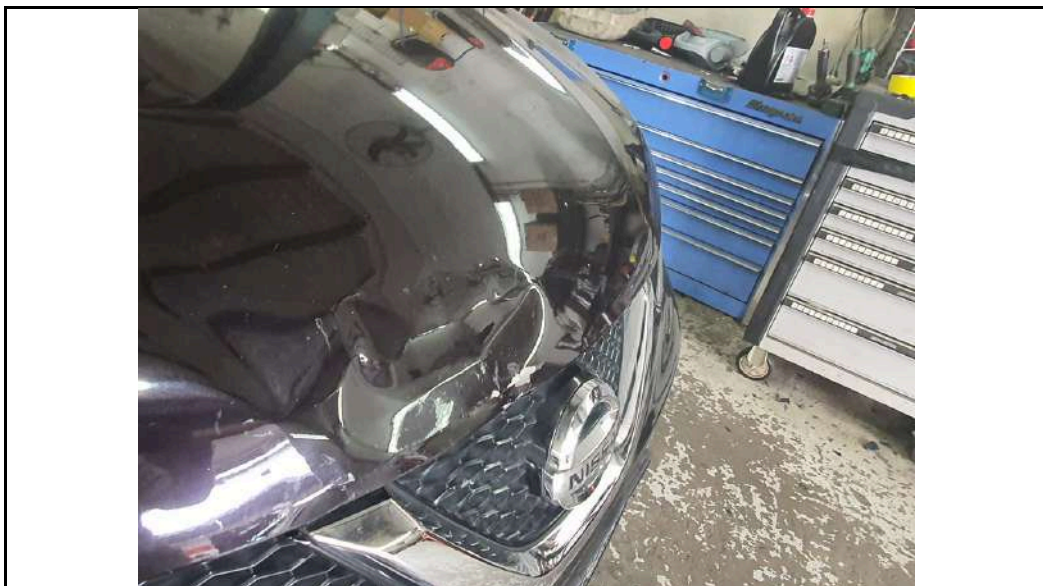



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 5 of 11)

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 10 of 11)

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.

19-9607198-R

INSPECTION PHOTOS (Page 11 of 11)


PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M





PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M




PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

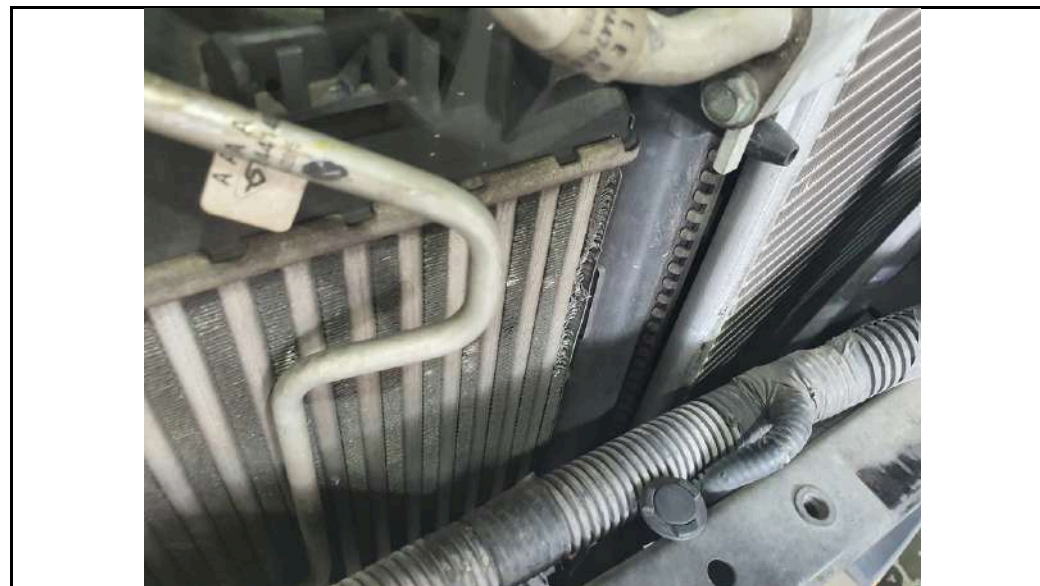

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

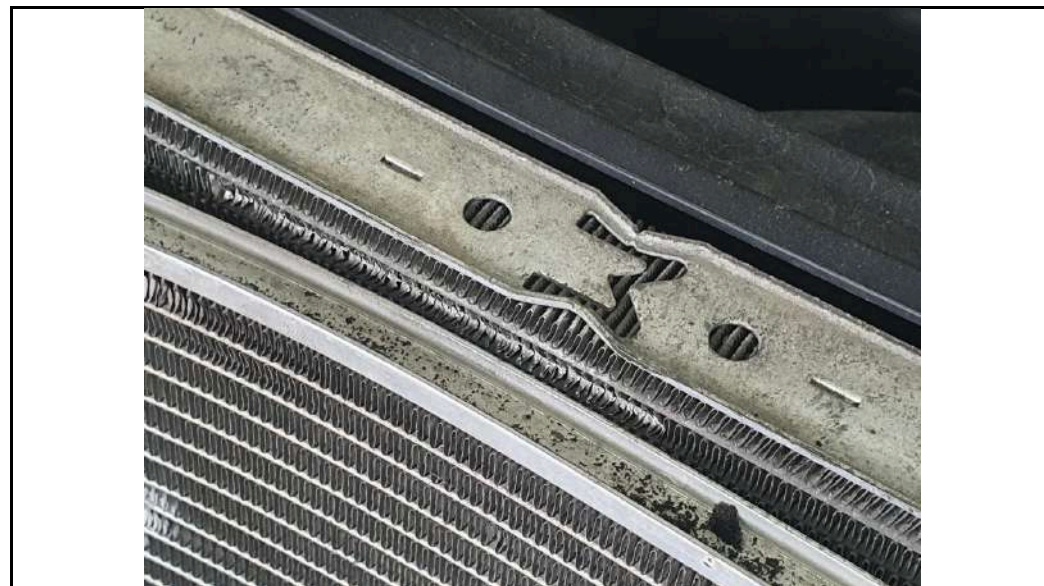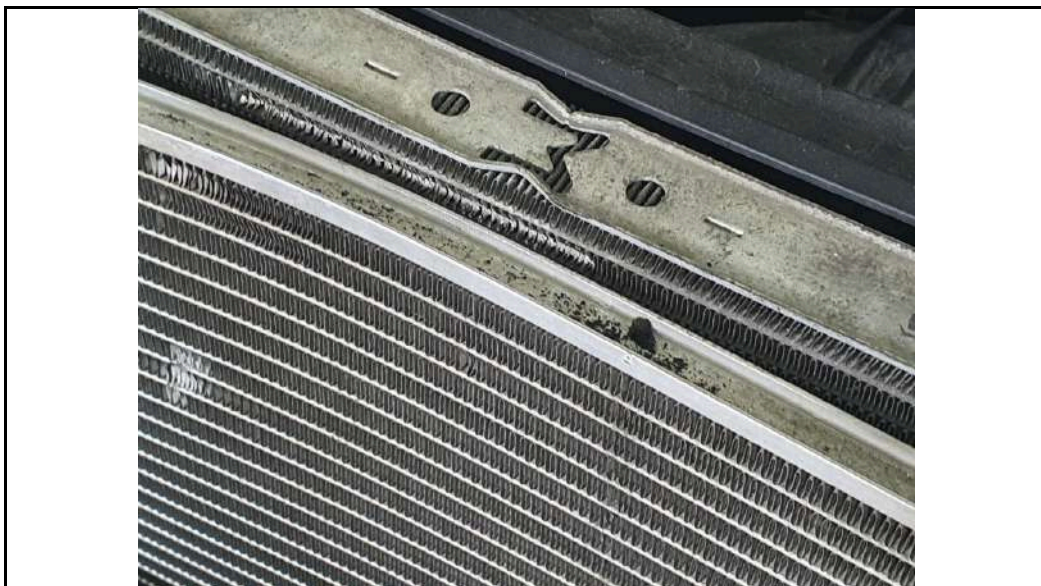

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

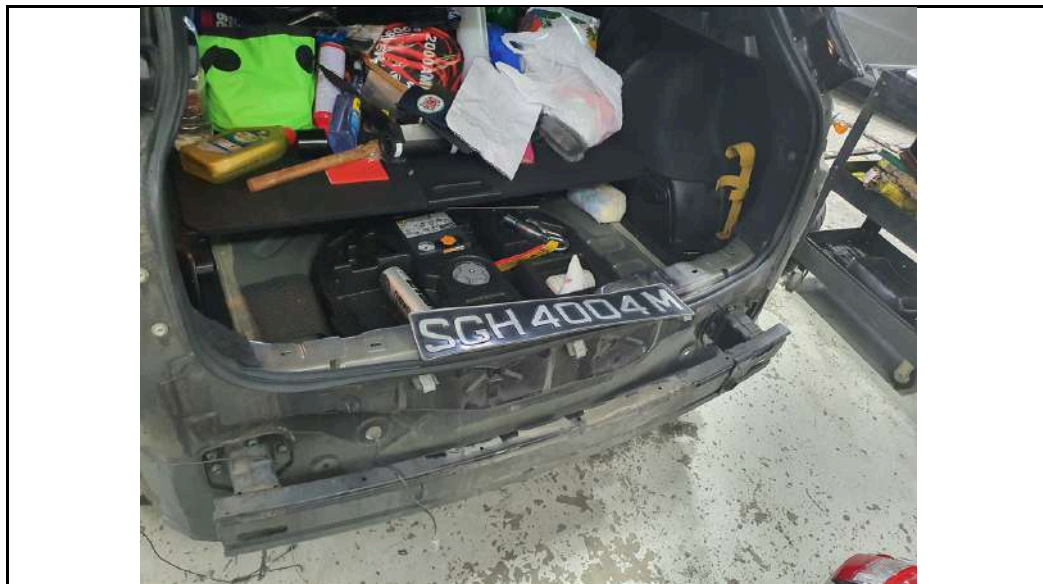

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M




PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M





PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M




PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

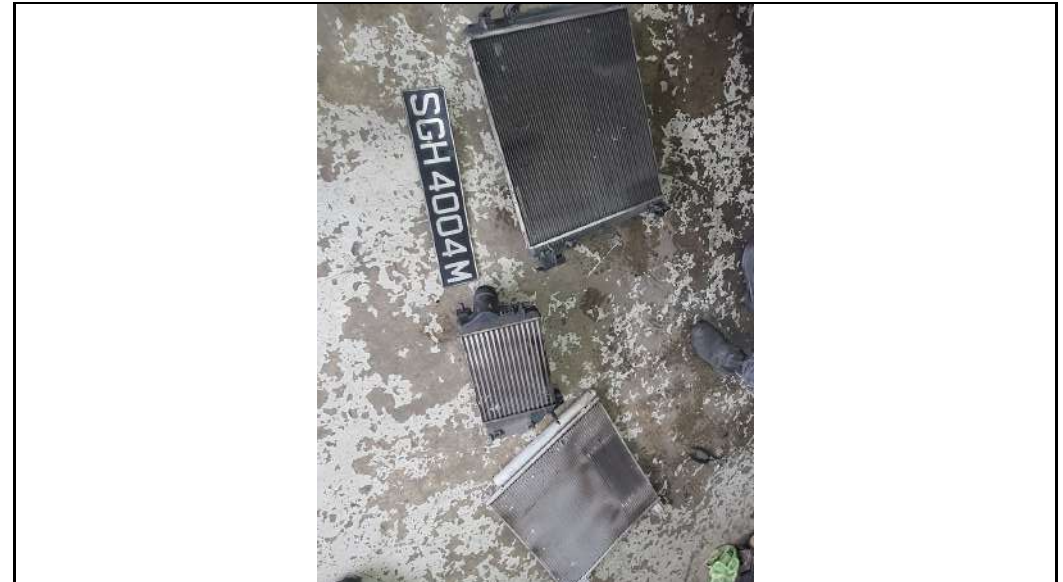

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

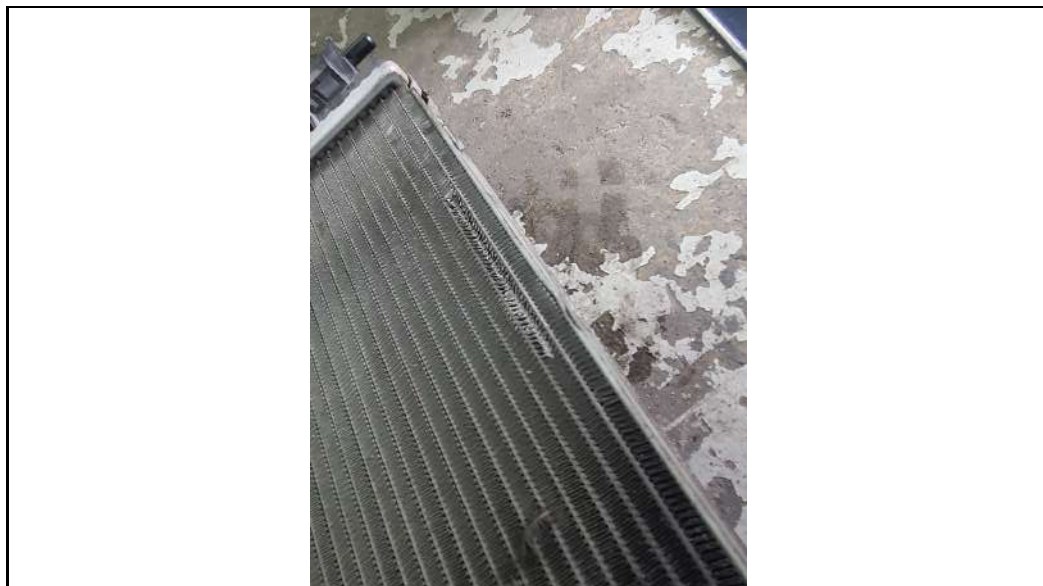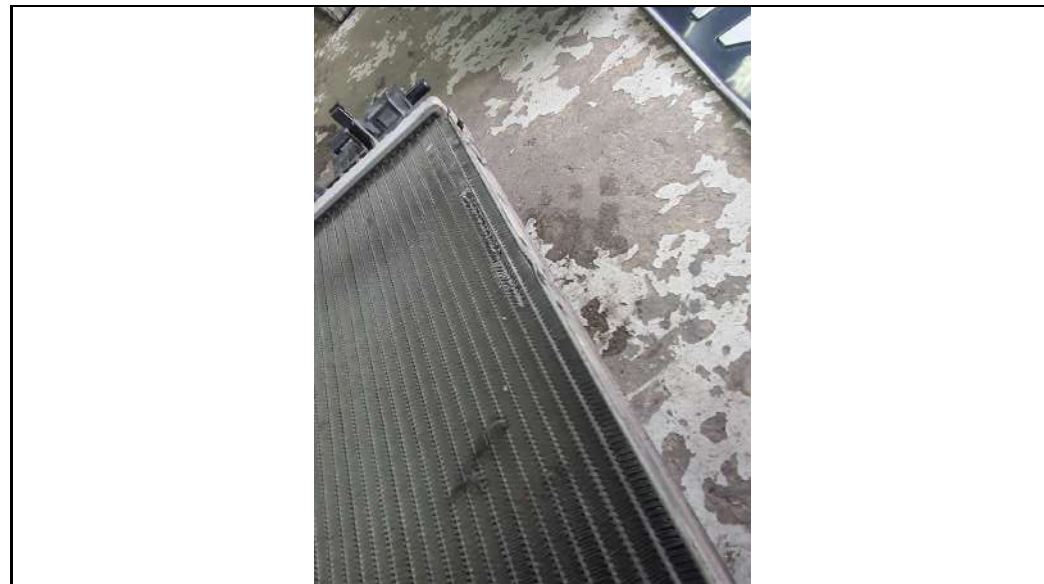

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

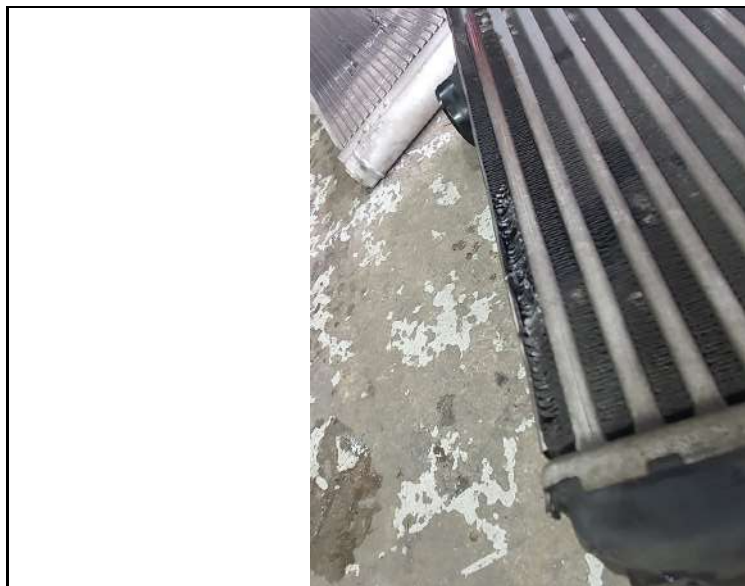

PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M



PHOTOGRAPHS FOR VEHICLE NO. : SGH 4004M

