

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. : SAC2401841

INV Date : 13-12-2024

Reference CD/CTI24090317/Uma3q2

Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SFX 8899Z
Insured Veh. GBK 4161K
Claim No. SNM24D205267
Policy No. DMCVSNW00098802300
Accident Date 17/09/2024
Inspection Date 18/09/2024

Description	Amount
Third Party Express Settlement	400.00
Sub-Total	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS CHINA TAIPING INSURANCE (S) PTE LTD	Ref:	CD/CTI24090317/Uma3q2
3 ANSON ROAD #16-00	Date:	13/12/2024
SPRINGLEAF TOWER SINGAPORE 079909	Code:	CTI

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	GBK 4161K	Veh. Inspected	SFX 8899Z
Policy No.	DMCVSNW00098802300	Coverage	0
Claim No.	SNM24D205267	Excess	\$0.00
Assign From	IRENE TAY	Assign Date	18/09/2024

2. Vehicle Details

Make & Model	TOYOTA WISH 1.8 CVT	C.C	1798
Engine No.	2ZR0A42182	Year of Reg.	10/01/2018
Chassis No.	JTDGG20WX0J008529	Colour	WHITE
Odometer	77695 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: SPORTS RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	195/65R15	YOKOHAMA	8
L/H Front Tyre	195/65R15	YOKOHAMA	8
R/H Rear Tyre	195/65R15	YOKOHAMA	8
L/H Rear Tyre	195/65R15	YOKOHAMA	8

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	17/09/2024	Inspection Date	18/09/2024
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 4 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SFX 8899Z

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN	NOT NECESSARY	\$1,288.10	\$0.00
1	REAR WINDSCREEN MOULDING	NOT NECESSARY	\$145.40	\$0.00
1	TAILGATE	TO REPAIR SEE LABOUR	\$1,742.00	\$0.00
1	TAILGATE OUTER HANDLE	NOT NECESSARY	\$299.40	\$0.00
2	TAILGATE REFLECTORS @\$182.40	NOT NECESSARY	\$364.80	\$0.00
1	TAILGATE INNER LOCK	SERVICEABLE	\$616.80	\$0.00
1	TAILGATE WEATHERSTRIP	TWISTED	\$386.20	\$386.20
1	TAILGATE INNER TRIM BOARD	NOT NECESSARY	\$567.30	\$0.00
1	REAR BUMPER	TORN	\$865.90	\$801.20
2	REAR BUMPER DAMPERS @\$85.00	N/S BENT / O/S SERVICEABLE	\$170.00	\$85.00
2	REAR BUMPER SIDE RETAINERS @\$65.00	NOT NECESSARY	\$130.00	\$0.00
2	REAR BUMPER REFLECTORS @\$60.00	CRACKED	\$120.00	\$120.00
1	REAR END PANEL OUTER	DENTED / BENT	\$842.00	\$842.00
1	REAR END PANEL LOWER	DENTED / BENT	\$389.20	\$389.20
1	REAR END PANEL TOP GARNISH	TWISTED	\$381.80	\$381.80
2	TAILLAMPS @\$395.00	NOT NECESSARY	\$790.00	\$0.00
1	REAR ANTENNA SENSOR	CRACKED	\$645.20	\$325.10
1	SET REAR REVERSE SENSOR WIRE	TORN	\$321.50	\$282.50
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	\$1,410.80	\$0.00
	LESS 25.00% DISCOUNT		(\$2,869.10)	(\$903.25)
			\$8,607.30	\$2,709.75

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	\$50.00	\$0.00
1	REAR WINDSCREEN INNER SEAL (SN)	NOT NECESSARY	\$50.00	\$0.00
1	SET TAILGATE INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	\$50.00	\$0.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	\$50.00	\$40.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	MALFUNCTION	\$280.00	\$200.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	\$180.00	\$0.00
			\$660.00	\$240.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO CHECK WIRING		\$50.00	\$20.00
	TO REMOVE & REPLACED REAR REVERSE SENSOR		\$80.00	\$30.00
	TO REMOVE & REFIX REAR WINDSCREEN	NOT NECESSARY	\$150.00	\$0.00
	TO REMOVE & REFIX TAILGATE MECHANISM	NOT NECESSARY	\$100.00	\$0.00
	TO REMOVE & REFIX CUSHION UPHOLSTERY		\$120.00	\$80.00
	TO REMOVE & REFIX REAR EXHAUST	NOT NECESSARY	\$100.00	\$0.00
	TO SPRAY ANTI RUST PROOFING		\$120.00	\$30.00
	TO DIAGNOSIS & REPROGRAMME SYSTEM	NOT NECESSARY	\$180.00	\$0.00
	LABOUR FOR PANEL BEATING.INCLUSIVE OF THE REPAIR OF TAILGATE AND REAR FLOOR PANEL.		\$1,200.00	\$600.00
	TO PUTTY & SPRAY PAINTING		\$1,800.00	\$800.00
			\$3,900.00	\$1,560.00
GRAND TOTAL			\$13,167.30	\$4,509.75
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			\$3,600.00
Report Ref No: CD/CTI24090317/Uma3q2				

CKS

MARCUS CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of repositibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 4 of 11)

PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z

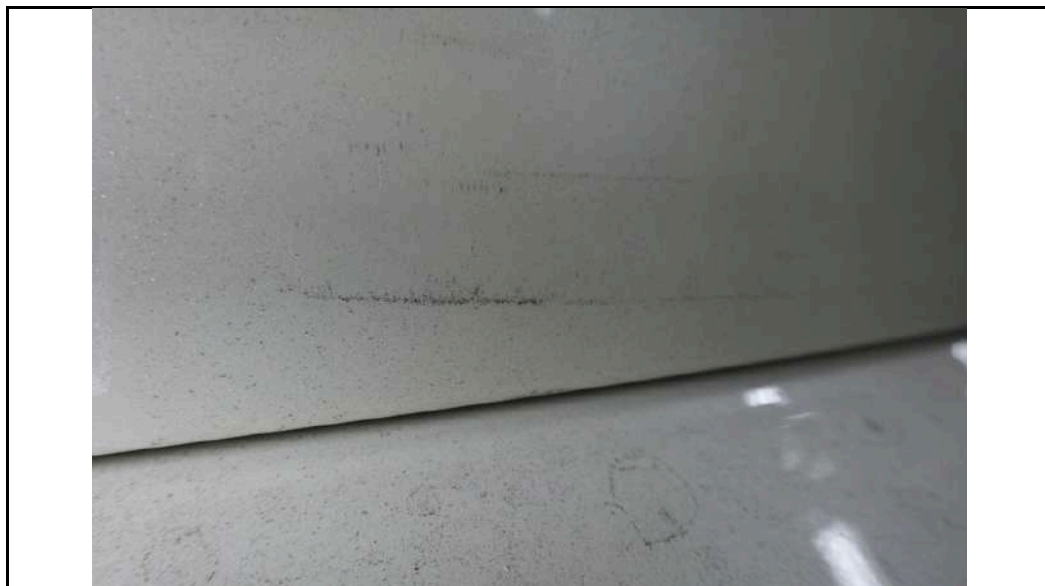

PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z




PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z

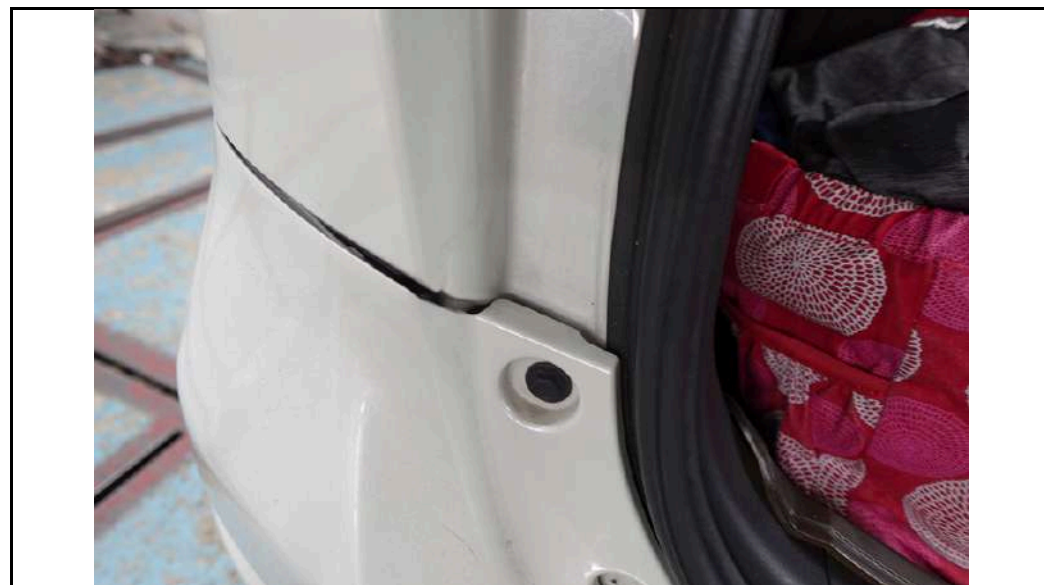

PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 3 of 14)

PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 4 of 14)

PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z

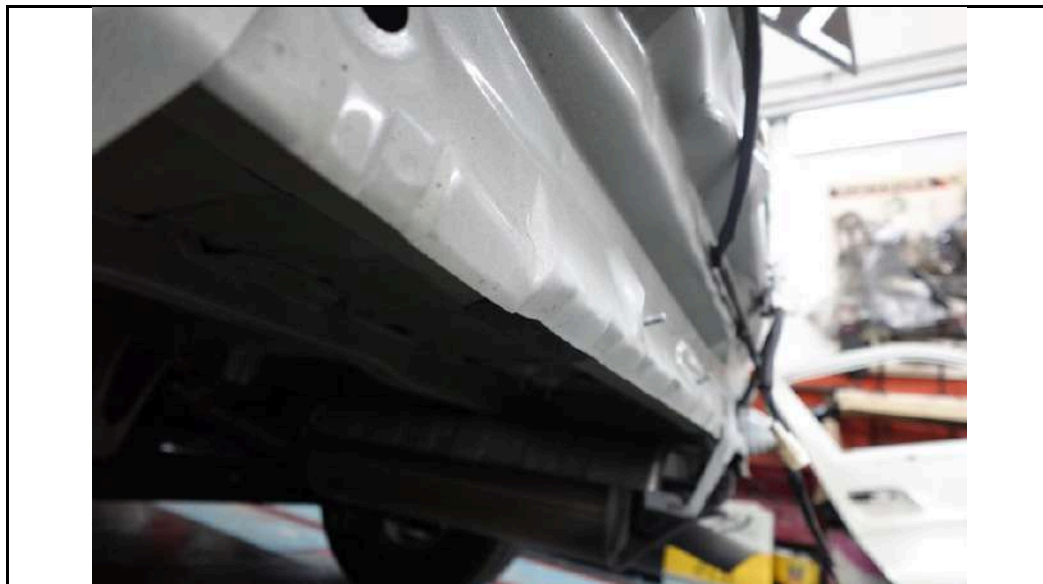

PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z



PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SFX 8899Z

