

REF:

ASSIGNMENT

From: _____ Date: _____

Estim: _____

OD / TP RES / CD RES / EVA / INV / MV

To in _____ Vehicle No: _____

at _____ of _____

Insured: _____

Policy No: _____

Claims No: _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

N/S	O/S

Remark: There had commenced its repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SMP7730S Yr Regn: 2019, Oct.

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or Avante

Make: Hyundai Elantra C.B. 1591

Colour: White A/C: Insured / Std / NI / NA

Sp. Reading: 321258 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KMH D841CM LU 99 7563

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55R16

R: 205/55R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Hankook

Front _____ Rear _____

R/Bal. 06 mm R/Bal. 06 mm

L/Bal. 06 mm L/Bal. 02 mm

D.O.A. _____ D.O.I. 23/09/24

Survey held at HD Perfect

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Front N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>TP Check</u>
	<u>COE Expiry</u>
	<u>Estimate given during 1st Survey</u>
	<u>MV: 72K</u>
	<u>PV: 29.9K</u>
	<u>Nett: 42.1K</u>

019H

Date/Time, File Pass to? : Preli. Report

1) : Final Report

Date/Time, File Return to?

2) _____

Report Format: _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Addl Fee: : Site Insp (\$ _____)

: Interview (\$ _____)

: Tech. Inve (\$ _____)

Survey Fee:	_____
Transportation:	B + P.S. \$ _____
Photos:	_____
Others:	_____


HD Perfect Autowork Pte Ltd

Company Reg No: 202136904Z

8 Kaki Bukit Ave 4, #08-09 Premier@Kaki Bukit
Singapore 415875

Tel : 6341 6789 Fax: 6341 6778

E-mail: hdperfectautowork@gmail.com

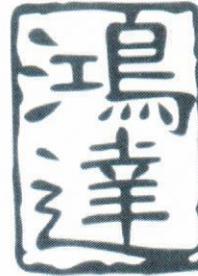

HD PERFECT
AUTOWORK PTE LTD

DATE : 26.08.2024

TO : **CHINA TAIPING** MOTOR CLAIMS DEPTS
VEHICLE NO : **SMP7730S**
MODEL : **HYUNDAI AVANTE**
DATE OF ACCIDENT : 03.08.2024
TIME OF ACCIDENT : 19:20 HOURS

WE APPEND HEREUNDER THE ESTIMATED COST OF REPAIRS TO BE CARRIED OUT TO THE ABOVE VEHICLE.

CLAIM DETAIL : PARTS

S/N	DESCRIPTION	QTY	UNIT LIST PRICE	TOTAL LIST PRICE
1	FRONT BUMPER <i>Dented</i>	1	\$ 474.40	\$ 474.40
2	FRONT BUMPER LOWER LIP <i>New</i>	1	\$ 71.70	\$ 71.70
3	FRONT BUMPER FOGLAMP C/W BRACKET RH <i>new</i>	1	\$ 165.00	\$ 165.00
4	FRONT BUMPER FOG LAMP LOWER GARNISH RH <i>new</i>	1	\$ 115.40	\$ 115.40
5	FRONT BUMPER SIDE RETAINER <i>new</i>	2	\$ 16.00	\$ 32.00
6	FRONT BUMPER AIR VENT LH <i>Dented</i>	1	\$ 24.40	\$ 24.40
7	FRONT BUMPER REINFORCEMENT <i>New</i>	1	\$ 695.80	\$ 695.80
8	FRONT BUMPER SPONGE <i>new</i>	1	\$ 110.70	\$ 110.70
9	FRONT BUMPER LOWER BEAM <i>New</i>	1	\$ 119.00	\$ 119.00
10	FRONT BUMPER BOTTOM GARNISH <i>New</i>	1	\$ 133.30	\$ 133.30
11	FRONT BUMPER CENTER BRACKET <i>New</i>	2	\$ 49.20	\$ 98.40
12	FRONT SIDE MIRROR RH <i>New</i>	1	\$ 1,332.90	\$ 1,332.90
13	HEAD LAMP <i>cracked LH</i>	2	\$ 3,034.90	\$ 6,069.80
14	HEAD LAMP LOWER BRACKET LH <i>New</i>	1	\$ 24.00	\$ 24.00
15	HEAD LAMP CLIP <i>new</i>	2	\$ 28.60	\$ 57.20
16	CENTER GRILLE <i>2 pc</i>	1	\$ 1,214.30	\$ 1,214.30
17	CENTER GRILLE LOGO <i>1 pc</i>	1	\$ 128.30	\$ 128.30
18	FRONT SUPPORT PANEL <i>1 pc</i>	1	\$ 949.30	\$ 949.30
19	WASHER TANK	1	\$ 238.00	\$ 238.00
20	FRONT FENDER LH <i>Dented</i>	1	\$ 1,227.70	\$ 1,227.70
21	FRONT FENDER INNER COWLING LH	2	\$ 85.70	\$ 171.40

Handwritten checkmarks and a total sum of 3034.90 are visible on the right side of the table.

TO : **CHINA TAIPING** MOTOR CLAIMS DEPTS
 VEHICLE NO : **SMP7730S**
 MODEL : **HYUNDAI AVANTE**
 DATE OF ACCIDENT : 03.08.2024
 TIME OF ACCIDENT : 19:20 HOURS

22	FRONT ABS SENSOR LH	1	\$ 201.90	\$ 201.90	+
23	FRONT KNUCKLE ARM LH	1	\$ 309.70	\$ 309.70	+
24	FRONT LOWER ARM LH	1	\$ 282.80	\$ 282.80	+
25	FRONT WHEEL HUP LH	1	\$ 168.30	\$ 168.30	+
26	FRONT KNUCKLE ARM BEARING LH	1	\$ 124.60	\$ 124.60	+
27	FRONT STABILIZER BAR LINKAGE LH	1	\$ 79.40	\$ 79.40	+
28	FRONT DRIVESHAFT LH	1	\$ 986.70	\$ 986.70	+
29	FRONT SHOCK ABSORBER LH	1	\$ 234.60	\$ 234.60	+
30	FRONT STEERING RACK AND PINION	1	\$ 1,168.50	\$ 1,168.50	+

TOTAL PRICE \$ 17,009.50
 LESS 20% \$ 3,401.90
SUB TOTAL PRICE \$ 13,607.60

SPECIAL NETT ITEMS

S/N	DESCRIPTION	QTY	UNIT S/NETT	TOTAL S/NETT	
1	FRONT NUMBER PLATE	1	\$ 50.00	\$ 50.00	+
2	FRONT BUMPER CLIP (SET)	1	\$ 80.00	\$ 80.00	+
3	FRONT BUMPER FOG LAMP LOWER GARNISH CLIP (SET)	1	\$ 60.00	\$ 60.00	+
4	FRONT ENGINE UNDER COVER CLIP (SET)	1	\$ 80.00	\$ 80.00	+
5	FRONT FENDER INNER COWLING CLIP (SET)	1	\$ 80.00	\$ 80.00	+
6	CENTER GRILLE CLIP (SET)	1	\$ 60.00	\$ 60.00	+
7	CENTER GRILLE TOP COVER GARNISH CLIP (SET)	1	\$ 60.00	\$ 60.00	+
8	FRONT TYRE RH	1	\$ 380.00	\$ 380.00	+
9	FRONT WHEEL SPORT RIM RH	1	\$ 450.00	\$ 450.00	+
10	FRONT WHEEL HUP (SET)	1	\$ 80.00	\$ 80.00	+
11	BRAKE OIL	1	\$ 80.00	\$ 80.00	+

TOTAL \$ 1,460.00

CLAIM DETAILS: LABOUR AND SPRAY PAINTING (FRONT)

S/N	JOB DESCRIPTION	PRICE	ADJUSTED COST
1	PANEL BEATING, REMOVING AND REPLACING PARTS	\$ 1,600.00	400
2	SPRAY PAINTING TO AFFECTED AREA	\$ 1,400.00	400

TO : **CHINA TAIPING** MOTOR CLAIMS DEPTS
 VEHICLE NO : **SMP7730S**
 MODEL : **HYUNDAI AVANTE**
 DATE OF ACCIDENT : 03.08.2024
 TIME OF ACCIDENT : 19:20 HOURS

3	REFOCUS HEADLAMP BEAM	\$ 60.00	X
4	REMOVE AND REFIX FRONT UNDERCARRIAGE	\$ 850.00	X
5	FOUR WHEEL ALIGNMNET	\$ 120.00	X
6	REMOVE AND REFIX POWER STEERING RACK AND PINION	\$ 350.00	X
7	RESET ABS LIGHT	\$ 350.00	X
8	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT/CONTROL UNITS,RESET MEMORIES TO SPECIFICATION ETC.	\$ 180.00	X

TOTAL \$ 4,910.00

ESTIMATE REPORT

TOTAL PARTS COST : \$ 15,067.60
 TOTAL LABOUR COST : \$ 4,910.00
 TOTAL REPAIR COST : \$ 19,977.60

Adrian G
2/3 23/09/24
04 Days

NB: THIS IS ONLY AN ESTIMATE AND SHOULD ADDITIONAL WORK BE FOUND NECESSARY TO BE CARRIED OUT IN THE COURSE OF REPAIRS, EXTRA MATERIALS AND LABOUR COST WILL BE CHARGED ACCORDINGLY WHICH HOWEVER, YOU WILL BE INFORMED PRIOR TO ACTION TAKEN.

PARTS PRICES ARE SUBJECT TO CHANGES.

YOURS FAITHFULLY,

IRENE

SERVICE ADVISOR
 IRENE
 HP : 8297 9787

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed **and** is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date: