



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2500084

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 06/01/2025
Reference CD/CTI24100125/Uma3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SGG 5505H
Insured Veh. SNM 365M
Claim No. SNM24D205637
Policy No. DMHCSNA00012112400
Accident Date 07/10/2024
Inspection Date 07/10/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER SINGAPORE 079909

Ref: CD/CTI24100125/Uma3q2

Date: 06/01/2025

Code: CTI

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	SNM 365M	Veh. Inspected	SGG 5505H
Policy No.	DMHCSNA00012112400	Coverage	0
Claim No.	SNM24D205637	Excess	\$0.00
Assign From	CECILIA LEE	Assign Date	07/10/2024

2. Vehicle Details

Make & Model	HONDA SHUTTLE 1.5G A	C.C	1496
Engine No.	L15B3535969	Year of Reg.	16/08/2016
Chassis No.	GK81005119	Colour	BLUE
Odometer	147719 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: SPORTS RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	185/55R16	CONTINENTAL	6
L/H Front Tyre	185/55R16	CONTINENTAL	6
R/H Rear Tyre	185/55R16	CONTINENTAL	6
L/H Rear Tyre	185/55R16	CONTINENTAL	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION & REAR WINDSCREEN.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	07/10/2024	Inspection Date	07/10/2024
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 7 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SGG 5505H

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN	SHATTERED	\$1,650.00	\$1,288.60
1	REAR WINDSCREEN MOULDING	NECESSARY	\$166.20	\$121.40
1	TAILGATE	BADLY DENTED	\$1,455.20	\$1,193.40
1	TAILGATE REAR LOGO	NECESSARY	\$48.00	\$48.00
2	TAILGATE REFLECTORS @\$441.60	CRACKED	\$883.20	\$761.20
1	TAILGATE SHUTTLE EMBLEM	NECESSARY	\$75.00	\$52.00
1	TAILGATE OUTER GARNISH	TWISTED / CRACKED	\$495.00	\$428.20
1	TAILGATE INNER LOCK	DAMAGED	\$288.20	\$265.20
1	TAILGATE INNER TRIM BOARD	DEFORMED / CRACKED	\$455.10	\$388.50
1	TAILGATE WEATHERSTRIP	TWISTED	\$232.80	\$185.40
1	REAR TAILGATE WIPER MOTOR	BENT	\$655.20	\$655.20
1	REAR WIPER ARM	NOT NECESSARY	\$211.80	\$0.00
2	TAILLAMPS @\$950.00	CRACKED	\$1,900.00	\$910.60
1	REAR BUMPER	DISTORTED	\$1,415.10	\$936.00
2	REAR BUMPER SIDE RETAINERS @\$45.00	BENT	\$90.00	\$90.00
2	REAR BUMPER REFLECTORS @\$75.00	TWISTED	\$150.00	\$150.00
2	REAR BUMPER SIDE COVERS @\$111.00	TWISTED	\$222.00	\$177.00
1	REAR BUMPER INNER SPONGE	NOT NECESSARY	\$183.00	\$0.00
1	REAR BUMPER TOW COVER	TWISTED	\$45.00	\$45.00
1	REAR END PANEL	DENTED / BENT	\$755.20	\$615.00
1	REAR END PANEL TOP GARNISH	TWISTED	\$248.70	\$248.70
1	REAR END PANEL ANTENNA SENSOR	NOT NECESSARY	\$108.90	\$0.00
2	REAR END PANEL SIDE EXTENSION PANELS @\$285.00	BENT	\$570.00	\$570.00
1	REAR EXHAUST	NOT NECESSARY	\$688.20	\$0.00
1	REAR FLOOR PANEL TOP BOARD	WARPED /CRACKED	\$544.10	\$482.50
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	\$1,140.20	\$0.00
1	REAR FLOOR PANEL TOOLS TRAY	TWISTED / CRACKED	\$652.30	\$466.80
1	REAR BUMPER TOOLS SPONGE	NOT NECESSARY	\$588.00	\$0.00
2	REAR FENDER INNER TRIM BOARDS @\$690.00	DEFORMED / TORN	\$1,380.00	\$776.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR FENDER	TO REPAIR SEE LABOUR	\$1,155.20	\$0.00
	LESS 0.00 / 20.00% DISCOUNT		\$0.00	(\$2,170.94)
			\$18,451.60	\$8,683.76

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN SOLAR FILM (SN)	NECESSARY	\$250.00	\$150.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	\$50.00	\$40.00
1	REAR WINDSCREEN INNER SEAL (SN)	NECESSARY	\$50.00	\$20.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	MALFUNCTION	\$280.00	\$200.00
1	SET REAR REVERSE CAMERA (SN)	MALFUNCTION / SHORTED	\$450.00	\$300.00
1	SET TAILGATE INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	\$50.00	\$0.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	\$60.00	\$30.00
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	\$50.00	\$0.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	\$200.00	\$0.00
			\$1,440.00	\$740.00

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO CHECK WIRING		\$50.00	\$20.00
	TO DISMANTLE & REPLACED REVERSE SENSOR		\$80.00	\$30.00
	TO DISMANTLE & REFIX REAR WINDSCREEN		\$150.00	\$120.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY		\$120.00	\$60.00
	TO TRANSFER TAILGATE MECHANISM		\$100.00	\$60.00
	TO SPRAY RUST PROOFING		\$100.00	\$60.00
	TO RESET DIAGNOSTIC & REPROGRAMME SYSTEM		\$120.00	\$80.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL AND REAR FENDER		\$1,800.00	\$800.00
	TO PUTTY & SPRAY PAINTING		\$1,800.00	\$1,000.00
			\$4,320.00	\$2,230.00

GRAND TOTAL			\$24,211.60	\$11,653.76
--------------------	--	--	--------------------	--------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)		\$9,300.00
Report Ref No: CD/CTI24100125/Uma3q2			

CKS

MARCUS CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H




PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H




PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H




PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H

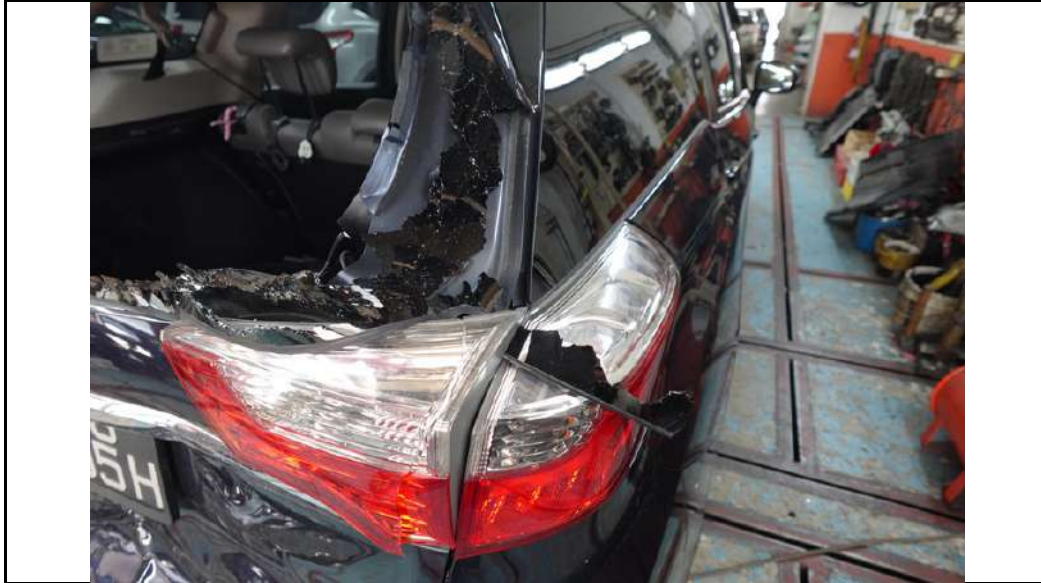

PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H

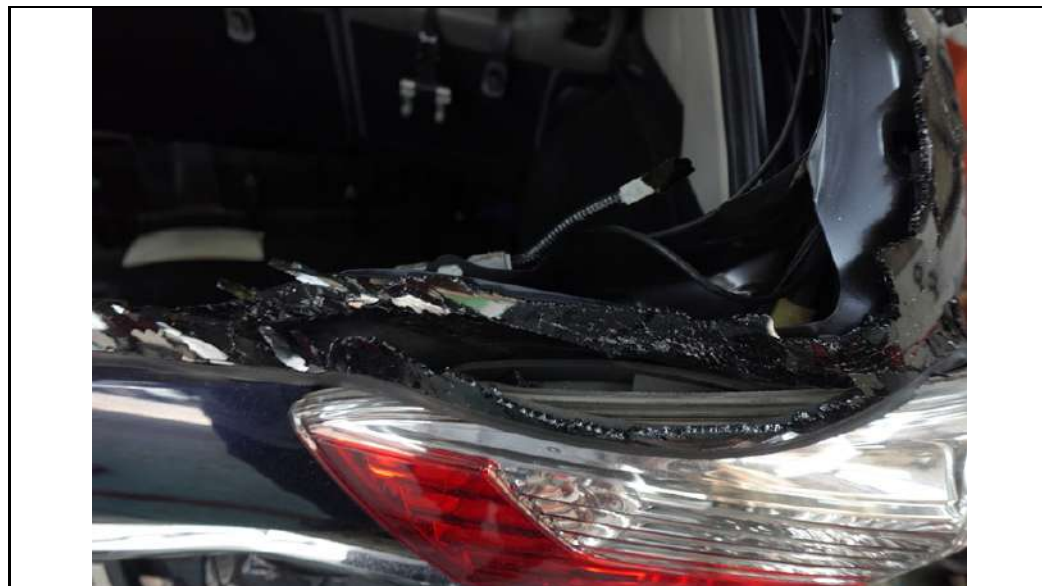


PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H

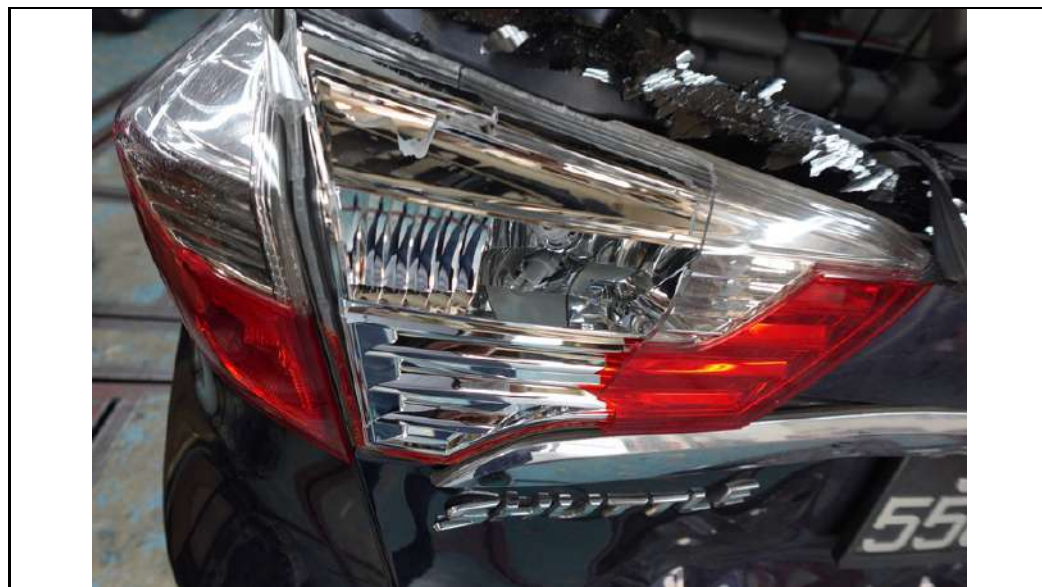

PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H

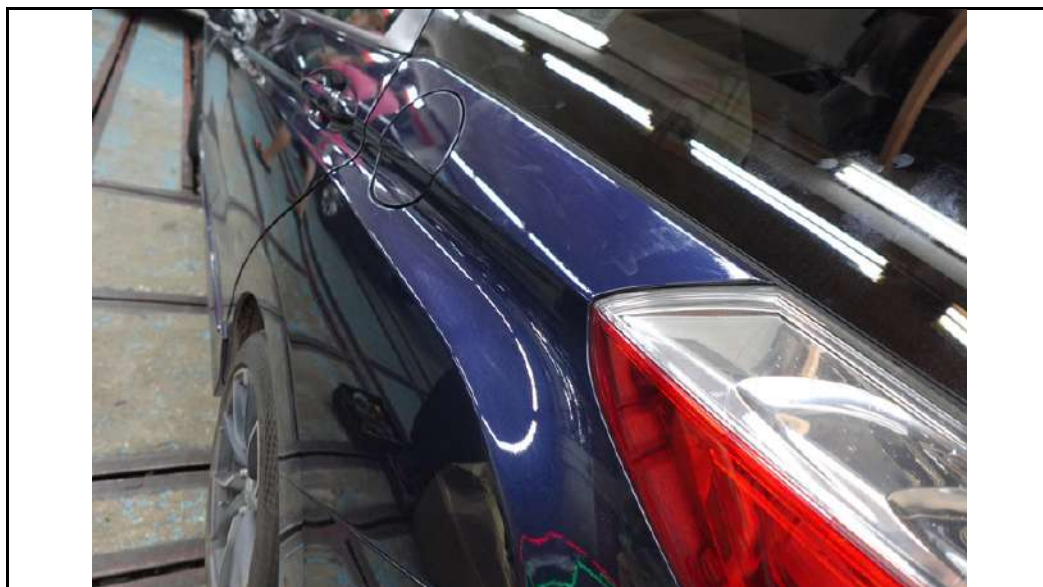

PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H





PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H

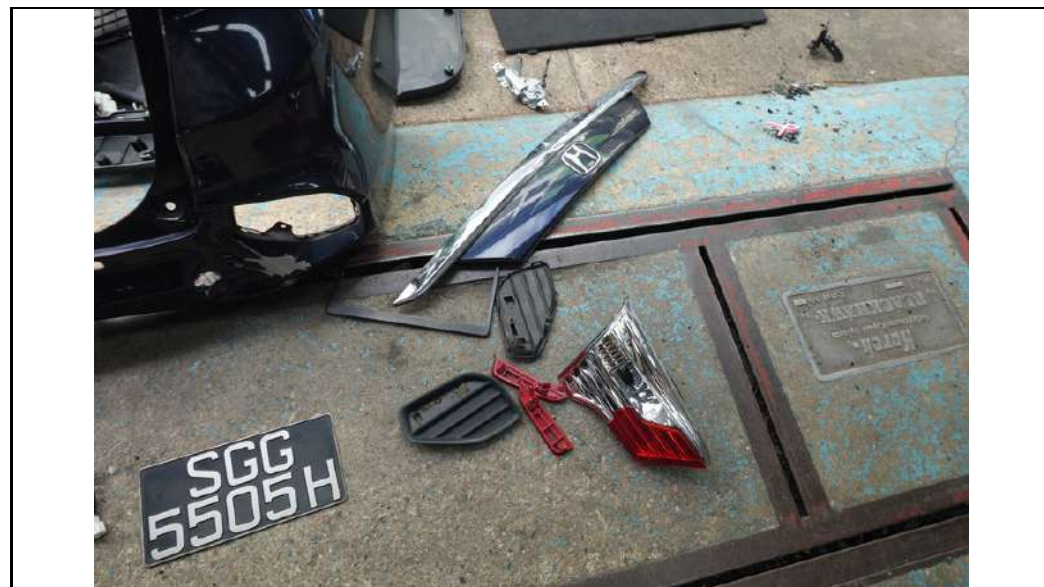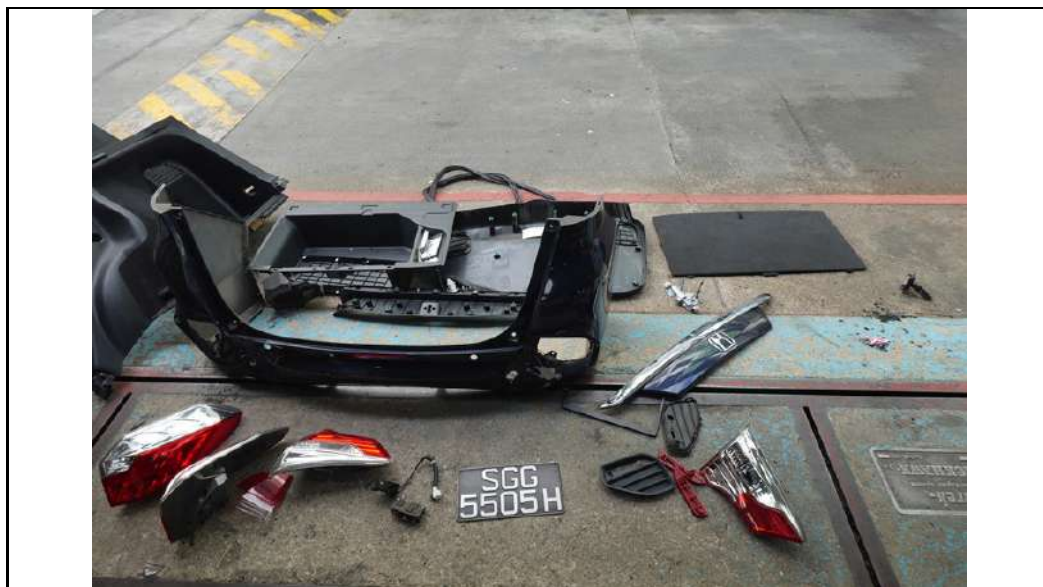


PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H

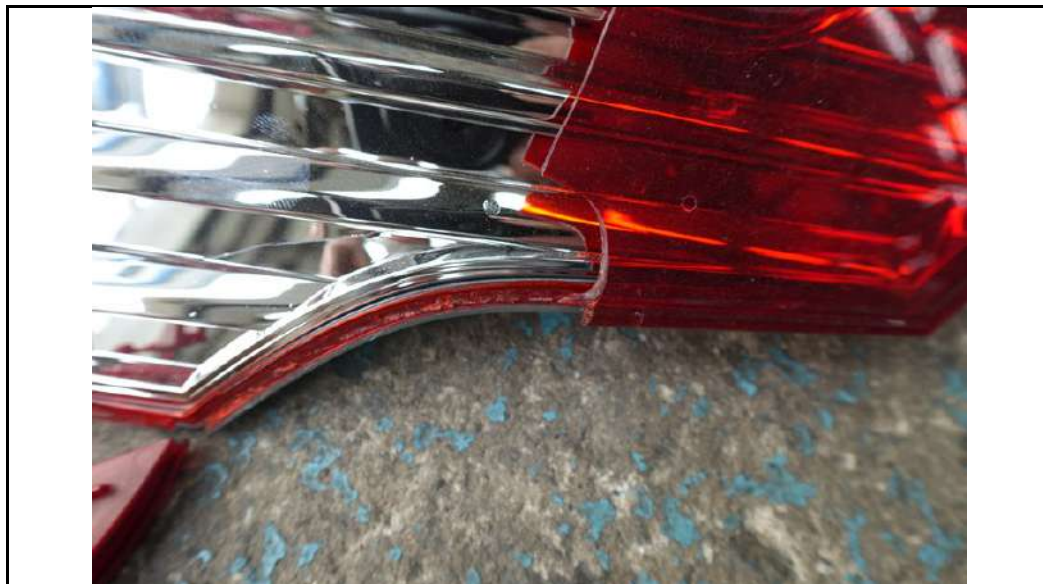

PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H




PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H

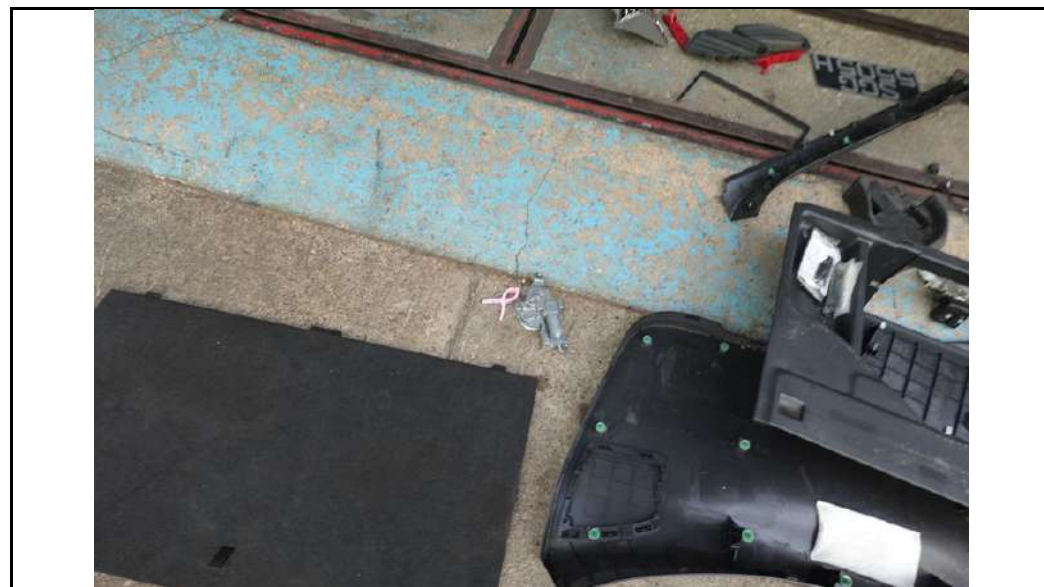

PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H





LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 27 of 27)

PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H



PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H

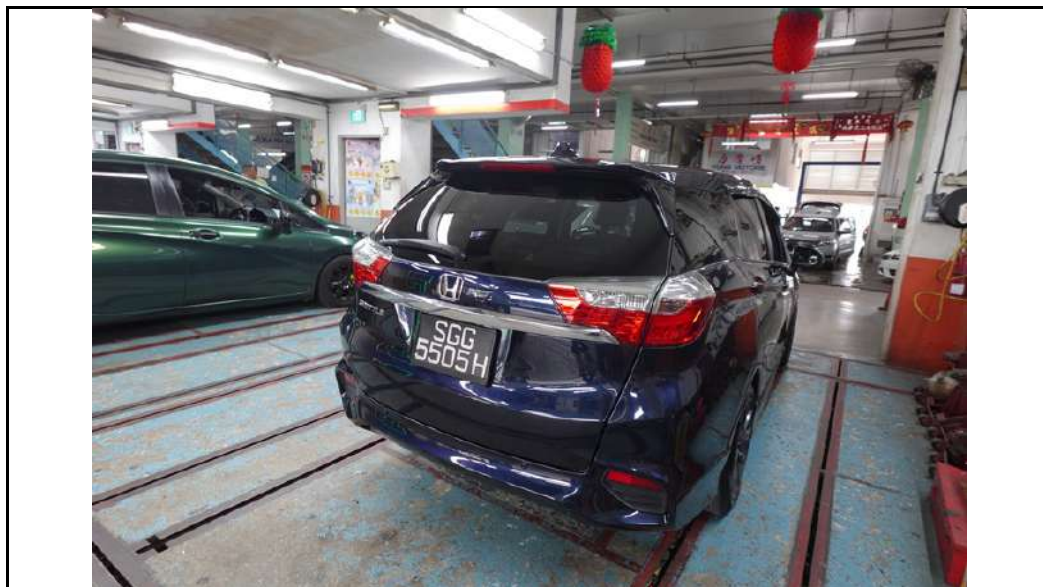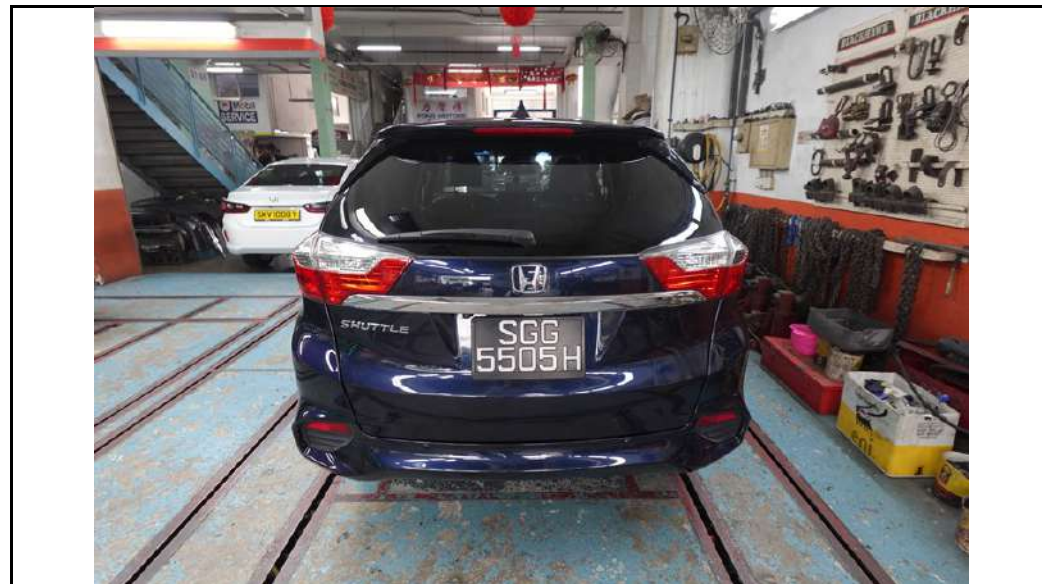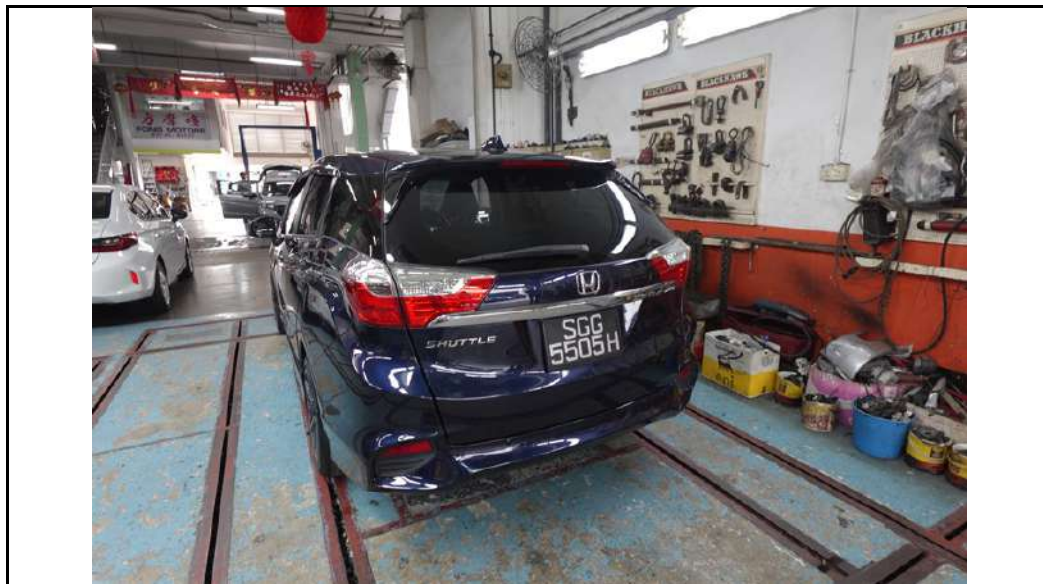



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SGG 5505H

