

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

MS FIRST CAPITAL INSURANCE LTD
16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING

SINGAPORE 048581

INV No. : SAC2401043
INV Date : 17-10-2024

Reference CD/FCI24060021/Rma3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SKH 6823E
Insured Veh. SHD 3606S
Claim No. D24004822MFCT
Policy No. D-24101861MFCT
Accident Date 28/05/2024
Inspection Date 09/07/2024

Description	Amount
Survey Inspection	250.00
Resurvey Inspection	0.00
Digital Photographs	0.00
Transportation	0.00
Sub-Total	250.00
GST (9%)	22.50
Grand Total	272.50

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS MS FIRST CAPITAL INSURANCE LTD	Ref:	CD/FCI24060021/Rma3q2
16 RAFFLES QUAY	Date:	17/10/2024
#42-01 HONG LEONG BUILDING	Code:	FCI2
SINGAPORE 048581		

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	SHD 3606S	Veh. Inspected	SKH 6823E
Policy No.	D-24101861MFCT	Coverage	0
Claim No.	D24004822MFCT	Excess	\$0.00
Assign From	KAREN TAN	Assign Date	11/06/2024

2. Vehicle Details

Make & Model	HONDA STEPWAGON SPADA E:HEV 7 SEATER	C.C	1993
Engine No.	LFA2212046	Year of Reg.	12/04/2023
Chassis No.	RP81022039	Colour	GREY
Odometer	28711 KM	Steering	IN ORDER
Brakes	IN ORDER	General	FAIR
Modification(s)	RIMS: SPORTS RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	205/60 R16	BRIDGESTONE	6
L/H Front Tyre	205/60 R16	BRIDGESTONE	6
R/H Rear Tyre	205/60 R16	BRIDGESTONE	6
L/H Rear Tyre	205/60 R16	BRIDGESTONE	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	28/05/2024	Inspection Date	09/07/2024
Survey held at	MOVA AUTOMOTIVE PTE LTD 15 FAN YONG ROAD SINGAPORE 629792		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 6 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SKH 6823E

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	TAILGATE	BENT	\$2,841.40	\$2,841.40
1	TAILGATE GLASS MOULDING	NECESSARY	\$261.40	\$261.40
1	TAILGATE LOGO	NECESSARY	\$66.10	\$66.10
1	TAILGATE EMBLEM -STEP WAGON	NECESSARY	\$59.40	\$59.40
1	TAILGATE EMBLEM -SPADA	NECESSARY	\$75.40	\$75.40
1	TAILGATE EMBLEM -E	NECESSARY	\$61.40	\$61.40
1	TAILGATE EMBLEM -HEV	NECESSARY	\$70.40	\$70.40
1	TAILGATE LOWER GARNISH	DEFORMED	\$881.40	\$881.40
1	TAILGATE LOWER GARNISH RUBBER	DEFORMED	\$301.40	\$301.40
1	TAILGATE LOCK	SERVICEABLE	\$311.30	\$0.00
1	TAILGATE WEATHERSTRIP	CUT	\$181.40	\$181.40
1	TAILGATE INNER TRIM BOARD	SERVICEABLE	\$251.50	\$0.00
1	REVERSE SENSOR -INNER LH	SERVICEABLE	\$251.40	\$0.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	\$688.40	\$0.00
1	REAR END PANEL TOP COVER	SERVICEABLE	\$188.40	\$0.00
1	REAR BUMPER	DEFORMED	\$1,494.40	\$1,494.40
2	REAR BUMPR BRACKET LH & RH	SERVICEABLE	\$195.40	\$0.00
1	REAR BUMPER MOULDING CENTER @\$97.70	SCRATCHED	\$301.40	\$301.40
2	REAR BUMPER MOULDING LH & RH @\$177.60	SERVICEABLE	\$355.20	\$0.00
2	REAR BUMPER RETAINER LH & RH @\$45.40	SERVICEABLE	\$90.80	\$0.00
10	REAR BUMPER CLIPS @\$5.90	NECESSARY	\$59.00	\$59.00
1	TAILLAMP ASSY LH (NPA)	NOT NECESSARY	\$0.00	\$0.00
	LESS 20.00% DISCOUNT		(\$1,797.38)	(\$1,330.90)
			\$7,189.52	\$5,323.60
Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	TAILGATE GLASS SEALANT (SN)	NECESSARY	\$40.00	\$40.00
			\$40.00	\$40.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO CUT /WELD REAR END PANEL ,KNOCK & STRAIGHTEN REAR BODY MEMBER ,REMOVE & REPLACE ACCIDENT DAMAGED PARTS,REALIGN ALL CONNECTION.INCLUSIVE OF THE REPAIR OF REAR END PANEL.	NOT NECESSARY	\$800.00	\$700.00
	SPRAY PAINT TAILGATE ,TAILGATE GARNISH ,REAR END PANEL,REAR BODY MEMBERS ,REAR BUMPER		\$1,000.00	\$800.00
	REMOVE & REPLACE TAILGATE GLASS & CHECK WATER LEAKAGE		\$120.00	\$120.00
	REMOVE & REPLACE TAILGATE INNER TRIM ,MECHANISM & CHECK AUTO LOCKING SYSTEM		\$100.00	\$50.00
	REMOVE & REPLACE LUGGAGE COMPARTMENT INNER TRIM,GARNISH ,COVERING		\$80.00	\$40.00
	REMOVE & REPLACE REVERSE SENSOR & CHECK FUNCTION		\$80.00	\$60.00
	TO APPLY SEAL ON WELDING JOINTS		\$80.00	\$0.00
	RUST PROOF AFFECTED AREAS		\$60.00	\$40.00
			\$2,320.00	\$1,810.00
GRAND TOTAL			\$9,549.52	\$7,173.60
	RECOMMENDED COST OF REPAIRS			\$7,173.60
Report Ref No: CD/FCI24060021/Rma3q2				


MRB

MOHAMMED RASUL BIN MOHD YUNUS

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E

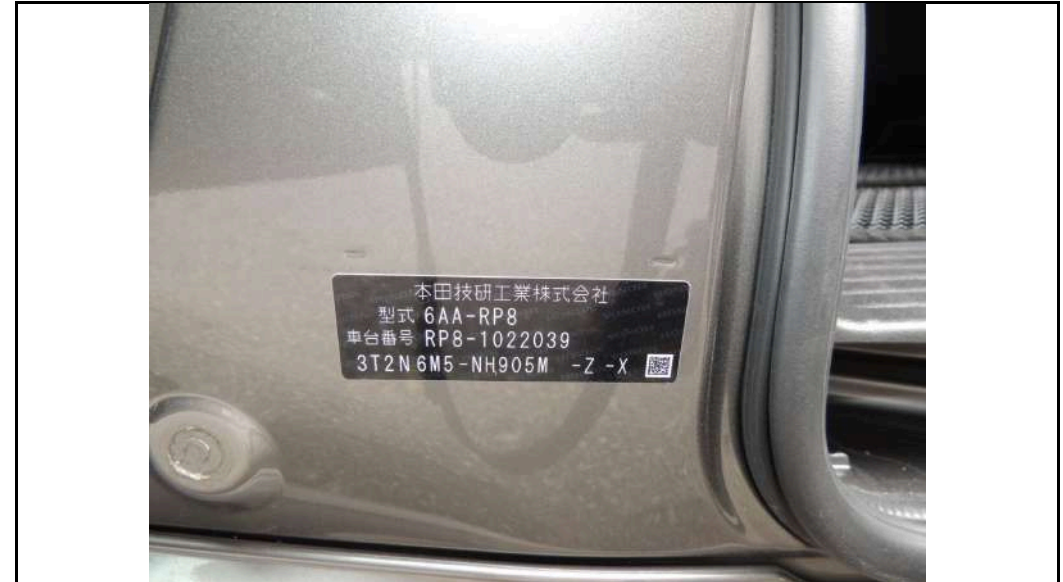

PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 9 of 17)

PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E

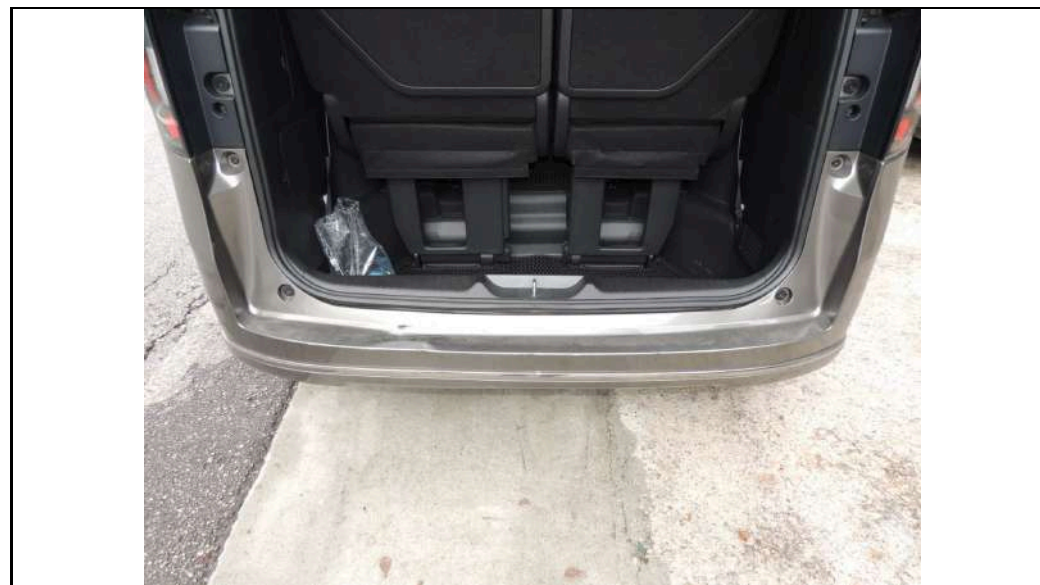



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 10 of 17)

PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E



PHOTOGRAPHS FOR VEHICLE NO. : SKH 6823E

