



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2501604

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 18/03/2025
Reference CD/CTI24100277/Ama3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBD 9119M
Insured Veh. GBH 1927D
Claim No. SNM24D205808
Policy No. DMCVSNW00009692406
Accident Date 14/10/2024
Inspection Date 15/10/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24100277/Ama3q2(N)	
			Date: 18/03/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBH 1927D	Veh. Inspected	GBD 9119M
	Policy No.	DMCVSNW00009692406	Coverage (\$)	0.00
	Claim No.	SNM24D205808	Excess (\$)	0.00
	Assign From		Assign Date	15/10/2024
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA HIACE	c.c	2982
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	JTFHT02P700190214	Colour	WHITE
	Odometer	201444 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195 R15C	CONDOR	6 mm
	L/H Front Tyre	195 R15C	CONDOR	6 mm
	R/H Rear Tyre	195 R15C	CONDOR	6 mm
	L/H Rear Tyre	195 R15C	CONDOR	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	14/10/2024	Inspection Date	15/10/2024
	Survey held at	JL PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBD 9119M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	DENTED	2,210.70	2,210.70
1	TAILGATE OUTER MOULDING	CUT	364.90	364.90
1	TAILGATE OUTER HANDLE	NOT NECESSARY	97.80	-
2	TAILGATE NUMBER PLATE LAMP @\$65.50	NOT NECESSARY	131.00	-
1	TAILGATE LOGO	NECESSARY	70.50	70.50
1	TAILGATE REVERSE CAMERA	NOT NECESSARY	894.20	-
2	TAILGATE CORNER GARNISH @\$185.90	NOT NECESSARY	371.80	-
2	TAILGATE STOPPER (UPPER SIDE) @\$24.10	NOT NECESSARY	48.20	-
2	TAILGATE SIDE STOPPER (LOWER) @\$28.60	NOT NECESSARY	57.20	-
1	TAILGATE INNER BOARD	TORN	388.70	165.00
1	TAILGATE WEATHERSTRIP	TORN	397.80	397.80
1	TAILGATE WEATHERSTRIP PROTECTOR	NOT NECESSARY	271.60	-
1	TAILGATE INNER LOCK	DAMAGED	354.60	354.60
1	TAILGATE LOCK MOTOR	NOT NECESSARY	545.00	-
1	TAILGATE LOWER LOCK	DAMAGED	254.10	254.10
2	TAIL LAMP @\$355.20	N/S CRACKED	710.40	355.20
1	TAIL LAMP PANEL LH	NOT NECESSARY	419.80	-
2	TAILLAMP LOWER GARNISH @\$257.40	N/S CRACKED	514.80	257.40
2	TAILLAMP LOWER GARNISH RETAINER @\$53.70	NOT NECESSARY	107.40	-
1	REAR SIDE PANEL LH	NOT NECESSARY	1,828.90	-
1	REAR SIDE PANEL AIR VENT LH	NOT NECESSARY	185.70	-
1	REAR BUMPER	DEFORMED	497.00	497.00
2	REAR BUMPER SIDE RETAINER @\$47.50	NOT NECESSARY	95.00	-
1	REAR END PANEL (EXTEND) (LH)	DENTED	428.10	428.10
1	REAR END PANEL (INNER)	TO REPAIR SEE LABOUR	1,124.80	-
1	REAR END PANEL (OUTER)	DENTED	498.60	498.60
1	REAR FLOOR PANEL MAT	NOT NECESSARY	1,215.10	-
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,966.20	-

Report Ref No. CD/CTI24100277/Ama3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-4,012.48	-1,463.48
			12,037.42	4,390.42
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NECESSARY	50.00	30.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
2	REAR SIDE PANEL SEALANT (OUTER) @\$150.00 (SN)	NOT NECESSARY	300.00	-
1	SET TAIL LAMP CLIP (SN)	NOT NECESSARY	30.00	-
1	SET TAILLAMP LOWER GARNISH CLIP (SN)	NECESSARY	30.00	20.00
1	TAILGATE SEALANT (SN)	NOT NECESSARY	150.00	-
1	SET TAILGATE OUTER MOULDING CLIP (SN)	NOT NECESSARY	50.00	-
1	SET TAILGATE TOP TRIM CLIP (SN)	NOT NECESSARY	50.00	-
1	SET TAILGATE INNER TRIM CLIP (SN)	NECESSARY	50.00	30.00
1	TAILGATE STICKER 70KM/H (SN)	NECESSARY	30.00	15.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	TAILGATE WINDSCREEN INNER SEAL (SN)	NECESSARY	60.00	30.00
1	REAR END PANEL (OUTER) SEALANT (SN)	NECESSARY	150.00	60.00
1	REAR END PANEL (EXTEND) SEALANT (SN)	NOT NECESSARY	150.00	-
1	REAR FLOOR PANEL TOP COVER (BOARD) SPECAIL TYPE (SN)	NOT NECESSARY	800.00	-
1	REAR STICKER (SPECAIL TYPE) (SN)	NECESSARY	400.00	120.00
			2,430.00	375.00
	<u>LABOUR</u>			
	PANEL BEATING AND REPLACE PARTS.INCLUSIVE OF THE REPAIR OF REAR END PANEL (INNER).		2,400.00	800.00
	SPRAY PAINTING TO AFFECTED AREA.		2,000.00	700.00
	WIRING BULB CHECKING.		80.00	30.00
	TRANSFER TAILGATE MECHANISM .		80.00	60.00
	CONDUCT WATER LEAKAGE TEST .	NOT NECESSARY	120.00	-
	REMOVE AND REFIX ROOF LINING.	NOT NECESSARY	100.00	-
	REMOVE AND REFIX FUEL TANK .	NOT NECESSARY	100.00	-
	REMOVE AND REFIX REAR FLOOR BOARD .	NOT NECESSARY	350.00	-
	REMOVE AND REFIX REVERSE CAMERA .		120.00	50.00

Report Ref No. CD/CTI24100277/Ama3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REAR CHASSIS ALIGNMENT.	NOT NECESSARY	250.00	-
	REMOVE AND REFIX REAR WINDSCREEN .		120.00	120.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	180.00	-
			5,900.00	1,760.00
GRAND TOTAL			20,367.42	6,525.42
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,200.00

Report Ref No. CD/CT124100277/Ama3q2(N)

ADRIAN LING WAI PING


B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M

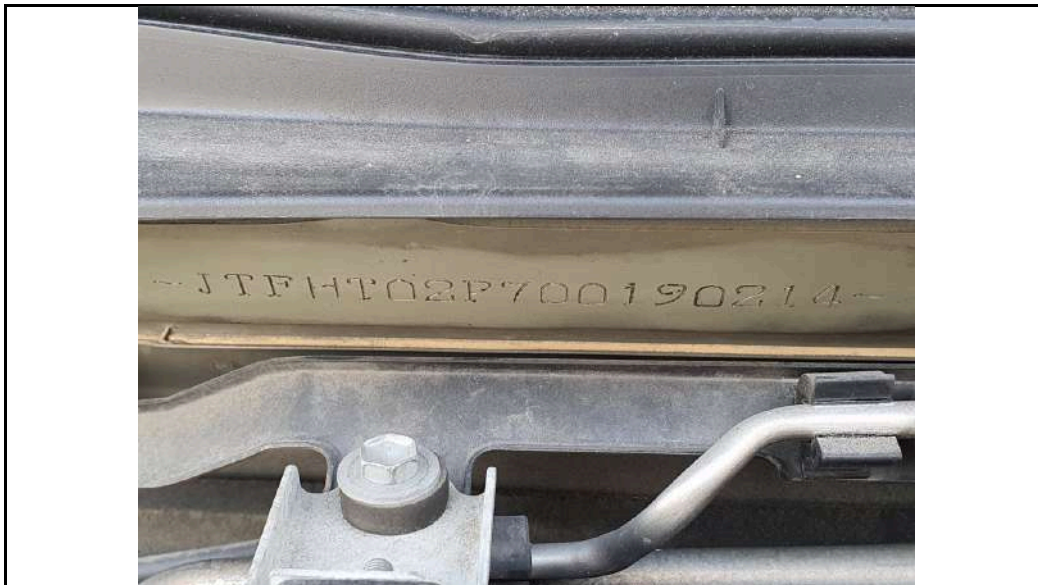

PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 3 of 8)

PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M



PHOTOGRAPHS FOR VEHICLE NO. : GBD 9119M

