



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555
ATTN: Jasmine Lok

INV No. AC2601129
INV Date 11/02/2026
Reference CD/LPC24100399/Upa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SGW 60Y
Insured Veh. GBK 5742C
Claim No. 24/24/24/VC05/030071
Policy No. Z24VC05000126
Accident Date 21/10/2024
Inspection Date 04/11/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS LONPAC INSURANCE BHD	Ref:	CD/LPC24100399/Upa3q2
300 BEACH ROAD	Date:	11/02/2026
#17-04/07 THE CONCOURSE SINGAPORE 199555	Code:	LPC2

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	GBK 5742C	Veh. Inspected	SGW 60Y
Policy No.	Z24VC05000126	Coverage	0
Claim No.	24/24/24/VC05/030071	Excess	\$0.00
Assign From	JASMINE LOK	Assign Date	23/10/2024

2. Vehicle Details

Make & Model	MERCEDES BENZ S320L	C.C	2996
Engine No.	27682430366110	Year of Reg.	16/08/2016
Chassis No.	WDD2221622A258905	Colour	SILVER
Odometer	132874 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: S/RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	245/45R19	PIRELLI	6
L/H Front Tyre	245/45R19	PIRELLI	6
R/H Rear Tyre	275/40R19	GOODYEAR	6
L/H Rear Tyre	275/40R19	GOODYEAR	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	21/10/2024	Inspection Date	04/11/2024
Survey held at	PROGRESSIVE CAR CARE PTE LTD BLK 3022A UBI ROAD 1 #01-45/46, SINGAPORE 048716		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 3 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SGW 60Y

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR BUMPER (UPPER)	CUT/ TORN	\$2,635.00	\$2,635.00
2	REAR BUMPER SIDE RETAINER - LH/RH	NOT NECESSARY	\$156.00	\$0.00
10	REAR BUMPER RIVET	NECESSARY	\$90.00	\$90.00
1	REAR BUMPER (LOWER TRIM)	NOT NECESSARY	\$585.00	\$0.00
1	REAR BUMPER REFLECTOR - LH	NOT NECESSARY	\$35.00	\$0.00
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	\$1,640.00	\$0.00
2	REAR BUMPER SIDE CHROME MOULDING - LH/RH	N/S CRACKED	\$312.00	\$156.00
1	REAR EXHAUST CHROME - LH	NOT NECESSARY	\$950.00	\$0.00
1	REAR BUMPER SENSOR (OUTER) - LH	NOT NECESSARY	\$215.00	\$0.00
1	REAR BUMPER SENSOR (INNER) - LH	MALFUNCTION	\$215.00	\$215.00
4	REAR BUMPER SENSOR RING	NOT NECESSARY	\$56.00	\$0.00
1	TAIL LAMP - LH	CRACKED	\$1,285.00	\$1,285.00
1	TAIL LAMP LOWER RETAINER - LH	CRACKED	\$130.00	\$130.00
	LESS 10.00% DISCOUNT		(\$830.40)	(\$451.10)
			\$7,473.60	\$4,059.90

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO KNOCK OUT DENTS, REMOVE, REPLACE ACCIDENT PORTIONS.		\$600.00	\$300.00
	TO RESPRAY PAINT ON ACCIDENT PORTIONS.		\$550.00	\$400.00
	TO CHECK WIRING.		\$30.00	\$20.00
	TO REMOVE, REFIT GARNISH TO FACILITATE REPAIR.		\$150.00	\$0.00
	TO REMOVE, REPLACE REAR BUMPER SENSOR.		\$80.00	\$30.00
	TO RESET REAR SENSOR & OTHER NEC CHECKLIGHT.		\$200.00	\$0.00
			\$1,610.00	\$750.00

GRAND TOTAL			\$9,083.60	\$4,809.90
--------------------	--	--	-------------------	-------------------

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				\$3,800.00
---	--	--	--	-------------------

Report Ref No: CD/LPC24100399/Upa3q2

MARKET VALUE: \$118,000.00(EST) LESS LTA REBATE: \$83,809.00(EST) = NETT VALUE :\$34,191.00(EST)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

CKS

MARCUS CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of repositibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y



PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y



PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y



PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y



PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y




PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y



PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y



PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y

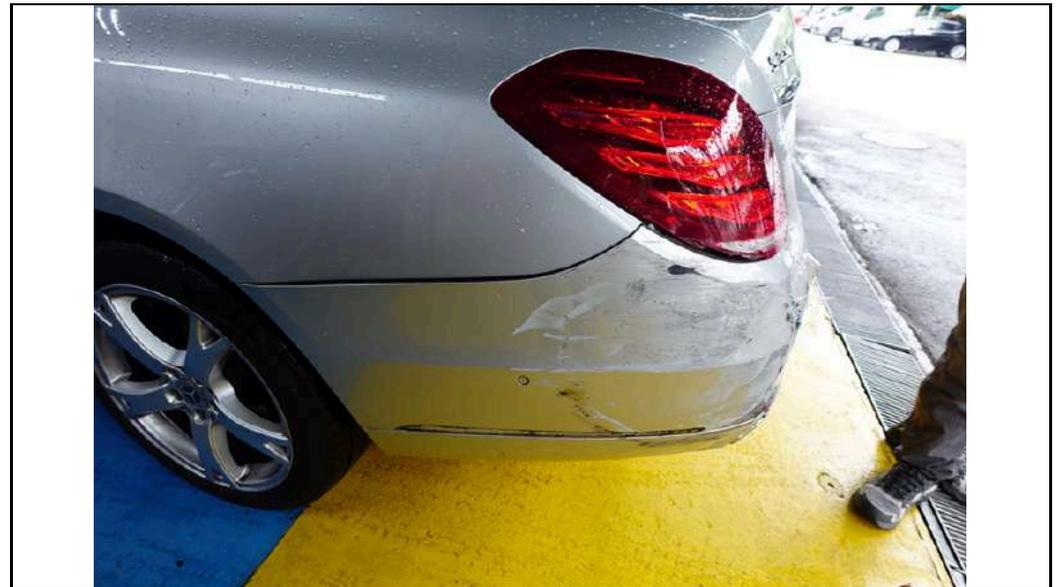

PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y



PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y



PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y



PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SGW 60Y

