

ASS. REG. BY: Tauhin

REF: CS/11524100448/Top3

ASSIGNMENT

COE 2029/03

From: _____ Date: _____

Estimated Cost: _____

☒ TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. MCV24B00017900

Claims No. DMCV2400233H/ST

Sum Insured: _____ Excess: 600

(Client's Record) Top-up \$1000

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \$45K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seer: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: G1BD409K Yr Regn: 2014, 64

Type: M.Car / M.Cycle / Bus / ☒ Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Hiace c.c. 2982

Colour: white A/C: Insured / Std / NI / NA

Sp. Reading: 377 627 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: STFHT02P100133779

Gen. Cond: ☒ Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: NV / S/Rim / STD A/Rim or

Tyre Size: F: 195/R15

R: 17

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

LingLong

Front

Rear

R/Bal. 6 mm

R/Bal. 6 mm

L/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 23/10/2024

D.O.I. 28/10/24

Survey held at

CYS WL

Des. of Damages: ☒ Front / Rear / O/S / N/S / U/G / Rooftop or

The U/G / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Repair limit \$13000

15/11/24 LS \$10,000 confirmed by email (Red 4631.10, 32%)

Date/Time, File Pass to?

☐ : Prell. Report

Days Of Repair: 8

1) Date/Time, File Return to?

☐ : Final Report

Resurvey No. of Trip: _____

2) _____

Add Fee: ☐ : Site Insp (\$ _____)


☐ : Interview (\$ _____)

Survey Fee: _____

Transportation: _____

\$ + RS. \$ _____

Photos

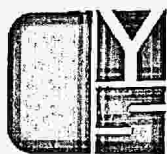

進友成汽車服務私人有限公司 CYS Automobile Services Pte Ltd

ROC Reg. No :A05041/2001E

GST Reg. NO: 20-0105041-E

INSURER:

ECICS Limited (HQ)

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	OD 3970
Policy No:	MCV24B00017900	Date of Loss:	23/10/2024
Vehicle Reg. No.:	GBD409K	Driveable?	
Driver Age/Info:	70 / MALE / OTHERS: -	Party At Fault:	DRIVER
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	MING XIN TRADING (1997)	Contact No:	+6596646094
Driver:	KWA CHWEE HOE		

Make/Model:	TOYOTA HIACE, 3.0 D TURBO 5DR (M)	Vehicle Reg. Date:	28/04/2014
Vehicle Colour:	WHITE		
Engine No:	1KD2373137	Chassis No:	JTFHT02P100133779
Odometer:	377626 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	15		

Description of Accident/Loss: ON THE ABOVE-MENTIONED DATE & TIME, I WAS TRAVELLING ALONG BKE TO WOODLANDS. VEHICLE B IN FRONT OF ME BRAKE. I COULDN'T BRAKE IN TIME AND COLLIDED ONTO VEHICLE B REAR PORTION. WHEN I GET DOWN OF MY VEHICLE, I REALIZED IT WAS A 3 VEHICLE CHAIN COLLISION.

Present Location: CYS AUTOMOBILE SERVICES PTE LTD (WOODLANDS)

COST OF CLAIMS

	Amount
Parts	11,936.10
Miscellaneous Items	65.00
Labour	2,630.00
Paintwork Labour	0.00
Towing	0.00
Calculated Gross Total (S\$)	14,631.10
- Excess (S\$)	600.00
(S\$)	14,031.10
+ GST 9.00% (S\$)	1,262.80
Nett Amount (S\$)	15,293.90

This claim is handled by: TEE WEE SIN

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 24 Oct 2024)
 Parts: 213 TOYOTA HIACE 3.0 D TURBO 5DR (M) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: CYS Automobile Services Pte Ltd/GBD409K/24/10/2024 14:51
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*BONNET	0.00	0.00	bt-410.00 F
2	2		*BONNET HINGES	0.00	0.00	bt-66.00 F
3	1		*BONNET LOCK	0.00	0.00	bt-59.00 F
4	1		*BONNET EMBLEM	0.00	0.00	ua-35.00 F
5	1		*FRONT GRILLE	0.00	0.00	mis-235.00 F
6	2		*FRONT CORNER PANEL	0.00	0.00	bt-196.00 F
7	2		*HEADLAMP ASSY	0.00	0.00	an-660.00 F
8	1		*FRONT BUMPER	0.00	0.00	mis-250.00 F
9	1		*FRONT BUMPER BEAM	0.00	0.00	bt-100.00 F
10	2		*FRONT BUMPER BRACKETS	0.00	0.00	de-190.00 F
11	2		*FRONT BUMPER SIDE RETAINERS	0.00	0.00	de-150.00 F
12	2		*FRONT BUMPER STAY	0.00	0.00	?-116.00 F
13	1		*FRONT BUMPER REINFORCEMENT	0.00	0.00	bb-170.00 F
14	2		*FRONT BUMPER REINFORCEMENT STAY	0.00	0.00	bt-116.00 F
15	1		*FRONT BUMPER TOWING COVER	0.00	0.00	mis-15.00 F
16	1		*FRONT BUMPER LOWER GRILLE	0.00	0.00	mis-80.00 F
17	2		*FRONT BUMPER FOG LAMP COVER	0.00	0.00	mis-70.00 F
18	1		*FRONT SUPPORT PANEL	0.00	0.00	bt-185.00 F
19	1		*FRONT SUPPORT PANEL TOP GARNISH	0.00	0.00	*140.00 F
20	1		*FRONT BRACE PANEL	0.00	0.00	bt-35.00 F
21	1		*WASHER TANK	0.00	0.00	de-85.00 F
22	1		*TURBO COOLER <i>disassemble photo</i>	0.00	0.00	dd-700.00 F
23	1		*AIR-CON CONDENSER <i>disassemble</i>	0.00	0.00	bt-690.00 F
24	1		*AIR-CON CONDENSER FAN COWLING	0.00	0.00	?-170.00 F
25	1		*AIR-CON CONDENSER FAN BLADE	0.00	0.00	?-90.00 F
26	1		*AIR-CON CONDENSER FAN MOTOR	0.00	0.00	?-590.00 F
27	1		*AIR-CON ALUMINIUM PIPE	0.00	0.00	?-390.00 F
28	1		*AIR-CON SUCTION PIPE	0.00	0.00	?-370.00 F
29	1		*AIR-CON DISCHARGE HOSE	0.00	0.00	?-380.00 F
30	1		*RADIATOR	0.00	0.00	bt-780.00 F
31	1		*RADIATOR FAN COWLING	0.00	0.00	?-160.00 F
32	1		*RADIATOR FAN BLADE	0.00	0.00	?-85.00 F
33	1		*RADIATOR FAN MOTOR	0.00	0.00	?-580.00 F
34	1		*RADIATOR SPARE TANK	0.00	0.00	an-160.00 F
35	1		*AIR CLEANER ASSY	0.00	0.00	an-330.00 F
36	1		*AIR DUCT	0.00	0.00	an-85.00 F
37	1		*HORN	0.00	0.00	an-55.00 F
38	1		*AIR-CON BLOWER ASSY	0.00	0.00	?-670.00 F
39	1		*AIRE HARDNESS COVER RH	0.00	0.00	?-75.00 F
40	1		*FRONT DOOR RH	0.00	0.00	bt-750.00 F
41	1		*FRONT DOOR PILLAR RH	0.00	0.00	*290.00 F
42	1		*FRONT DOOR STEP GARNISH RH	0.00	0.00	cut-88.00 F

F=Franchise part.

Sub Total (\$\$)

10,851.00

+ Margin on L,N Items 10.00% (\$\$)

1,085.10

CYS Automobile Services Pte Ltd/GBD409K/24/10/2024 14:51. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
Total Parts (S\$)						11,936.10

CYS Automobile Services Pte Ltd/GBD409K/24/10/2024 14:51. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No Qty Particulars

Amount

Miscellaneous Items

- | No | Qty | Particulars |
|----|-----|----------------------|
| 1 | 1 | DOOR COMPANY STICKER |
| 2 | 1 | FRONT NUMBER PLATE |

RM 30.00

MY 35.00

Sub Total (S\$)

65.00

Estimates on Labour

No Particulars

Lab.Type

Amount

Labour Items

- | No | Particulars | Lab.Type | Amount |
|----|---|----------|----------|
| 1 | TO REMOVE AIR-CON CONDENSER, PIPE, DRIER AND TOP-UP AIR-CON GAS | New | 120.00 |
| 2 | TO DISMANTLE AND REFIX DASHBOARD | New | 300.00 |
| 3 | TO CHECK WIRING FUNCTION | New | 30.00 |
| 4 | TO APPLY RUST PROOFING ON REPLACED/ REPAIRED PANEL | New | 80.00 |
| 5 | LABOUR CHARGES FOR REMOVING, REFITTING AND REPAIRING OF AFFECTED ACCIDENT PARTS | New | 1,200.00 |
| 6 | TO PUTTY AND SPRAY PAINTING CHARGES | New | 900.00 |

Gross Labour Cost (S\$)

2,630.00

CYS Automobile Services Pte Ltd/GBD409K/24/10/2024 14:51. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

38 Woodlands Industrial Park East 1, #07-17, Admiralty Industrial Park, Singapore 757700
Tel: 6219 2098 (3 lines) Fax: 6219 2096 E-mail: cysauto@singnet.com.sg

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Taufik 27445749/62563561
WP No Authorise
EX \$1000 28/10/24 Egm
L/S Resurvey after repair
taufik@khauto.com
8 days