



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2502108

16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING
SINGAPORE 048581
ATTN:JOANNE YONG

INV Date 08/04/2025
Reference CD/FCI24110080/Uma3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLD 8621S
Insured Veh. SHD 8806Z
Claim No. D24009457MFCT/CCPL/TPD 2
Policy No. D-24101860MFCT
Accident Date 25/10/2024
Inspection Date 07/11/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 16 RAFFLES QUAY #42-01 HONG LEONG BUILDINGSINGAPORE 048581 ATTN:JOANNE YONG		Ref: CD/FCI24110080/Uma3q2(N) Date: 08/04/2025 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SHD 8806Z	Veh. Inspected	SLD 8621S
Policy No.	D-24101860MFCT	Coverage (\$)	0.00
Claim No.	D24009457MFCT/CCPL/TPD 2	Excess (\$)	0.00
Assign From	JOANNE YONG	Assign Date	07/11/2024
2. Vehicle Particulars & Condition			
Make & Model	MAZDA 5 (A)	c.c	1998
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	JM6CW1071G0123932	Colour	WHITE
Odometer	245952 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	205/55 R16	YOKOHAMA	6 mm
L/H Front Tyre	205/55 R16	YOKOHAMA	6 mm
R/H Rear Tyre	205/55 R16	YOKOHAMA	6 mm
L/H Rear Tyre	205/55 R16	YOKOHAMA	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	25/10/2024	Inspection Date	07/11/2024
Survey held at	TRANS EUROKARS PTE LTD NO 5 UBI CLOSE SINGAPORE 408605		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLD 8621S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
1	REAR BUMPER CW (SN)	DISTORTED	916.78	916.78
4	RIVET (SN)	NECESSARY	18.56	18.56
2	TAPE PROTECTOR (SN)	NECESSARY	5.90	5.90
1	REFLECTOR LHR REFLEX (SN)	CRACKED	55.13	55.13
1	GUARD (L)REAR BUMPER CW (SN)	NOT NECESSARY	21.50	-
1	BRACKET LHR BUMPER CW (SN)	NOT NECESSARY	2.79	-
1	RETAINER (L) RR BUM CW (SN)	NOT NECESSARY	48.55	-
1	SHIELD (L),SPLASH -R B CW (SN)	NOT NECESSARY	40.38	-
2	FASTENER (SN)	NOT NECESSARY	5.24	-
1	ROD ,PERFORMANCE CW (SN)	NOT NECESSARY	162.00	-
1	BODY LIFT GATE CW (SN)	DENTED / BENT	1,590.90	1,590.90
2	VALVE ONEWAY (SN)	NECESSARY	24.12	24.12
3	CLIP (SN)	NECESSARY	16.71	16.71
1	MOULD RR WINDOW CW (SN)	NECESSARY	61.62	61.62
6	FASTENER (SN)	NECESSARY	14.16	14.16
1	SPACER (SN)	NECESSARY	6.49	6.49
2	FASNTENER (SN)	NECESSARY	14.84	14.84
4	SPACER (SN)	NECESSARY	44.52	44.52
1	PIN STUD (SN)	NECESSARY	10.20	10.20
1	LAMP (L) RR COMB CW (SN)	CRACKED	596.58	596.58
2	FASTENER LAMP (SN)	NECESSARY	29.68	29.68
2	GROMMET SCREW -R COMB (SN)	NECESSARY	5.06	5.06
2	GROMMET SCREW -R COMB (SN)	NECESSARY	5.06	5.06
4	GROMMET SCREW -R COMB (SN)	NECESSARY	10.48	10.48
1	LAMP (L)TRUNK LID CW (SN)	CRACKED	397.75	397.75
1	GASKET (R) LAMP -TRUNK CW (SN)	NECESSARY	102.83	102.83
1	GASKET (L) LAMP -TRUNK CW (SN)	NECESSARY	102.83	102.83
1	NUMBER PLATE (SN)	BENT	70.00	70.00
1	SEALER ON THE WINDSCREEN GLASS (SN)	NECESSARY	120.00	120.00
1	GARNISH LIFT GATE CW (SN) (ADDITIONAL)	CRACKED	492.49	492.49

Report Ref No. CD/FCI24110080/Uma3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ORNAMENT CAR NAME -RR CW (SN) (ADDITIONAL)	NECESSARY	51.67	51.67
1	ORNAMENT CAR NAME-RE CW (SN) (ADDITIONAL)	NECESSARY	40.63	40.63
3	CLIP SPOILER (SN) (ADDITIONAL)	NECESSARY	19.47	19.47
1	CLIP SPOILER (SN) (ADDITIONAL)	NECESSARY	7.42	7.42
			5,162.34	4,851.88
	LABOUR			
	TO REMOVE & REPLACE REAR BUMPER & TAILGATE AND ALL ACCIDENT AFFECTED AREA.		2,376.00	1,584.00
	TO RESPRAY REAR BUMPER & TAILGATE.		2,835.00	1,512.00
	TO TRANSFER REVERSE SENSORS.		330.00	180.00
	TO TRANSFER TAILGATE MECHANISM .		792.00	396.00
	TO REMOVE & REFIT THE WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST .		670.00	670.00
	TO CARRY OUT BODY CAVITY PRESERVATION .	NOT NECESSARY	250.00	-
	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		250.00	150.00
	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		300.00	180.00
			7,803.00	4,672.00
	GRAND TOTAL		12,965.34	9,523.88
	RECOMMENDED COST OF REPAIRS			9,523.88

Report Ref No. CD/FCI24110080/Uma3q2(N)

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S





PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S

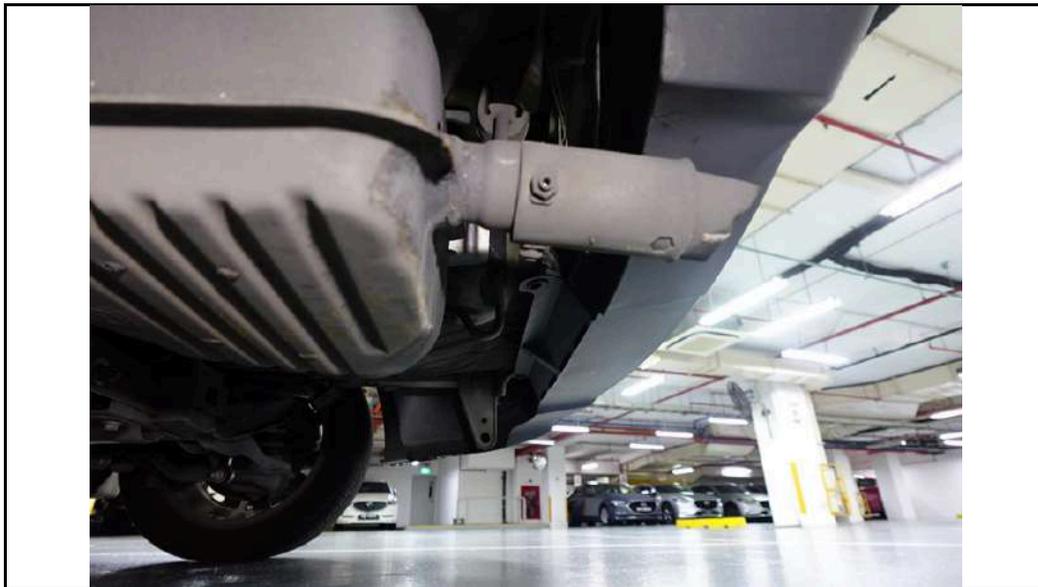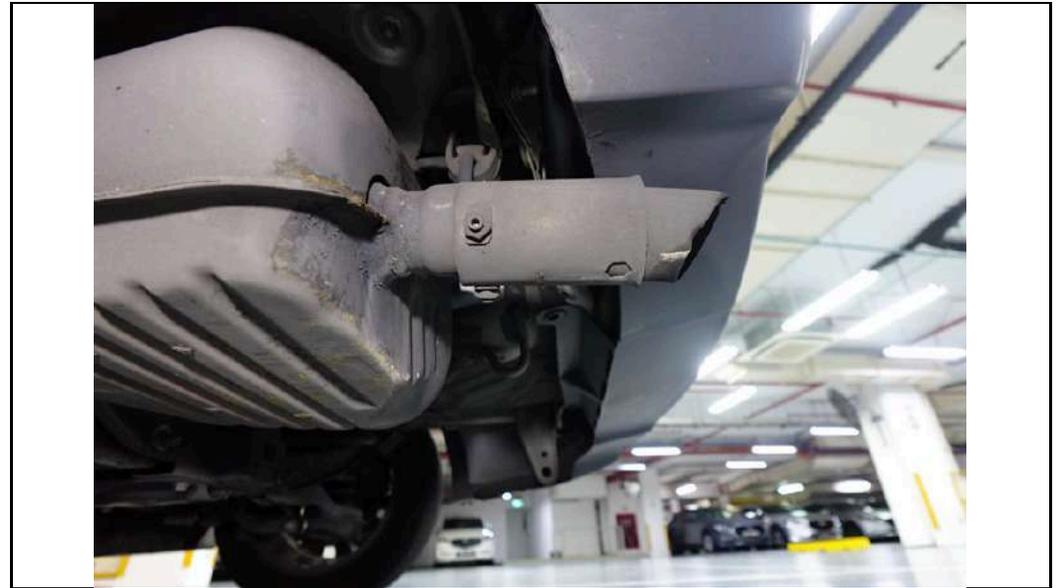


PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S

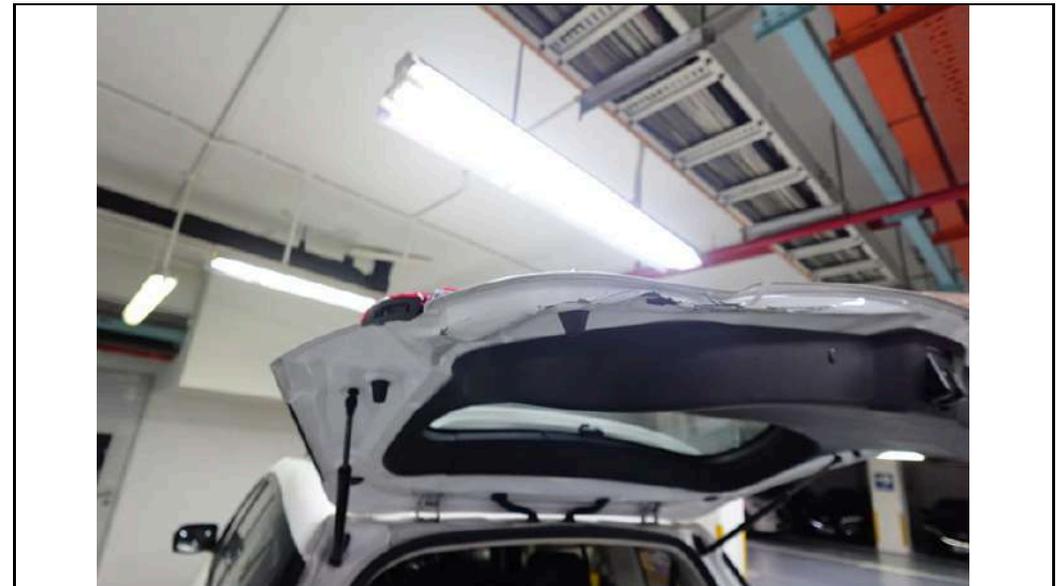

PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S



PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SLD 8621S

