



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555
ATTN:ERIC WOO

INV No. AC2502890
INV Date 13/05/2025
Reference CD/LPC24110105/Aua3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLB 3676C
Insured Veh. GBE 9133R
Claim No. 24/24/24/VC05/030139
Policy No. Z24VC05023419
Accident Date 05/11/2024
Inspection Date 06/11/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

ATTN:ERIC WOO

Ref: CD/LPC24110105/Aua3q2(N)

Date: 13/05/2025

Code: LPC2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBE 9133R	Veh. Inspected	SLB 3676C
Policy No.	Z24VC05023419	Coverage (\$)	0.00
Claim No.	24/24/24/VC05/030139	Excess (\$)	0.00
Assign From	ERIC WOO	Assign Date	06/11/2024

2. Vehicle Particulars & Condition

Make & Model	HONDA ODYSSEY	c.c	2356
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	JHMRC1880GC203188	Colour	RED
Odometer	110240 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/55 R17	YOKOHAMA	6 mm
L/H Front Tyre	215/55 R17	YOKOHAMA	6 mm
R/H Rear Tyre	215/55 R17	YOKOHAMA	6 mm
L/H Rear Tyre	215/55 R17	YOKOHAMA	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	05/11/2024	Inspection Date	06/11/2024
Survey held at	SM INTEGRATED PTE LTD 1 KAKI BUKIT AVE 6, BLK C #01-43 AUTOBAY SINGAPORE 417883		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLB 3676C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR TAILGATE	DENTED	1,502.50	1,502.50
2	REAR TAILGATE ABSORBER @\$277.10	NOT NECESSARY	554.20	-
1	REAR TAILGATE LOCK	DAMAGED	220.70	220.70
1	REAR TAILGATE INNER TRIM	CRACKED	392.40	392.40
2	REAR TAILGATE LAMP @\$481.20	CRACKED	962.40	962.40
1	REAR TAILGATE CENTER LAMP	CRACKED	349.20	349.20
2	REAR TAILGATE NUMBER PLATE LAMP @\$34.10	NOT NECESSARY	68.20	-
1	REAR TAILGATE EMBLEM LOGO	NECESSARY	28.30	28.30
1	REAR TAILGATE LOWER CHROME MOULDING	CRACKED	426.50	295.00
1	REAR TAILGATE INNER TOP TRIM	NOT NECESSARY	212.20	-
2	REAR TAILGATE INNER SIDE TRIM @\$220.80	NOT NECESSARY	441.60	-
1	REAR TAILGATE INNER HANDLE	DEFORMED	112.30	112.30
1	REAR BUMPER	DEFORMED	786.90	786.90
2	REAR BUMPER SIDE RETAINER @\$42.50	NOT NECESSARY	85.00	-
2	REAR BUMPER REFLECTOR @\$108.70	NOT NECESSARY	217.40	-
4	REAR BUMPER REVERSE SENSOR @\$195.40	DAMAGED (2 PCS ONLY)	781.60	390.80
4	REAR BUMPER REVERSE SENSOR BRACKET @\$38.40	NOT NECESSARY	153.60	-
1	REAR BUMPER REVERSE SENSOR WIRE HARNESS	NOT NECESSARY	1,315.60	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	592.30	-
1	REAR END PANEL KEYLESS SENSOR	CRACKED	198.70	198.70
1	REAR END PANEL TOP GARNISH	DEFORMED	212.60	212.60
2	REAR TAILLAMP @\$915.80	O/S CRACKED	1,831.60	821.00
2	REAR TAILLAMP INNER PANEL @\$314.80	NOT NECESSARY	629.60	-
1	REAR WEATHERSTRIPE	CUT	325.70	325.70
1	REAR SPARE TYRE COMPARTMENT PANEL	TO REPAIR SEE LABOUR	1,120.40	-
1	REAR FENDER RH	NOT NECESSARY	1,128.70	-
1	REAR FENDER INNER TRIM RH	NOT NECESSARY	809.59	-
1	REAR WINDSCREEN GLASS TOP MOULDING	NECESSARY	156.50	156.50
1	REAR WINDSCREEN GLASS BOTTOM MOULDING	NECESSARY	166.20	166.20

Report Ref No. CD/LPC24110105/Aua3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR WINDSCREEN GLASS SIDE MOULDING @\$163.30	NECESSARY	326.60	95.00
2	REAR WINDSCREEN GLASS SIDE MOULDING JOINT @ \$145.40	NOT NECESSARY	290.80	-
1	REAR EXHAUST MUFFLER	NOT NECESSARY	895.40	-
1	REAR END PANEL BUZZER	CRACKED	141.50	141.50
	LESS 20% DISCOUNT		-3,487.36	-1,431.54
			13,949.43	5,726.16
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	120.00	-
1	REAR WINDSCREEN GLASS SEALANT (SN)	NECESSARY	150.00	60.00
1	REAR TAILGATE INNER TRIM CLIPS (SN)	NECESSARY	60.00	30.00
1	REAR REVERSE CAMERA (SN)	DAMAGED	380.00	380.00
1	REAR NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	60.00	-
			850.00	500.00
	<u>LABOUR</u>			
	LABOUR FOR PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR END PANEL AND REAR SPARE TYRE COMPARTMENT PANEL.		1,800.00	700.00
	LABOUR FOR SPRAY PAINTING.		1,600.00	700.00
	LABOUR FOR REMOVE & REFIX REAR UPHOLSTERY /CARPET /ALL TRIM .		300.00	60.00
	LABOUR FOR REMOVE & RENEW REAR WINDSCREEN GLASS .		150.00	120.00
	LABOUR FOR REMOVE & RENEW REAR EXHAUST MUFFLER ,REPAIR & STRAIGHTEN REAR EXHAUST PIPE .	NOT NECESSARY	300.00	-
	WIRING CHECK.		80.00	30.00
	TO APPLY RUST PROOF /TUFF COAT ON ACCIDENT AREAS.		300.00	40.00
			4,530.00	1,650.00
	GRAND TOTAL		19,329.43	7,876.16

Report Ref No. CD/LPC24110105/Aua3q2(N)



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,300.00
---	--	--	-----------------

Report Ref No. CD/LPC24110105/Aua3q2(N)

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 2 of 11)

PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 3 of 11)

PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C




PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C

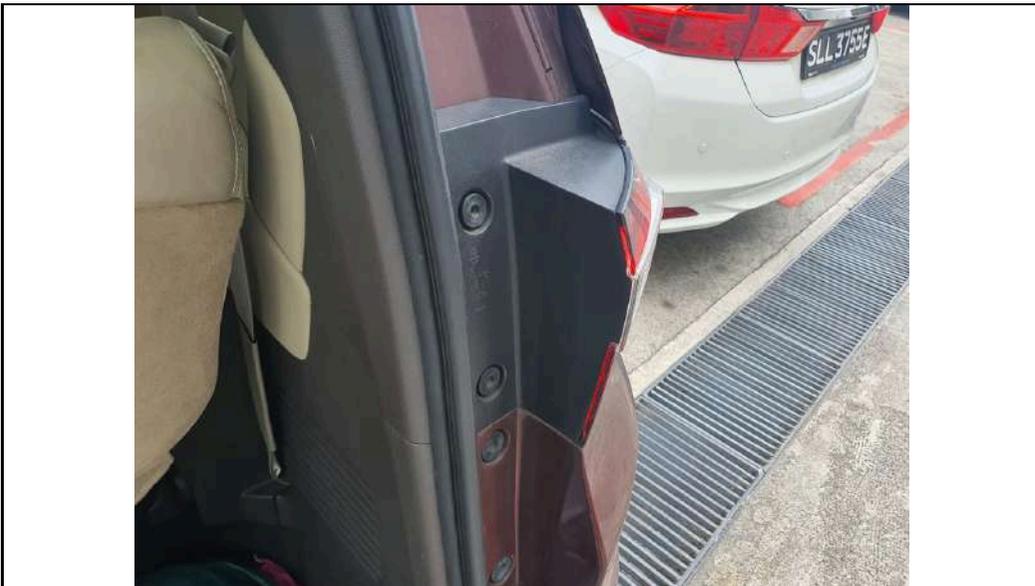

PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C



PHOTOGRAPHS FOR VEHICLE NO. : SLB 3676C

