



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2501596

16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING
SINGAPORE 048581
ATTN:KAREN TAN

INV Date 18/03/2025
Reference CD/FCI24110328/Uma3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMC 1963U
Insured Veh. SHB 6616D
Claim No. D24010033MFCT
Policy No. D-24101861MFCT
Accident Date 13/11/2024
Inspection Date 15/11/2024

Description	Total
Third Party Express Settlement	550.00
Subtotal	550.00
GST (9%)	49.50
Grand Total	599.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS MS FIRST CAPITAL INSURANCE LTD 16 RAFFLES QUAY #42-01 HONG LEONG BUILDING SINGAPORE 048581		Ref:	CD/FCI24110328/Uma3q2	
		Date:	18/03/2025	
		Code:	FCI2	
1. Policy Particulars :- DIRECT SETTLEMENT				
Insured Veh.	SHB 6616D	Veh. Inspected	SMC 1963U	
Policy No.	D-24101861MFCT	Coverage	0	
Claim No.	D24010033MFCT	Excess	\$0.00	
Assign From	KAREN TAN	Assign Date	15/11/2024	
2. Vehicle Details				
Make & Model	HONDA SHUTTLE 1.5G CVT	C.C	1496	
Engine No.	L15B5461567	Year of Reg.	27/06/2018	
Chassis No.	GK81201322	Colour	WHITE	
Odometer	94478 KM	Steering	IN ORDER	
Brakes	IN ORDER	General	GOOD	
Modification(s)	RIMS: SPORTS RIM			
3. Conditions of Tyres				
	Size	Make	Balance (mm)	
R/H Front Tyre	185/60R15	MICHELIN	6	
L/H Front Tyre	185/60R15	MICHELIN	6	
R/H Rear Tyre	185/60R15	MICHELIN	6	
L/H Rear Tyre	185/60R15	MICHELIN	6	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	13/11/2024	Inspection Date	15/11/2024	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR: 6 Working Days				



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SMC 1963U

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN MOULDING	NECESSARY	\$166.20	\$121.50
1	TAILGATE	BADLY DENTED	\$1,455.20	\$1,193.40
1	TAILGATE REAR LOGO	SERVICEABLE	\$48.00	\$0.00
2	TAILGATE REFLECTORS @\$341.60	NOT NECESSARY	\$683.20	\$0.00
1	TAILGATE SHUTTLE EMBLEM	NECESSARY	\$75.00	\$75.00
1	TAILGATE OUTER GARNISH	NOT NECESSARY	\$495.00	\$0.00
1	TAILGATE INNER LOCK	BENT / TWISTED	\$288.20	\$288.20
1	TAILGATE INNER TRIM BOARD	DEFORMED / TORN	\$455.10	\$428.10
1	TAILGATE WEATHERSTRIP	TWISTED	\$232.80	\$185.40
2	TAILLAMPS @\$950.00	N/S CRACKED / O/S NOT NECESSARY	\$1,900.00	\$580.50
1	REAR BUMPER	DISTORTED	\$1,415.10	\$936.00
2	REAR BUMPER SIDE RETAINERS @\$45.00	NOT NECESSARY	\$90.00	\$0.00
2	REAR BUMPER REFLECTORS @\$75.00	N/S CRACKED	\$150.00	\$75.00
2	REAR BUMPER SIDE COVERS @\$111.00	N/S TWISTED	\$222.00	\$108.20
1	REAR BUMPER INNER SPONGE	TORN	\$183.00	\$183.00
1	REAR END PANEL	DENTED	\$755.20	\$605.00
1	REAR END PANEL TOP GARNISH	TWISTED	\$248.70	\$248.70
1	REAR END PANEL ANTENNA SENSOR	NOT NECESSARY	\$108.90	\$0.00
2	REAR END PANEL SIDE EXTENSION PANELS @\$285.00	NECESSARY / BENT	\$570.00	\$570.00
1	REAR EXHAUST	NOT NECESSARY	\$688.20	\$0.00
1	REAR FLOOR PANEL TOP BOARD	SERVICEABLE	\$544.10	\$0.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	\$1,140.20	\$0.00
1	REAR FLOOR PANEL TOOLS TRAY	TWISTED / CRACKED	\$652.30	\$466.50
1	REAR BUMPER TOOLS SPONGE	NOT NECESSARY	\$588.00	\$0.00
2	REAR FENDER INNER TRIM BOARDS @\$690.00	N/S DEFORMED / TORN	\$1,380.00	\$481.20
1	REAR FENDER	TO REPAIR SEE LABOUR	\$1,155.20	\$0.00
	LESS 0.00 / 20.00% DISCOUNT		\$0.00	(\$1,309.14)
			\$15,689.60	\$5,236.56



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	\$50.00	\$40.00
1	REAR WINDSCREEN INNER SEAL (SN)	NECESSARY	\$50.00	\$20.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	MALFUNCTION	\$280.00	\$200.00
1	SET TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	\$50.00	\$30.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	\$60.00	\$30.00
1	REAR BUMPER TOP CHROME PLATE (SN)	NOT FITTED	\$380.00	\$0.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	\$50.00	\$50.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	\$200.00	\$0.00
			\$1,120.00	\$370.00
Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO CHECK WIRING	NOT NECESSARY	\$50.00	\$20.00
	TO DISMANTLE & REPLACED REVERSE SENSOR		\$80.00	\$30.00
	TO DISMANTLE & REFIX REAR WINDSCREEN		\$150.00	\$120.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY		\$120.00	\$60.00
	TO TRANSFER TAILGATE MECHANISM		\$100.00	\$60.00
	TO SPRAY RUST PROOFING		\$100.00	\$60.00
	TO RESET DIAGNOSTIC & REPROGRAMME SYSTEM		\$120.00	\$0.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL AND REAR FENDER.		\$1,800.00	\$800.00
	TO PUTTY & SPRAY PAINTING		\$1,800.00	\$1,000.00
			\$4,320.00	\$2,150.00
GRAND TOTAL			\$21,129.60	\$7,756.56
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			\$6,200.00
Report Ref No: CD/FCI24110328/Uma3q2				

CKS

MARCUS CHUA KANG SENG

Licensed Appraiser



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U






PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U




PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U

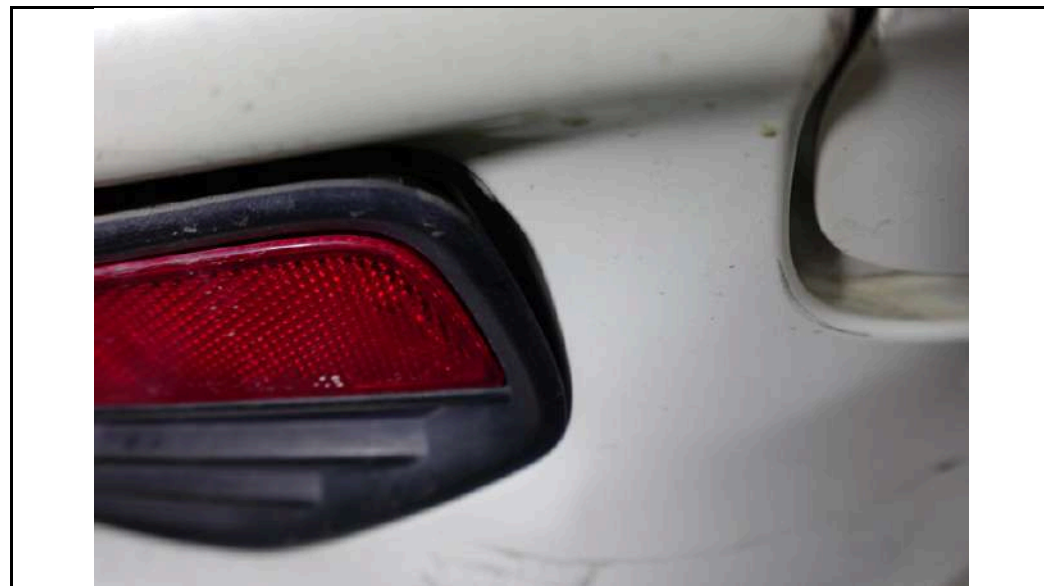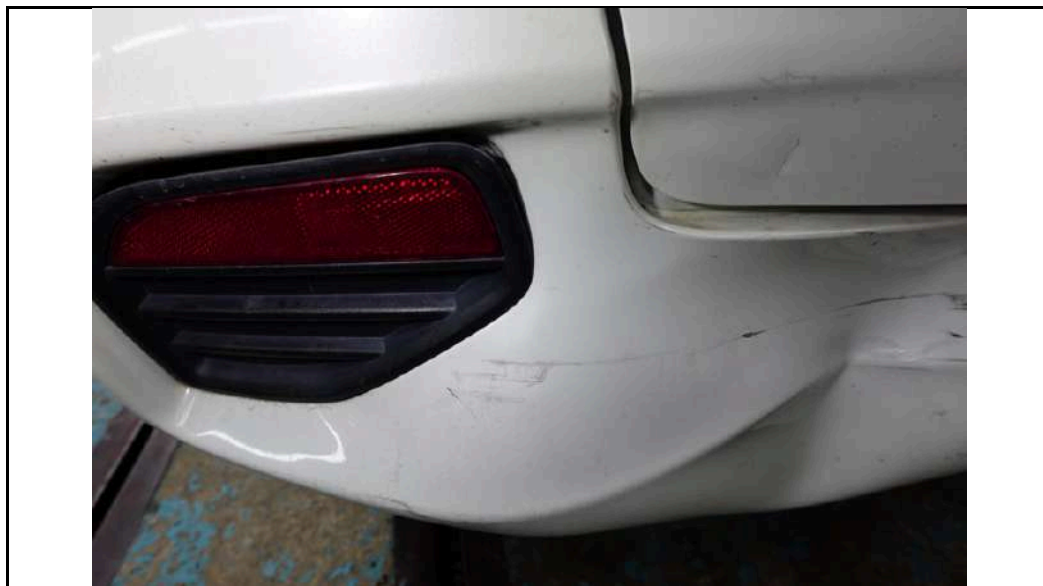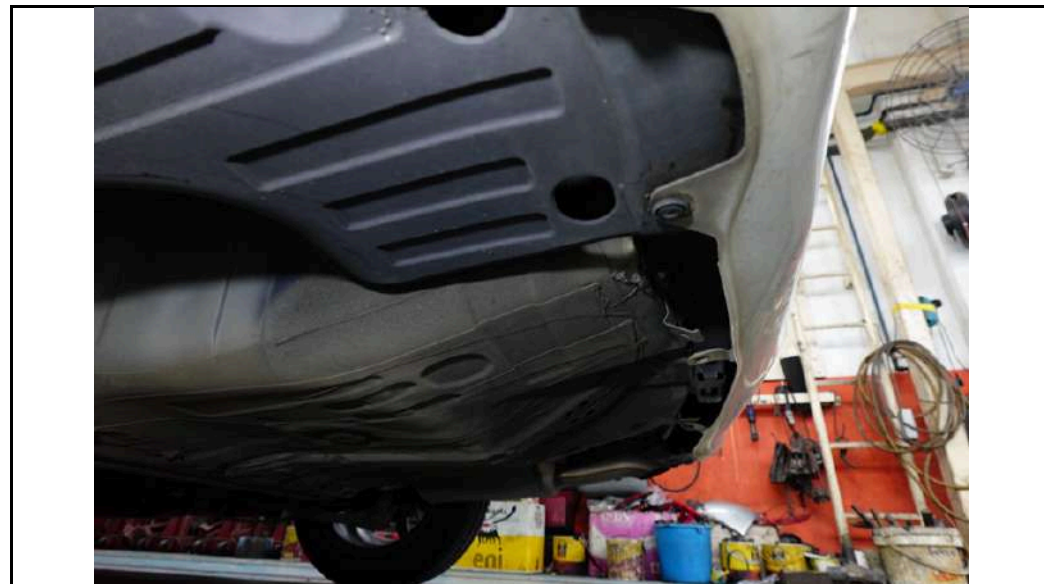

PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U

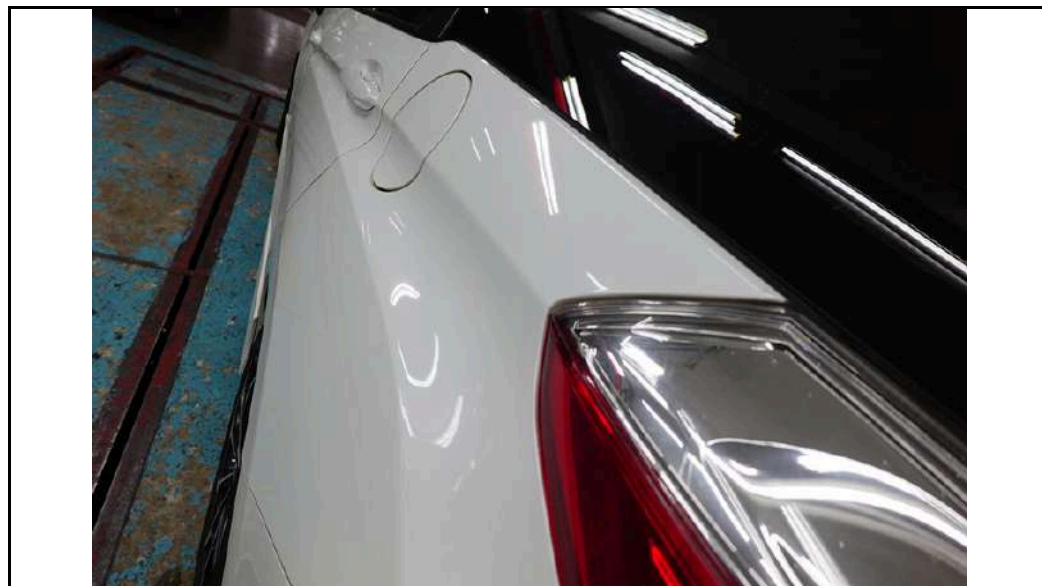

PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U




PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U

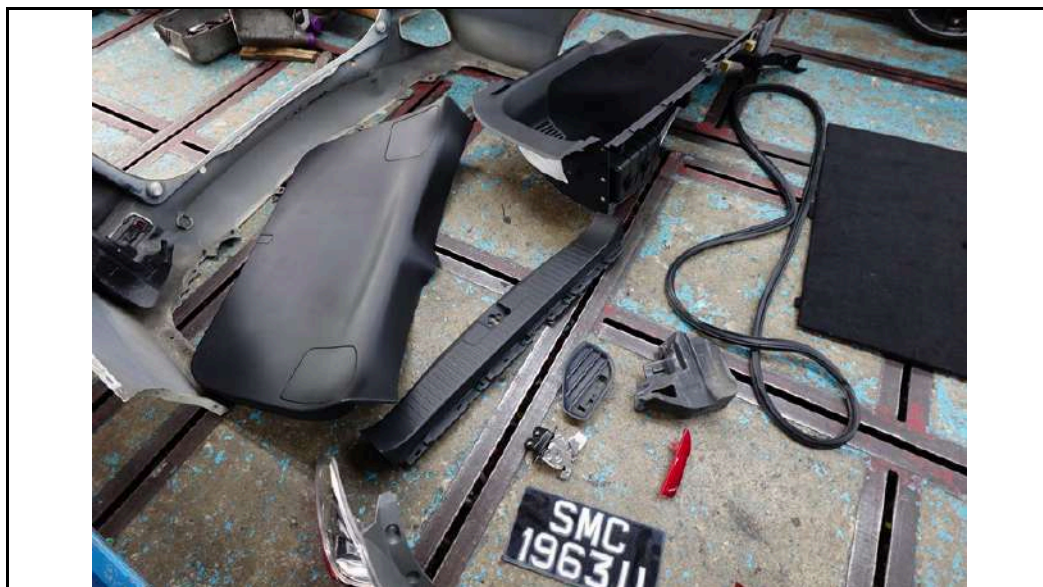

PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U




PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U

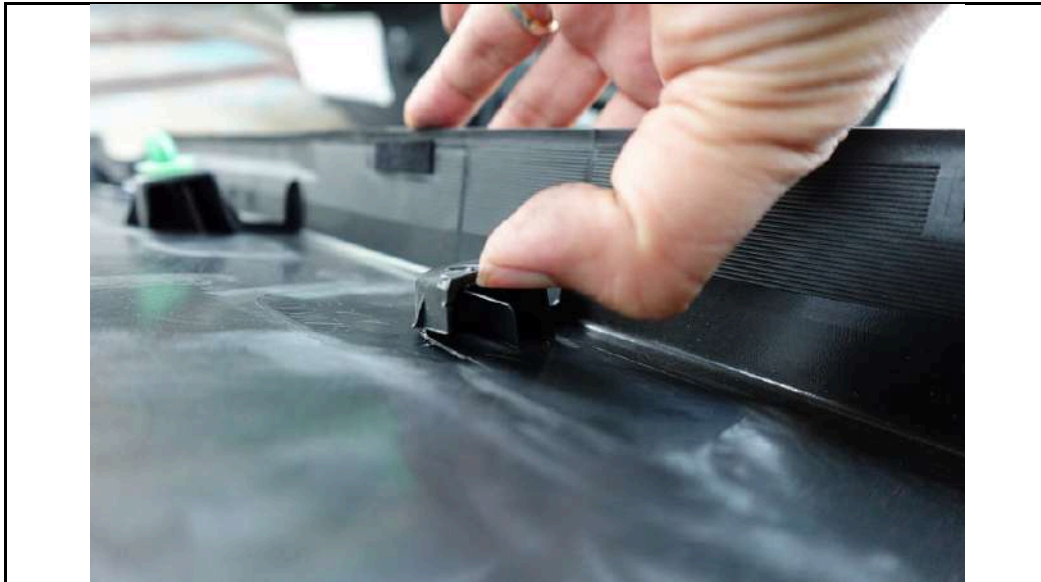

PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U




PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U



PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U

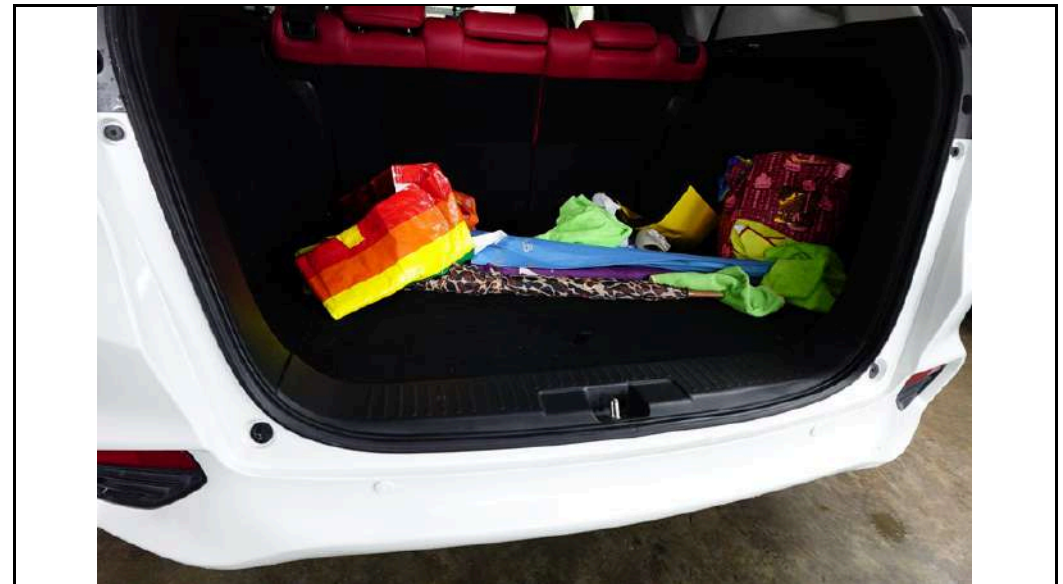

PHOTOGRAPHS FOR VEHICLE NO. : SMC 1963U

