

REFERENCE

Insured: CHIN WAH PAINTS PTE LTD Policy No: Z22VC05012830
Date of Loss: 05/10/2022 (Wed)
Claimant:

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: XE6167C Make: HINO
Date of Reg: 28/01/2021 Model: FS1EKND 28 TON 6X4 MT
Colour: White Engine No: E13CAT10691
Type: Tipper Truck Chassis No: JHDFS1EKNXXX10108
Type of Claims: Third Party Odometer: Unreadable
Engine Cap: 12,913 cc

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Fair Steering Yes Footbrake Yes
(Serviceable): (Serviceable):
Handbrake (Serviceable): Yes Engine No Pre-accident Good
Modification: Condition:

CONDITION OF TYRES

Front Tyre Size: 295/80R22.5 Rear Tyre Size: 295/80R22.5
Front Left Side: Sailun (10 mm) Rear Left Side: Sailun (10 mm)
Front Right Side: Sailun (10 mm) Rear Right Side: Sailun (10 mm)

The above values represent the remaining tyre treads depth

<u>COST OF REPAIRS</u>	Workshop's Amount (S\$)	Adjuster's Amount (S\$)	Difference (S\$)
Parts	62,090.00	46,745.00	15,345.00
Labour	32,900.00	10,300.00	22,600.00
Calculated Cost (S\$)	94,990.00	57,045.00	37,945.00


Recommended Lump Sum Repair Cost (S\$): 45,600.00

Date of Assignment: 07/10/2022 (Fri)
Date of Surveyed: 07/10/2022 (Fri)
Est. repair Period: 21 days
Repair status: Survey on a "Without Prejudice" basis

Vehicle: XE6167C

POINT OF IMPACT

Mainly on Front and Rear portion

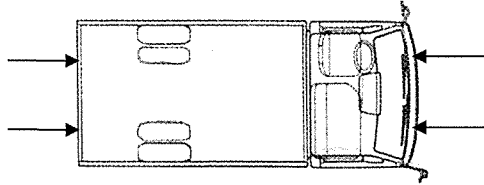

BRIEF CIRCUMSTANCES OF ACCIDENT

The Insured's vehicle (driver, YEO ENG KEID) and the Third Party's vehicle (driver, HAROON SYEDASHARAFALI) were involved in a 04-vehicle chain collision along PIE on 05/10/2022 @ 10:50.

CONSISTENCY OF DAMAGES

Our visual inspection of the vehicle revealed that the damage noted is consistent to the accident as reported.

MARKET VALUE

The market value of this vehicle is estimated S\$181,000.00. PARF/COE Rebate is S\$34,044.00. The estimated Economical Repair Limit is about S\$146,956.00.

SPECIAL REMARKS

We have not authorized repair. Under normal circumstances, estimated 21 working days are required to repair the vehicle.

This survey was conducted on a "Without Prejudice" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.

Vehicle: XE6167C

Annex A

REPAIR DETAILS

Recommended Parts

S/No.	Qty	Parts Description	Condition	Workshop's Amount (\$\$)	Adjuster's Amount (\$\$)	
1	2	CORNER PANEL COVER LH RH	Deformed	1,124.00	1,124.00	/
2	2	CORNER PANEL LAMP LH RH	Cracked	716.00	716.00	/
3	2	CORNER PANEL SIDE RUBBER LH RH	Necessary	170.00	170.00	x nn
4	2	CORNER PANEL LOWER RUBBER LH RH	Necessary	190.00	190.00	x nn
5	1	SIDE MIRROR ALUMINIUM BRACKE WITH MOTOR RH	Cracked / Missing	1,235.00	1,235.00	/
6	1	LOWER GRILLE	Missing	875.00	875.00	/
7	1	LOWER GRILLE PANEL	Missing	1,156.00	1,156.00	/
8	3	FRONT PANEL LOCK CATCH	Missing	495.00	495.00	/
9	3	FRONT PANEL LOCK	Missing	555.00	555.00	/
10	1	FRONT PANEL SHOCK ABSORBER	Bent	500.00	500.00	/
11	2	AIR HORN	Missing	170.00	170.00	/
12	1	AIR VALVE VENTER	Missing	385.00	385.00	/
13	1	AIR VALVE ROD	Missing	189.00	189.00	/
14	1 3-	WIPER MOTOR	Malfunction	1,260.00	1,260.00	/
15	3	WIPER ARM ASSY WITH WIPER	Bent	750.00	750.00	x nn
16	1	BRAKE MASTER AIR VALVE RH	Cracked	1,600.00	1,600.00	/
17	1	BRAKE FLUID TANK	Cracked	500.00	500.00	/
18	1	POWER STEERING TANK	Cracked	400.00	400.00	/
19	1	POWER STEERING BOX ASSY	Cracked	2,000.00	2,000.00	x nn
20	1	POWER STEERING SHAFT LOWER	Bent	150.00	150.00	x nn
21	1	POWER STEERING SHAFT UPPER	Bent	150.00	150.00	x nn
22	1	FRONT CABIN EXTENSION BAR	Bent	600.00	600.00	/
23	1	VALVE CABIN AIR FRONT	Cracked	350.00	350.00	/
24	1	DISCHARGE PIPE AND SUCTION HOSE	Bent / Deformed	200.00	200.00	/
25	1	REVERSE SENSOR	Not Necessary	950.00	-	
26	1	RADIATOR COVER BRACKET WTH COW RING	Cracked	1,000.00	1,000.00	/
27	1	RADIATOR ASSEMBLY	Cracked	700.00	700.00	/
28	1	TRUNNION BRACKET MIRROR ARM	Bent / Cracked	280.00	280.00	x nn
29	1	MIRROR ARM BRACKET UPPER LH	Bent	350.00	350.00	x nn
30	1	AIR CONDITIONER COIL SET	Cracked	500.00	500.00	/
31	1	AIR CON CONDENSER	Bent	300.00	300.00	/
32	1	GEAR BOX (Fuse box)	Cracked	1,200.00	1,200.00	500 /
33	1	CUSHION SEAT WITH BRACKET	Not Necessary	1,000.00	-	
34	1	CABIN SENSOR	Not Necessary	250.00	-	
35	1	MIT CYLINDER HEAD	Dented	900.00	900.00	/
36	1	STEERING DIESEL PIPE	Bent	120.00	120.00	/
37	1	ENGINE SIDE COVER - GRILLE BRACKET	Bent	250.00	250.00	/
38	1	MIRROR ARM MOTOR	Malfunction	350.00	350.00	x nn
39	1	TENSIONER	Bent	350.00	350.00	x nn
40	2	STEERING PIPE	Deformed	240.00	240.00	/
41	1	CYLINDER VALVE COVER	Cracked	260.00	260.00	/
42	1	CYLINDER VALVE HEAD	Cracked	4,000.00	4,000.00	2000 /
43	1	INTERCOOLER	Deformed	900.00	900.00	/

Vehicle: XE6167C

Annex A

REPAIR DETAILS

Recommended Parts

S/No.	Qty	Parts Description	Condition	Workshop's Amount (\$\$)	Adjuster's Amount (\$\$)	
44	2	MUG GUARD	Deformed	320.00	320.00	/
45	1	ECG MOTOR	Cracked	1,300.00	1,300.00	/
46	1	FAN WITH CLUTH	Cut	1,100.00	1,100.00	/
47	1	H700 HN HOSE WATER	Cut	50.00	50.00	/
48	1	FAN BELT	Cut	100.00	100.00	x nn
49	1	OVERHALL GASKET	Necessary	500.00	500.00	400 /
50	1	ENGINE OVERHALL GASKET KIT	Necessary	3,000.00	3,000.00	x nn
51	1	RR COMBINATION LAMP ASSY	Cracked	450.00	450.00	/
52	1	LAMP REVER MT	Cracked	80.00	80.00	/
53	1	FRONT WINDSHIELD	Cracked	2,000.00	2,000.00	1800 /
54	1	REAR WINDSHIELD	Cracked	1,500.00	1,500.00	1200 /
55	1	FRONT & REAR WINDSHIELD MOULDING	Necessary	600.00	600.00	400 /
56	2	WINDOW RUBBER SEAL LH/RH	Necessary	350.00	350.00	x nn
57	1	FRONT BONNET WITH UPPER GRILLE	Distorted	5,000.00	5,000.00	1500 /
58	2	SIGNAL LIGHT LH/RH	Not Necessary	400.00	-	
59	1	BUMPER	Deformed	3,000.00	3,000.00	2100 /
60	1	DASH BOARD	Cracked / Deformed	3,000.00	3,000.00	1800 /
61	1	TAILLAMP RH ASSY	Not Consistent	250.00	-	
62	1	TAILLAMP RH BRACKET	Not Consistent	220.00	-	
63	1	REAR MUDGUARD PANEL RH	Not Consistent	650.00	-	
64	3	REAR MUDGUARD PANEL UPPER BRACKET RH	Not Consistent	540.00	-	
65	1	REAR MUDGUARD METAL	Not Consistent	150.00	-	
66	1	REAR MUDFLAP RH	Not Consistent	180.00	-	
67	1	TAILGATE LOCK RH	Not Consistent	450.00	-	
68	1	REAR CHASSIS FRAME SIDE EXTENSION RH	Not Consistent	3,560.00	-	
69	1	BADGE, SCANIA LOGO	Necessary	80.00	80.00	/
70	1	HINO SCUFF PANEL	Necessary	200.00	200.00	/
71	1	AIR CONDITIONER CONTROL CENTER COVER	Cracked	1,000.00	1,000.00	x nn
				59,650.00	51,050.00	
				Less 10% (\$\$):	-	5,105.00
				Sub-Total (\$\$):	59,650.00	45,945.00
Special Nett items						
72	1	REAR TYRE RH	Not Necessary	450.00	-	
73	1	REAR WHEEL RIM RH	Not Necessary	650.00	-	
74	1	COMPANY STICKERS ASSY	Necessary	800.00	400.00	300
75	1	BODY SEALANT	Necessary	500.00	400.00	50
76	1	NUMBER PLATE	Not Necessary	40.00	-	
				Sub-Total (\$\$):	2,440.00	800.00
				Parts Total (\$\$):	62,090.00	46,745.00

Vehicle: XE6167C

Annex B

REPAIR DETAILS

Recommended Labour

S/No.	Labour	Workshop's Amount (S\$)	Adjuster's Amount (S\$)	
1	TO REMOVE DAMAGED PARTS WITH ALL NECESSARY COMPONENTS / ATTACHMENT APPLY HOT-WORKS WHERE NECESSARY STRAIGHTEN FRONT FLOOR PANEL REPAIR, RESHAPE BODY DENTED PANEL IN ACCORDANCE TO FACTORY SPECIFICATIONS REPLACE NEW PARTS REFIT AND ALIGN INTO POSITION REFIT ALL NECESSARY COMPONENTS / ATTACHMENTS	20,000.00	6,000.00	4000
2	TO SPRAY PAINT REPLACED/REPAIRED BODY PANELS INCLUSIVE OF PREPARATORY WORKS AND PAINTING MATERIALS	3,000.00	2,700.00	1500
3	TO REMOVE AND REFIT DASHBOARD	400.00	300.00	250
4	TO CHECK AND RECONNECT WIRING TO ALL NECESSARY COMPONENTS/ATTACHMENTS	3,000.00	300.00	150
5	SPECIALIST CHARGES - CHECK / DIAGNOSTIC AND REPROGRAMMING	6,000.00	500.00	x
6	APPLY RUST PROOFING ON ADJACENT PANELS	150.00	150.00	50
7	TOWING FEES (24FT)	350.00	350.00	/
Labour Total (S\$):		32,900.00	10,300.00	

Annex C

REPAIR DETAILS

Adjusted Repair Cost

	Workshop's Amount (S\$)	Adjuster's Amount (S\$)
Total parts (S\$):	62,090.00	46,745.00
Total labour (S\$):	32,900.00	10,300.00
Total repair cost (S\$):	94,990.00	57,045.00

Adjusted Repair Cost (Lump Sum basis) (S\$)	45,600.00
---	-----------

MV - \$180k

20 days