



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

16 RAFFLES QUAY  
#42-01 HONG LEONG BUILDING  
SINGAPORE 048581  
ATTN:KAREN TAN

INV No. AC2501308

INV Date 06/03/2025

Reference CD/FCI24110491/Epa3q2

Code FCI2

### PROFESSIONAL SERVICE FEE

Vehicle No. SND 7700E  
Insured Veh. SHD 3336X  
Claim No. D24010082MFCT/TPD2/KT  
Policy No. D-24101861MFCT  
Accident Date 14/11/2024  
Inspection Date 20/11/2024

Description	Total
Survey Inspection	400.00
Resurvey Inspection	
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>400.00</b>
<b>GST (9%)</b>	<b>36.00</b>
<b>Grand Total</b>	<b>436.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 16 RAFFLES QUAY #42-01 HONG LEONG BUILDINGSINGAPORE 048581 ATTN:KAREN TAN		Ref: CD/FCI24110491/Epa3q2(N) Date: 06/03/2025 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SHD 3336X	Veh. Inspected	SND 7700E
Policy No.	D-24101861MFCT	Coverage (\$)	0.00
Claim No.	D24010082MFCT/TPD2/KT	Excess (\$)	0.00
Assign From	KAREN TAN	Assign Date	20/11/2024
2. Vehicle Particulars & Condition			
Make & Model	PORSCHE CAYMAN GTS	c.c	3436
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	WP0ZZZ98ZFK182868	Colour	BLACK
Odometer	90033 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	235/35Z R20	PIRELLI	5 mm
L/H Front Tyre	235/35Z R20	PIRELLI	5 mm
R/H Rear Tyre	265/35Z R20	PIRELLI	5 mm
L/H Rear Tyre	265/35Z R20	PIRELLI	5 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	14/11/2024	Inspection Date	20/11/2024
Survey held at	27A Tanjong Penjuru, Singapore 609042		
Repairer	TRANS EUROKARS PTE LTD		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SND 7700E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>REPLACEMENT OF PARTS</b>			
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
1	FRONT BUMPER (SN)	BROKEN	2,507.10	2,507.10
1	FRONT BUMPER LOWER SPOILER (SN)	NOT NECESSARY	868.70	-
1	RETAINING FRAME RH (SN)	CUT	142.80	142.80
1	STRUT BRACE (SN)	NOT NECESSARY	173.20	-
1	SENSOR COVER RH (SN)	CUT	214.00	214.00
1	SENSOR (SN)	NOT NECESSARY	360.90	-
4	SENSOR GASKET (SN)	NECESSARY	26.80	26.80
2	FIXING DEVICE (SN)	NECESSARY	60.40	60.40
1	FRONT BUMPER RETAINER RH (SN)	NOT NECESSARY	30.30	-
6	BLIND RIVET (SN)	NECESSARY	48.60	48.60
6	EXPANSION RIVET (SN)	NECESSARY	18.60	18.60
2	BRACKET SPACER (SN)	NOT NECESSARY	55.80	-
1	RETAINER PLATE HEADLIGHT LH (SN)	NECESSARY	77.20	77.20
1	RETAINER PLATE HEADLIGHT RH (SN)	NECESSARY	77.20	77.20
1	FRONT FENDER RH (SN)	DENTED	1,966.80	1,966.80
1	BRACKET HEADLIGHT RH (SN)	NOT NECESSARY	35.50	-
1	FENDER BRACKET RH (SN)	NOT NECESSARY	34.30	-
1	FENDER STRUT BRACE RH (SN)	NOT NECESSARY	51.40	-
1	AIR GUIDE CONDENSER RH (SN)	NOT NECESSARY	129.40	-
1	CONDENSER RH (SN)	NOT NECESSARY	944.20	-
1	SEALING FRAME RH (SN)	NOT NECESSARY	89.00	-
1	RADIATOR RH (SN)	NOT NECESSARY	2,090.30	-
1	RADIATOR FAN RH (SN)	NOT NECESSARY	1,125.90	-
1	RADIATOR FAN BRACKET RH (SN)	NOT NECESSARY	546.10	-
1	AIR GUIDE RADIATOR RH (SN)	NOT NECESSARY	101.20	-
1	VENT LINE RH (SN)	NOT NECESSARY	118.70	-
6	ANTIFREEZE COOLANT (SN)	NOT NECESSARY	268.20	-
1	HEADLIGHT RH (SN)	NOT NECESSARY	5,906.20	-

Report Ref No. CD/FCI24110491/Epa3q2(N)



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ADDITIONAL HEADLIGHT RH (SN)	NOT NECESSARY	643.30	-
1	SIGNAL LIGHT RH (SN)	BROKEN	92.90	92.90
			18,855.00	5,252.40
	<b>LABOUR</b>			
	TO REMOVE /REPLACE FRONT BUMPER ,FRONT FENDER RH & ALL ACCIDENT DAMAGED BODY PARTS .TO REPAIR ALL AREAS AFFECTED BY THE ACCIDENT .		5,160.00	2,580.00
	TO RESPRAY FRONT BUMPER ,FRONT FENDER RH .		2,800.00	2,600.00
	TO CARRY-OUT BODY CAVITY PRESERVATION .		250.00	150.00
	TO REMOVE & REPLACE TURBO COOLER RADIATOR, CONDENSER AND RADIATOR FAN ASSY .	NOT NECESSARY	1,720.00	-
	TO TOP-UP GAS ,CONDUCT PRESSURE TEST & PERFORM LEAK TEST ON THE COOLING SYSTEM.	NOT NECESSARY	500.00	-
	TO TRANSFER THE FRONT BUMPER SENSORS.		500.00	250.00
	TO SUPPLY & INSTALL THE BODY WRAP STICKER ON AFFECTED AREAS (PRICE TO BE ADVISE).	NOT NECESSARY	1.00	-
	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		250.00	150.00
	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS .		600.00	600.00
			11,781.00	6,330.00
	<b>GRAND TOTAL</b>		<b>30,636.00</b>	<b>11,582.40</b>
	<b>RECOMMENDED COST OF REPAIRS</b>			<b>11,582.40</b>

Report Ref No. CD/FCI24110491/Epa3q2(N)

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

**PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E**



**PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E**



**PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E**



**PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E**





# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

INSPECTION PHOTOS (Page 5 of 10)

## PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E



**PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E**

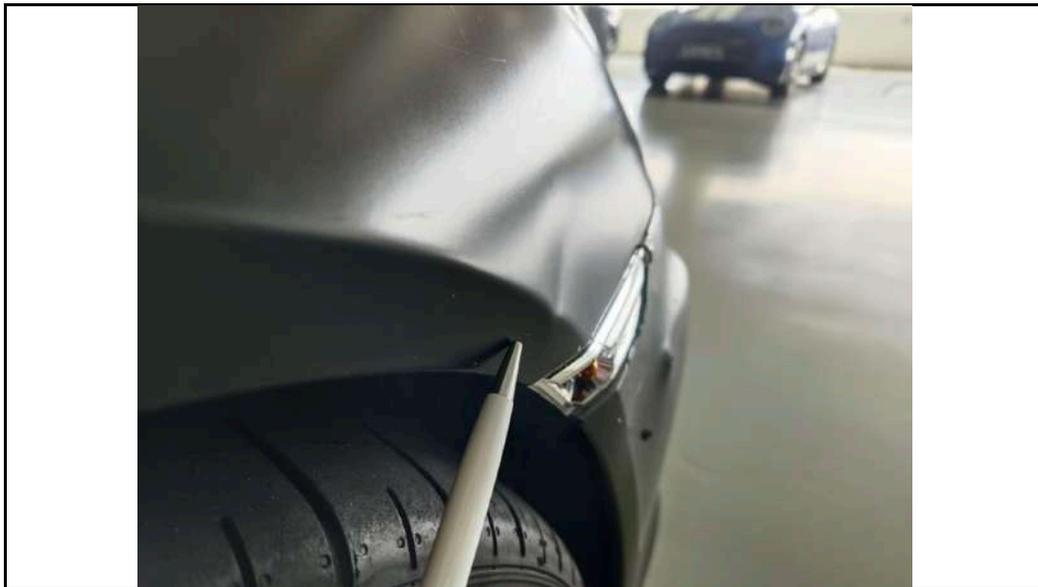

**PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E**



**PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E**



**PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E**





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

INSPECTION PHOTOS (Page 10 of 10)

### PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

PHOTOGRAPHS FOR VEHICLE NO. : SND 7700E

