



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2502261

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 14/04/2025
Reference CD/LPC24110492/Apa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SKT 8150L
Insured Veh. YP 9832B
Claim No. 24/24/24/VC05/030220
Policy No. Z24VC05026923
Accident Date 22/11/2024
Inspection Date 25/11/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CD/LPC24110492/Apa3q2(N)	
			Date: 14/04/2025	
			Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	YP 9832B	Veh. Inspected	SKT 8150L
	Policy No.	Z24VC05026923	Coverage (\$)	0.00
	Claim No.	24/24/24/VC05/030220	Excess (\$)	0.00
	Assign From	ERIC WOO	Assign Date	25/11/2024
2. Vehicle Particulars & Condition				
	Make & Model	HONDA VEZEL	c.c	1496
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	RU11022150	Colour	BLACK
	Odometer	196643 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/60 R16	YOKOHAMA	6 mm
	L/H Front Tyre	215/60 R16	YOKOHAMA	6 mm
	R/H Rear Tyre	215/60 R16	YOKOHAMA	6 mm
	L/H Rear Tyre	215/60 R16	YOKOHAMA	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	22/11/2024	Inspection Date	25/11/2024
	Survey held at	JL PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		
5a. Remarks				
	A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		12 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKT 8150L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR DOOR RH	TO REPAIR SEE LABOUR	950.80	-
1	REAR DOOR INNER LOCK RH	NOT NECESSARY	298.00	-
1	REAR DOOR INNER TRIM RH	NOT NECESSARY	680.00	-
1	REAR DOOR STICKER PROTECT RH	NOT NECESSARY	25.70	-
1	REAR DOOR OUTER MOULDING RH	NOT NECESSARY	136.00	-
1	REAR DOOR FRAME WEATHERSTRIP RH	NOT NECESSARY	187.00	-
1	REAR DOOR WEATHERSTRIP RH	NOT NECESSARY	169.00	-
2	REAR FENDER @\$1120.00	O/S BUCKLED	2,240.00	1,120.00
1	REAR FENDER INNER PANEL RH	TO REPAIR SEE LABOUR	798.20	-
2	REAR FENDER INNER TRIM @\$399.10	O/S DEFORMED	798.20	399.10
2	REAR FENDER COWLING @\$150.20	NOT NECESSARY	300.40	-
2	REAR FENDER ARCED GARNISH @\$184.70	O/S DEFORMED	369.40	184.70
1	REAR FENDER AIR VENT RH	NOT NECESSARY	83.00	-
1	REAR BUMPER	DISTORTED	865.50	745.00
2	REAR BUMPER REFLECTOR @\$178.20	O/S CRACKED	356.40	141.00
2	REAR BUMPER SIDE @\$230.00	O/S DEFORMED	460.00	195.00
2	REAR BUMPER SIDE RETAINER @\$57.00	NOT NECESSARY	114.00	-
2	TAIL LAMP @\$503.90	CUT	1,007.80	950.00
1	TAIL LAMP PANEL RH	TO REPAIR SEE LABOUR	268.00	-
2	TAIL LAMP INNER PANEL (LOWER) @\$479.00	TO REPAIR SEE LABOUR	958.00	-
1	TAILGATE	DISTORTED	1,100.00	1,100.00
1	TAILGATE LOGO	NECESSARY	65.00	65.00
1	TAILGATE EMBLEM 'VEZEL'	NECESSARY	75.50	75.50
1	TAILGATE OUTER GARNISH	CRACKED	267.80	267.80
2	TAILGATE SIDE LAMP @\$287.40	CRACKED	574.80	574.80
1	TAILGATE OUTER SWITCH BUTTON	DAMAGED	103.70	103.70
2	TAILGATE DAMPER @\$180.70	NOT NECESSARY	361.40	-
2	TAILGATE NUMBER PLATE LAMP @\$38.50	NOT NECESSARY	77.00	-

Report Ref No. CD/LPC24110492/Apa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILGATE INNER HOLDER	NOT NECESSARY	52.00	-
1	TAILGATE WIRE HARNESS	NOT NECESSARY	683.00	-
2	TAILGATE STOPPER @\$19.00	NOT NECESSARY	38.00	-
1	TAILGATE TOP LOCK	DAMAGED	180.00	180.00
1	TAILGATE LOWER LOCK	NOT NECESSARY	24.70	-
1	TAILGATE INNER TRIM	CRACKED	263.40	263.40
2	TAILGATE INNER SIDE TRIM @\$48.20	NOT NECESSARY	96.40	-
1	TAILGATE INNER TOP TRIM	NOT NECESSARY	135.20	-
1	TAILGATE WEATHERSTRIP	CUT	168.40	168.40
1	TAILGATE WINDSCREEN GLASS	SHATTERED	1,350.00	1,350.00
1	SET TAILGATE WINDSCREEN MOULDING	NECESSARY	164.00	164.00
1	TAILGATE WIPER MOTOR	NOT NECESSARY	205.40	-
1	TAILGATE WIPER ARM	NOT NECESSARY	138.00	-
1	TAILGATE LOCK DETECTOR	NOT NECESSARY	379.00	-
1	BUZZER	NOT NECESSARY	109.00	-
1	REAR END PANEL	DISTORTED	530.00	530.00
1	REAR END PANEL TOP GARNISH	DEFORMED	146.30	146.30
1	REAR FLOOR PANEL	DISTORTED	1,130.00	1,130.00
1	REAR FLOOR TOWING PANEL	TO REPAIR SEE LABOUR	545.00	-
1	REAR FLOOR BOTTOM CROSS MEMBER	TO REPAIR SEE LABOUR	250.80	-
1	REAR FLOOR SIDE PANEL	O/S BUCKLED	595.20	297.60
1	REAR FLOOR PANEL BOTTOM GARNISH	DEFORMED	269.00	269.00
1	REAR FLOOR PANEL TOP BOARD	DEFORMED	325.70	325.70
1	REAR STORAGE SPONGE	CRACKED	156.40	156.40
1	EDLC MODULE	NOT NECESSARY	1,432.70	-
1	REAR CHASSIS MEMBER RH	TO REPAIR SEE LABOUR	797.40	-
1	SET CENTER EXHAUST GASKET	NOT NECESSARY	80.00	-
1	CENTER EXHAUST	NOT NECESSARY	1,448.00	-
1	CENTER EXHAUST INSULATOR	NOT NECESSARY	89.00	-
1	REAR EXHAUST INSULATOR	NOT NECESSARY	155.00	-
1	REAR EXHAUST PIPE	NOT NECESSARY	980.00	-

Report Ref No. CD/LPC24110492/Apa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
4	REAR EXHAUST MOUNTING @\$29.40	NOT NECESSARY	117.60	-
1	SET REAR EXHAUST GASKET	NOT NECESSARY	80.00	-
	LESS 20% DISCOUNT		-5,361.04	-2,180.48
			21,444.16	8,721.92
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	SET TAILGATE OUTER GARNISH CLIP (SN)	NECESSARY	50.00	20.00
1	SET TAILGATE INNER TRIM BOARD CLIP (SN)	NECESSARY	50.00	30.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	TAILGATE WINDSCREEN INNER SEAL (SN)	NECESSARY	60.00	30.00
1	TAILGATE WINDSCREEN SOLAR FILM (SN)	NECESSARY	550.00	200.00
1	SET TAIL LAMP CLIP (SN)	NOT NECESSARY	40.00	-
2	TAIL LAMP PANEL SEALANT @\$60.00 (SN)	NOT NECESSARY	120.00	-
2	REAR FENDER SEALANT @\$150.00(SN)	NECESSARY	300.00	60.00
1	SET REAR FENDER INNER TRIM CLIP (SN)	NECESSARY	60.00	30.00
1	SET REAR FENDER COWLING CLIP (SN)	NOT NECESSARY	60.00	-
1	SET REAR END PANEL TOP GARNISH CLIP (SN)	NECESSARY	50.00	20.00
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	60.00
1	REAR FLOOR PANEL SEALANT (SN)	NECESSARY	350.00	60.00
1	SET REAR FLOOR PANEL BOTTOM GARNISH CLIP (SN)	NECESSARY	60.00	30.00
1	REAR SEAT BOTTOM FLOOR PANEL SEALANT (SN)	NOT NECESSARY	250.00	-
1	REVERSE CAMERA (SN)	NOT NECESSARY	480.00	-
1	SET REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
			2,980.00	810.00
	<u>LABOUR</u>			
	PANEL BEATING ,REMOVAL AND REPLACING PARTS.INCLUSIVE OF THE REPAIR OF REAR DOOR RH ,REAR FENDER INNER PANEL RH ,TAIL LAMP PANEL RH,TAIL LAMP INNER PANEL (LOWER),REAR FLOOR TOWING PANEL,REAR FLOOR BOTTOM CROSS MEMBER AND REAR CHASSIS MEMBER RH .		2,200.00	1,600.00
	TO SPRAY PAINT AFFECTED AREA.		1,800.00	1,000.00
	TUFF COAT.		250.00	100.00

Report Ref No. CD/LPC24110492/Apa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY AND ROOF LINNING TO FACILITATE REPAIR.		250.00	120.00
	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING.		80.00	50.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		80.00	50.00
	REAR CHASSIS ALIGNMENT.	NOT NECESSARY	250.00	-
	REMOVE AND REFIX TAILGATE WINDSCREEN.		120.00	120.00
	TRANSFER TAILGATE MECHANISM .		80.00	60.00
	REMOVE AND REFIX VIDEO RECORDER .		120.00	50.00
	REMOVE AND REFIX REAR DOOR WINDOW GLASS .	NOT NECESSARY	80.00	-
	REMOVE & REFIX REAR DOOR MECHANISM.	NOT NECESSARY	80.00	-
	CONDUCT WATER LEAKAGE TEST .	NOT NECESSARY	100.00	-
	REMOVE AND REFIX REAR EXHAUST PIPE .	NOT NECESSARY	180.00	-
	REMOVE AND REFIX FUEL TANK TO FACILITATE FLOOR PANEL REPLACEMENT.	NOT NECESSARY	80.00	-
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	180.00	-
			5,930.00	3,150.00
GRAND TOTAL			30,354.16	12,681.92

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,000.00
---	--	--	-----------------

Report Ref No. CD/LPC24110492/Apa3q2(N)

ADRIAN LING WAI PING


B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

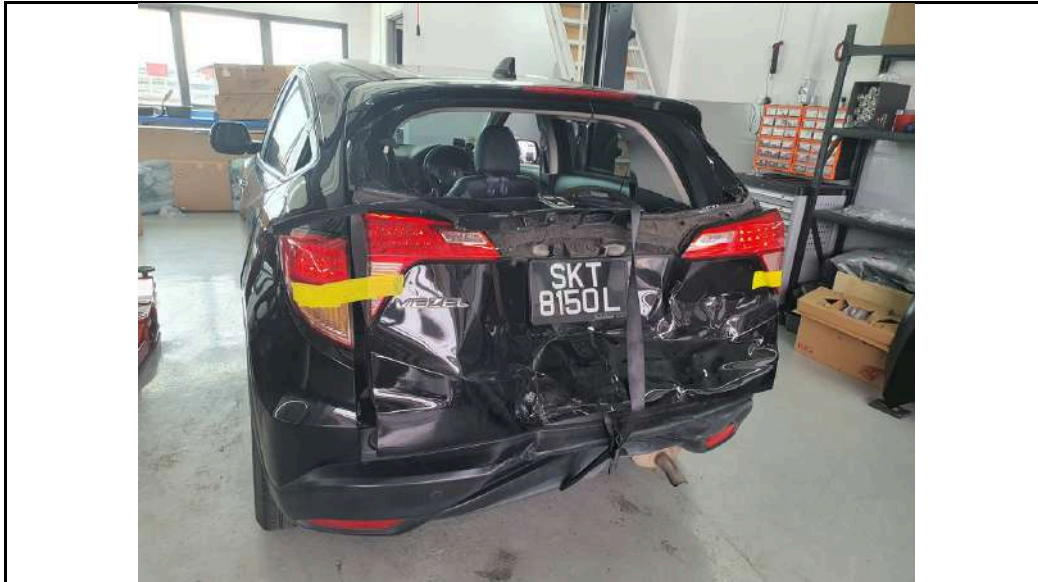


PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

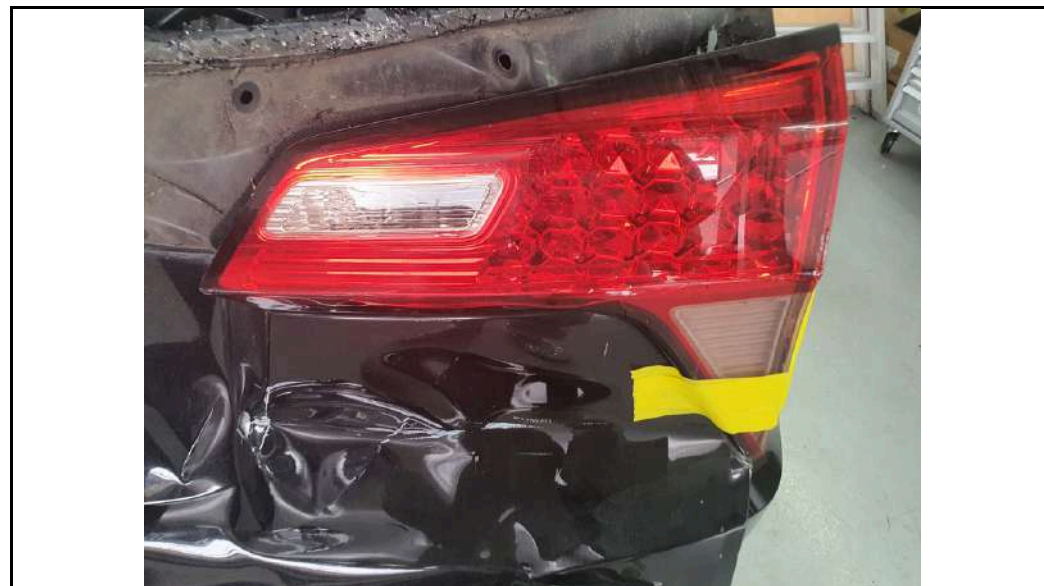

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L




PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L





PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

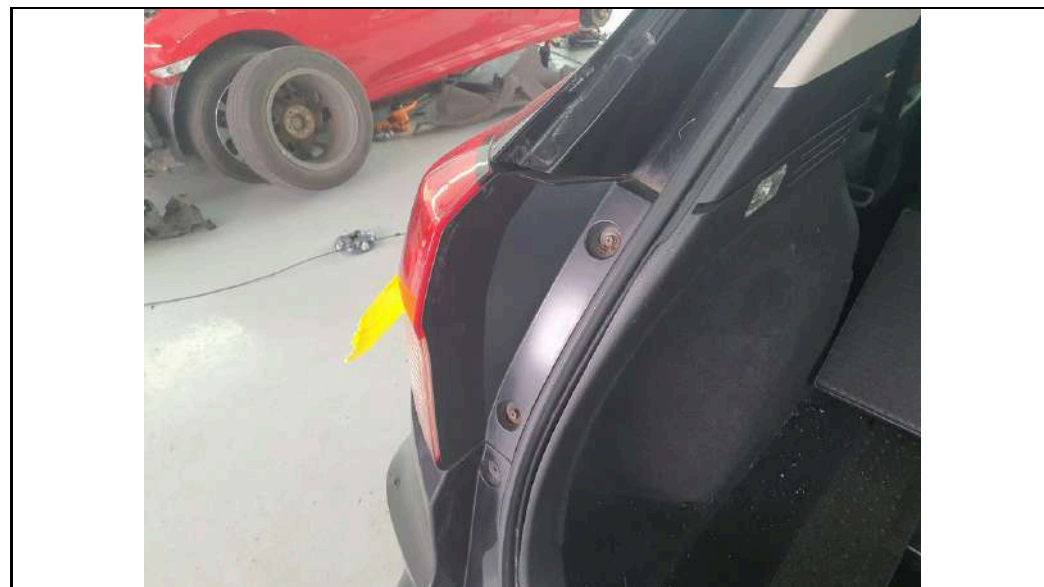


PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

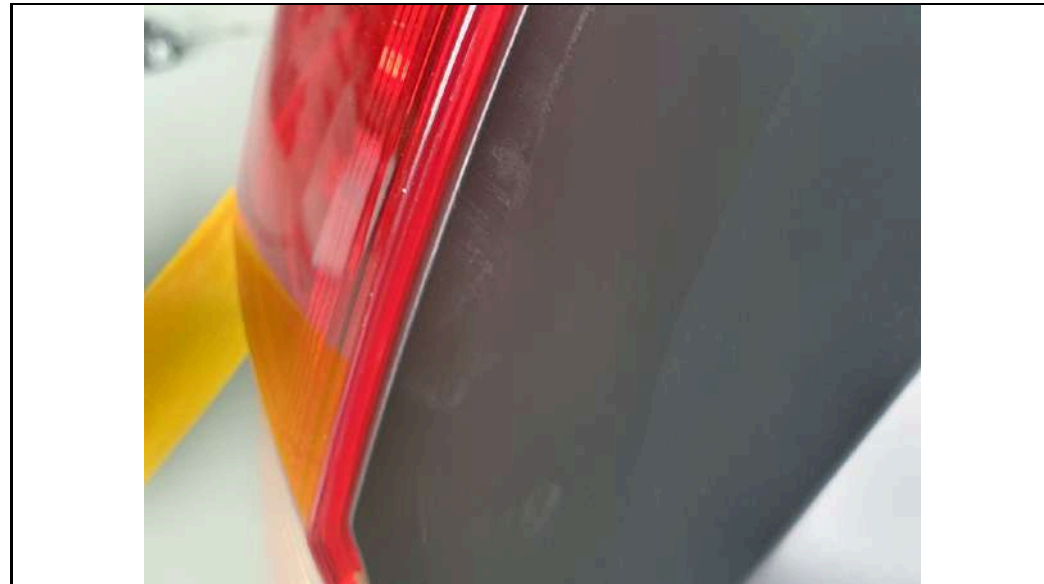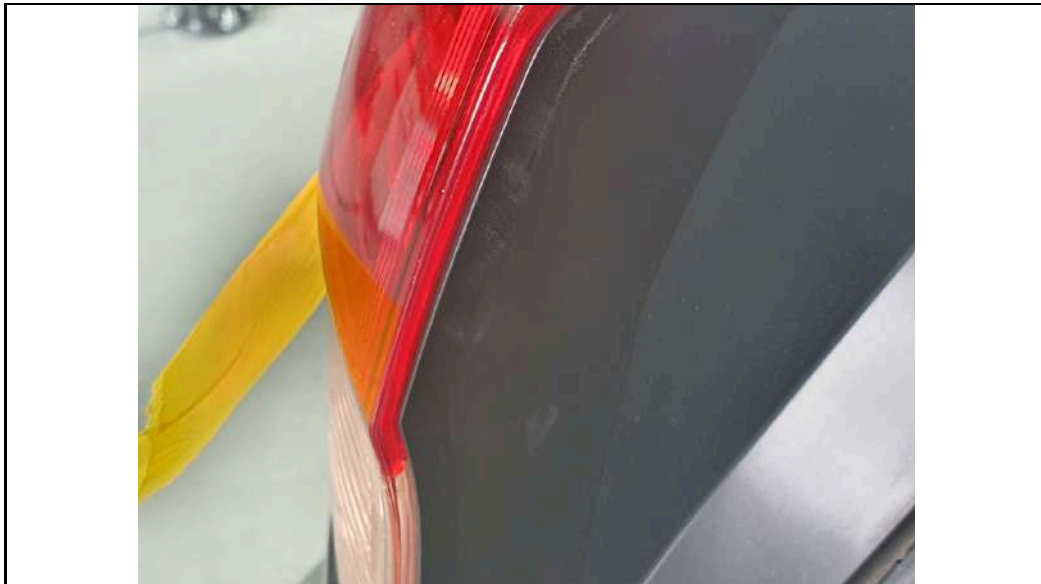


PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L




PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

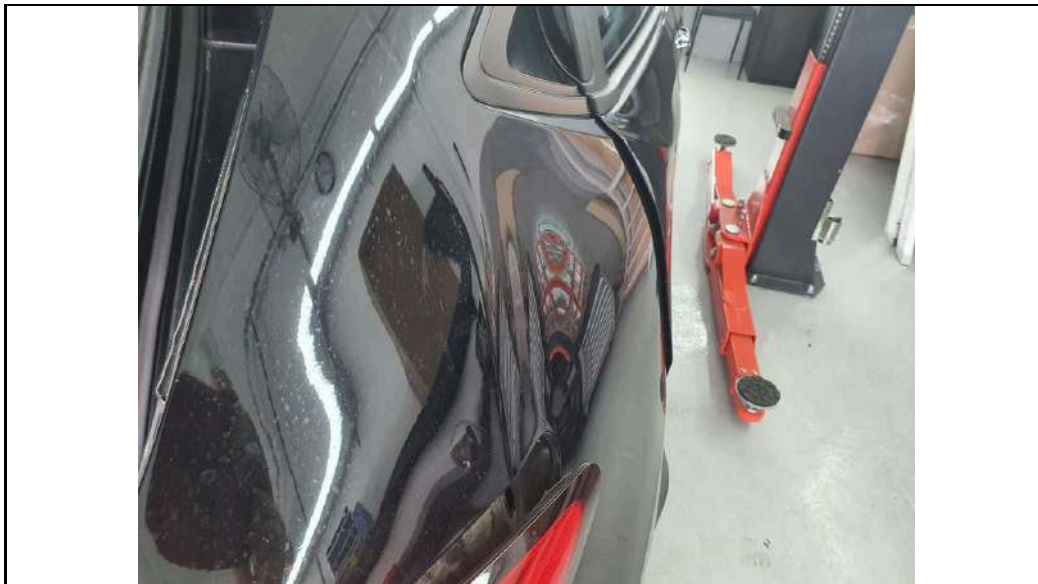


PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

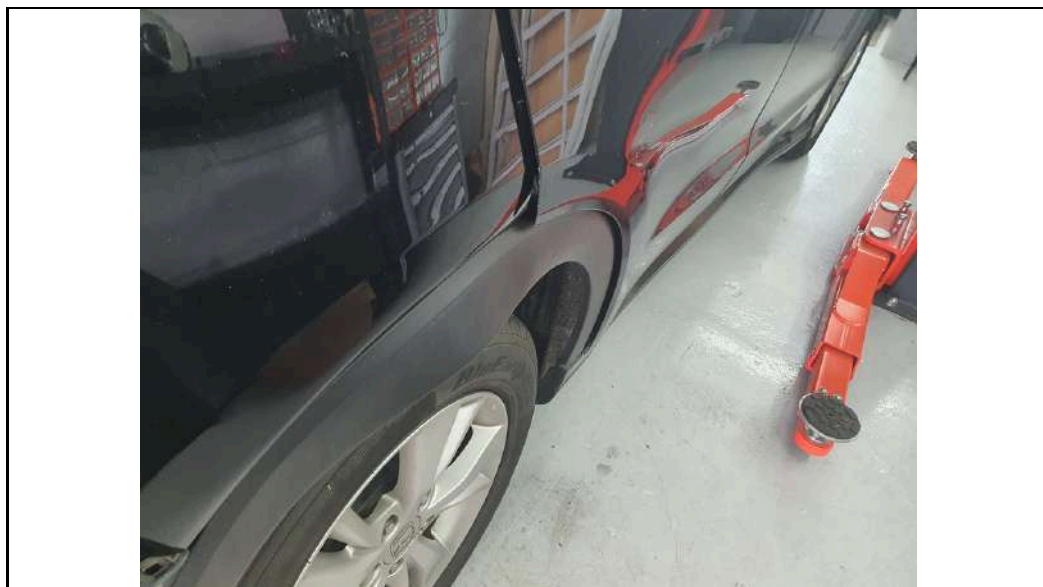

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

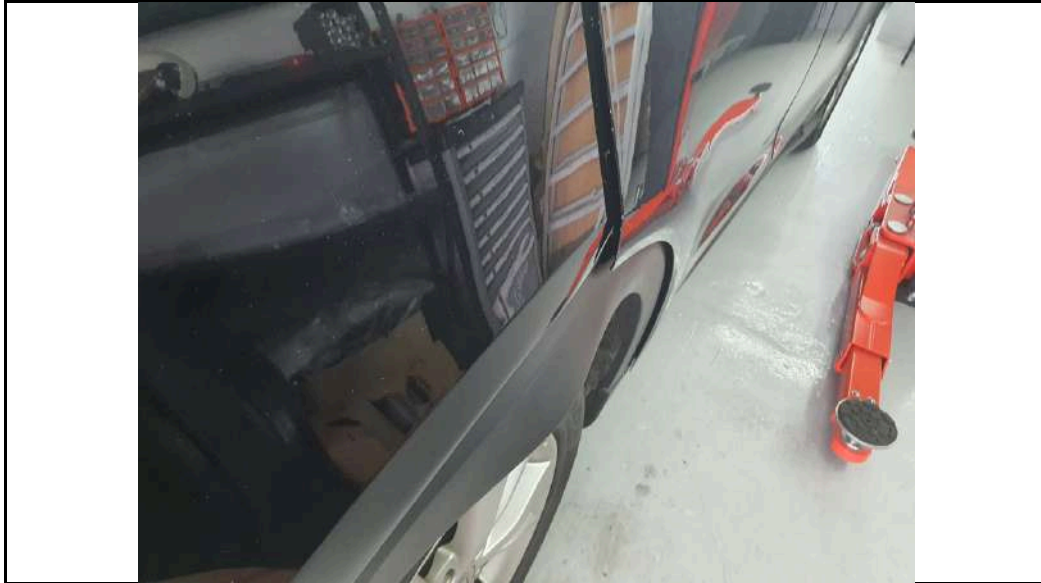

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

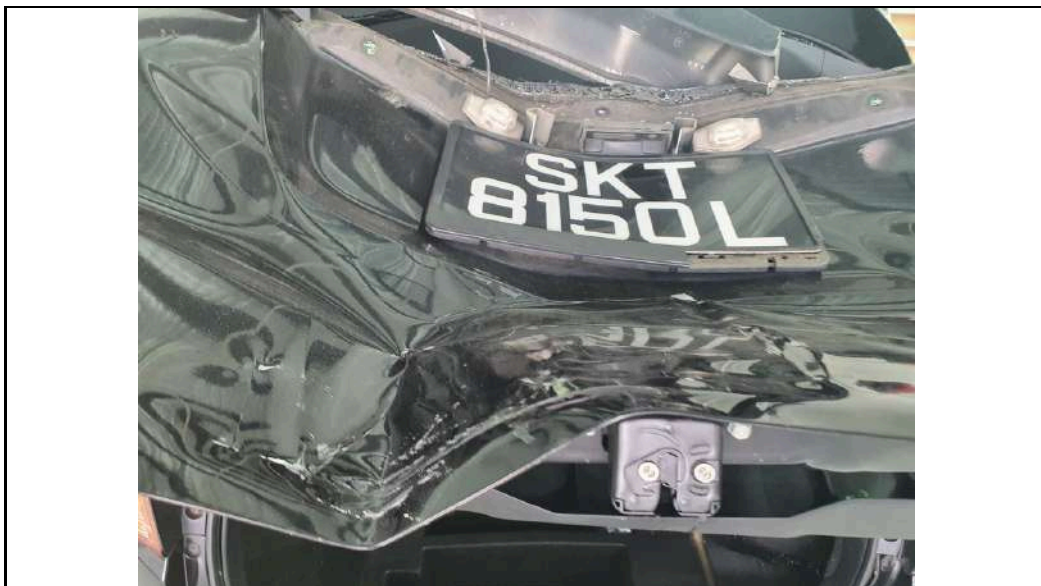


PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L





PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L




PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

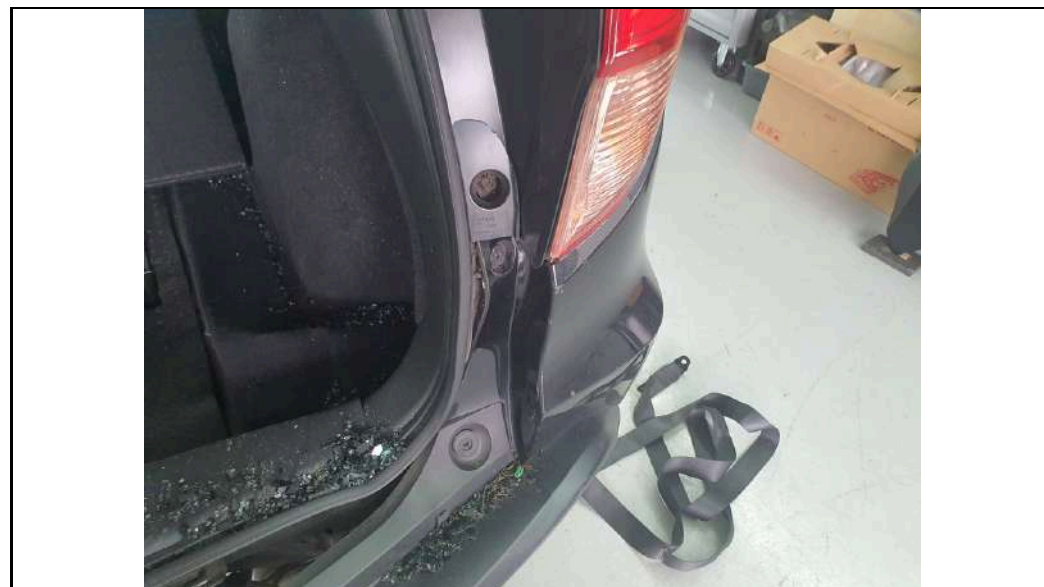

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

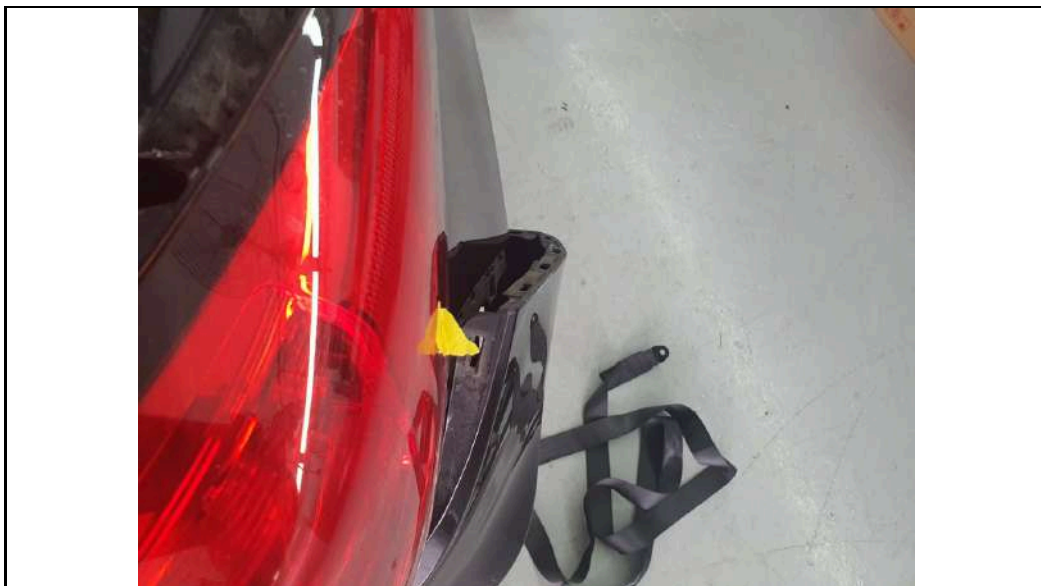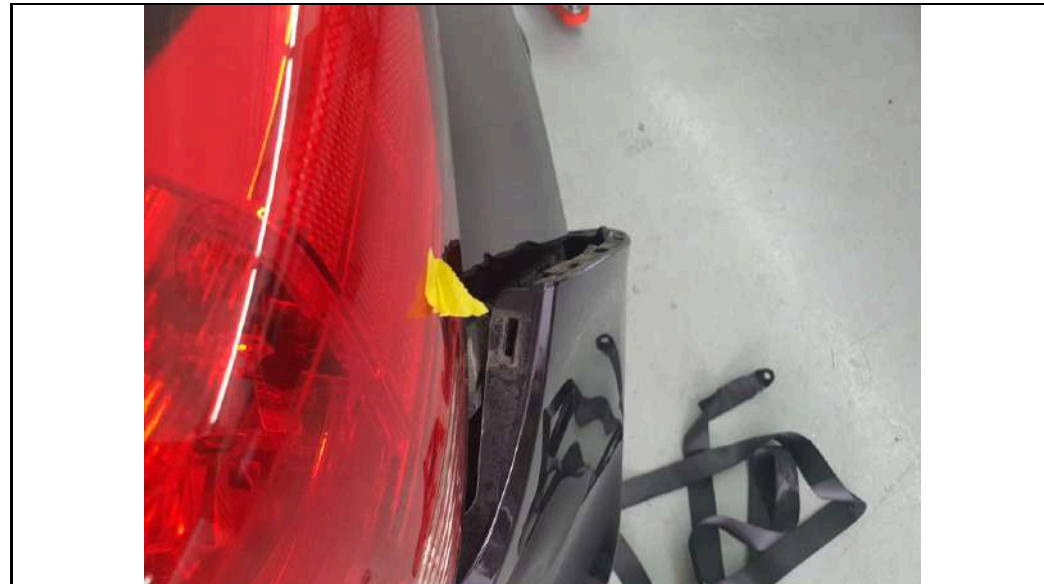


PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

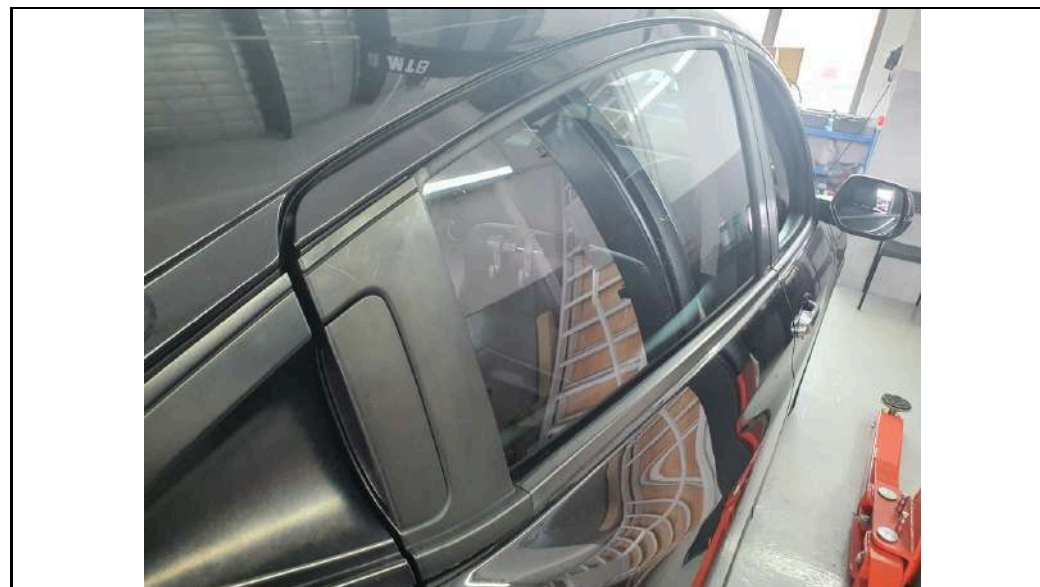

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

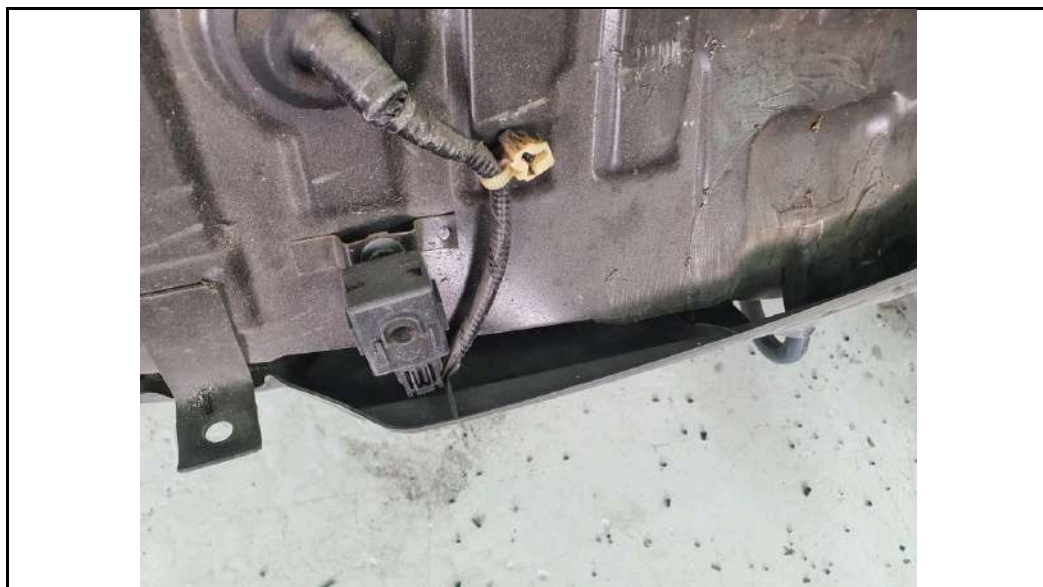

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L






PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L






PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

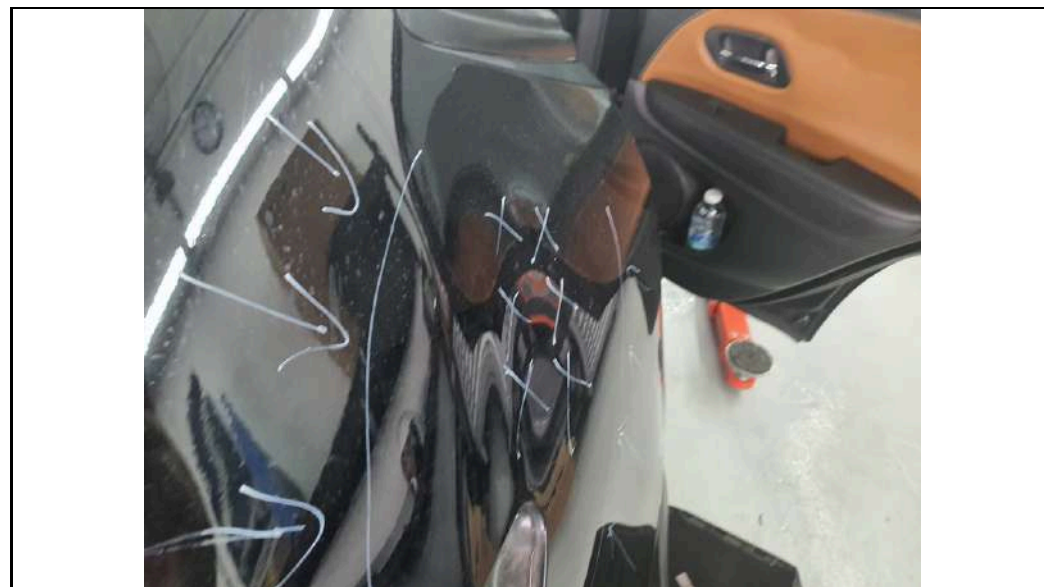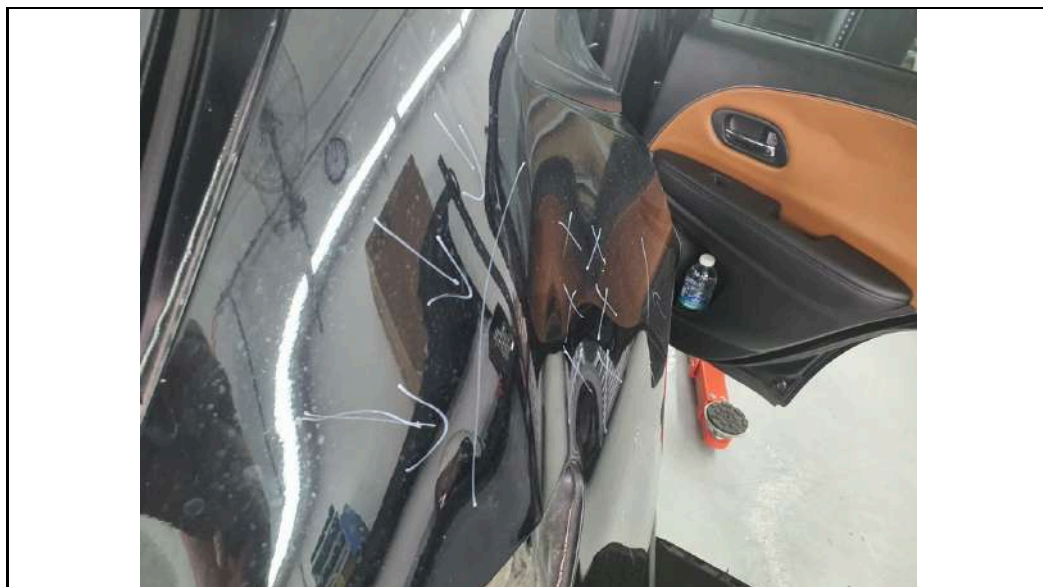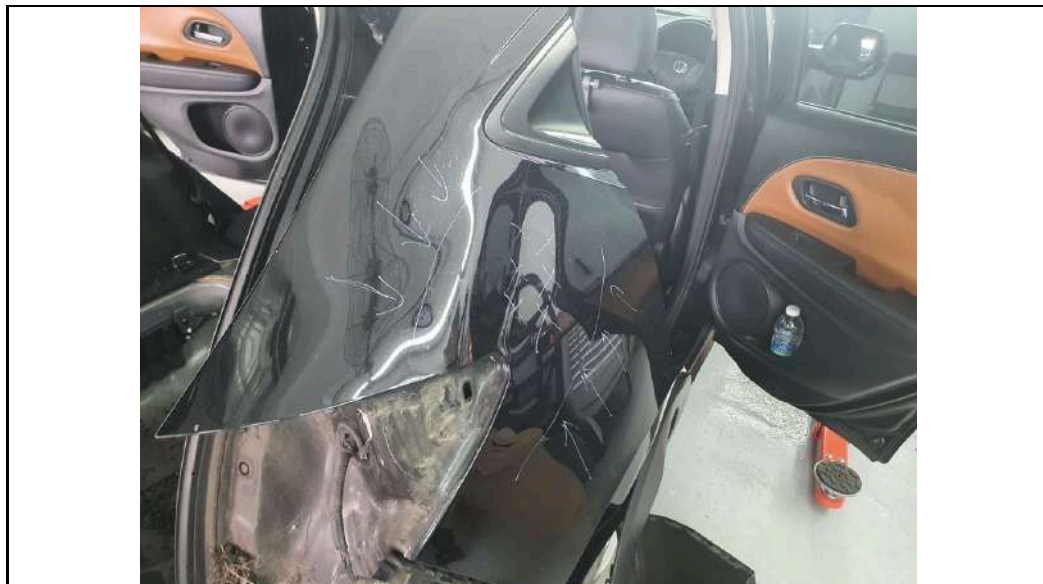

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

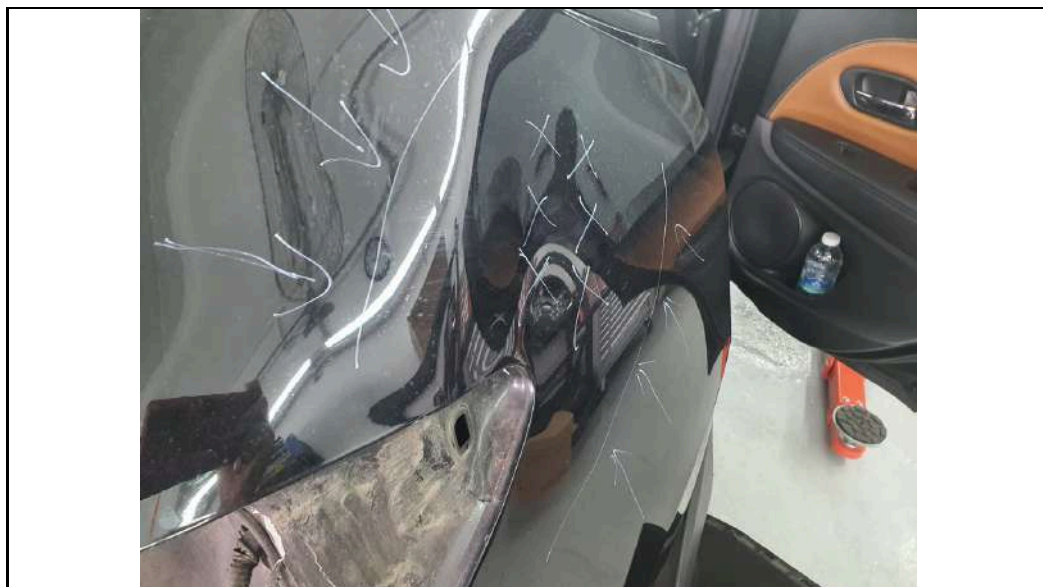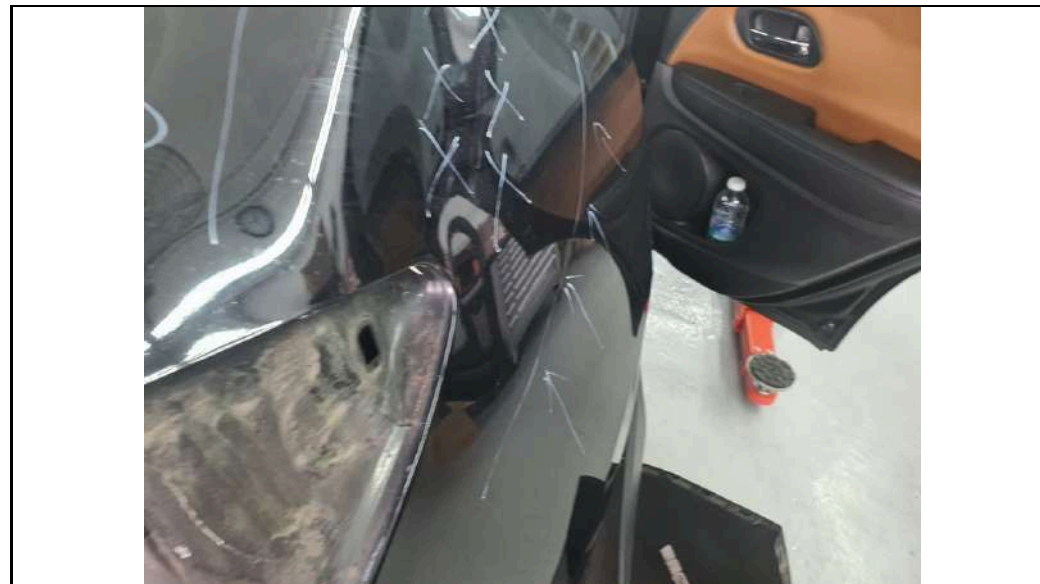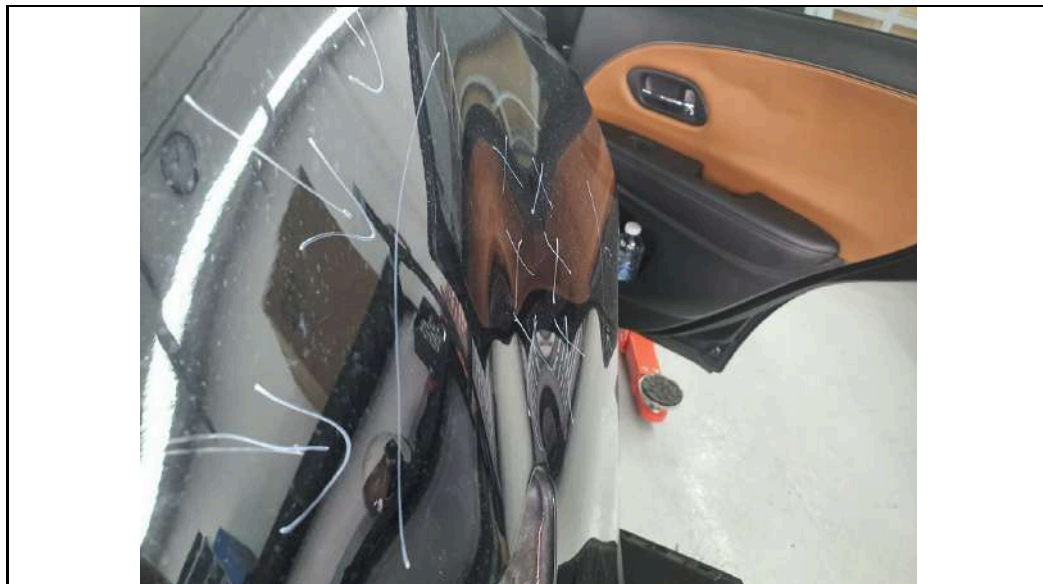

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 12 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L



PHOTOGRAPHS FOR VEHICLE NO. : SKT 8150L

