

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
Blk 2 Rivervale Link, #09-02 Singapore 545040
Mobile: 9007 5234
Email: constant_as@yahoo.com.sg
RCB No. 53138015K

Automobile Inspection Report

To: Autobahn Rent A Car Pte Ltd 459 Macpherson Road Shariot Building Singapore 368177	Date : 13/09/2024 Reference No : CAS/24-09/012																				
<u>General Information</u>																					
Registration No. : SMX 4410T Accident Date : 27/07/2024																					
<u>Particulars of Damaged Vehicle</u>																					
Colour : Black Engine Capacity : 1797 cc Mileage (KM) : 132794 Chassis No. : ZWR800449929 Registration Date : 13/01/2021	Make & Model : Toyota Noah Hybrid Pre-Accident Condition : Good Engine No. : 2ZR2H80600 Steering : In Order Brake : In Order																				
<u>Tyre Condition</u>																					
	<table><thead><tr><th></th><th>Size</th><th>Make</th><th>Balance</th></tr></thead><tbody><tr><td>R/H Front Tyre</td><td>225/45R17</td><td>GRENLANDER</td><td>80%</td></tr><tr><td>L/H Front Tyre</td><td>225/45R17</td><td>GRENLANDER</td><td>80%</td></tr><tr><td>R/H Rear Tyre</td><td>225/45R17</td><td>CONTINENTAL</td><td>90%</td></tr><tr><td>L/H Rear Tyre</td><td>225/45R17</td><td>CONTINENTAL</td><td>90%</td></tr></tbody></table>		Size	Make	Balance	R/H Front Tyre	225/45R17	GRENLANDER	80%	L/H Front Tyre	225/45R17	GRENLANDER	80%	R/H Rear Tyre	225/45R17	CONTINENTAL	90%	L/H Rear Tyre	225/45R17	CONTINENTAL	90%
	Size	Make	Balance																		
R/H Front Tyre	225/45R17	GRENLANDER	80%																		
L/H Front Tyre	225/45R17	GRENLANDER	80%																		
R/H Rear Tyre	225/45R17	CONTINENTAL	90%																		
L/H Rear Tyre	225/45R17	CONTINENTAL	90%																		
<u>Inspection</u>																					
Repairer : Autobahn Rent A Car Pte Ltd 459 Macpherson Road, Shariot Building, Singapore 368177																					
<u>Adjustment And Recommendation Cost Of Repair</u>																					
Repairer's Estimate : \$7,766.45 Revised Amount : \$4,900.00 Less Excess : - Nett Total : \$4,900.00																					
<u>Remarks</u>																					
(A) Survey was done on 06/08/2024 (B) Re-survey was done on 15/08/2024 (C) Re-survey after repair was done on 10/09/2024 (D) The survey was conducted entirely on WITHOUT PREJUDICE basis. (E) We have NOT given any instruction to authorize the repair of the vehicle.																					

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deem to be valid.

Constant Appraiser Services

Vehicle No : SMX 4410T

Our ref : CAS/24-09/012

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)	
		<u>PARTS REPLACEMENT – LIST ITEMS</u>				
1	1pc	Rear bumper	Grazed/Torn	1,927.80	1,927.80	1025 /
2	1pc	Rear bumper retainer RH	Twisted/Bent	141.50	141.50	/
3	1pc	Rear fender RH	Dented/Warped	1,899.30	1,899.30	/
				3,968.60	3,968.60	
		Less 25%		(992.15)	(992.15)	
			Sub total	2,976.45	2,976.45	
		<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS</u>				
1	1pc	Rear sport rim RH	Grazed/Warped	1,200.00	900.00	x nn
2	1pc	Rear tyre RH	Serviceable	400.00	-	
3	1pc	Rear bumper top chrome plate	Necessary	500.00	350.00	x nn
4	1set	Rear bumper clip	Necessary	50.00	45.00	30
			Part total	5,126.45	4,271.45	
		<u>LABOUR & MISC. CHARGES</u>				
1		Repair & replace damaged parts		1,000.00	750.00	/
2		Spray paint affected area		1,200.00	800.00	450
3		Diagnose & reset system after repair		360.00	250.00	30
4		Spray anti rust on affected area		80.00	30.00	/
			Grand total	7,766.45	6,101.45	
Recommended cost of lump sum repair (To its pre-accident condition)					4,900.00	

5 days

Constant Appraiser Services

Vehicle No : SMX 4410T

Our ref : CAS/24-09/012

Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of **\$4,900.00** on a contractual basis. Under normal circumstances, the repair period would be about **5 (Five)** working days.

Yours faithfully,

Constant Appraiser Services



Lim Yong Tian (Sebastian)
Licensed Appraiser
Adv. Dip. In Mechanical Engineering (AUS)
MSAAA

Constant Appraiser Services



Constant Appraiser Services



Constant Appraiser Services




Constant Appraiser Services



Constant Appraiser Services



Constant Appraiser Services

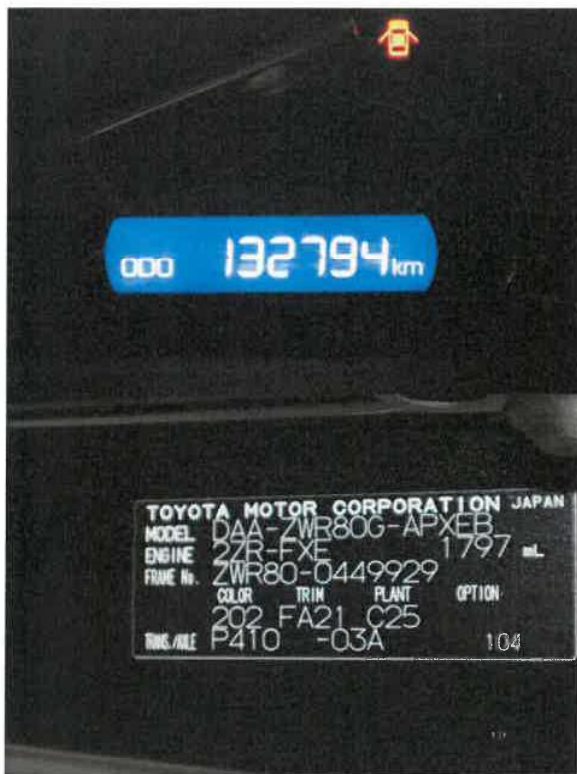

Constant Appraiser Services





Constant Appraiser Services



Constant Appraiser Services



Constant Appraiser Services

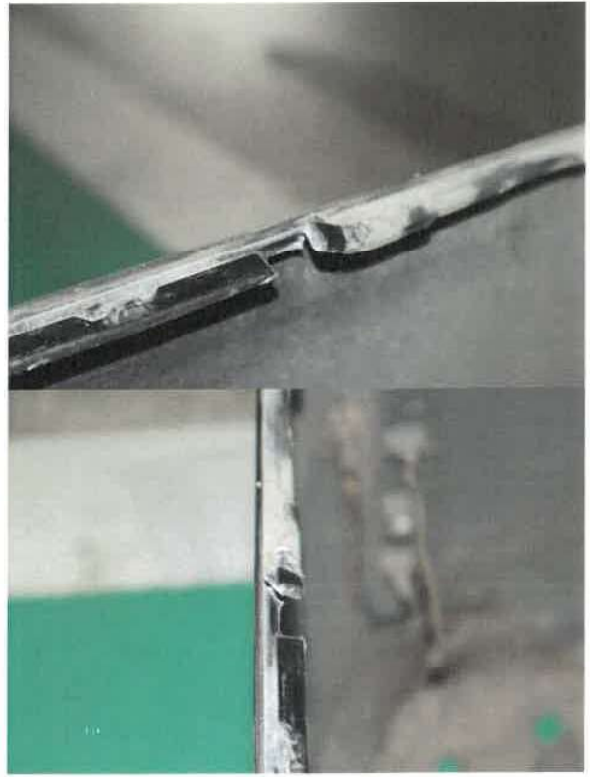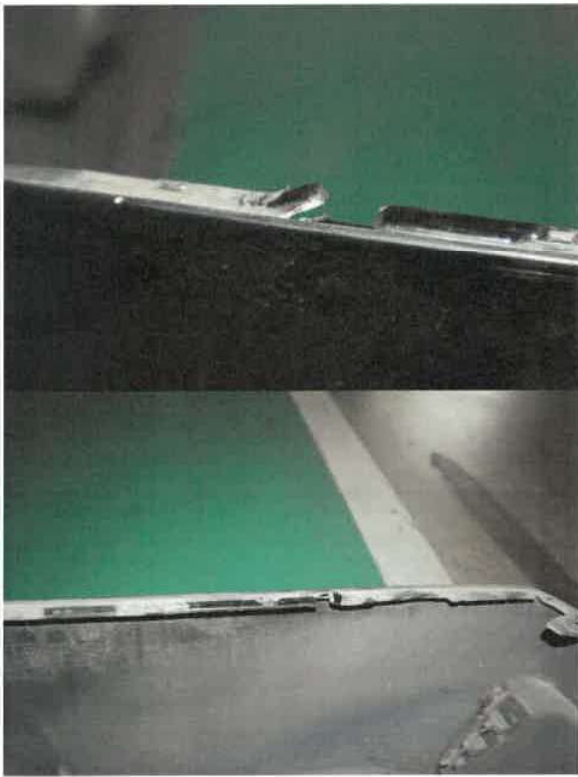

Constant Appraiser Services



Constant Appraiser Services

