



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555
ATTN: Eric Woo

INV No. AC2507970

INV Date 20/11/2025

Reference CD/LPC24110529/Apa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SNQ 5250G
Insured Veh. SKS 2785A
Claim No. 24/24/24/VP05/030240
Policy No. Z23VP05033088
Accident Date 26/11/2024
Inspection Date 26/11/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555 ATTN: Eric Woo			Ref: CD/LPC24110529/Apa3q2(N) Date: 20/11/2025 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SKS 2785A	Veh. Inspected	SNQ 5250G
	Policy No.	Z23VP05033088	Coverage (\$)	0.00
	Claim No.	24/24/24/VP05/030240	Excess (\$)	0.00
	Assign From	ERIC WOO	Assign Date	26/11/2024
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA SIENTA HYBRID	c.c	1490
	Engine No.	HIDDEN	Year of Reg.	2024
	Chassis No.	JTDBBBA300L001655	Colour	WHITE
	Odometer	57855 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	185/65 R15	TOYO	6 mm
	L/H Front Tyre	185/65 R15	TOYO	6 mm
	R/H Rear Tyre	185/65 R15	TRIANGLE	6 mm
	L/H Rear Tyre	185/65 R15	TRIANGLE	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	26/11/2024	Inspection Date	26/11/2024
	Survey held at	HHHB PTE LTD 2 KAKI BUKIT AVENUE 2, #02-11, KAKI BUKIT AUTOHUB, SINGAPORE 417921		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNQ 5250G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	488.00	488.00
1	REAR TAILGATE	DEFORMED	1,890.00	1,690.00
1	REAR TAILGATE GLASS MOULDING	NECESSARY	54.00	54.00
1	REAR TAILGATE LOGO	NOT NECESSARY	90.00	-
1	REAR TAILGATE "HYBRID" EMBLEM	NECESSARY	68.00	68.00
2	REAR TAILGATE HINGE RH/LH	NOT NECESSARY	176.00	-
1	REAR TAILGATE LOCK	DAMAGED	629.00	395.00
1	REAR END PANEL	DENTED	616.00	616.00
1	REAR END TOP GARNISH	CRACKED	199.00	199.00
2	REAR REVERSE SENSOR	DAMAGED (1 PCS ONLY)	1,006.00	280.00
4	REAR REVERSE SENSOR COVER	NECESSARY	260.00	200.00
	LESS 20% DISCOUNT		-1,095.20	-
	LESS 25% DISCOUNT		-	-997.50
			4,380.80	2,992.50
1	REAR TAILGATE WEATHERSTRIP (ADDITIONAL)	CUT	451.00	451.00
1	ELECTRICAL KEY ANTENNA (ADDITIONAL)	CRACKED	97.00	97.00
1	BATTERY CARRIER (ADDITIONAL)	BENT	80.00	80.00
1	TAILGATE HANDLE COVER (ADDITIONAL)	CRACKED	38.80	38.80
	LESS 25% DISCOUNT		-166.70	-166.70
			500.10	500.10
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	TAILGATE TRIM BOARD CLIPS (SN)	NOT NECESSARY	50.00	-
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	60.00	60.00
1	TAILGATE WINDSCREEN CLEANER (SN)	NECESSARY	40.00	30.00
1	TAILGATE WINDSCREEN SPONGE (SN)	NECESSARY	40.00	30.00
1	REAR END PANEL GARNISH CLIPS (SN)	NOT NECESSARY	50.00	-

Report Ref No. CD/LPC24110529/Apa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR END PANEL SEALANT (SN)	NECESSARY	60.00	60.00
1	BATTERY (SN) (ADDITIONAL)	DEFORMED	220.00	200.00
			570.00	410.00
	<u>LABOUR</u>			
	TO PUTTY AND SPRAY PAINTING.		600.00	400.00
	TO REMOVE, REFIX REVERSE SENSOR.		100.00	50.00
	TO REMOVE, REFIX REVERSE CAMERA.		100.00	50.00
	TO REMOVE, REFIX REAR WINDSCREEN GLASS.		120.00	120.00
	TO REMOVE, TRANSFER AND REFIX TAILGATE FITTINGS.		100.00	60.00
	TUFF COAT.		60.00	60.00
	LABOUR TO REMOVE REAR ACCIDENT DAMAGED PARTS IN ORDER TO REPAIR INCLUDING PANEL BEAT AND REPLACE ABOVE PARTS.		800.00	600.00
			1,880.00	1,340.00
GRAND TOTAL			7,330.90	5,242.60

RECOMMENDED COST OF REPAIRS				5,242.60
------------------------------------	--	--	--	-----------------

Report Ref No. CD/LPC24110529/Apa3q2(N)

Market Value: \$158,000.00(est) less LTA Rebate: \$94,104.00(est) = Nett Value :\$63,896.00(est)

ADRIAN LING WAI PING



B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G

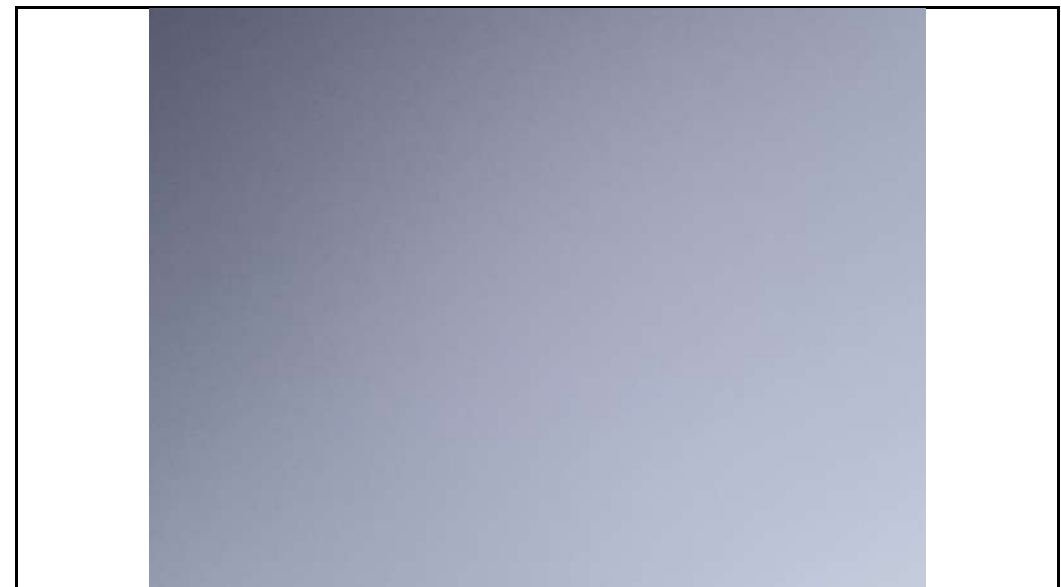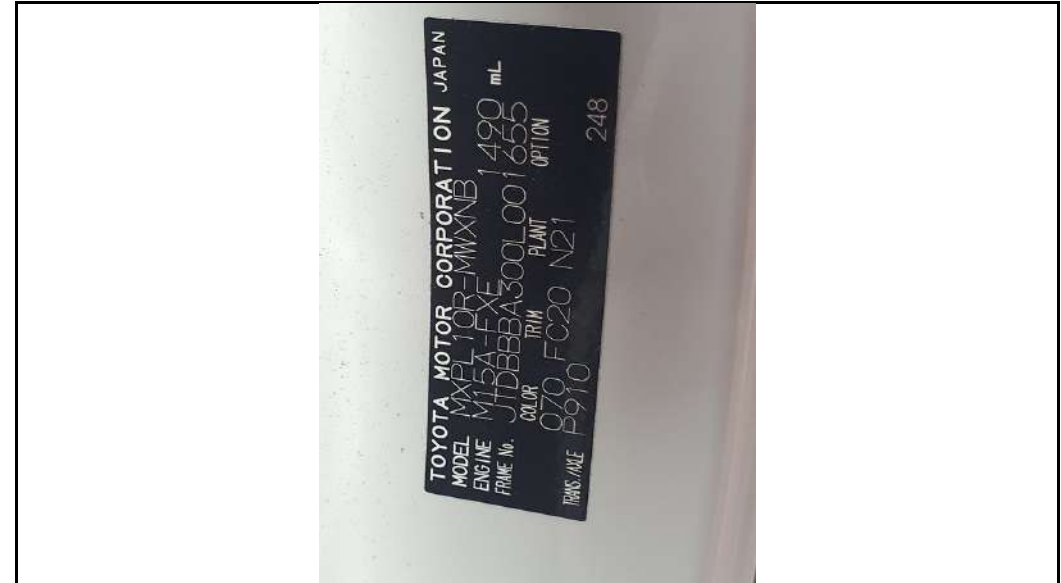

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 3 of 7)


PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G

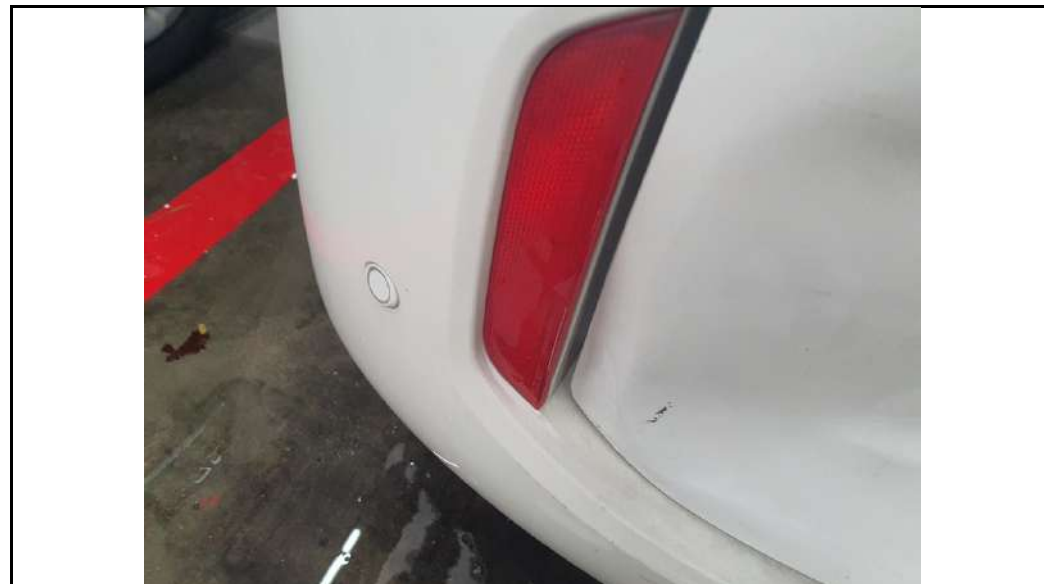

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 7 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 4)

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G




PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G

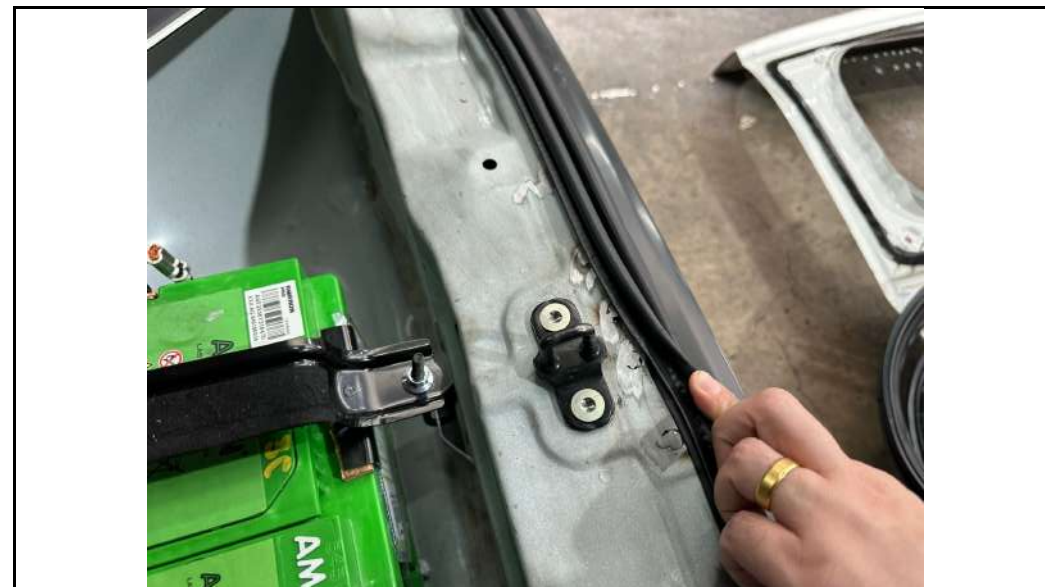

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 5250G

