

ASS. REC. BY: Taufikh

REF: CS/1CS24110561/T9P3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: 100 0/-

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

☒	☒
N/S	O/S
☐	☐

Bal. or Market Value: 4120K

IDAC Accident Report _____

Consistent? : Yes or No

GIA / PR Seent _____

Consistent? : Yes or No

Est. Repairs: _____

4

days

Res.: Yes or No

Lum Sumt _____

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____

Person Contacted: _____

Veh No: SMN1974E

Yr Regn: 209, 07

Type: Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: BMW X3

c.c. 1998

Colour: Grey

A/C: Insured / Std / NI / NA

S.p. Reading: 138881

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WBATR92030LE27/26

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: NI / SRM / STD A/Rim or

Tyre Size: F: 245/45R20

R: 245/45R20

BS DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. _____

Survey held at CYS

Des. of Damages Frt / Rear / O/S / N/S / U/G / Rooftop or

Rear

R/Bal. 6 mm

L/Bal. 6 mm

D.O.I. 27/11/24

The U/G / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Taufikh finalised LS \$11400, 4 days (Red \$16084.50, 59%)

Date/Time, File Pass to?

1) 12/02. Typist

Date/Time, File Return to?

2)

Report Format:

☐

: Prel. Report

☐

: Final Report

Days Of Repair: 4

Resurvey No. of Trip: 2

Add Fee:

☐

: Site Insp (\$

☐


: Interview (\$

Survey Fee:

Transportation:

\$ + RS \$

Photos

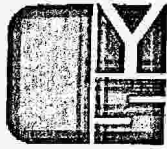

進友成汽車服務私人有限公司
CYS Automobile Services Pte Ltd

ROC Reg. No :A05041/2001E

GST Reg. NO: 20-0105041-E

INSURER:

ECICS Limited (HQ)

PARTICULARS OF CLAIM

Claim Type:	OD (Own Damage)	Ref. No:	OD 3975
Policy No:	MPC24P00285500	Date of Loss:	24/11/2024
Vehicle Reg. No.:	SMM1974E	Driveable?	
Driver Age/Info:	60 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	HARIZ MUHAMAD SYAHMI	Contact No:	+6598571287
Driver:	HARIZ MUHAMAD SYAHMI		
Make/Model:	BMW X3 XDRIVE30I, 2.0 LED NAV HUD MSPT (A)	Vehicle Reg. Date:	26/07/2019
Vehicle Colour:	Grey		
Engine No:	H3883309B48B20B	Chassis No:	WBATR92030LE27126
Odometer:	138881 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	12		

Description of Accident/Loss ON THE ABOVE-MENTIONED DATE & TIME, I WAS TRAVELLING ALONG
PAYA LEBAR FLYOVER EUNOS. VEHICLE B IN FRONT OF ME JAMMED BRAKE. I
COULDN'T BRAKE IN TIME AND COLLIDED ONTO VEHICLE B REAR PORTION.

Present Location: CYS AUTOMOBILE SERVICES PTE LTD (WOODLANDS)

COST OF CLAIMS	Amount
Parts	16,109.50
Miscellaneous Items	55.00
Labour	1,420.00
Paintwork Labour	0.00
Towing	0.00
Calculated Gross Total (S\$)	17,584.50
- Excess (S\$)	500.00
(S\$)	17,084.50
+ GST 9.00% (S\$)	1,537.61
Nett Amount (S\$)	18,622.11

This claim is handled by: TEE WEE SIN

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 26 Nov 2024)
 Parts: M1-SUV BMW X3 XDRIVE30I 2.0 LED NAV HUD MSPT (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: CYS Automobile Services Pte Ltd/SMM1974E/26/11/2024 14:12
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*BONNET	0.00	0.00	*2,200.00 F <i>bb</i>
2	1		*BONNET EMBLEM	0.00	0.00	*85.00 F <i>ae</i>
3	2		*BONNET LOCK	0.00	0.00	*260.00 F ?
4	1		*BONNET LOCK PASSIVE WITH SWITCH	0.00	0.00	*90.00 F <i>x</i>
5	1		*FRONT GRILLE BASE	0.00	0.00	*390.00 F ?
6	2		*FRONT GRILLE CHROME	0.00	0.00	*280.00 F <i>de</i>
7	1		*FRONT GRILLE AIR FLAP CONTROL	0.00	0.00	*120.00 F ?
8	1		*FRONT BUMPER	0.00	0.00	*1,800.00 F <i>de</i>
9	1		*FRONT BUMPER REINFORCEMENT UPPER	0.00	0.00	*980.00 F ?
10	1		*FRONT BUMPER REINFORCEMENT LOWER	0.00	0.00	*420.00 F ?
11	1		*FRONT BUMPER SPONGE	0.00	0.00	*90.00 F ?
12	2		*FRONT BUMPER FOG LAMP	<i>RHx</i> 0.00	0.00	*1,100.00 F <i>LH-?</i>
13	2		*FRONT BUMPER FOG LAMP GARNISH	<i>RHy</i> 0.00	0.00	*280.00 F <i>LH-?</i>
14	1		*FRONT BUMPER CENTRE GARNISH	0.00	0.00	*250.00 F <i>de</i>
15	1		*FRONT BUMPER NUMBER PLATE GARNISH	0.00	0.00	*110.00 F <i>de</i>
16	1		*FRONT BUMPER TOWING COVER	0.00	0.00	*60.00 F <i>mis</i>
17	1		*FRONT BUMPER CAMERA	0.00	0.00	*780.00 F ?
18	1		*FRONT BUMPER LOWER GRILLE	0.00	0.00	*190.00 F ?
19	<i>32</i>		*FRONT BUMPER PARKING SENSOR	0.00	0.00	*1,440.00 F ?
20	2		*FRONT BUMPER PARKING SENSOR BRACKET	0.00	0.00	*300.00 F <i>me</i>
21	1		*FRONT SUPPORT PANEL	0.00	0.00	*350.00 F ?
22	1		*FRONT SUPPORT PANEL TOP GARNISH	0.00	0.00	*280.00 F <i>me</i>
23	1		*AIR-CON CONDENSER	0.00	0.00	*1,190.00 F ?
24	1		*RADIATOR 1	0.00	0.00	*850.00 F ?
25	1		*RADIATOR 2	0.00	0.00	*750.00 F ?

F=Franchise part.

Sub Total (\$\$) 14,645.00
 + Margin on L,N Items 10.00% (\$\$) 1,464.50

Total Parts (\$\$) 16,109.50

CYS Automobile Services Pte Ltd/SMM1974E/26/11/2024 14:12. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
<u>Miscellaneous Items</u>			20.00 <i>key</i>
1	4	FRONT BUMPER CLIPS	35.00 <i>bt</i>
2	1	FRONT NUMBER PLATE	
Sub Total (S\$)			55.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Labour Items</u>			
1	TO DISMANTLE AND REFIX FRONT PARKING SENSOR & CHECK WIRING FUNCTION	New	50.00 ✓
2	TO REMOVE AIR-CON CONDENSER, PIPE, DRIER & TOP-UP AIR-CON GAS	New	120.00 ?
3	LABOUR CHARGE FOR REMOVING, REFITTING AND REPAIRING OF AFFECTED ACCIDENT PARTS	New	650.00 <i>450</i>
4	TO PUTTY AND SPRAY PAINTING CHARGES	New	600.00 <i>500</i>
Gross Labour Cost (S\$)			1,420.00

CYS Automobile Services Pte Ltd/SMM1974E/26/11/2024 14:12. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

38 Woodlands Industrial Park East 1, #07-17, Admiralty Industrial Park, Singapore 757700
Tel: 6219 2098 (3 lines) Fax: 6219 2096 E-mail: cysauto@singnet.com.sg

- LKK Auto Consultants hence notify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Taufik 97495749

Not Authorise 27/11/24 240pm

Ex: to be advise

taufik@lkhawt.com

c/s Resurvey after repair

4 days

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 27 Nov 2024)

Parts: M1-SUV BMW X3 XDRIVE30I 2.0 LED NAV HUD MSPT (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: CYS Automobile Services Pte Ltd/SMM1974E/27/11/2024 14:44

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	2		*HEADLAMP ASY	0.00	0.00	*9,000.00 F
Sub Total (\$\$)						9,000.00
+ Margin on L,N Items 10.00% (\$\$)						900.00
Total Parts (\$\$)						9,900.00

CYS Automobile Services Pte Ltd/SMM1974E/27/11/2024 14:44. Not valid without Reference section.

Generated using Merimen e-Claims IEAS