



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2501937

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 01/04/2025
Reference CD/CTI24110572/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMC 9990M
Insured Veh. SNF 4418E
Claim No. SNM25D200181
Policy No. DMHCSNA00006782400
Accident Date 15/11/2024
Inspection Date 19/11/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24110572/Apa3q2(N)	
			Date: 01/04/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SNF 4418E	Veh. Inspected	SMC 9990M
	Policy No.	DMHCSNA00006782400	Coverage (\$)	0.00
	Claim No.	SNM25D200181	Excess (\$)	0.00
	Assign From		Assign Date	19/11/2024
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA ESTIMA	c.c	2362
	Engine No.	HIDDEN	Year of Reg.	2014
	Chassis No.	ACR507120881	Colour	SILVER
	Odometer	211001 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	235/50 R18	DUNLOP	6 mm
	L/H Front Tyre	235/50 R18	DUNLOP	6 mm
	R/H Rear Tyre	235/50 R18	DUNLOP	6 mm
	L/H Rear Tyre	235/50 R18	DUNLOP	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	15/11/2024	Inspection Date	19/11/2024
	Survey held at	JL PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMC 9990M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEFORMED	1,689.70	1,195.00
2	REAR BUMPER TOW HOOK COVER @\$25.70	N/S DEFORMED	51.40	25.70
2	REAR BUMPER REFLECTOR @\$89.00	N/S CRACKED	178.00	89.00
2	REAR BUMPER SIDE RETAINER (FRONT) @\$96.00	NOT NECESSARY	192.00	-
2	REAR BUMPER SIDE RETAINER (REAR) @\$75.00	N/S CRACKED	150.00	75.00
2	REAR BUMPER SIDE SPONGE @\$70.00	N/S CRACKED	140.00	70.00
1	TALGATE	NOT NECESSARY	1,854.70	-
1	TAIL GATE LOGO	NOT NECESSARY	75.00	-
1	TAILGATE EMBLEM ESTIMA	NOT NECESSARY	67.20	-
1	TAILGATE EMBLEM AERAS	NOT NECESSARY	64.50	-
2	TAILGATE SIDE STOPPER @\$50.00	NOT NECESSARY	100.00	-
2	TAILGATE STOPPER @\$21.00	NOT NECESSARY	42.00	-
1	TAILGATE BUZZER	NOT NECESSARY	162.30	-
1	TAILGATE TOP LOCK	NOT NECESSARY	768.00	-
1	TAILGATE LOWER LOCK	NOT NECESSARY	35.00	-
1	TAILGATE DETECTOR	NOT NECESSARY	385.00	-
1	TAILGATE DETECTOR WIRE HARNESS	NOT NECESSARY	968.60	-
1	TAILGATE INNER TRIM	NOT NECESSARY	560.00	-
1	TAILGATE WEATHERSTRIP	NOT NECESSARY	360.00	-
1	SET TAILGATE WINDSCREEN MOULDING	NOT NECESSARY	160.00	-
1	REAR FENDER LH	DENTED	1,185.30	1,185.30
2	REAR FENDER INNER TRIM @\$1370.20	NOT NECESSARY	2,740.40	-
1	REAR FENDER INNER TRIM TOOLS COVER	NOT NECESSARY	134.00	-
1	REAR FENDER GLASS C/W MOULDING LH	NOT NECESSARY	583.20	-
2	REAR FENDER COWLING @\$110.00	NOT NECESSARY	220.00	-
1	REAR END PANEL	DENTED	695.00	695.00
1	REAR END PANEL TOP GARNISH	DEFORMED	280.00	280.00
1	REAR END PANEL LOWER GARNISH	DEFORMED	194.20	194.20
	LESS 25% DISCOUNT		-3,508.88	-952.30
			10,526.62	2,856.90

Report Ref No. CD/CTI24110572/Apa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	TAILGATE SEALANT (SN)	NOT NECESSARY	150.00	-
1	SET TAILGATE OUTER MOULDING CLIP (SN)	NOT NECESSARY	30.00	-
1	SET TAILGATE INNER TRIM CLIP (SN)	NOT NECESSARY	50.00	-
1	TAILGATE WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	TAILGATE WINDSCREEN INNER SEAL (SN)	NOT NECESSARY	60.00	-
1	SET TAIL LAMP CLIP (SN)	NOT NECESSARY	40.00	-
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	30.00	20.00
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	60.00
1	SET REAR END PANEL LOWER GARNISH CLIP (SN)	NECESSARY	50.00	20.00
1	SET REAR FLOOR PANEL MAT CLIP (SN)	NOT NECESSARY	50.00	-
2	SET REVERSE SENSOR (2 PCS) (SN)	NOT NECESSARY	480.00	-
			1,300.00	130.00
	<u>LABOUR</u>			
	PANEL BEATING ,REMOVAL AND REPLACING PARTS.		1,800.00	1,200.00
	TO SPRAY PAINT AFFECTED AREA.		1,600.00	600.00
	TUFF COAT.		250.00	60.00
	REMOVE AND REFIX CUSHION SEAT/ UPHOLSTERY AND ROOF LINING TO FACILITATE REPAIR .		350.00	60.00
	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING.	NOT NECESSARY	80.00	-
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		80.00	50.00
	REMOVE AND REFIX TAILGATE AUTO SYSTEM.	NOT NECESSARY	250.00	-
	REMOVE AND REFIX TAILGATE WINDSCREEN.	NOT NECESSARY	120.00	-
	TRANFER TAILGATE MECHANISM .	NOT NECESSARY	80.00	-
	REMOVE AND REFIX FUEL TANK.	NOT NECESSARY	80.00	-
	REMOVE AND REFIX FENDER GLASS LH .		150.00	60.00
	CONDUCT WATER LEAKAGE TEST .	NOT NECESSARY	100.00	-

Report Ref No. CD/CTI24110572/Apa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	180.00	-
			5,120.00	2,030.00
GRAND TOTAL			16,946.62	5,016.90
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,000.00

Report Ref No. CD/CTI24110572/Apa3q2(N)

ADRIAN LING WAI PING


B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M

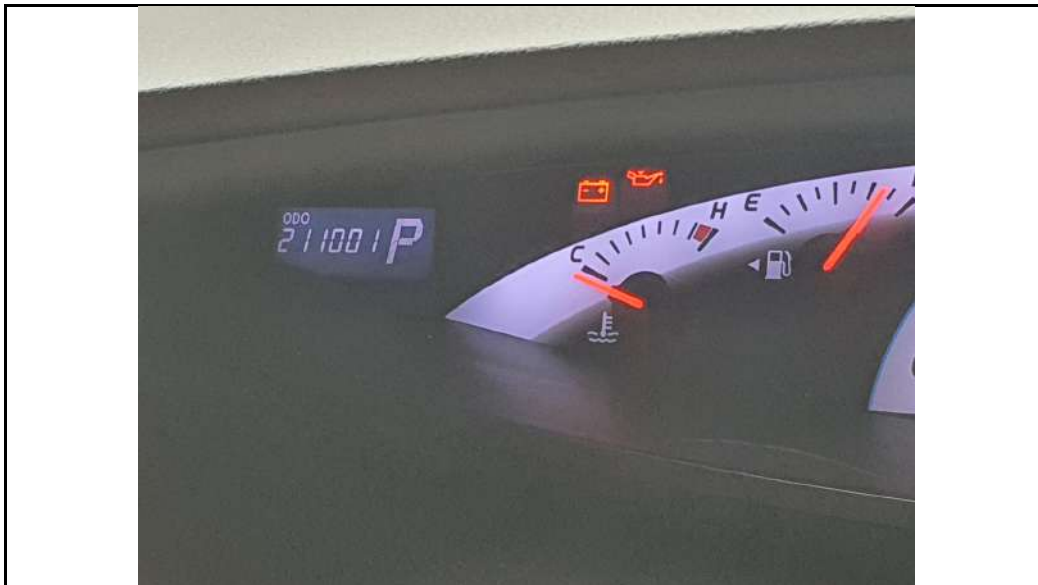

PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M



PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M



PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M



PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M




PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M



PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M



PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M

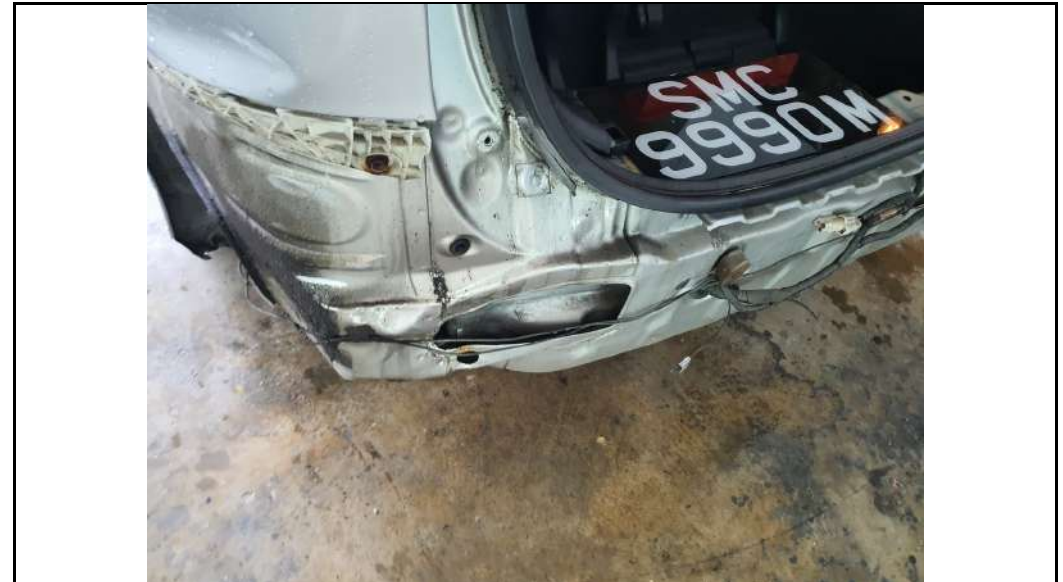

PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M



PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M



PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M



PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 9 of 9)

PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M



PHOTOGRAPHS FOR VEHICLE NO. : SMC 9990M

