



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2504619

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 18/07/2025
Reference CD/CTI24120079/Aua3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SKV 6778D
Insured Veh. GBG 7787G
Claim No. SNM24D206777
Policy No. DMCVSNW00059522404
Accident Date 01/12/2024
Inspection Date 03/12/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24120079/Aua3q2(N)	
			Date: 18/07/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBG 7787G	Veh. Inspected	SKV 6778D
	Policy No.	DMCVSNW00059522404	Coverage (\$)	0.00
	Claim No.	SNM24D206777	Excess (\$)	0.00
	Assign From		Assign Date	03/12/2024
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA WISH	c.c	1797
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	ZGE206024820	Colour	BRONZE
	Odometer	333343 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	NEXEN	6 mm
	L/H Front Tyre	195/65 R15	NEXEN	6 mm
	R/H Rear Tyre	195/65 R15	NEXEN	6 mm
	L/H Rear Tyre	195/65 R15	NEXEN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	01/12/2024	Inspection Date	03/12/2024
	Survey held at	J-MART MOTOR PTE LTD BLK 5 DEFU LANE 10 #01-578 DEFU INDUSTRIAL PARK C SINGAPORE 539186		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		14 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKV 6778D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	DISTORTED	1,515.00	1,515.00
1	TAILGATE OUTER CHROME	CRACKED	236.10	236.10
1	LOGO EMBLEM	NECESSARY	72.20	72.20
1	VALVE MATIC EMBLEM	NECESSARY	88.50	88.50
2	TAILGATE REFLECTOR	CRACKED	735.60	735.60
1	TAILGATE LOCK	JAMMED	360.00	360.00
1	TAILGATE W/STRIP	CUT	290.00	290.00
2	TAILGATE HINGES	NOT NECESSARY	136.20	-
1	TAILGATE TRIMBOARD	DEFORMED	508.10	508.10
1	TAILGATE INSULATOR	NOT NECESSARY	300.10	-
2	REAR NO PLATE LAMP	NOT NECESSARY	138.20	-
1	WIPER MOTOR	NOT NECESSARY	368.90	-
2	TAILLAMP	CRACKED	849.40	849.40
1	REAR BUMPER	DISTORTED	798.10	798.10
2	REAR BUMPER RETAINER SHORT	DAMAGED	110.00	110.00
2	REAR BUMPER RETAINER LONG	NOT NECESSARY	120.00	-
2	REAR BUMPER BRACKET	DISTORTED	110.00	110.00
4	REAR BUMPER CLIPS	NECESSARY	20.00	20.00
2	REAR FENDERS	BUCKLED	3,120.00	3,120.00
2	REAR FENDER AIR DUCT	DEFORMED	158.00	158.00
1	END PANEL OUTER	DISTORTED	640.80	640.80
1	END PANEL INNER	DISTORTED	980.60	780.00
1	END PANLE INNER GARNISH	DISTORTED	236.10	236.10
1	KEY LOCK SENSOR	CRACKED	136.20	136.20
1	SPARE TYRE PANEL	DISTORTED	780.10	780.10
1	SPARE TYRE CARDBOARD	DEFORMED	290.10	290.10
1	REAR CHASSIS MEMBER	DISTORTED	1,460.00	750.00
2	REAR FENDER INNER TRIM	DISTORTED	1,530.00	1,530.00
1	EXHAUST PIPE	BENT	867.50	867.50
1	EXHAUST HEAT SHIELD	CRUMPLED	76.80	76.80
1	SPARE TYRE TRAY	MISSING	237.60	237.60

Report Ref No. CD/CTI24120079/Aua3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-4,317.55	-3,824.05
			12,952.65	11,472.15
	<u>SPECIAL NETT ITEMS</u>			
1	REAR W/SCREEN GUM (SN)	NECESSARY	50.00	50.00
1	REAR W/SCREEN SEAL (SN)	NECESSARY	30.00	30.00
1	REVERSE SENSOR (SN)	DAMAGED	250.00	200.00
1	SPARE TYRE (SN)	NOT NECESSARY	300.00	-
1	REAR NO PLATE (SN)	BENT	40.00	40.00
			670.00	320.00
	<u>LABOUR</u>			
	TOWING.		120.00	60.00
	PANEL BEATING.		3,000.00	2,000.00
	SPRAY PAINTING.		3,000.00	1,400.00
	WIRING.		30.00	30.00
	REMOVE & REFIT REAR W/SCREEN.		120.00	120.00
	REMOVE & REFIX EXHAUST PIPE.		80.00	80.00
	RUST RPOOFING.		80.00	80.00
	UPHOLSTERY.		120.00	100.00
			6,550.00	3,870.00
GRAND TOTAL			20,172.65	15,662.15
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				9,000.00

Report Ref No. CD/CTI24120079/Aua3q2(N)

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 1 of 14)


PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D

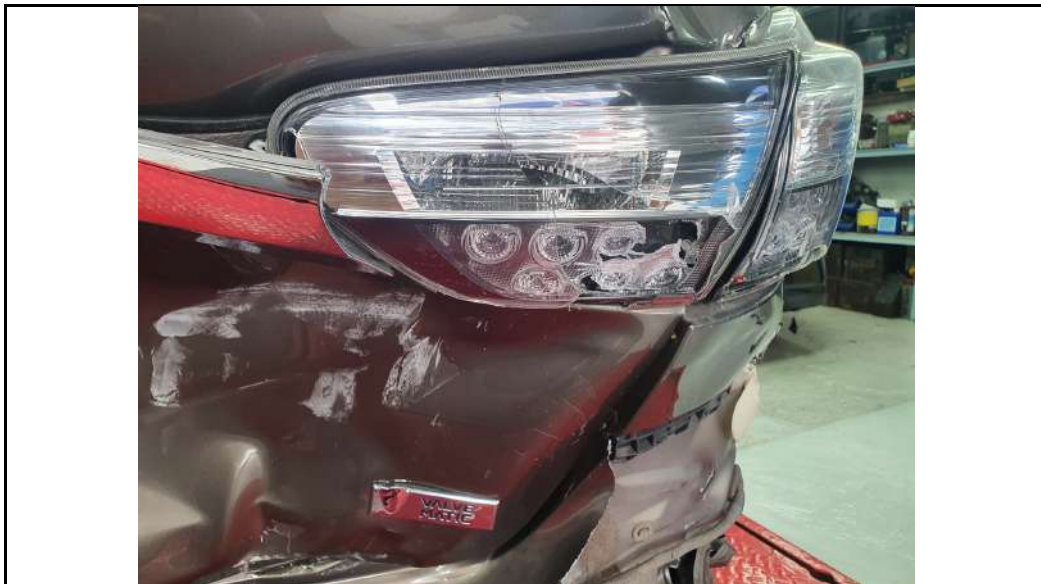

PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D




PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D

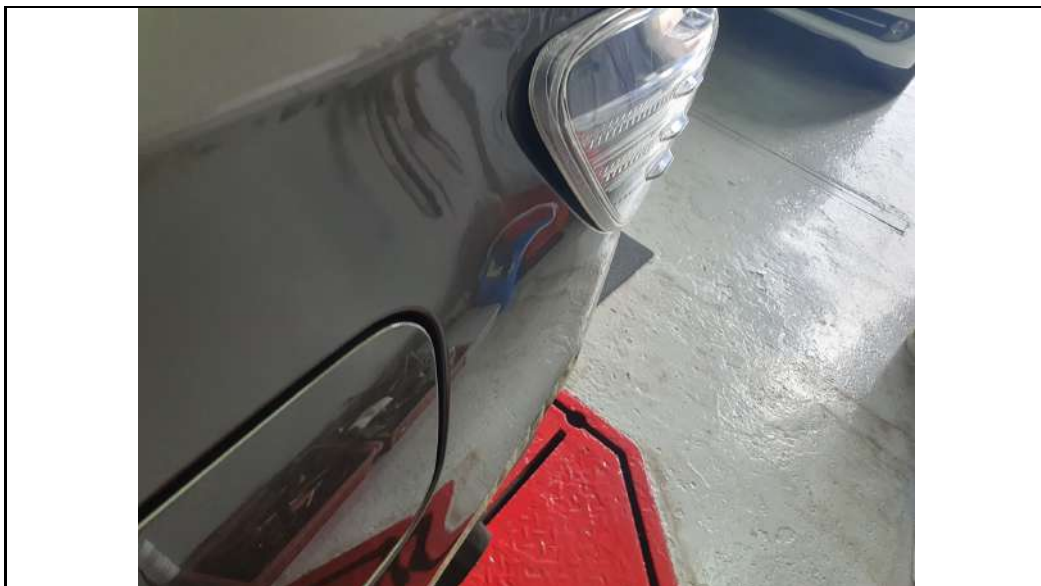

PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D



PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

PHOTOGRAPHS FOR VEHICLE NO. : SKV 6778D

