



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2502997

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 15/05/2025
Reference CD/CTI24120166/Aua3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMX 1308B
Insured Veh. EG 5566E
Claim No. SNM24D206778
Policy No. DMPCSNW00048642400
Accident Date 30/11/2024
Inspection Date 02/12/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24120166/Aua3q2(N)	
			Date: 15/05/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	EG 5566E	Veh. Inspected	SMX 1308B
	Policy No.	DMPCSNW00048642400	Coverage (\$)	0.00
	Claim No.	SNM24D206778	Excess (\$)	0.00
	Assign From		Assign Date	02/12/2024
2. Vehicle Particulars & Condition				
	Make & Model	B.M.W. 216D	c.c	1496
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	WBA2B32000V259881	Colour	BLUE
	Odometer	155897 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	225/45 R18	YOKOHAMA	6 mm
	L/H Front Tyre	225/45 R18	YOKOHAMA	6 mm
	R/H Rear Tyre	225/45 R18	YOKOHAMA	6 mm
	L/H Rear Tyre	225/45 R18	YOKOHAMA	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	30/11/2024	Inspection Date	02/12/2024
	Survey held at	HD PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMX 1308B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEFORMED	1,372.00	1,372.00
2	REAR BUMPER SENSOR @\$341.00	DAMAGED	682.00	682.00
4	REAR BUMPER SENSOR HOLDER @\$46.00	NECESSARY (2 PCS ONLY)	184.00	50.00
1	REAR BUMPER SENSOR WIRE HARNESS	NOT NECESSARY	422.00	-
1	REAR BUMPER TOWING COVER	NOT NECESSARY	40.00	-
1	REAR BUMPER TAILGATE DETECTOR	NOT NECESSARY	472.00	-
2	REAR BUMPER SMART OPEN SENSOR GARNISH BRACKET @\$45.00	NOT NECESSARY	90.00	-
1	REAR BUMPER SMART OPEN SENSOR GARNISH	CRACKED	164.00	164.00
1	REAR BUMPER SMART SENSOR MODULE	CRACKED	485.60	485.60
2	REAR BUMPER SIDE BRACKET (PLASTIC) @\$177.00	NOT NECESSARY	354.00	-
2	REAR BUMPER CENTER BEAM (UPPER) @\$159.00	CRACKED	318.00	318.00
1	REAR BUMPER REINFORCEMENT	DENTED	513.00	513.00
2	REAR FENDER INNER COWLING @\$189.00	NOT NECESSARY	378.00	-
2	REAR FENDER INNER TRIM @\$487.00	NOT NECESSARY	974.00	-
2	TAIL LAMP @\$598.00	NOT NECESSARY	1,196.00	-
2	TAIL LAMP SIDE COVER GARNISH @\$168.20	NOT NECESSARY	336.40	-
1	TAILGATE	DENTED	1,266.00	1,266.00
1	TAILGATE LOGO	NECESSARY	75.00	75.00
1	TAILGATE EMBLEM M	NECESSARY	114.00	114.00
2	TAILGATE LAMP @\$472.00	NOT NECESSARY	944.00	-
1	TAILGATE SMART OPEN SENSOR	NOT NECESSARY	185.00	-
2	TAILGATE DAMPER (ELECTRIC) @\$334.00	NOT NECESSARY	668.00	-
1	TAILGATE INNER LOCK COVER SPONGE	NOT NECESSARY	76.00	-
1	TAILGATE INNER LOCK	DAMAGED	343.00	343.00
1	TAILGATE INNER LOCK MOTOR	NOT NECESSARY	595.00	-
1	TAILGATE LOCK CATCH	NOT NECESSARY	55.00	-
1	TAILGATE WEATHERSTRIP	CUT	188.00	188.00
1	TAILGATE INNER BOARD	NOT NECESSARY	298.00	-
1	TAILGATE WINDSCREEN MOULDING	NECESSARY	210.00	210.00

Report Ref No. CD/CTI24120166/Aua3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR END PANEL	DENTED	747.00	747.00
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	146.00	-
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	714.00	-
1	REAR EXHAUST PIPE WITH MUFFLER	NOT NECESSARY	1,741.00	-
6	REAR EXHAUST MOUNTING @\$38.00	NOT NECESSARY	228.00	-
2	REAR EXHAUST PIPE MOUNTING BRACKET @\$114.00	NOT NECESSARY	228.00	-
1	REAR EXHAUST MUFFLER INSULATOR (REAR)	NOT NECESSARY	112.00	-
1	REAR EXHAUST MUFFLER INSULATOR (CENTER)	NOT NECESSARY	133.00	-
1	REAR EXHAUST CHROME PIPE	NOT NECESSARY	149.00	-
	LESS 5% DISCOUNT		-859.80	-326.38
			16,336.20	6,201.22
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	80.00	30.00
1	TAILGATE SEALANT (SN)	NOT NECESSARY	150.00	-
1	SET TAILGATE INNER BOARD CLIP (SN)	NOT NECESSARY	80.00	-
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	TAILGATE WINDSCREEN INNER SHIELD (SN)	NECESSARY	60.00	30.00
1	SET REAR FENDER INNER COWLING CLIP (SN)	NOT NECESSARY	60.00	-
1	SET REAR FENDER INNER TRIM CLIP (SN)	NOT NECESSARY	60.00	-
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	60.00
1	REAR END PANEL TOP GARNISH CLIP (SN)	NOT NECESSARY	80.00	-
			850.00	160.00
	<u>LABOUR</u>			
	TO PANEL BEAT ,REMOVE AND REPLACE PARTS .		1,800.00	800.00
	TO SPRAY PAINT AFFECTED AREA.		1,600.00	700.00
	TUFF COAT.		250.00	60.00
	WIRING AND BULB CHECK.		250.00	30.00
	REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR .		350.00	60.00
	REMOVE AND REFIX TAILGATE WINDSCREEN.		120.00	120.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		150.00	50.00

Report Ref No. CD/CTI24120166/Aua3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING.		100.00	50.00
	REMOVE AND REFIX VIDEO RECORDER .		100.00	50.00
	RESET SMART OPENER .	NOT NECESSARY	350.00	-
	TRANSFER TAILGATE MECHANISM .		80.00	60.00
	REMOVE AND REFIX TAILGATE AUTO SYSTEM.		300.00	120.00
	CONDUCT WATER LEAKAGE TEST .	NOT NECESSARY	120.00	-
	REMOVE AND REFIX REAR EXHAUST PIPE .	NOT NECESSARY	180.00	-
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	680.00	-
			6,430.00	2,100.00
GRAND TOTAL			23,616.20	8,461.22

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,750.00
---	--	--	-----------------

Report Ref No. CD/CTI24120166/Aua3q2(N)

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 2 of 10)

PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B

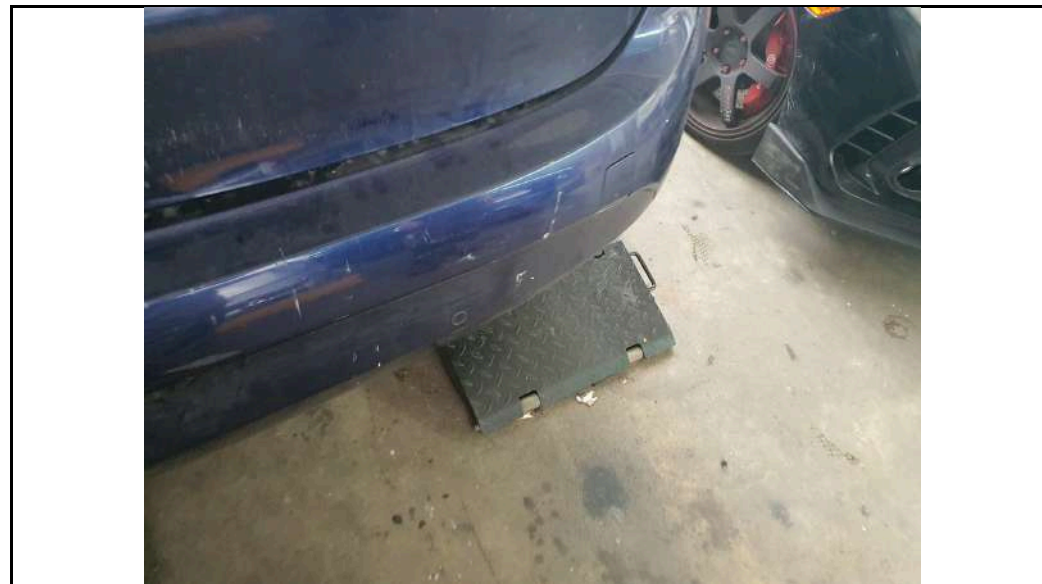

PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B




PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B

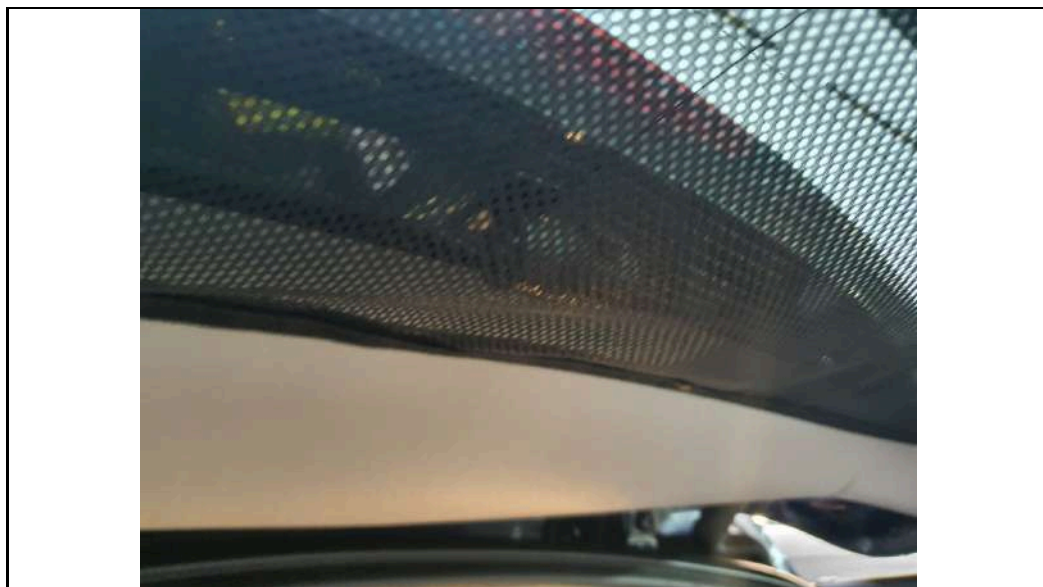



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 10 of 10)

PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B




PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B

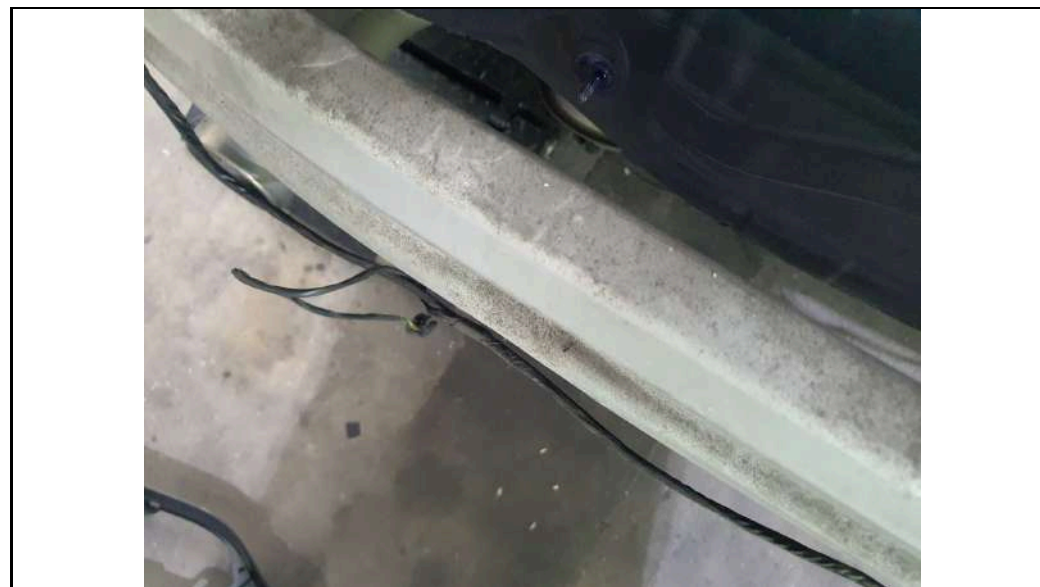

PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B



PHOTOGRAPHS FOR VEHICLE NO. : SMX 1308B

