

**40 TOH GUAN ROAD EAST,  
#01-65 ENTERPRISE HUB,  
SINGAPORE 608582**

Our Reference:	3008/SKZ8727S
Date:	30-Jul-2024
Vehicle Num:	SKZ 8727 S
Make/Model:	PEUGEOT 3008 1.6 E-HDI ETG ACTIVE SUV
Chassis No.:	VF30U9HD8FS196758
Engine No.:	10JBFT0099660
Accident Date:	26-Jun-2024

[illegible]



## INVOICE

TO : AHAMAD FAREED BIN NOORUL AMEEN  
C/O: TRUST FELLAS AUTO SERVICE PTE LTD  
40 TOH GUAN ROAD EAST,  
#01-65 ENTERPRISE HUB,  
SINGAPORE 608582

Invoice No.: 0724/TF1258  
Date: 30-Jul-2024

### PARTICULARS

Vehicle Registration No.: SKZ 8727 S  
Date of Loss: 26-Jun-2024  
Date of Assessment: 01-Jul-2024

### SERVICES

### FEES

1. Assessment with report Photographs -  
Including developing photos, storage and Transport. \$600.00

**TOTAL** \$600.00

**SINGAPORE DOLLARS SIX HUNDRED ONLY**

We would appreciate your cheque crossed and made payable to:  
"AEON AUTO CONSULTANTS LLP" with our invoice no. written on the back of the cheque.

**AEON AUTO CONSULTANTS LLP**



### AEON AUTO CONSULTANTS LLP

50 Chin Swee Road #09-04 Thong Chai Building Singapore 169874  
Tel: +65 97687958 Fax +65 68264112 Email amas@aeonac.com.sg/amasopm@gmail.com  
Reg. No. T07LL1273E (registered with limited liability)

## AUTOMOBILE ASSESSMENT REPORT

TO: AHAMAD FAREED BIN NOORUL AMEEN  
C/O: TRUST FELLAS AUTO SERVICE PTE LTD  
40 TOH GUAN ROAD EAST,  
#01-65 ENTERPRISE HUB,  
SINGAPORE 608582

Our Reference: 0724/TF1258  
Date: 30-Jul-2024

### ASSESSMENT OF VEHICLE NO. SKZ 8727 S

DATE OF LOSS: 26-Jun-2024

We have carried out a physical assessment at **TRUST FELLAS AUTO SERVICE PTE LTD**,  
40 Toh Guan Road East, #01-65 Enterprise Hub, Singapore 608582, according to your instruction  
on **01-Jul-2024** and are pleased to submit our report herewith.

### 1. VEHICLE PARTICULARS

Registration No.: SKZ 8727 S  
Make & Model: PEUGEOT 3008 1.6 E-HDI ETG ACTIVE SUV  
Year of Registration: 2016  
Engine Capacity: 1560  
Chassis No.: VF30U9HD8FS196758  
Engine No.: 10JBFT0099660  
Colour: RED  
Mileage (km): 126908

### 2. VEHICLE CONDITION

Body Paint: GOOD  
Steering: SERVICEABLE  
Foot Brake: SERVICEABLE  
Parking Brake: SERVICEABLE  
Modification: NIL

### 3. TYRE PARTICULARS & CONDITION

Front  
RH Make/Size/Thread: MICHELIN 225/50 R17 – 70%  
LH Make/Size/Thread: MICHELIN 225/50 R17 – 70%


Rear  
RH Make/Size/Thread: MICHELIN 225/50 R17 – 70%  
LH Make/Size/Thread: MICHELIN 225/50 R17 – 70%

#### 4. DESCRIPTION OF DAMAGE

At the time of the inspection, the vehicle sustained damages to the REAR portion.

#### 5. REMARKS

Market Value:	Na
Salvage Value:	Na
Repair Limit:	Na
Estimated Amount:	\$13,339.77
Adjusted Amount:	\$9,189.37
Lump Sum:	<b>\$7,300.00</b>
Estimated Repair Days:	7 days

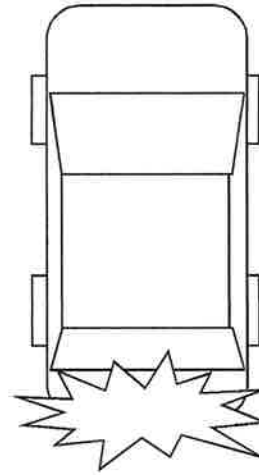

Pursuant to your instruction, we have **NOT AUTHORISED** repair.  
The assessment was conducted on a **"Without Prejudice"** basis.  
If we are not notified of anything to the contrary within **14 days** from the date hereof, this report shall be treated as correct.

#### Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by Aeon Auto Consultants LLP for any reliance on this report by any third party.

**ASSESSMENT REPORT FOR VEHICLE NO. SKZ 8727 S**

**PARTS (LIST ITEMS)**

Qty	Description	Condition	Workshop's Estimate	Our Assessment
1	REAR TAILGATE	Repair	1,982.20	-
1	REAR TAILGATE MECHANISM LOCK	Bent	221.30	221.30
1	REAR TAILGATE WEATHER STRIP	Repair	274.10	-
1	REAR RH TAILLAMP	Cracked	625.20	625.20
1	REAR RH TAILLAMP BACK RUBBER GASKET	Necessary	88.60	88.60
1	REAR RH TAILLAMP LOWER BRACKET	Bent	186.40	186.40
1	REAR BUMPER	Cracked	1,752.40	1,752.40
2	REAR BUMPER SIDE RETAINER L/R	Bent	422.90	422.90
2	REAR BUMPER SIDE BRACKET L/R	Bent	284.20	284.20
1	REAR BUMPER INNER FRAME BRACKET	Bent	282.10	282.10
4	REAR BUMPER REVERSE SENSOR	Faulty	1,120.90	1,120.90
4	REAR BUMPER REVERSE SENSOR 'O' RING	Necessary	32.40	32.40
4	REAR BUMPER REVERSE SENSOR HOLDER BRACKET	Bent	142.40	142.40
1	REAR BUMPER REVERSE SENSOR WIRE HARNESS	Repair	387.00	-
2	REAR BUMPER REFLECTOR LAMP L/R	Cracked	388.00	388.00
1	REAR BUMPER REINFORCEMENT	Bent	692.20	692.20
1	REAR BUMPER LOWER DIFFUSER	Cracked	382.30	382.30
1	REAR END PANEL INNER TOP GARNISH	Cut	388.80	388.80
1	REAR END PANEL ANTENNA SENSOR	Faulty	289.20	289.20
1	REAR END PANEL	Repair	1,512.70	-

Less 10% discount  
Parts Total:

11,455.30	7,299.30
1,145.53	729.93
10,309.77	6,569.37

### ASSESSMENT REPORT FOR VEHICLE NO. SKZ 8727 S

#### SPECIAL NETT ITEMS

1	REAR BUMPER CLIPS - SET	Necessary	30.00	30.00
1	REAR END PANEL INNER TOP GARNISH CLIPS - SET	Necessary	30.00	30.00
Special Nett Total :			60.00	60.00

#### LABOUR

S/N	Description	Workshop's Estimate	Our Assessment
1	To remove, reinstall electrical wiring harness, check lighting, and rewire for parking sensor.	120.00	100.00
2	To remove, reinstall top trim, trim garnish, trim liner.	100.00	80.00
3	To reset system after repair works.	250.00	200.00
4	To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	1,000.00	900.00
5	To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.	1,400.00	1,200.00
6	To apply anti-rust chemical on repaired and replaced panel.	100.00	80.00
Labour Total :		2,970.00	2,560.00
<b>TOTAL (PARTS &amp; LABOUR) \$</b>		<b>13,339.77</b>	<b>9,189.37</b>

The workshop has agreed to undertake the repair on a Lump Sum basis.

The final adjusted Lump Sum contract amount is

**\$7,300.00**

**(SINGAPORE DOLLARS SEVEN THOUSAND THREE HUNDRED ONLY)**



Amas Ong  
Automobile Assessor































