



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2507305

16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING
SINGAPORE 048581
ATTN: ZENA LIM

INV Date 27/10/2025
Reference CD/FCI24120324/Ama3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SNQ 2915S
Insured Veh. SHD 6516Z
Claim No. D24011046MFCT/CTPL/TPD 2
Policy No. D-24101861MFCT
Accident Date 16/12/2024
Inspection Date 18/12/2024

Description	Total
Third Party Express Settlement	550.00
Subtotal	550.00
GST (9%)	49.50
Grand Total	599.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 16 RAFFLES QUAY #42-01 HONG LEONG BUILDINGSINGAPORE 048581 ATTN: ZENA LIM			Ref: CD/FCI24120324/Ama3q2(N) Date: 27/10/2025 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHD 6516Z	Veh. Inspected	SNQ 2915S	
Policy No.	D-24101861MFCT	Coverage (\$)	0.00	
Claim No.	D24011046MFCT/CTPL/TPD 2	Excess (\$)	0.00	
Assign From	KAREN TAN	Assign Date	18/12/2024	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA SIENTA	c.c	1490	
Engine No.	HIDDEN	Year of Reg.	2024	
Chassis No.	JTDBBBA3X0L001470	Colour	GREY	
Odometer	14976 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/65 R15	TOYO	6 mm	
L/H Front Tyre	185/65 R15	TOYO	6 mm	
R/H Rear Tyre	185/65 R15	TOYO	6 mm	
L/H Rear Tyre	185/65 R15	TOYO	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/12/2024	Inspection Date	18/12/2024	
Survey held at	KT MOTORWERK 3012 BEDOK INDUSTRIAL PARK E, #01-2020, BEDOK INDUSTRIAL PARK E, SINGAPORE 489978			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNQ 2915S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT	DENTED	2,253.60	1,995.00
2	REAR BOOT HINGE @\$94.90	NOT NECESSARY	189.80	-
2	REAR BOOT ABSORBER @\$453.00	NOT NECESSARY	906.00	-
1	REAR BOOT LOCK MECHANISM	DAMAGED	647.90	549.00
1	REAR BOOT STRIKER	NOT NECESSARY	35.90	-
1	REAR BOOT WEATHERSTRIP	BENT	465.30	465.30
1	REAR BOOT INNER TRIM	NOT NECESSARY	480.00	-
1	REAR BOOT OUTER GARNISH	NOT NECESSARY	868.70	-
1	REAR BOOT OUTER GARNISH LOGO	NOT NECESSARY	145.60	-
1	REAR WIPER	NOT NECESSARY	55.00	-
1	REAR WIPER ARM	NOT NECESSARY	267.60	-
1	REAR WIPER ARM MOTOR	NOT NECESSARY	522.50	-
1	END PANEL	DENTED	724.20	724.20
1	END PANEL TOP GARNISH	DEFORMED	254.80	254.80
2	REAR FENDER INNER TRIM @\$863.30	N/S CRACKED	1,726.60	863.30
1	REAR LUGGAGE COMPARTMENT BOARD	CRACKED	789.60	610.00
1	REAR LUGGAGE COMPARTMENT	TO REPAIR SEE LABOUR	574.20	-
1	HYBRID BATTERY COVER	CRACKED	363.70	363.70
1	REAR EXHAUST MUFFLER	NOT NECESSARY	1,255.60	-
2	REAR EXHAUST MUFFLER HOLDER @\$76.70	NOT NECESSARY	153.40	-
2	REAR TAILLAMP @\$1274.10	NOT NECESSARY	2,548.20	-
1	REVERSE CAMERA	NOT NECESSARY	850.00	-
1	REAR BUMPER	DISTORTED	516.40	516.40
2	REAR BUMPER RETAINERS @\$105.90	NOT NECESSARY	211.80	-
1	REAR BUMPER TOW COVER	NOT NECESSARY	68.20	-
2	REAR BUMPER REFLECTOR @\$102.50	N/S CUT	205.00	102.50
2	REAR BUMPER SIDE GARNISH @\$198.20	N/S TORN	396.40	198.20
2	REAR BUMPER TOP EXTENSION @\$577.00	CRACKED	1,154.00	577.00
2	REAR BUMPER TOP EXTENSION RAILING WAY @\$872.90	NOT NECESSARY	1,745.80	-

Report Ref No. CD/FCI24120324/Ama3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR FUEL COVER	NOT NECESSARY	87.50	-
1	REAR WINDSCREEN MOULDING	NECESSARY	135.80	135.80
2	REAR PARKING SENSOR @\$454.20	DAMAGED (2 PCS ONLY)	908.40	640.00
1	KEY ANTENNA	CRACKED	205.20	205.20
	LESS 25% DISCOUNT		-5,428.18	-2,050.10
			16,284.52	6,150.30
	<u>SPECIAL NETT ITEMS</u>			
1	SET BODY PANEL JOINT SEALANT (SN)	NECESSARY	120.00	60.00
1	SET END PANEL TOP TRIM CLIPS (SN)	NECESSARY	30.00	20.00
2	SET TAILLAMPS CLIPS @\$25.00 (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	40.00	30.00
2	SET REAR FENDER INNER TRIM CLIPS @\$30.00 (SN)	NECESSARY	60.00	30.00
2	SET REAR FENDER INNER COWLING CLIPS @\$30.00 (SN)	NOT NECESSARY	60.00	-
1	SET BOOTLID INNERTRIM CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET REAR BUMPER PLATE WITH CASING (SN)	NOT NECESSARY	50.00	-
1	SET REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	SET REAR WINDSCREEN PRIMER (SN)	NECESSARY	30.00	30.00
1	SET REAR WINDSCREEN SUPPORT SPONGE (SN)	NOT NECESSARY	40.00	-
			560.00	210.00
	<u>LABOUR</u>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR LUGGAGE COMPARTMENT .		2,000.00	800.00
	SPRAY PAINTING .		2,000.00	800.00
	CHECK WIRING ON TAILLAMPS .		60.00	30.00
	ANTI RUST.		80.00	60.00
	REMOVE AND INSTALL REVERSE CAMERA.		80.00	50.00
	REMOVE AND INSTALL REVERSE SENSOR .		120.00	50.00
	REMOVE AND TRANSFER TAILGATE COMPONENTS.		150.00	60.00
	REMOVE AND REFIT UPHOLSTERY TO FACILITATE REPAIR.		150.00	60.00
	SYSTEM RECALIBRATION AND RESET.	NOT NECESSARY	400.00	-
	REMOVE AND INSTALL REAR EXHAUST SILENCER.	NOT NECESSARY	180.00	-

Report Ref No. CD/FCI24120324/Ama3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND REFIT REAR WINDSCREEN.		160.00	120.00
	TO INSTALL REAR PARKING SENSOR .		120.00	50.00
			5,500.00	2,080.00
GRAND TOTAL			22,344.52	8,440.30
RECOMMENDED COST OF REPAIRS				8,440.30

Report Ref No. CD/FCI24120324/Ama3q2(N)

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 3 of 13)

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S




PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S





PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S

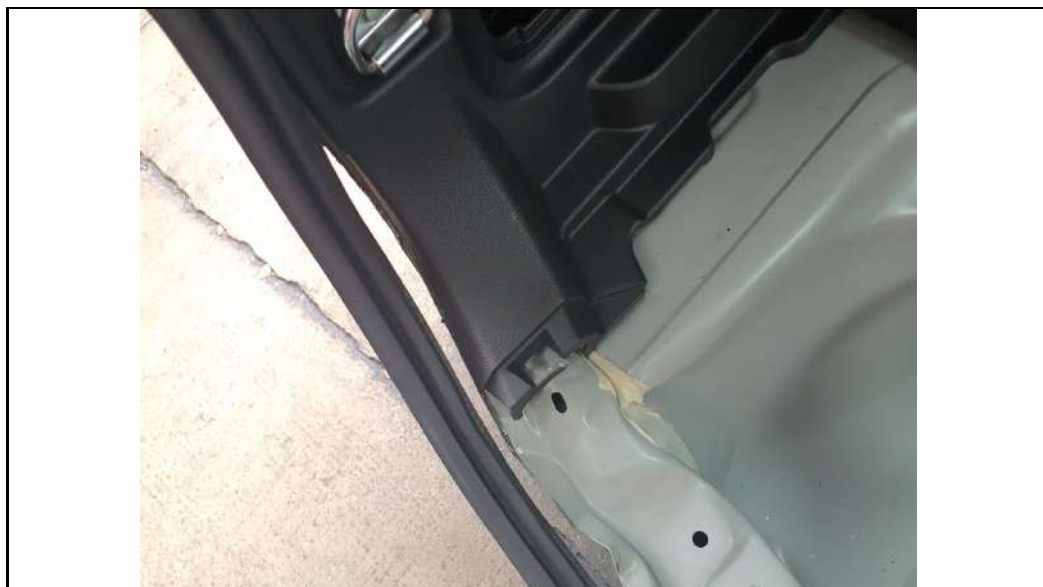

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S

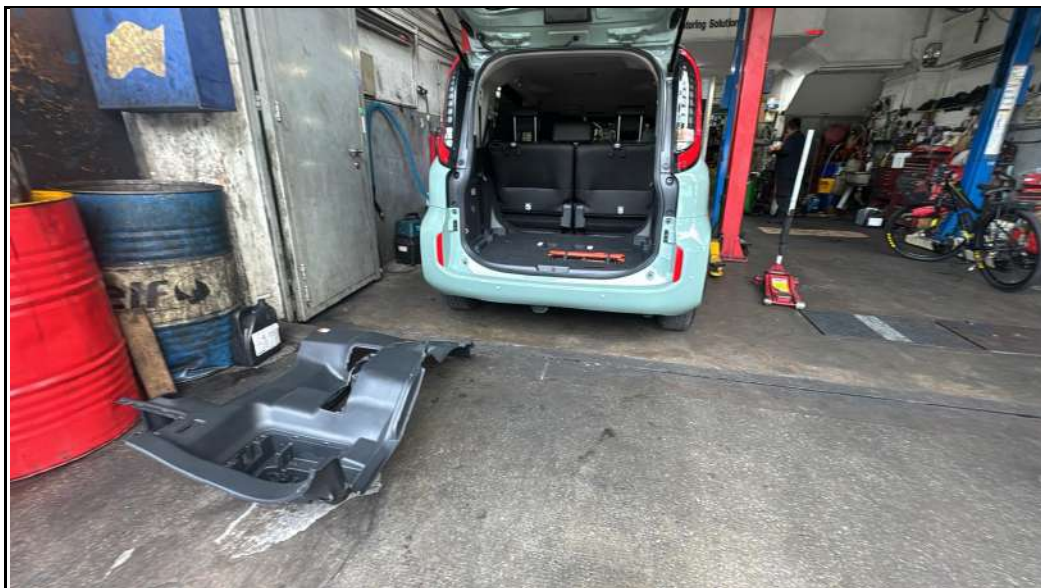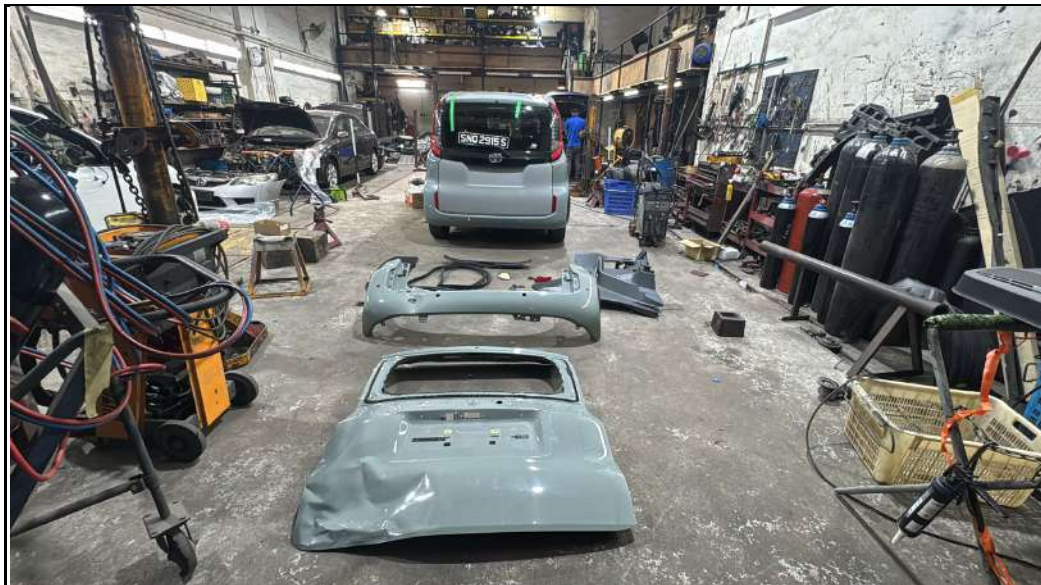

PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S



PHOTOGRAPHS FOR VEHICLE NO. : SNQ 2915S

