

Appraisal Services

Insurance Loss Adjusters & Licensed Appraisers

Insurance Claim Investigator

Business Address: 110A Arab Street Singapore 199806

Mobile: +65 98586761 / +65 66523352 Fax: +65 67220690

Mailing Address : 161 Alexandra Post Office Singapore 911506

Email: mail.stappraisal@gmail.com

Date : 12th April 2024

Our Ref : TP / YKA SLC1950T/ 03.21/24

Your Ref :

Mr Lim Geng Bai
188 Boon Lay Drive
#09 - 110
Singapore 640188

DAMAGED VEHICLE (SLC 1950 T) INSPECTION REPORT (WITHOUT PREJUDICE)

Detailed accounts of our inspection are as follows: -

(A) Reference

Name of Claimant	: Mr Lim Geng Bai	Date of Request	: 25 th March 2024
	:	Referred By	: Insured
Policy No.	: Please Advice	Date of Inspection	: 25 th March 2024
Claim No.	: Please Advice	Date of Re-inspection	:
Accident Date	: 21 st March 2024	Sum Insured	: NA
Repairer	: M/s YK Supreme Autowerkz Pte Ltd	Excess Amount	: NA
	: 1 Kaki Bukit Avenue 6, AutoBay	3 rd Party Vehicle	: Please Advice
	: #01-11 Singapore 417883	3 rd Party Insurer	: Please Advice

(B) Particulars of Vehicle

Registration No	: SLC 1950 T	Mileage	: 419801 km
Make & Model	: TOYOTA COROLLA ALTIS 1.6	Engine No	: 1ZRY241891
Year of Registration	: 4 th March 2016	Chassis No.	: MR053REH104543376
Colour	: Black	Engine Capacity.	: 1,598 cc


(C) Pre-Accident Condition (Static Test Only)

Steering	: Serviceable	Paint Work	: Good
Foot-brake	: Serviceable	Modification	: NIL
Hand-brake	: Serviceable	General Condition	: Good

(D) Tyre Condition

	Tread Depth	Make	Size
Front Right	80 %	KAPSEN	205/55 R16
Front Left	80 %	KAPSEN	205/55 R16
Rear Right	80 %	BRIDGESTONE	205/55 R16
Rear Left	80 %	KAPSEN	205/55 R16

(E) Point of Impact

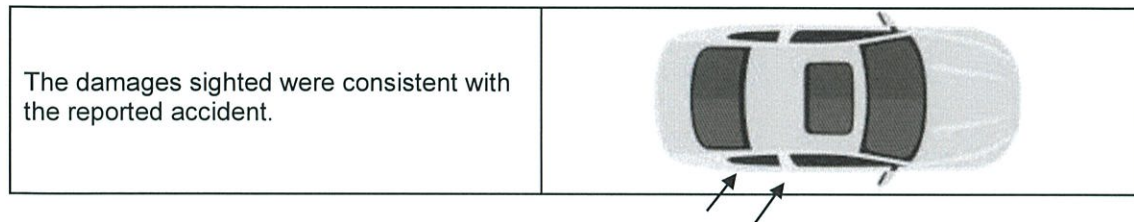

(F) General Description of Damages

The impact of the collision has damaged/affected the RH rear wheel rim, RH rear tyre, RH rear suspension, rear fender, rear bumper, rear door, front door and etc.

Please refer to the Annex for a detailed account of the damages and photographs taken.

(G) Recommendation

We have inspected thoroughly the actual damages found on the vehicle, before we arrived at our recommendation as to whether the parts needed replacement or repairs.

Our adjusted cost of repair is **\$11,481.18** and an estimated **8** days is required to repair the vehicle. Please refer to the Annex for a detailed account of the cost estimates.

(H) Remarks

We have not authorized the repairs. However, for information under normal circumstances, the repairs should not exceed **8** days.

This inspection was conducted on a **“without prejudice”** basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

ST Appraisal Services



T T RAJAN
MVI, ITC (Mechanical), NTC (Motor Vehicle)
ASIET, MSAAA, Assessor/Appraiser
AD041-2007532D

TP / YKA SLC1950T/ 03.21/24

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS FOR VEHICLE NO: SLC 1950 T

Adjustment of Spare Parts Costs for Repairs

Item	Qty	Vehicle parts description	Condition / Remark	Estimated by workshop	Disc. (%)	Adjusted cost
1	1	RH rear fender	dented	998.20 /	25	748.65
2	1	RH rear fender dust cover	folded/torn	224.00 /	25	168.00
3	1	Rear windscreen moulding	necessary	186.30 /	25	139.73
4	1	Rear bumper fascia	cut/torn	988.00 585 /	25	741.00
5	1	Rear bumper side retainer	damaged	104.60 /	25	78.45
6	1	Rear door panel	dented	1198.60 /	25	898.95
7	1	Rear door outer moulding	necessary	178.60 x nn	25	133.95
8	1	Rear door outer upper moulding	necessary	169.70 x nn	25	127.28
9	1	Rear door weatherstrip	torn	294.60 x nn	25	220.95
10	1	Rear door upper hinge	distorted	98.20 x nn	25	73.65
11	1	Rear door lower hinge	distorted	102.40 x nn	25	76.80
12	1	Rear door inner trim board	cut/damaged	622.00 x nn	25	466.50
13	1	Rear door glass regulator	distorted	422.00 x nn	25	316.50
14	1	Rear door outer moulding	necessary	172.40 x nn	25	129.30
15	1	Rear door inner lock	distorted	524.30 x nn	25	393.23
16	1	Rear door outer handle	cut/damaged	202.00 /	25	151.50
17	1	Rear door upper sticker	necessary	106.00 /	25	79.50
18	1	Rear door side sticker	necessary	94.30 /	25	70.73
19	1	Rear door glass channel	necessary	98.30 x nn	25	73.73
20	1	Front door panel	dented	1245.65 /	25	934.24
21	1	Front door lock	malfunction	486.30 x nn	25	364.73
22	1	Front door weatherstrip	necessary	262.66 x nn	25	197.00
23	1	Front door glass channel	necessary	87.60 x nn	25	65.70
24	1	Front door outer moulding	necessary	167.46 x nn	25	125.60
25	1	Front door glass regulator	serviceable	467.20 x nn	100	0.00
26	1	Front door inner trim board	serviceable	726.30 x nn	100	0.00
27	1	Front door outer handle	missing	197.60 /	25	148.20
28	1	Front door upper sticker	necessary	98.60 /	25	73.95
29	1	Front door side sticker	necessary	90.20 /	25	67.65
30	1	RH rear shock absorber	distorted	387.00 x nn	25	290.25
31	1	RH rear wheel bearing	distorted	298.00 x nn	25	223.50
Special Nett Items						
1	1	Rear alloy rim	distorted	680.00 450 /		600.00
2	1	Rear tyre	cut/damaged	245.00 70% of \$150		220.00 105
3	1	Rear windscreen sealant	necessary	80.00 40 /		60.00
4	1 set	RH rear fender dust cover clip	necessary	40.00 x nn		36.00
5	1 set	Front door inner trim board clip	necessary	45.00 x nn		38.00
6	1 set	Rear door inner trim board clip	necessary	45.00 x nn		38.00
Total parts				12434.07		8571.18

Adjustment of Labour Costs for Repairs

To remove and replaced damaged parts including straightening and repositioning replacement parts.	1150.00	1050.00	1000
To supply paint materials and to respray affected panels.	1200.00	1100.00	1000
To remove and refit rear windscreen to facilitate repair.	150.00	120.00	/
To carry out anti rust treatment on affected panels.	120.00	100.00	30
To remove/transfer door fittings and attachments. To check for proper functions.	200.00	160.00	100
Carry out wheel alignment and reset settings.	120.00	100.00	80
To remove and replace rear suspension components. To realign affected parts.	250.00	200.00	x
To provide towing service.	80.00	80.00	/
Total Labour (S\$)	3270.00	2910.00	

Adjustment Parts and Labour Costs of Repairs

	Estimated by workshop	Adjusted cost
TOTAL PARTS COSTS	12434.07	8571.18
TOTAL LABOUR COSTS	3270.00	2910.00
TOTAL REPAIR COSTS	15704.07	11481.18

ADJUSTED REPAIR COST	11481.18
-----------------------------	-----------------

8 days