



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2502320

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 15/04/2025
Reference CD/CTI24070111/Ama3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLJ 4685C
Insured Veh. PA 898G
Claim No. SNM24D203834/C02
Policy No. DMB1SNW00022822302
Accident Date 01/07/2024
Inspection Date 03/07/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24070111/Ama3q2(N)	
			Date: 15/04/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	PA 898G	Veh. Inspected	SLJ 4685C
	Policy No.	DMB1SNW00022822302	Coverage (\$)	0.00
	Claim No.	SNM24D203834/C02	Excess (\$)	0.00
	Assign From		Assign Date	03/07/2024
2. Vehicle Particulars & Condition				
	Make & Model	AUDI Q5	c.c	1984
	Engine No.	HIDDEN	Year of Reg.	2010
	Chassis No.	WAUZZZ8RXBA004202	Colour	BLACK
	Odometer	209180 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	255/45 R20	PIRELLI	6 mm
	L/H Front Tyre	255/45 R20	PIRELLI	6 mm
	R/H Rear Tyre	255/45 R20	PIRELLI	6 mm
	L/H Rear Tyre	255/45 R20	PIRELLI	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT & REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	01/07/2024	Inspection Date	03/07/2024
	Survey held at	HD PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		12 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLJ 4685C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DEFORMED	2,573.00	2,573.00
1	FRONT BUMPER LOWER DIFFUSER	NOT NECESSARY	650.00	-
2	FRONT BUMPER FOGLAMP @\$482.00	NOT NECESSARY	964.00	-
2	FRONT BUMPER FOGLAMP COVER @\$250.00	NOT NECESSARY	500.00	-
1	FRONT BUMPER CENTER GRILLE C/W CHROME	CRACKED	1,855.00	1,663.00
2	FRONT BUMPER CENTER GRILLE BRACKET @\$85.00	CRACKED	170.00	170.00
1	FRONT BUMPER LOWER GRILLE	NOT NECESSARY	399.40	-
1	FRONT BUMPER BOTTOM COVER GARNISH	NOT NECESSARY	174.90	-
2	FRONT BUMPER NOZZLE @\$200.90	NOT NECESSARY	401.80	-
2	FRONT BUMPER NOZZLE COVER @\$108.70	NOT NECESSARY	217.40	-
2	FRONT BUMPER NOZZLE TUBE C/W JOINT @\$40.80	NOT NECESSARY	81.60	-
4	FRONT BUMPER SENSOR @\$842.00	DAMAGED (1 PCS ONLY)	3,368.00	285.00
4	FRONT BUMPER SENSOR HOLDER @\$56.00	NECESSARY	224.00	100.00
2	FRONT BUMPER SIDE RETAINER @\$59.70	NOT NECESSARY	119.40	-
1	FRONT BUMPER REINFORCEMENT	DENTED	750.80	750.80
2	FRONT BUMPER REINFORCEMENT BRACKET @\$184.00	NOT NECESSARY	368.00	-
1	FRONT BUMPER CENTRE BEAM	CRACKED	389.70	389.70
1	FRONT BUMPER SPONGE	DEFORMED	217.80	217.80
1	BONNET	DENTED	3,652.00	3,652.00
1	BONNET LOGO	NECESSARY	163.00	163.00
2	BONNET HINGE @\$190.00	BENT	380.00	380.00
2	BONNET DAMPER @\$158.00	NOT NECESSARY	316.00	-
1	BONNET SAFETY HOOK	NOT NECESSARY	95.00	-
2	BONNET BOTTOM LOCK @\$132.00	NOT NECESSARY	264.00	-
1	BONNET INSULATOR	NOT NECESSARY	283.00	-
2	BONNET STOPPER @\$15.00	NOT NECESSARY	30.00	-
1	FRONT SUPPORT PANEL	CRACKED	1,865.00	1,865.00
1	FRONT SUPPORT PANEL TOP GARNISH	TORN	385.00	385.00
1	FRONT SUPPORT PANEL LOWER SUPPORT BEAM	NOT NECESSARY	324.00	-
1	FRONT AIR DUCT	CRACKED	86.00	86.00

Report Ref No. CD/CTI24070111/Ama3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIR CLEANER	NOT NECESSARY	495.00	-
1	AIR CLEANER DUCT	DEFORMED	112.00	112.00
1	RADIATOR	NOT NECESSARY	1,592.00	-
1	RADIATOR FAN COWLING C/W FAN MOTOR	NOT NECESSARY	1,529.00	-
2	HORN @\$124.00	NOT NECESSARY	248.00	-
1	OUTSIDE TEMPERATURE SENSOR	NOT NECESSARY	163.00	-
1	FRONT AIR GUARD	NOT NECESSARY	188.00	-
1	OIL COOLER	NOT NECESSARY	486.50	-
2	AIRCON CONDENSER SIDE AIR GUARD @\$165.00	O/S DEFORMED	330.00	165.00
1	AIRCON CONDENSER	DENTED	1,259.00	1,259.00
1	AIRCON PIPE (SUCTION)	NOT NECESSARY	492.00	-
1	AIRCON PIPE (PRESSURE)	NOT NECESSARY	582.00	-
1	FRONT TURBO COOLER	NOT NECESSARY	368.00	-
1	FRONT TURBO COOLER PIPE	DENTED	982.00	601.00
1	FRONT TURBO COOLER AIR GUARD	NOT NECESSARY	134.00	-
1	FRONT FENDER RH	TO REPAIR SEE LABOUR	1,983.00	-
2	FRONT FENDER COWLING @\$279.90	NOT NECESSARY	559.80	-
2	HEADLAMP @\$5428.00	CRACKED	10,856.00	6,916.00
2	HEADLAMP BRACKET @\$154.00	CRACKED	308.00	308.00
1	FRONT SUPPORT PANEL TOP COVER	REPEATED	200.70	-
1	REAR BUMPER	DISTORTED	3,258.00	2,841.00
1	REAR BUMPER (LOWER)	DISTORTED	948.00	445.00
2	REAR BUMPER LAMP @\$398.00	CRACKED	796.00	796.00
2	REAR BUMPER SIDE RETAINER @\$486.00	NOT NECESSARY	972.00	-
2	REAR BUMPER SIDE BRACKET @\$107.60	NOT NECESSARY	215.20	-
1	REAR BUMPER REINFORCEMENT	DENTED	894.00	894.00
2	REAR BUMPER REINFORCEMENT BRACKET @\$254.00	NOT NECESSARY	508.00	-
4	REVERSE SENSOR @\$244.70	DAMAGED (2 PCS ONLY)	978.80	489.40
4	REVERSE SENSOR HOLDER @\$56.00	NECESSARY	224.00	100.00
1	REVERSE SENSOR WIREHARNES	NOT NECESSARY	800.90	-
2	REAR FENDER COWLING @\$248.90	NOT NECESSARY	497.80	-
2	REAR FENDER INNER TRIM @\$530.70	TORN	1,061.40	1,061.40

Report Ref No. CD/CTI24070111/Ama3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN GLASS C/W MOULDING	NECESSARY	1,300.70	245.00
1	TAILGATE	DISTORTED	6,953.00	5,473.00
1	TAILGATE LOGO	NECESSARY	150.80	150.80
1	TAILGATE EMBLEM Q5	NECESSARY	137.70	137.70
1	TAILGATE EMBLEM 2.0T	NECESSARY	121.10	121.10
1	TAILGATE EMBLEM QUATTRO	NECESSARY	181.30	181.30
4	TAILGATE STOPPER @\$21.70	NOT NECESSARY	86.80	-
2	TAILGATE HINGE @\$143.90	NOT NECESSARY	287.80	-
1	TAILGATE INNER TRIM	CRACKED	886.30	886.30
1	TAILGATE TOP LOCK	DAMAGED	200.40	200.40
2	TAILGATE LOWER LOCK @\$280.80	NOT NECESSARY	561.60	-
1	TAILGATE LOWER LOCK MOTOR	NOT NECESSARY	658.00	-
1	TAILGATE LOWER MOULDING	NOT NECESSARY	228.00	-
1	TAILGATE WEATHERSTRIP	CUT	217.60	217.60
2	TAILLAMP @\$1682.00	CUT	3,364.00	2,848.00
1	REAR END PANEL	DENTED	1,986.50	1,309.00
1	REAR END PANEL TOP GARNISH	DEFORMED	300.70	300.70
1	REAR EXHAUST PIPE	NOT NECESSARY	3,825.00	-
1	REAR EXHAUST INSULATOR	NOT NECESSARY	299.40	-
1	SET REAR EXHAUST GASKET	NOT NECESSARY	169.30	-
2	REAR EXHAUST MOUNTING @\$189.80	NOT NECESSARY	379.60	-
	LESS 5% DISCOUNT		-3,879.28	-2,036.95
			73,706.22	38,702.05
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	CRACKED	50.00	50.00
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	80.00	30.00
1	SET FRONT BUMPER BOTTOM COVER GARNISH CLIP (SN)	NOT NECESSARY	50.00	-
1	SET REAR FENDER COWLING CLIP (SN)	NOT NECESSARY	50.00	-
1	FRONT BONNET SEALANT (SN)	NOT NECESSARY	120.00	-
1	SET FRONT BONNET INSULATOR CLIP (SN)	NOT NECESSARY	80.00	-
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	80.00	30.00

Report Ref No. CD/CTI24070111/Ama3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR FENDER COWLING CLIP (SN)	NOT NECESSARY	50.00	-
1	SET REAR FENDER INNER TRIM CLIP (SN)	NECESSARY	80.00	30.00
1	REAR WINDSCREEN GLASS SEALANT (SN)	NECESSARY	80.00	40.00
1	REAR WINDSCREEN GLASS INNER SEAL (SN)	NECESSARY	60.00	40.00
1	REAR WINDSCREEN GLASS SOLAR FILM (SN)	NOT NECESSARY	550.00	-
1	SET TAILLAMP CLIP (SN)	NOT NECESSARY	30.00	-
1	TAILGATE SEALANT (SN)	NOT NECESSARY	150.00	-
1	SET TAILGATE INNER TRIM CLIP (SN)	NECESSARY	50.00	30.00
1	SET REAR END PANEL TOP GARNISH CLIP (SN)	NECESSARY	30.00	20.00
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	250.00	60.00
1	REAR FLOOR PANEL SEALANT (SN)	NOT NECESSARY	350.00	-
			2,240.00	330.00
	LABOUR			
	PANEL BEATING ,REMOVAL AND REPLACING PARTS. (FRONT).INCLUSIVE OF THE REPAIR OF FRONT FENDER RH.		1,400.00	800.00
	TO SPRAY PAINT AFFECTED AREA. (FRONT)		1,400.00	600.00
	REFOCUS HEADLAMP BEAM. (FRONT)	NOT NECESSARY	80.00	-
	REMOVE AND REFIX AIRCON CONDENSOR AND REFILL AIRCON GAS. (FRONT)		150.00	60.00
	REMOVE AND REFIX RADIATOR AND CONDUCT PRESSURE TEST . (FRONT)		150.00	60.00
	REMOVE AND REFIX TURBO COOLER . (FRONT)		150.00	50.00
	REMOVE AND REFIX OIL COOLER . (FRONT)		150.00	50.00
	REMOVE REFIX AND RESET FRONT SAFETY BELT . (FRONT)	NOT NECESSARY	650.00	-
	TO PANEL BEAT ,REMOVE AND REPLACE PARTS. (REAR)		2,200.00	900.00
	TO SPRAY PAINT AFFECTED AREA.(REAR)		2,000.00	700.00
	TUFF COAT.(REAR)		250.00	60.00
	WIRING AND BULB CHECK .(REAR)		180.00	30.00
	REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR .(REAR)		350.00	60.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.(REAR)		80.00	50.00
	REAR CHASSIS ALIGNMENT .(REAR)	NOT NECESSARY	250.00	-

Report Ref No. CD/CTI24070111/Ama3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE ,REFIX AND RESET BOOTLID FOOT SENSOR .	NOT NECESSARY	350.00	-
	TRANFER TAILGATE MECHANISM.		80.00	60.00
	REMOVE AND REFIX REAR UNDERCARRIAGE.	NOT NECESSARY	1,200.00	-
	TO PRESS REAR WHEEL BEARING.	NOT NECESSARY	180.00	-
	FOUR WHEEL ALIGNMENT.	NOT NECESSARY	180.00	-
	CONDUCT WATER LEAKAGE TEST .	NOT NECESSARY	180.00	-
	REMOVE AND REFIX REAR EXHAUST PIPE .	NOT NECESSARY	180.00	-
	REMOVE AND REFIX FUEL TANK .	NOT NECESSARY	180.00	-
	REMOVE AND REFIX TAILGATE WINDSCREEN GLASS .		160.00	120.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.		450.00	180.00
			12,580.00	3,780.00
GRAND TOTAL			88,526.22	42,812.05
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				34,000.00

Report Ref No. CD/CTI24070111/Ama3q2(N)

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 1 of 31)


PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C

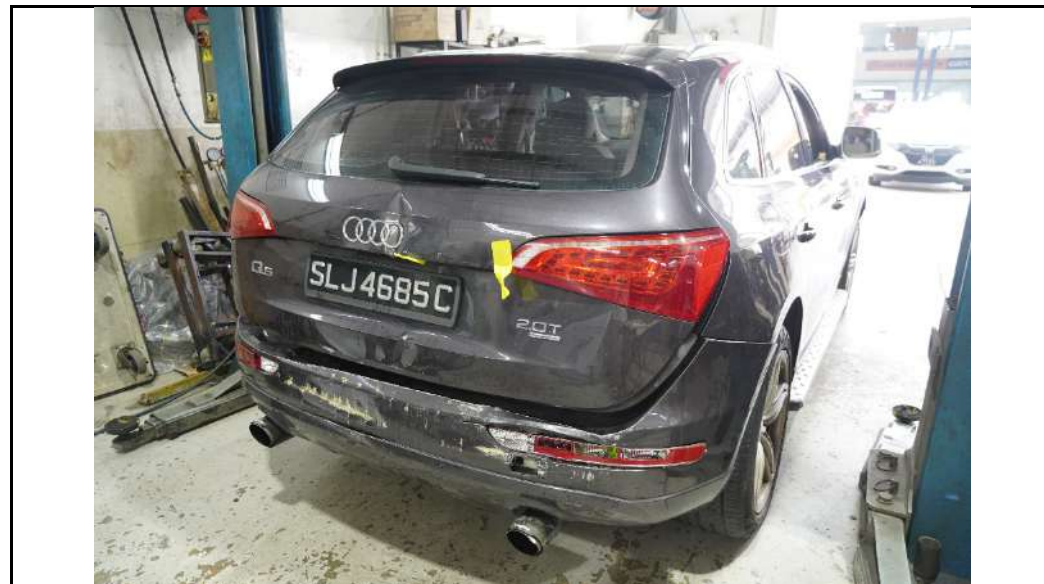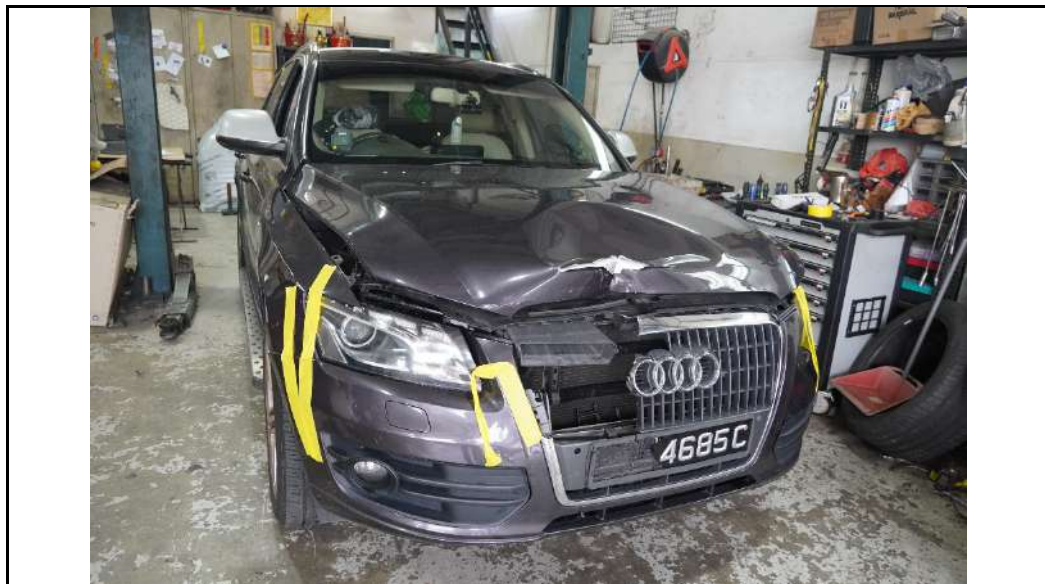

PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C

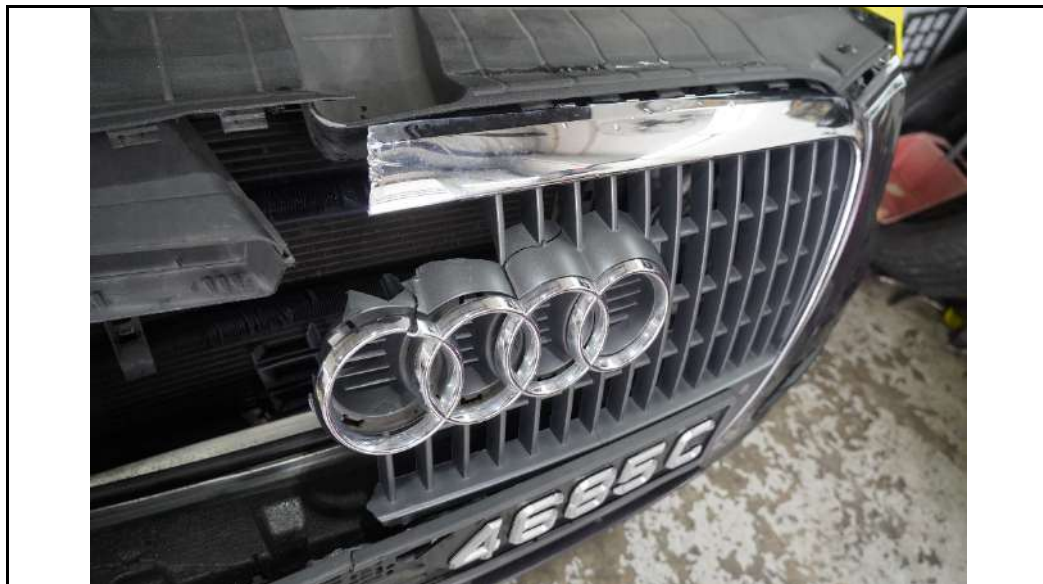

PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C




PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C




PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C

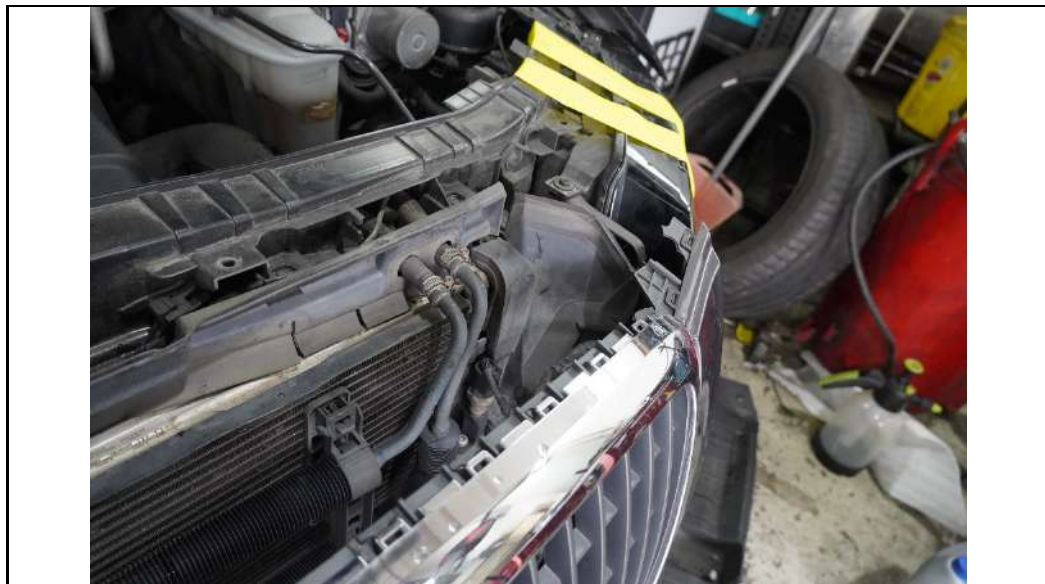


PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C

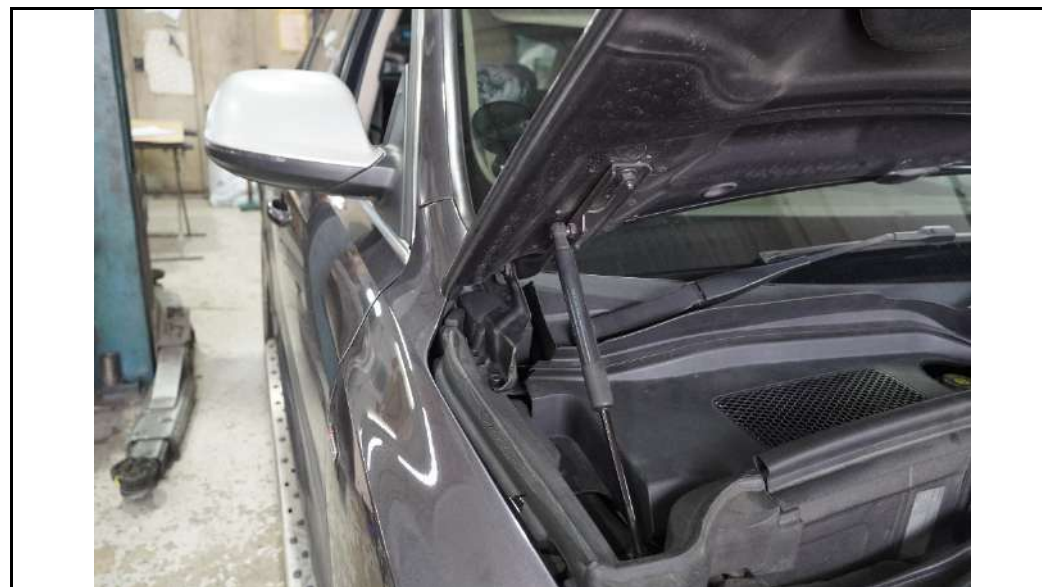

PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C

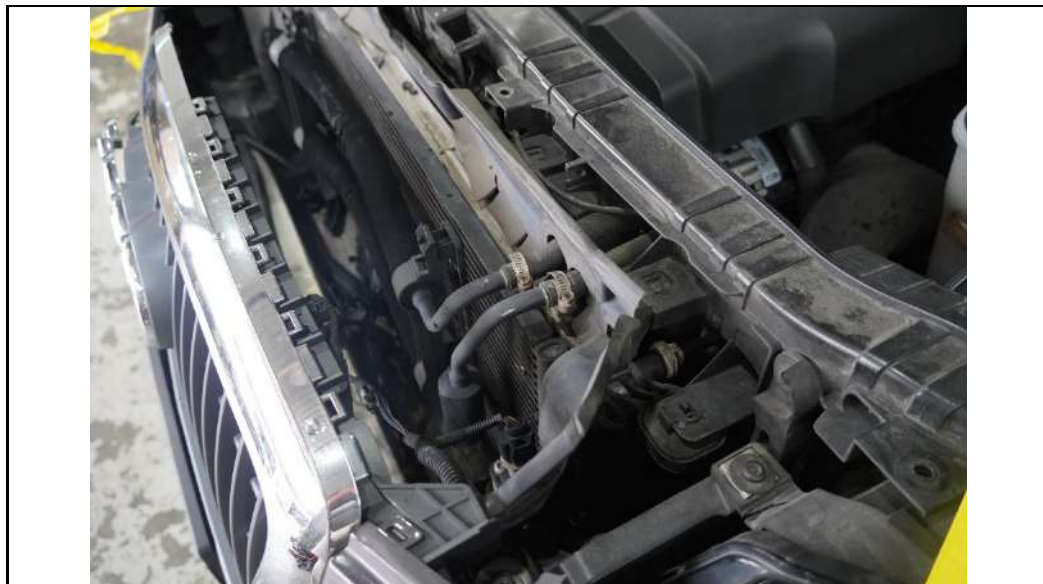

PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C




PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C

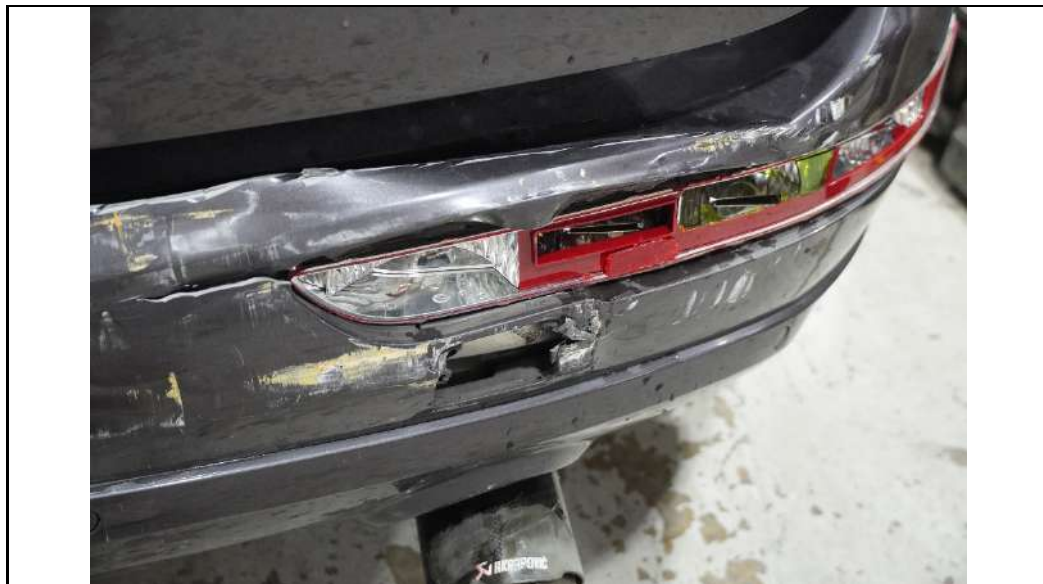

PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C




PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C

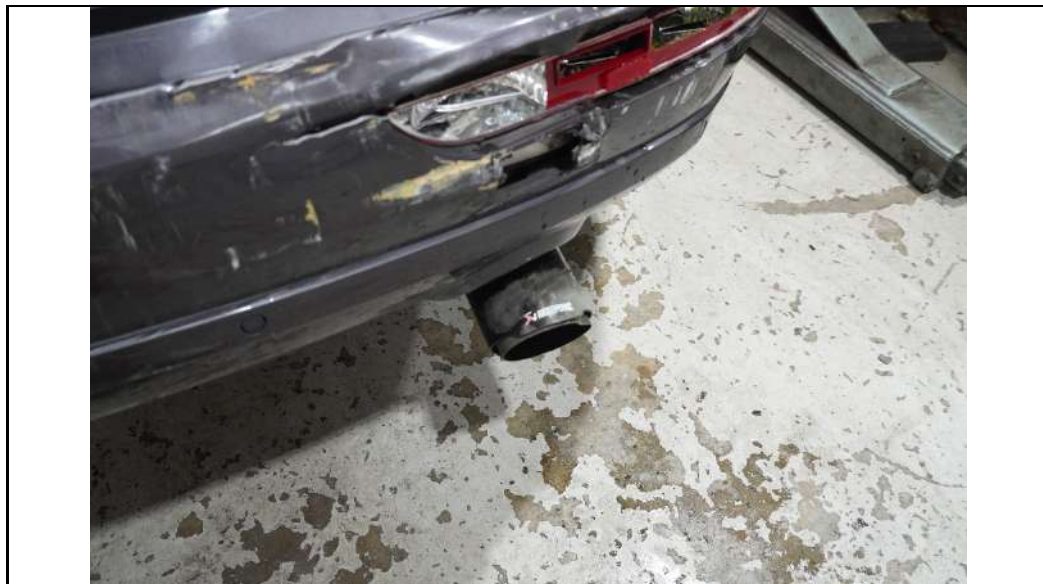

PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C




PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C

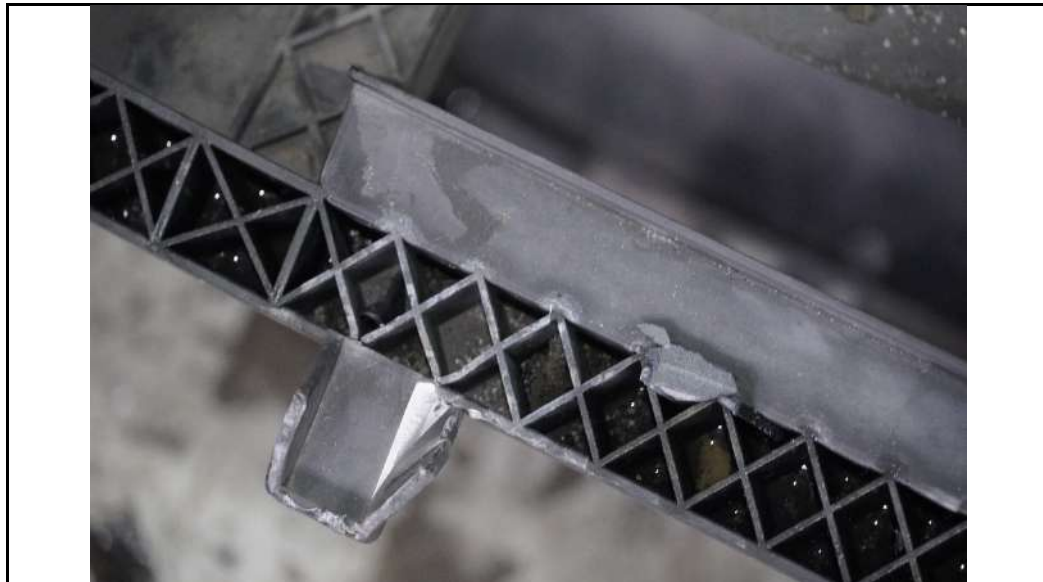

PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C



PHOTOGRAPHS FOR VEHICLE NO. : SLJ 4685C

