

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

STRIDES PREMIER AUTOMOTIVE SERVICES PL.
60 WOODLANDS INDUSTRIAL PARK E4
SINGAPORE 757705

INV No. : SAC2401294

INV Date : 08-11-2024

Reference CS/SMR24070195/Rnp3e2

Code SMR

PROFESSIONAL SERVICE FEE

Vehicle No. SML 4662X
Insured Veh. SHD 6313S
Claim No. TAX/07/24/2020
Policy No.
Accident Date 06/07/2024
Inspection Date 11/07/2024

Description	Amount
Survey Inspection	128.00
Resurvey Inspection	0.00
Digital Photographs	0.00
Transportation	0.00
Sub-Total	128.00
GST (9%)	11.52
Grand Total	139.52

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

KHM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS STRIDES PREMIER AUTOMOTIVE SERVICES PL.	Ref:	CS/SMR24070195/Rnp3e2
60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705	Date:	08/11/2024
	Code:	SMR

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHD 6313S	Veh. Inspected	SML 4662X
Policy No.	-	Coverage	0
Claim No.	TAX/07/24/2020	Excess	\$0.00
Assign From	HUA YEN	Assign Date	10/07/2024

2. Vehicle Details

Make & Model	MAZDA 6 SEDAN 2.0 AT EXE	C.C	1998
Engine No.	PE21258602	Year of Reg.	22/05/2019
Chassis No.	JM6GL1072K0312254	Colour	BLACK
Odometer	35284 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: SPORTS RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	225/55 R17	BRIDGESTONE	6
L/H Front Tyre	225/55 R17	BRIDGESTONE	6
R/H Rear Tyre	225/55 R17	BRIDGESTONE	6
L/H Rear Tyre	225/55 R17	BRIDGESTONE	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT AND N/S REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	06/07/2024	Inspection Date	11/07/2024
Survey held at	27A TANJUNG PENJURU - REPAIRER: EUROKARS HABITAT PTE LTD		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 18 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SML 4662X

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	FRT NUMBER PLATE (SN)	NOT NECESSARY	\$70.00	\$0.00
2	TIRE (SN) (70%)	CUT (1PC ONLY)	\$1,400.00	\$490.00
1	SUNDRIES (SN)	NECESSARY	\$50.00	\$20.00
1	FRT BUMPER GL3 W/PS (SN)	TORN	\$1,177.81	\$1,177.81
12	NUT, CLIP (SN)	NECESSARY	\$28.32	\$28.32
4	RIVET (SN)	NECESSARY	\$14.84	\$14.84
8	RIVET, SPLASH SHIELD (SN)	NECESSARY	\$24.96	\$24.96
2	GROMMET, SCREW (SN)	NECESSARY	\$4.72	\$4.72
2	FASTENER (SN)	NECESSARY	\$4.72	\$4.72
2	SPRING (SN)	NECESSARY	\$18.56	\$18.56
1	CAP (L) GL (SN)	MISSING	\$73.00	\$73.00
1	PROTECTOR (L), BUMPER GL3 (SN)	MISSING	\$79.23	\$79.23
1	COVER LHF BUMPER GL3 (SN)	MISSING	\$24.87	\$24.87
1	STIFF 'A', BUMPER GL3 (SN)	TORN	\$119.35	\$119.35
1	RETAINER LHF BUMPER GJ/GL (SN)	CRACKED	\$14.84	\$14.84
1	COVER (L), BUMPER GL3 (SN)	MISSING	\$36.50	\$36.50
1	PLATE (L), SEAL-F, BUMPER GL (SN)	MISSING	\$95.25	\$95.25
1	FOAM, BUMPER-FRONT GL (SN)	CRACKED	\$73.00	\$73.00
2	FASTENER (SN)	NECESSARY	\$10.62	\$10.62
1	REINF, FRT BUMPER GL3 (SN)	BENT	\$563.37	\$563.37
1	HOLDER, LIC GL (SN)	NOT NECESSARY	\$111.77	\$0.00
1	RETAINER S/ACTIV (SN)	MISSING	\$15.77	\$15.77
1	SENSOR, ULTRASONIC (SN)	MISSING	\$184.59	\$184.59
1	RETAINER LHF BUMPER GJ/GL (SN)	MISSING	\$14.84	\$14.84
1	MOULD LHF LWR BUMPER GL3 (SN)	CRACKED	\$303.10	\$303.10
1	MESH, GRILL GL IPM3 (SN)	NOT NECESSARY	\$592.11	\$0.00
1	CLIP (SN)	NECESSARY	\$9.28	\$9.28
1	REINF, RADIATOR GRILLE GL (SN)	CRACKED	\$161.58	\$161.58
1	BRACKET LHF BUMPER GL (SN)	MISSING	\$44.76	\$44.76



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
4	CLIP (SN)	NECESSARY	\$18.56	\$18.56
1	BRACKET GRILL GL (SN)	SERVICEABLE	\$15.77	\$0.00
2	PIN, LOCATOR (SN)	SERVICEABLE	\$4.72	\$0.00
4	RIVET (SN)	NECESSARY	\$29.36	\$29.36
1	BRACKET (L), F.BUMPER SIDE GL3 (SN)	MISSING	\$44.76	\$44.76
2	GROMMET (SN)	NECESSARY	\$4.72	\$4.72
1	BRACKET RHF BUMPER SIDE GL3 (SN)	NOT NECESSARY	\$44.76	\$0.00
4	FASTENER (SN)	NECESSARY	\$10.48	\$10.48
6	RIVET (SN)	NECESSARY	\$44.52	\$44.52
1	BRACKET, GRILLE-RADIA GL3 (SN)	CRACKED	\$114.63	\$114.63
1	GRILLE, UP.RADIATOR GL3 (SN)	SCRATCHED	\$482.37	\$482.37
1	BRACKET LHF BUMPER GL3 (SN)	MISSING	\$14.84	\$14.84
1	BRACKET RHF BUMPER GL3 (SN)	NOT NECESSARY	\$14.84	\$0.00
8	RIVET, SPLASH SHIELD (SN)	NECESSARY	\$24.96	\$24.96
1	MOULD RHF LWR BUMPER GL3 (SN)	MISSING	\$303.10	\$303.10
1	BRACKET RAD GRILLE GL (SN)	NOT NECESSARY	\$128.37	\$0.00
1	MASCOT, FRT GJ/GL (SN)	NOT NECESSARY	\$66.51	\$0.00
1	BRACKET LHF GRILL GL (SN)	SERVICEABLE	\$15.77	\$0.00
8	RIVET, SPLASH SHIELD (SN)	NECESSARY	\$24.96	\$24.96
1	PROTECTOR LHF HL GL3 (SN)	NECESSARY	\$123.15	\$123.15
1	HEADLAMP LH IPM3 GL (SN)	BROKEN	\$5,460.29	\$5,460.29
1	BRACKET LHF HL GL3 (SN)	NECESSARY	\$15.77	\$15.77
1	BRACKET (L), HEAD LAMP GL3 (SN)	NECESSARY	\$37.01	\$37.01
1	COVER, SOCKET GL (SN)	NECESSARY	\$13.91	\$13.91
2	RIVET (SN)	NECESSARY	\$5.90	\$5.90
1	CORD, SHORT DJ/BM/BP/DM/KG/TC (SN)	CUT	\$60.52	\$60.52
1	FENDER LHF GJ/GL (SN)	BUCKLED	\$372.97	\$372.97
1	GUARD LHF MUD GL3 (SN)	MISSING	\$123.15	\$123.15
1	STAY (L), FENDER GJ/GL (SN)	MISSING	\$58.33	\$58.33
21	FASTENER (SN)	NECESSARY	\$49.56	\$49.56
3	FASTENER (SN)	NECESSARY	\$7.08	\$7.08



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	SHIELD (L), SPLASH GL3 (SN)	MISSING	\$16.69	\$16.69
1	BONNET GL3 (SN)	BENT	\$1,228.97	\$1,228.97
11	FASTENER, BONNET (SN)	NECESSARY	\$25.96	\$25.96
20	FASTENER (SN)	NECESSARY	\$54.00	\$54.00
1	WTHSTP, PARTING SEAL GJ/GL (SN)	CUT	\$106.63	\$106.63
22	RIVET (SN)	NECESSARY	\$40.92	\$40.92
1	CONVERTER DC/DC SKYACTIV (SN)	SERVICEABLE	\$459.78	\$0.00
1	BRACKET GJ (SN)	BENT	\$15.77	\$15.77
1	BRACKET HARNESS KE (SN)	BENT	\$13.91	\$13.91
1	BLOCK, RELAY GL/KF/KG (SN)	SERVICEABLE	\$68.95	\$0.00
2	WHEEL DISC 17"X7 GL (SN)	SERVICEABLE	\$2,444.30	\$0.00
1	LHF DOOR GJ/GL (SN)	TO REPAIR SEE LABOUR	\$1,126.65	\$0.00
1	FASTENER (L) (SN)	NECESSARY	\$9.28	\$9.28
9	GROMMET, SCREW (SN)	NECESSARY	\$21.24	\$21.24
1	GARNISH(L), SAIL-OUT GJ/GL (SN)	NOT NECESSARY	\$125.08	\$0.00
1	GARNISH LHF DR GL (SN)	NOT NECESSARY	\$119.35	\$0.00
1	GARNISH (L) REAR DOOR GL (SN)	NOT NECESSARY	\$133.18	\$0.00
1	GARNISH LHR DOOR GJ (SN)	NOT NECESSARY	\$69.71	\$0.00
1	GUARD STONE LHR, GJ (SN)	CUT	\$15.77	\$15.77
1	DOOR LHR GJ/GL (SN)	BENT	\$1,275.33	\$1,275.33
1	FASTENER (L), WEATHERSTRIP (SN)	NECESSARY	\$9.28	\$9.28
1	FASTENER (L), WEATHERSTRIP (SN)	NECESSARY	\$9.28	\$9.28
7	GROMMET, SCREW (SN)	NECESSARY	\$16.52	\$16.52
1	FENDER LHR GL3 (SN)	BENT	\$1,506.02	\$1,506.02
1	MOULD, RR, WINDOW GL (SN)	NECESSARY	\$126.01	\$126.01
1	SPACER (SN)	NECESSARY	\$11.13	\$11.13
3	TERMICAL, BACK WIND (SN)	NECESSARY	\$95.34	\$95.34
2	RIVET (SN)	NECESSARY	\$14.84	\$14.84
1	GASKET (R), RR COMB, GL3 (SN)	NECESSARY	\$52.77	\$52.77
1	GASKET (L), RR COMB, GL3 (SN)	NECESSARY	\$52.77	\$52.77
1	SHAFT LHF DRIVE KF/KG/GL5 (SN)	SERVICEABLE	\$1,609.44	\$0.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	NUT, AXLE (SN)	SERVICEABLE	\$12.98	\$0.00
1	HUB WHEEL FRT BM/GJ/KF (SN)	SERVICEABLE	\$682.80	\$0.00
1	COVER (L), DUST GL/DK/KF (SN)	SERVICEABLE	\$34.31	\$0.00
1	KNUCKLE LHF GL (SN)	SERVICEABLE	\$455.57	\$0.00
1	HOSE FLEXIBLE LHF GJ/GL (SN)	SERVICEABLE	\$84.29	\$0.00
1	JOINT (L), STRG GL (SN)	SERVICEABLE	\$143.96	\$0.00
1	PIN, SNAP (SN)	SERVICEABLE	\$5.74	\$0.00
1	GEAR, STEERING ASSY GL5 (SN)	SERVICEABLE	\$962.13	\$0.00
1	ARM LOWER LHF GL (SN)	SERVICEABLE	\$577.70	\$0.00
1	DAMPER LHF GL (SN)	SERVICEABLE	\$449.92	\$0.00
1	MEMBER, CROSS FRT GL/KF (SN)	BENT	\$2,086.24	\$2,086.24
1	LINK, CONTROL FRT GJ/GL/KE/KF/TC (SN)	SERVICEABLE	\$72.32	\$0.00
1	STABILIZER FRONT GL (SN)	SERVICEABLE	\$667.72	\$0.00
1	MEMBER, SHROUD-UPPER GL3 (SN)	SERVICEABLE	\$139.24	\$0.00
1	STAY, LOCK GJ/GL (SN)	SERVICEABLE	\$44.51	\$0.00
1	PANEL SHROUD GL3 (SN)	SERVICEABLE	\$479.34	\$0.00
1	GRILLE, UNDER GL3 (SN)	SERVICEABLE	\$877.08	\$0.00
1	PLATE, SET GL (SN)	SERVICEABLE	\$188.97	\$0.00
4	FASTENER (SN)	SERVICEABLE	\$10.48	\$0.00
1	MLDG(L), FENDER-FRT GL3 (SN)	NOT NECESSARY	\$15.77	\$0.00
1	COVER UNDER FRT GL (SN)	DEFORMED	\$90.78	\$90.78
1	COVER UNDER BM/BN/GL (SN)	SERVICEABLE	\$322.99	\$0.00
6	BRAKE FLUID D3 0.33L (SN)	NOT NECESSARY	\$69.30	\$0.00
1	HARNESS FRT GL (SN)	SERVICEABLE	\$9,970.30	\$0.00
1	WHEELDISC 17"X7 GL (SN) (ADDITIONAL)	SCRATCHED	\$1,222.15	\$1,222.15
1	MESH, GRILL GL IPM3 (SN) (ADDITIONAL)	CRACKED	\$592.11	\$592.11
1	PLATE(L), SEAL F, FENDER GJ/GL (SN) (ADDITIONAL)	BENT	\$88.76	\$88.76
1	CONVERTER DC/DC SKYACTIV (SN) (ADDITIONAL)	SHORTED	\$459.78	\$459.78
1	GARNISH(L) REAR DOOR GL (SN) (ADDITIONAL)	CRACKED	\$133.18	\$133.18
1	GARNISH LHR DOOR GJ (SN) (ADDITIONAL)	CRACKED	\$69.71	\$69.71
1	NUT, AXLE (SN) (ADDITIONAL)	NECESSARY	\$12.98	\$12.98



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	GEAR, STEERING ASSY GL5 (SN) (ADDITIONAL)	BENT	\$962.13	\$962.13
1	ARM LOWER LHF GL (SN) (ADDITIONAL)	BENT	\$577.70	\$577.70
1	CORD, SHORT FRT BUMPER GL (SN) (ADDITIONAL)	NECESSARY	\$133.60	\$133.60
1	WHEEL, DISC 17"X7 GL (SN) (ADDITIONAL)	SCRATCHED	\$1,222.15	\$1,222.15
1	HUB, WHEEL FRT BM/GJ/KF (SN) (ADDITIONAL)	BENT	\$682.80	\$682.80
			\$48,533.76	\$24,105.28

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO REMOVE & REPLACE FRT BUMPER, GRILLE TOP, BONNET, FRT FENDER RH, FRT FENDER LH, FRT SUPPORT PANEL, FRT DOOR LH, REAR DOOR LH, REAR FENDER LH & REAR BUMPER AND ALL ACCIDENT AFFECTED AREA. INCLUSIVE OF THE REPAIR OF LHF DOOR GJ/GL.		\$11,880.00	\$7,920.00
	TO RESPRAY FRT BUMPER, GRILLE TOP, BONNET, FRT FENDER RH, FRT FENDER LH, A PILLAR LH, FRT DOOR LH, REAR DOOR LH, REAR FENDER LH, REAR BUMPER & ROCKER PANEL LH		\$11,340.00	\$5,620.00
	TO TRANSFER FRONT SENSORS		\$330.00	\$180.00
	TO TRANSFER THE DOOR MECHANISM		\$792.00	\$396.00
	TO REMOVE & REFIT CARPET & TRIMS ON THE REAR SECTION TO GIVE WAY TO THE REPAIR ON THE REAR SECTION		\$792.00	\$396.00
	TO REMOVE & REFIT THE WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST		\$560.00	\$560.00
	TO SUPPLY SEALER ON THE WINDSCREEN GLASS		\$120.00	\$120.00
	TO REMOVE & REPLACE THE WIRE HARNESS ASSY		\$792.00	\$792.00
	TO REMOVE & REPLACE UNDERCARRIAGE		\$1,584.00	\$792.00
	TO REMOVE & REPLACE ABS HYDRAULIC UNIT ASSY AND BRAKE PIPING	NOT NECESSARY	\$792.00	\$0.00
	TO REMOVE & INSTALL ENGINE ASSY FOR ACCESS	NOT NECESSARY	\$2,376.00	\$0.00
	TO REALIGN BODY CHASSIS ALIGNMENT	NOT NECESSARY	\$2,376.00	\$0.00
	TO MOUNT SPORT RIM AND CONDUCT WHEEL BALANCING		\$120.00	\$80.00
	TO CHECK STEERING GEOMETRY & CONDUCT FULL WHEEL ALIGNMENT		\$560.00	\$560.00
	TO TOW THE VEHICLE FROM THE ACCIDENT SITE TO THE WORKSHOP		\$250.00	\$250.00
	TO MOUNT CAR ON CAR O LINER AND REALIGN THE CAR BODY ACCORDING MAZDA SPECIFICATION	NOT NECESSARY	\$1,500.00	\$0.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO CONDUCT BRAKE SYSTEM CHECKING USING SPECIFIC BRAKING TEST MACHINE	NOT NECESSARY	\$792.00	\$0.00
	TO CARRY OUT BODY CAVITY PRESERVATION		\$250.00	\$250.00
	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING		\$250.00	\$150.00
	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS		\$300.00	\$250.00
	TO MOUNT SPORT RIM AND CONDUCT WHEEL BALANCING - PO173050 (ADDITIONAL)		\$80.00	\$80.00
			\$37,836.00	\$18,396.00
GRAND TOTAL			\$86,369.76	\$42,501.28
	RECOMMENDED COST OF REPAIRS			\$42,501.28
Report Ref No: CS/SMR24070195/Rnp3e2				

MRB

MOHAMMED RASUL BIN MOHD YUNUS

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission	08/07/2024 14:08 (SGT)
Reported by	Actual Driver
Date of Accident	06/07/2024 22:10 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	ALONG SHEARES LINK TOWARDS SHEARES AVENUE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SML4662X
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	DAPHNE TEO CHENG LIAN
NRIC No	J420D
Email Address	
Mobile Phone No	
Alternative Phone No	

VEHICLE PARTICULARS

Manufacturer	Mazda
Model	6
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	2000

INSURANCE COMPANY

Name of Insurance Company	Income Insurance Limited
Policy Number / Cover Note Number	5144975794

DRIVER

Name of Driver	TEO HEE YEOW
NRIC No	
Date Of Birth	
Occupation	Indoor



Driving Pass Date	09/05/1995
Driving experience	29 YEARS AND 2 MONTHS
Gender	Male
Mobile Number	
Alt. Phone Number	
Email Address	
Address	
Address complement	
Postcode	
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Spouse
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	
Insurance Company of Other Vehicle Owned by Driver	

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Chain Collision
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	3
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	Yes
Translator's name	
Translator's ID	
Translator's phone number	
Translator's email	
Original language used in the statement	

PASSENGER 1

Name	DAPHNE TEO CHENG LIAN
Gender	Female

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	

CIRCUMSTANCES OF ACCIDENT

I was driving along Sheares link towards Sheares Avenue on the right lane while slow moving. As my vehicle passed along the yellow box, suddenly I felt a hard impact coming from the left side rear of my vehicle and discovered that the taxi SHD6313S that was exiting from Bayfront avenue had failed to check for on coming traffic and collided onto my left side rear vehicle. And due to the impact my vehicle had moved slightly forward and hit onto SMD9248T that was in the queuing on the left lane. I managed to take some photos and exchange details with both parties, no injuries was involved at the scene.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHD6313S
-----------------------------	----------

 Accident report SN0724770003

Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	-
Name of Driver	Taxi
NRIC No	NG BENG SOON
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	1

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SMD9248T
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	-
Name of Driver	Private car
-	Irewan bin Abdul Rahman
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	3

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with any claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims, (collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process any Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature - Date & Time

Driver's Signature (if driver is not the policyholder) - Date & Time

09/07/2024
13:50hrs


Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)
Muhammad Sumardi Bin Mohd Attandi
S995530

Sketch Plan

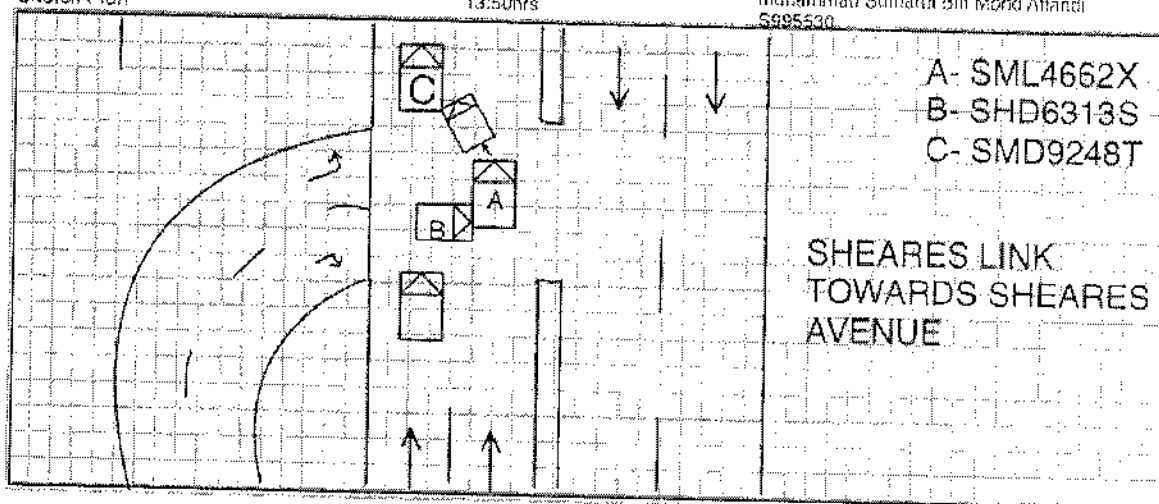

Describe Circumstance of the Accident

REFER TO GEARS

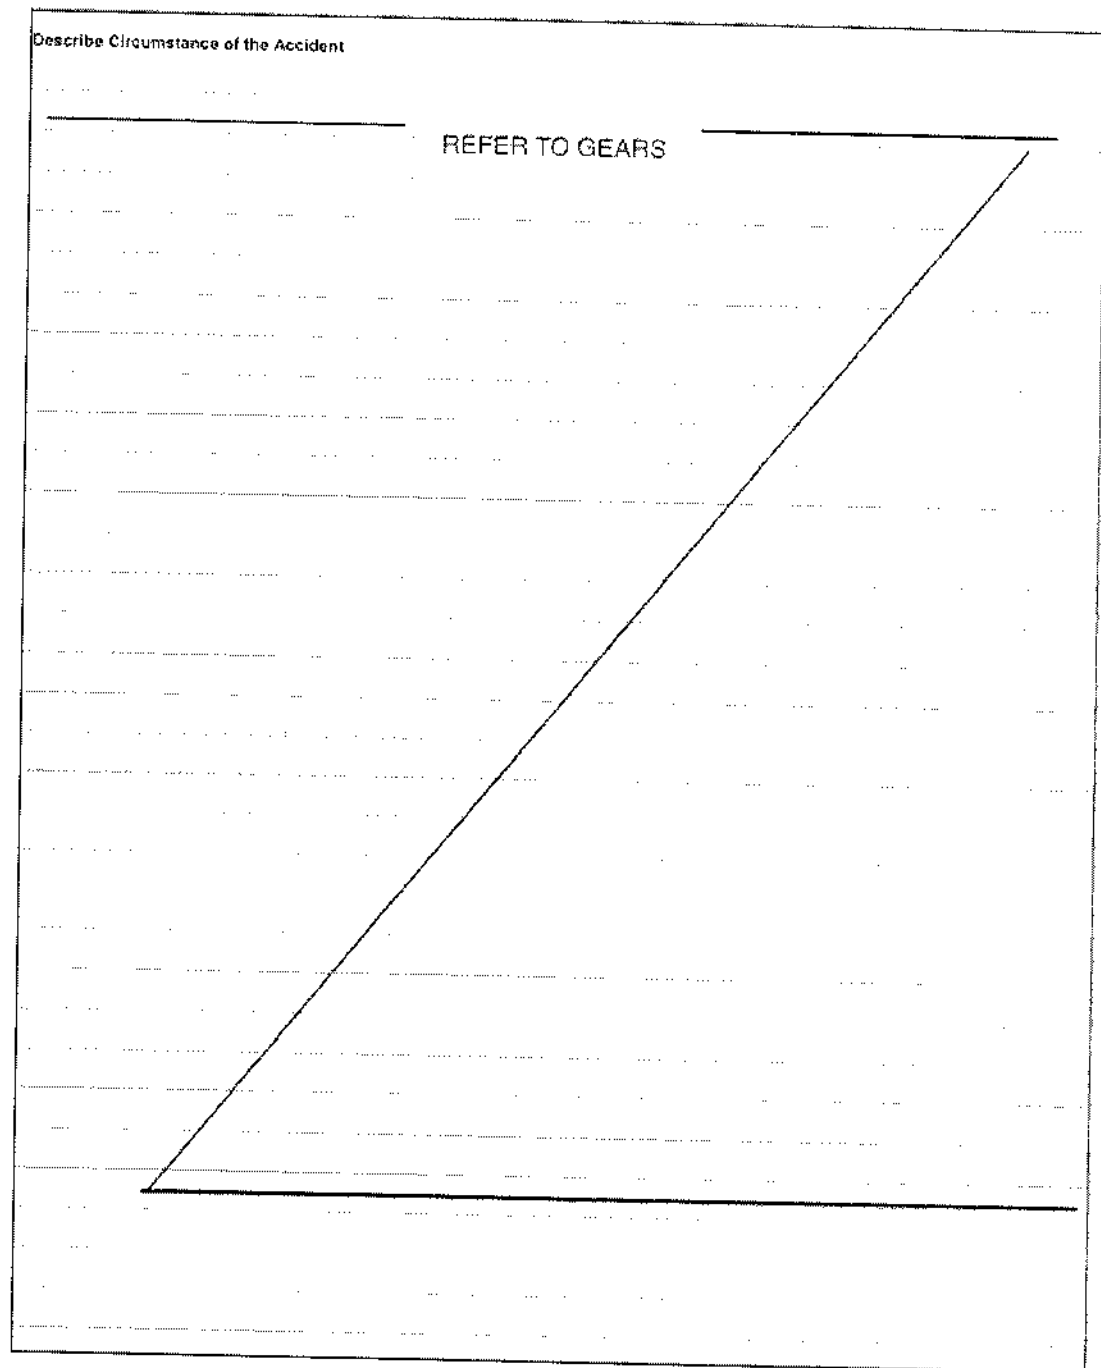

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

08/07/2024
13:50hrs



Witnessed by Reporting Centre Personnel:
(Name as in NRIC card)

Muhammad Sumardi Bin Mohd Alfandi
S995530


PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

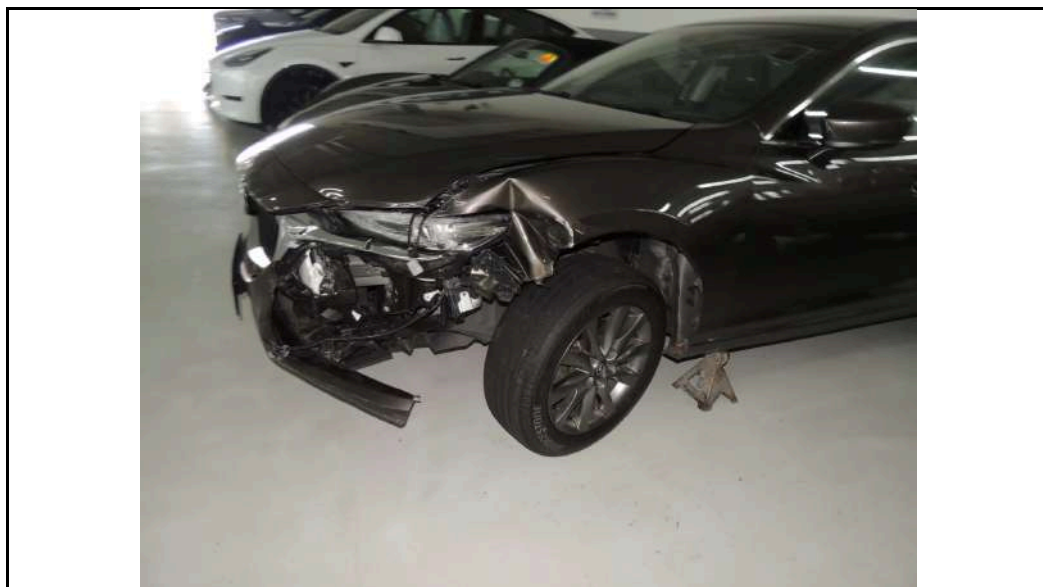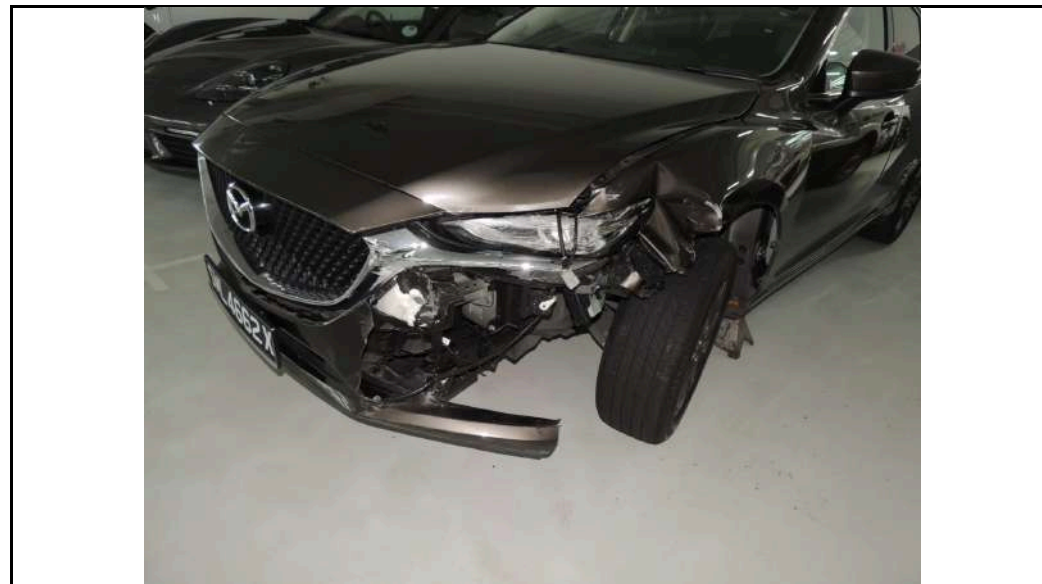

PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

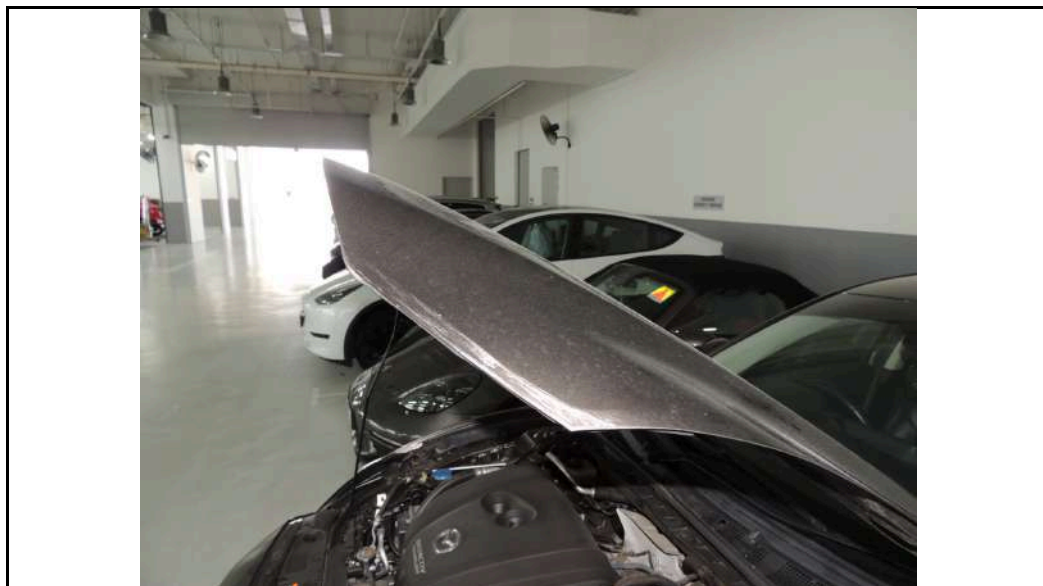


PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z





PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

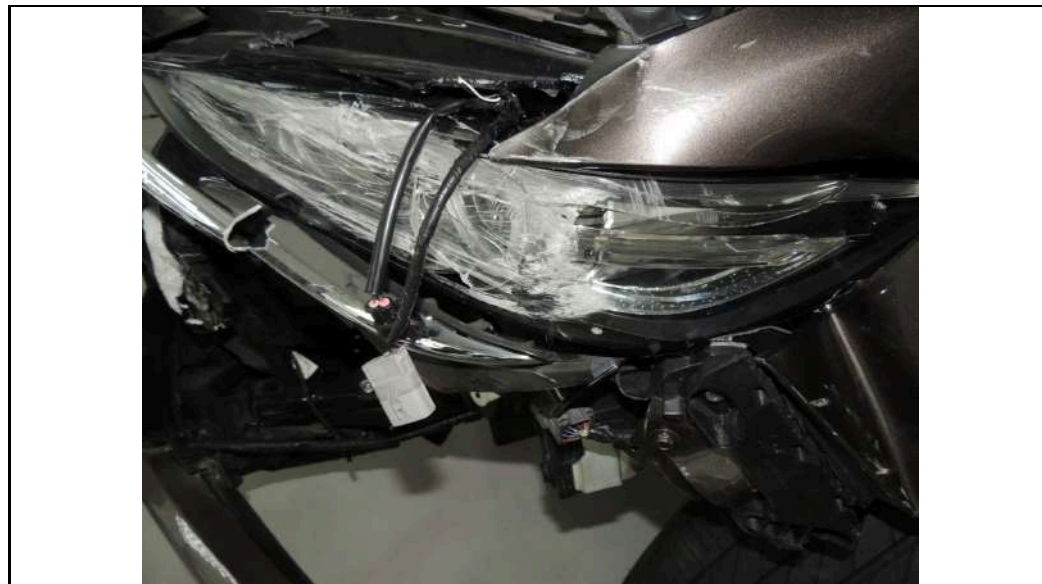


PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

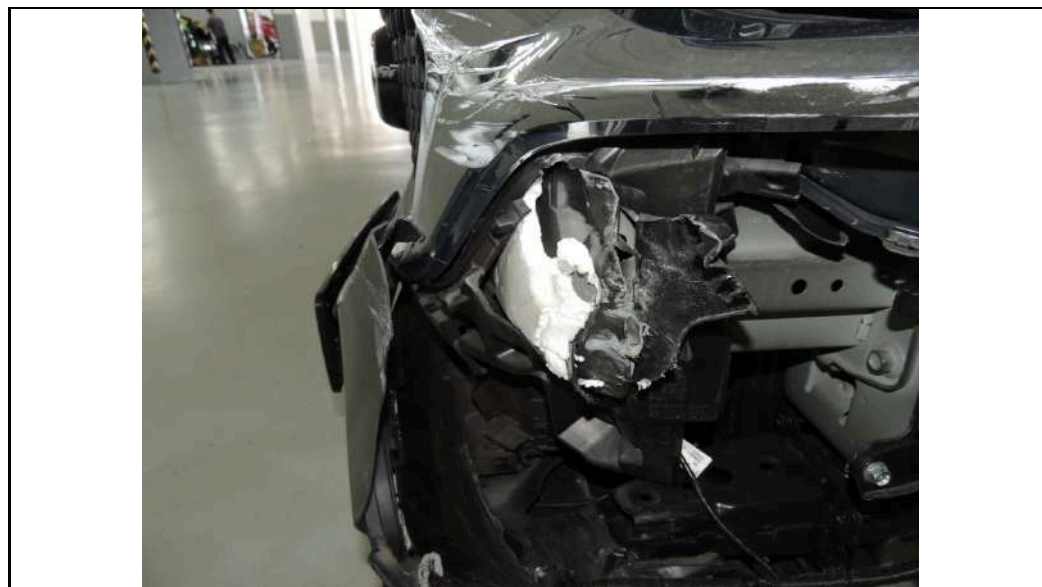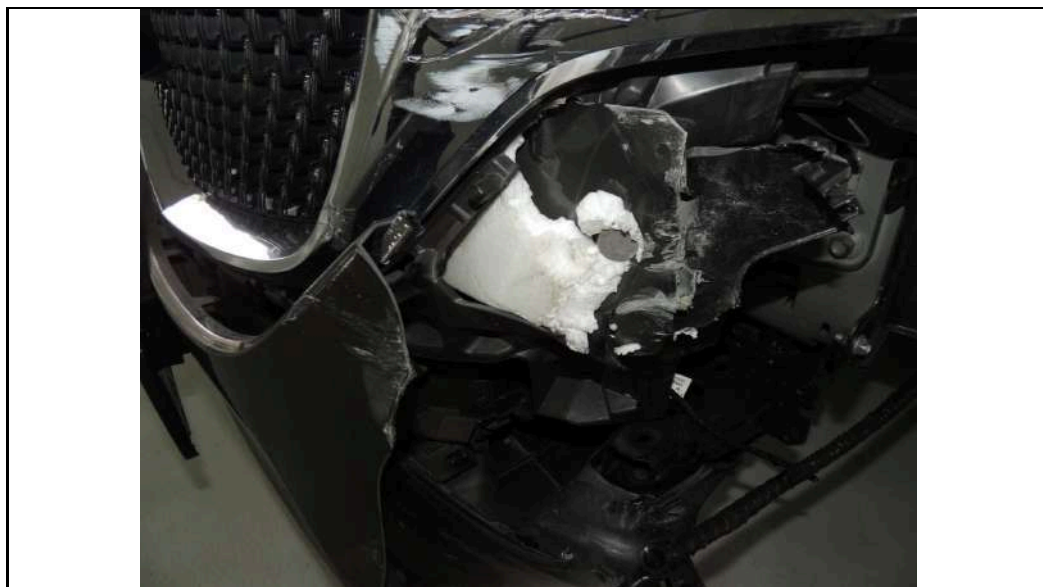

PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

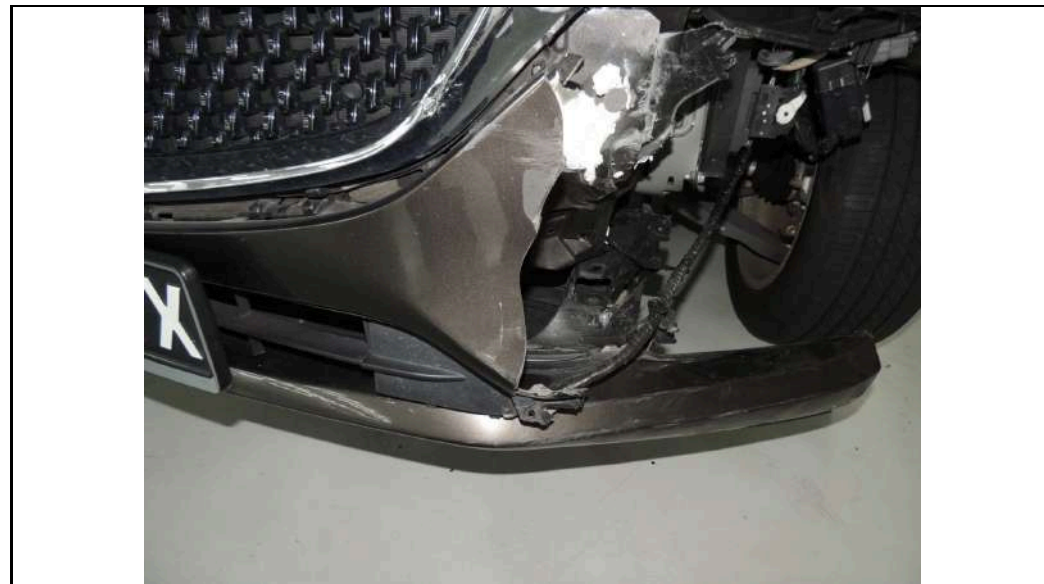

PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z




PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

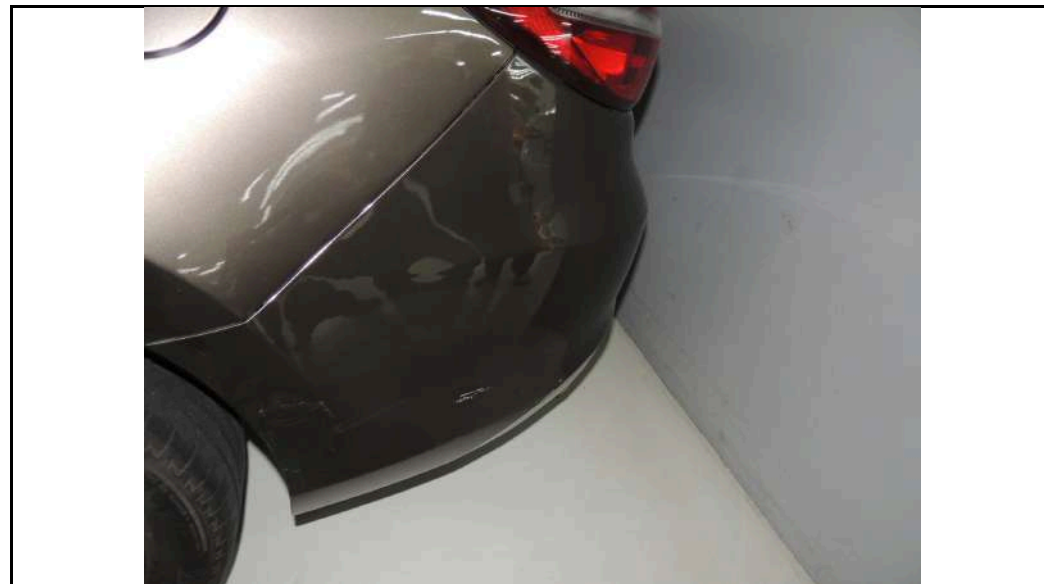

PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z




PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z




PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

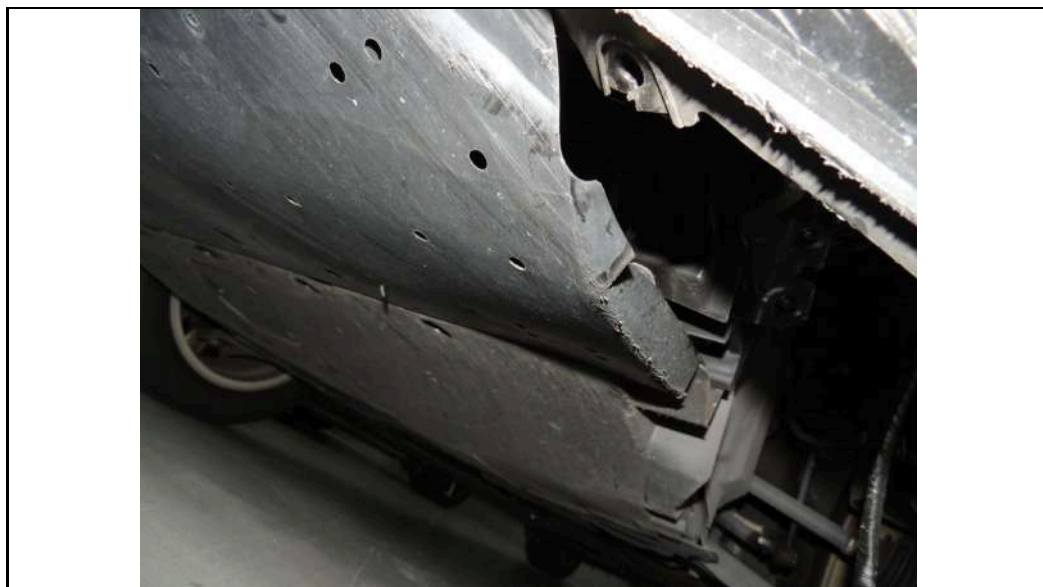



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z




PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

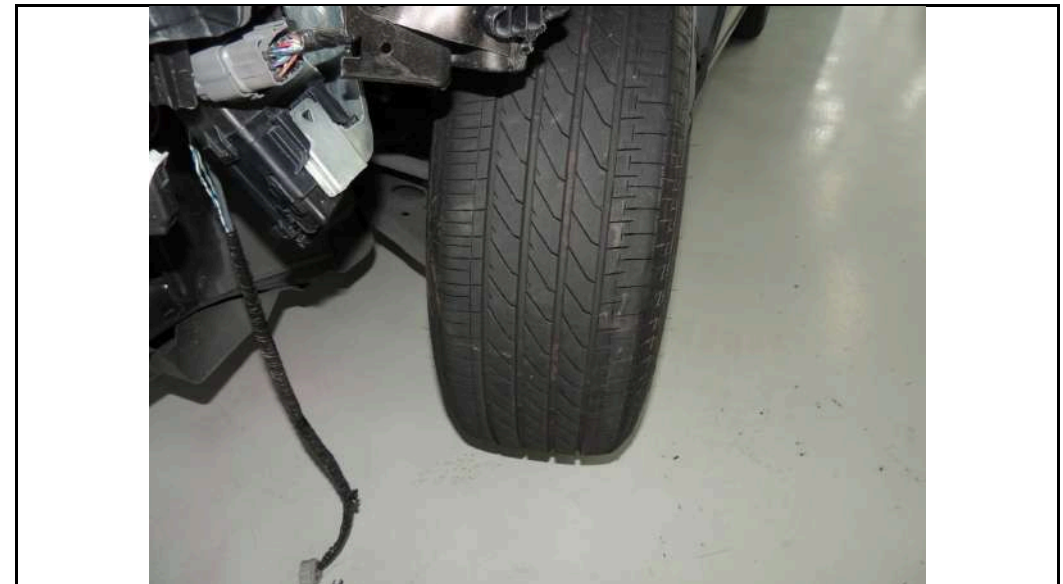



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

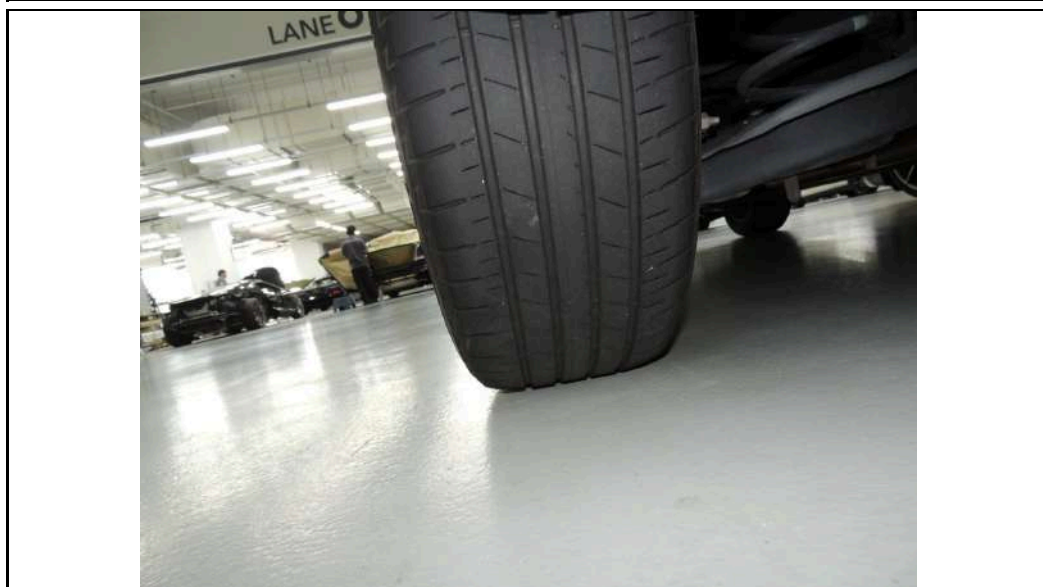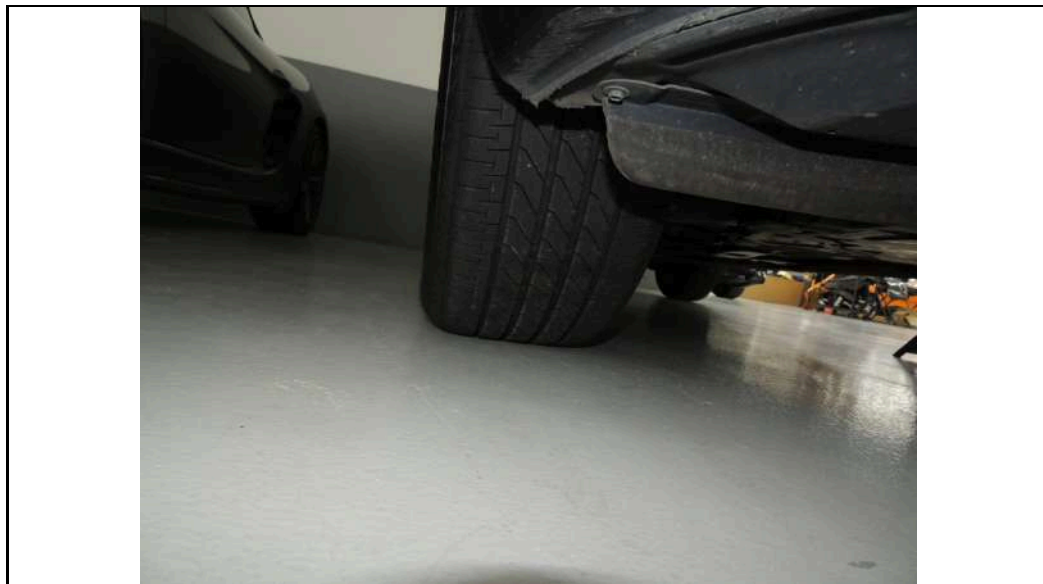

PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

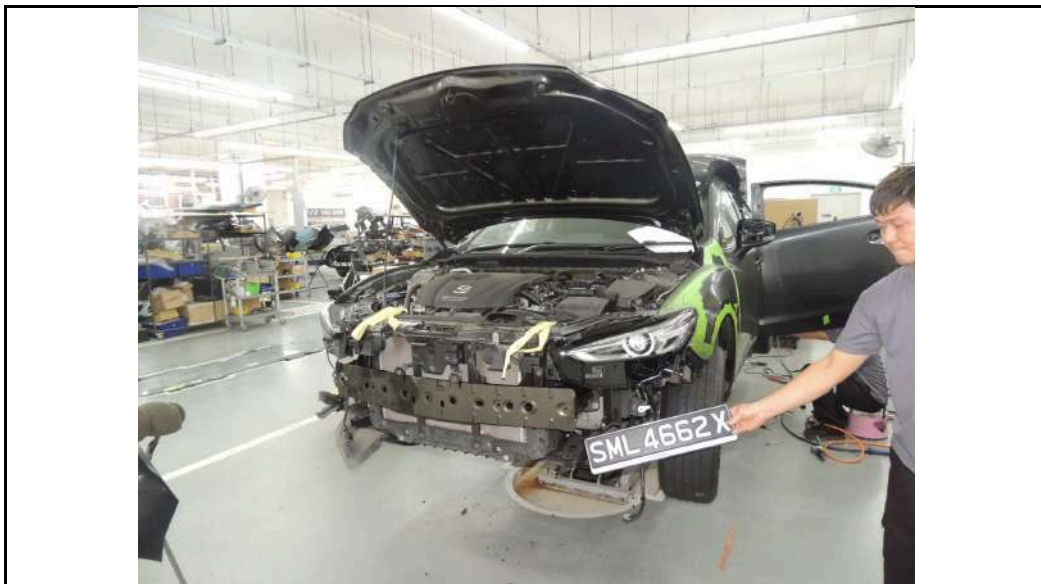

PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

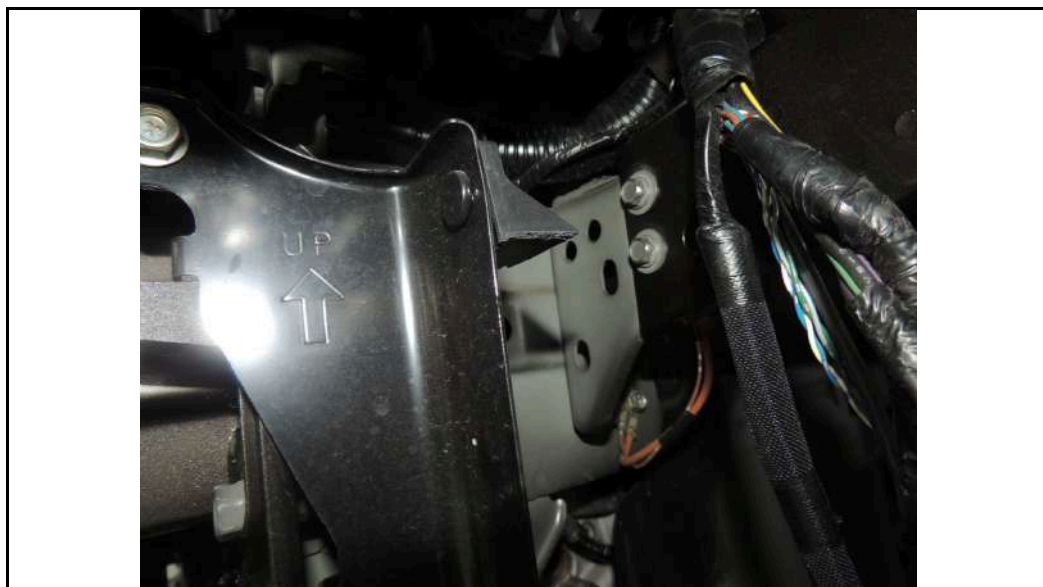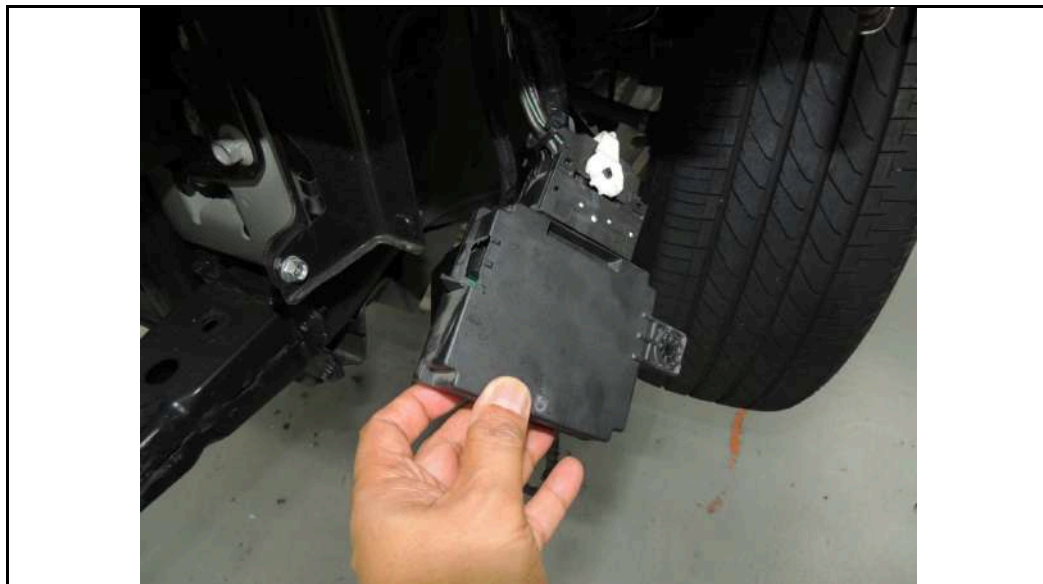

PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z



PHOTOGRAPHS FOR VEHICLE NO. : SML 4662Z

