

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

MS FIRST CAPITAL INSURANCE LTD
16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING

SINGAPORE 048581

INV No. : SAC2401689
INV Date : 06-12-2024

Reference CD/FCI24060051/Rma3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLF 4091L
Insured Veh. SHB 3351L
Claim No. D24005160MFCT/CCPL/TPD-2
Policy No. D-24101860MFCT
Accident Date 07/06/2024
Inspection Date 19/06/2024

Description	Amount
Survey Inspection	350.00
Resurvey Inspection	0.00
Digital Photographs	0.00
Transportation	0.00
Sub-Total	350.00
GST (9%)	31.50
Grand Total	381.50

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS MS FIRST CAPITAL INSURANCE LTD 16 RAFFLES QUAY #42-01 HONG LEONG BUILDING SINGAPORE 048581		Ref:	CD/FCI24060051/Rma3q2	
		Date:	06/12/2024	
		Code:	FCI2	
1. Policy Particulars :- DIRECT SETTLEMENT				
Insured Veh.	SHB 3351L	Veh. Inspected	SLF 4091L	
Policy No.	D-24101860MFCT	Coverage	0	
Claim No.	D24005160MFCT/CCPL/TPD-2	Excess	\$0.00	
Assign From	ERIC WOO	Assign Date	11/06/2024	
2. Vehicle Details				
Make & Model	HONDA HRV 1.5 LX CVT	C.C	1496	
Engine No.	L15B4530240	Year of Reg.	25/08/2016	
Chassis No.	JHMRU1830GX200239	Colour	ORANGE	
Odometer	47486 KM	Steering	IN ORDER	
Brakes	IN ORDER	General	FAIR	
Modification(s)	RIMS: SPORTS RIM			
3. Conditions of Tyres				
	Size	Make	Balance (mm)	
R/H Front Tyre	215/60 R16	YOKOHAMA	6	
L/H Front Tyre	215/60 R16	YOKOHAMA	6	
R/H Rear Tyre	215/60 R16	YOKOHAMA	6	
L/H Rear Tyre	215/60 R16	YOKOHAMA	6	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	07/06/2024	Inspection Date	19/06/2024	
Survey held at	255 ALEXANDRA ROAD SINGAPORE 159937			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR: 7 Working Days				



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SLF 4091L

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REVERSE SENSOR (SN)	NOT NECESSARY	\$320.00	\$0.00
2	WINDSCREEN SEALANT (SN)	NOT NECESSARY	\$120.00	\$0.00
14	CLIP BUMPER (SN)	NECESSARY	\$24.15	\$24.15
1	EMBLEMRR (SN)	NOT NECESSARY	\$12.07	\$0.00
1	EMBLEM RR I-VTEC (SN)	NOT NECESSARY	\$13.12	\$0.00
1	FACE RR BUMPER (SN)	DEFORMED	\$370.80	\$370.80
1	REFLECTOR ASSYR RR (SN)	SERVICEABLE	\$141.90	\$0.00
1	REFLECTOR ASSYL RR (SN)	NOT NECESSARY	\$141.90	\$0.00
1	SPACER R RR BUMPER SIDE (SN)	NECESSARY	\$13.87	\$13.87
1	SPACER L RR BUMPER SIDE (SN)	NECESSARY	\$13.87	\$13.87
1	FACER RR BUMPER CORNER (SN)	CRACKED	\$79.42	\$77.10
1	PROTECTOR RR WHEEL ARCH (SN)	DEFORMED	\$148.05	\$138.15
1	PANEL COMP RR (SN)	SERVICEABLE	\$305.47	\$0.00
1	PANEL SETR RR OUTSIDE (SN)	BENT	\$518.17	\$503.10
1	SUNDRIES (SN)	NECESSARY	\$110.00	\$30.00
1	DISK ALUMINIUM WHEEL (SN) (ADDITIONAL)	CUT	\$639.67	\$639.67
2	SCREW TAPPING 5X20 (SN) (ADDITIONAL)	NECESSARY	\$6.45	\$6.45
3	CLIPINNER FENDER (SN) (ADDITIONAL)	NECESSARY	\$0.90	\$0.90
4	CLIP INNER FENDER (SN) (ADDITIONAL)	NECESSARY	\$8.40	\$8.40
1	OUTLETRR AIR (SN) (ADDITIONAL)	CRACKED	\$20.62	\$20.62
1	SEALANT FOR RHR FENDER (SN) (ADDITIONAL)	NOT NECESSARY	\$120.00	\$0.00
			\$3,128.83	\$1,847.08

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	WHEEL ALIGNMENT ((ADDITIONAL)		\$220.00	\$220.00
	BODY UNDERSIDE COATING		\$520.00	\$520.00
	SEALANT FOR TAILGATE	NOT NECESSARY	\$120.00	\$0.00
	SEALANT FOR REAR END PANEL	NOT NECESSARY	\$120.00	\$0.00
	INSPECT RR LIGHTING MECHANISMS PERFORM WATER		\$250.00	\$220.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	REMOVE & RENEW REVERSE SENSORS		\$250.00	\$220.00
	APPLY BODY UNDERSIDE COATING		\$520.00	\$120.00
	REMOVE & INSTALL RR WINDSCREEN	NOT NECESSARY	\$650.00	\$0.00
	WINDSCREEN DAMKIT	NOT NECESSARY	\$120.00	\$0.00
	REMOVE & INSTALL REVERSE CAMERA & CALIBRATION	NOT NECESSARY	\$650.00	\$0.00
	RESET VEHICLE SMART KEY ACCESS/ENTRY SYSTEM		\$650.00	\$580.00
	REMOVE & INSTALL REAR COMPARTMENT LININGS		\$650.00	\$650.00
	REMOVE & TRANSFER ITEMS TO NEW TAILGATE ADJUST &	NOT NECESSARY	\$650.00	\$0.00
	SPRAY PAINTING ON REPAIRED OR RELACED AREAS		\$4,000.00	\$2,080.00
	CUT OFF & RENEW RR PANEL STRAIGHTEN RR FENDERS AN		\$5,000.00	\$2,600.00
			\$14,370.00	\$7,210.00
GRAND TOTAL			\$17,498.83	\$9,057.08
RECOMMENDED COST OF REPAIRS				\$9,057.08
Report Ref No: CD/FCI24060051/Rma3q2				

DEAR ALL,

KINDLY ARRANGE FOR A SURVEY ON 19/06/2024
OWNER LEAVING CAR AT 1230PM

THANK YOU AND HAVE A NICE DAY,☐

BEST REGARDS,
NG SIN HAI
SENIOR SERVICE ADVISOR
MANDAI BODY REPAIR & PAINT

HONDA SINGAPORE
KAH MOTOR CO. SDN. BHD.
255 ALEXANDRA ROAD, SINGAPORE 159937
DID/MOBILE: 6471 5419 / 9072 1769

MRB

MOHAMMED RASUL BIN MOHD YUNUS


DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.


PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L




PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L

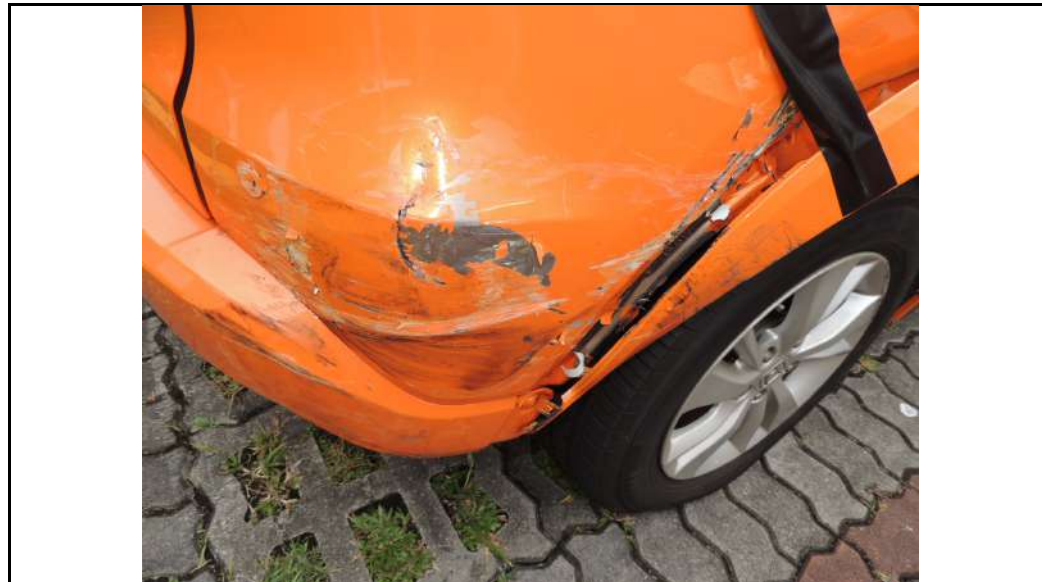

PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L

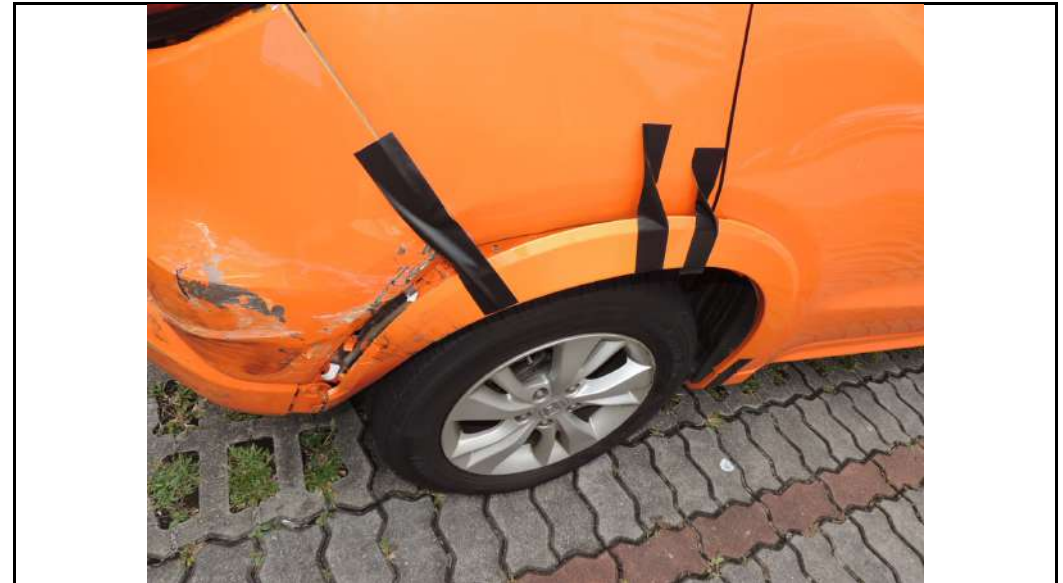

PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L

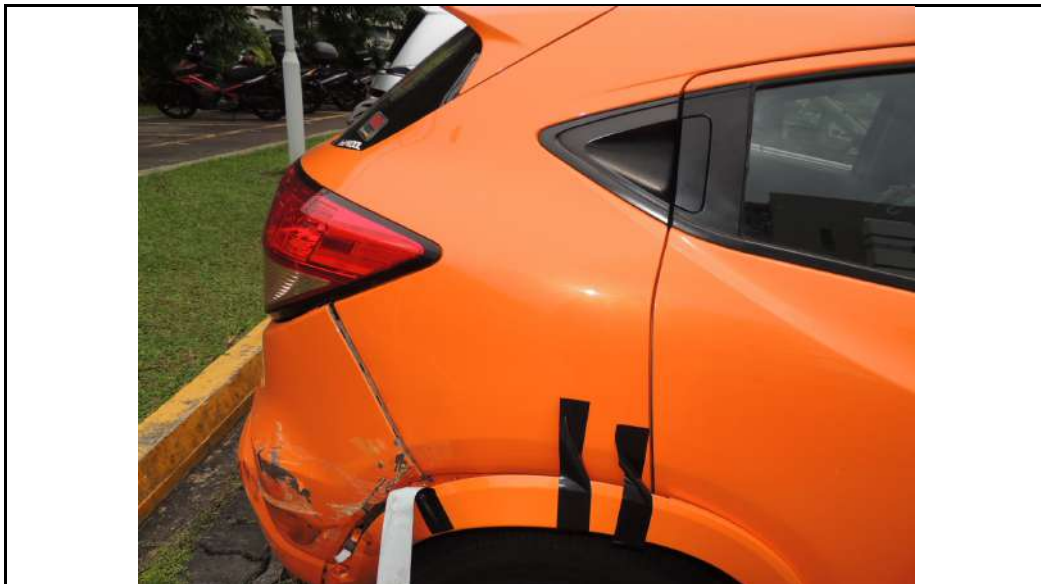


PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L





PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L



PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L

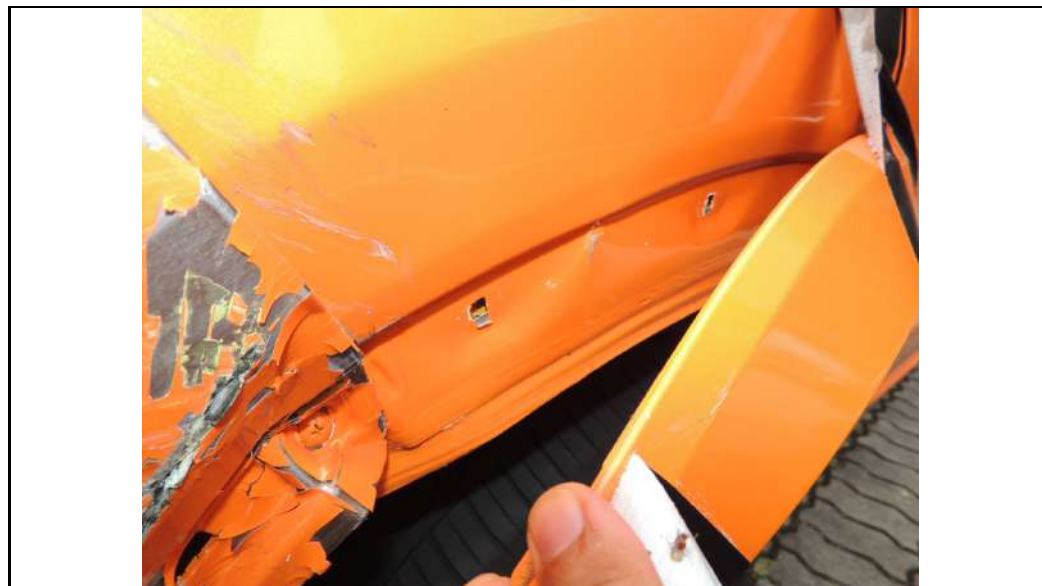

PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L

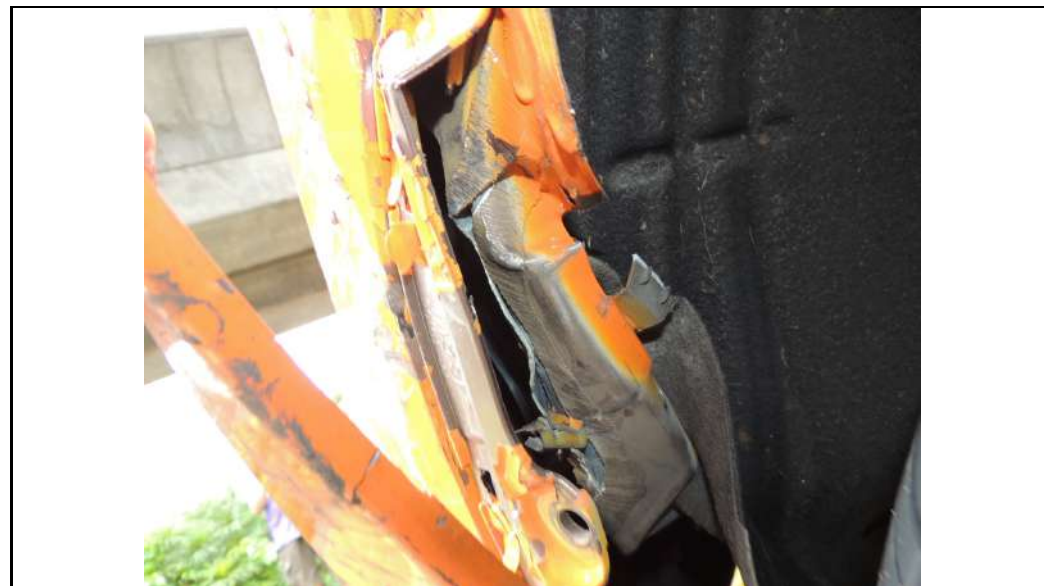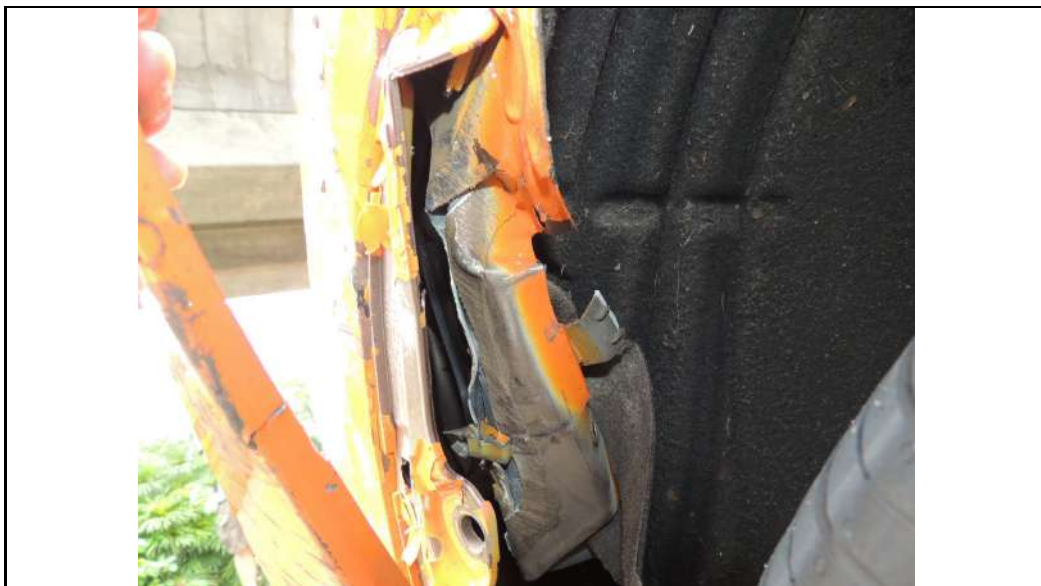

PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 10 of 10)

PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L



PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L



PHOTOGRAPHS FOR VEHICLE NO. : SLF 4091L

