

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. : SAC2401777

INV Date : 10-12-2024

Reference CD/CTI24070328/Aua3q2

Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMX 5566X
Insured Veh. XE 7447M
Claim No. SNM24D203745
Policy No. DMCVSNA00097142302
Accident Date 23/06/2024
Inspection Date 15/07/2024

Description	Amount
Third Party Express Settlement	400.00
Sub-Total	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS CHINA TAIPING INSURANCE (S) PTE LTD	Ref:	CD/CTI24070328/Aua3q2
3 ANSON ROAD #16-00	Date:	10/12/2024
SPRINGLEAF TOWER SINGAPORE 079909	Code:	CTI

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	XE 7447M	Veh. Inspected	SMX 5566X
Policy No.	DMCVSNA00097142302	Coverage	0
Claim No.	SNM24D203745	Excess	\$0.00
Assign From	JENNY LEW	Assign Date	22/07/2024

2. Vehicle Details

Make & Model	HONDA JAZZ 1.5 VTIR CVT ABS D/AIRBAG 2WD	C.C	1498
Engine No.	L15B31190040	Year of Reg.	
Chassis No.	JHMGK5850HX200080	Colour	ORANG
Odometer	225671 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: SPORTS RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	185/60 R15	YOKOHAMA	6
L/H Front Tyre	185/60 R15	YOKOHAMA	6
R/H Rear Tyre	185/60 R15	YOKOHAMA	6
L/H Rear Tyre	185/60 R15	YOKOHAMA	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	23/06/2024	Inspection Date	15/07/2024
Survey held at	HD PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 4 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SMX 5566X

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR BUMPER	DEFORMED	\$710.30	\$495.00
2	REAR BUMPER SIDE COVER GARNISH @\$24.10	NOT NECESSARY	\$48.20	\$0.00
2	REAR BUMPER SIDE RETAINER@\$35.20	NOT NECESSARY	\$70.40	\$0.00
2	TAIL LAMP @\$247.70	NOT NECESSARY	\$495.40	\$0.00
2	REAR FENDER INNER COWLING @\$78.10	NOT NECESSARY	\$156.20	\$0.00
2	REAR FENDER INNER TRIM @\$298.90	NOT NECESSARY	\$597.80	\$0.00
1	TAIL GATE	DENTED	\$984.90	\$984.90
1	TAIL GATE	NOT NECESSARY	\$24.70	\$0.00
1	TAIL GATE EMBLEM JAZZ	NECESSARY	\$39.40	\$39.40
1	TAIL GATE OUTER MOULDING	NOT NECESSARY	\$197.10	\$0.00
2	TAIL GATE WINDSCREEN MOULDING @\$76.00	NECESSARY	\$152.00	\$152.00
2	TAIL GATE DAMPER @\$104.70	NOT NECESSARY	\$209.40	\$0.00
1	TAIL GATE INNER HOLDER	NOT NECESSARY	\$32.10	\$0.00
2	TAIL GATE STOPPER @\$15.20	NOT NECESSARY	\$30.40	\$0.00
1	TAIL GATE INNER LOCK	DAMAGED	\$169.40	\$169.40
1	TAIL GATE LOCK CATCH	NOT NECESSARY	\$25.00	\$0.00
1	TAIL GATE WEATHERSTRIP	CUT	\$134.50	\$134.50
1	TAIL GATE INNER TRIM	CRACKED	\$246.20	\$246.20
2	TAIL GATE BUZZER @\$134.10	NECESSARY	\$268.20	\$268.20
1	TAIL GATE DETECTOR	CRACKED	\$347.60	\$347.60
1	REAR END PANEL	DENTED	\$396.80	\$396.80
1	REAR END PANEL TOP GARNISH	DEFORMED	\$116.20	\$116.20
	LESS 20.00% DISCOUNT		(\$1,090.44)	(\$670.04)
			\$4,361.76	\$2,680.16
Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	\$50.00	\$0.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	\$80.00	\$30.00
1	SET REAR BUMPER SIDE COVER GARNISH CLIP (SN)	NOT NECESSARY	\$50.00	\$0.00
1	TAIL GATE SEALANT (SN)	NOT NECESSARY	\$150.00	\$0.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	SET TAIL GATE OUTER MOULDING CLIP (SN)	NOT NECESSARY	\$30.00	\$0.00
1	SET TAIL GATE TRIM CLIP (SN)	NECESSARY	\$50.00	\$30.00
1	TAIL GATE WINDSCREEN SEALANT (SN)	NECESSARY	\$80.00	\$40.00
1	TAIL GATE WINDSCREEN INNER SEAL (SN)	NECESSARY	\$60.00	\$30.00
1	SET TAIL LAMP CLIP (SN)	NOT NECESSARY	\$30.00	\$0.00
1	SET REAR FENDER INNER COWLING (SN)	NOT NECESSARY	\$50.00	\$0.00
1	SET REAR FENDER INNER TRIM CLIPS (SN)	NOT NECESSARY	\$50.00	\$0.00
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	\$150.00	\$60.00
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	\$40.00	\$20.00
			\$870.00	\$210.00

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	PANE BEATING ,REMOVING AND REPLACING PARTS		\$1,800.00	\$900.00
	SPRAY PAINTING TO AFFECTED AREA		\$1,400.00	\$700.00
	TUFF COAT		\$250.00	\$80.00
	WIRING CHECK		\$180.00	\$30.00
	REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY AND ROOF LINING TO FACILITATE REPAIR		\$250.00	\$60.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING		\$80.00	\$50.00
	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING		\$80.00	\$50.00
	REMOVE AND REFIX TAILGATE WINDSCREEN		\$120.00	\$120.00
	TRANSFER TAILGATE MECHANISM		\$80.00	\$60.00
	CONDUCT WATER LEAKAGE TEST	NOT NECESSARY	\$80.00	\$0.00
	REMOVE AND REFIX VIDEO CAMERA		\$120.00	\$50.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS RESET MEMORIES TO SPECIFICATION ETC	NOT NECESSARY	\$180.00	\$0.00
			\$4,620.00	\$2,100.00

GRAND TOTAL			\$9,851.76	\$4,990.16
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			\$4,000.00
Report Ref No: CD/CTI24070328/Aua3q2				



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

LWP

ADRIAN LING WAI PING

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X



PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X



PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X



PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X



PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X



PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X



PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315


Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 4 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X



PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X

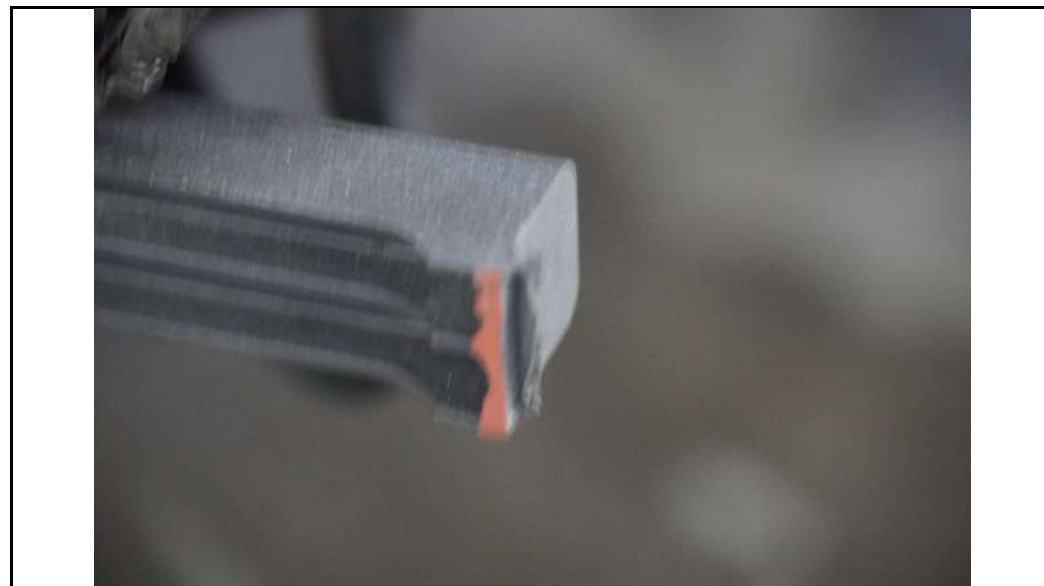

PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X



PHOTOGRAPHS FOR VEHICLE NO. : SMX 5566X

