

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. : SAC2401038

INV Date : 17-10-2024

Reference CD/LPC24080026/Uma3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SKK 633K
Insured Veh. GBE 743P
Claim No. 23/24/24/VC05/029625
Policy No. Z23VC05019485
Accident Date 31/07/2024
Inspection Date 02/08/2024

Description	Amount
Third Party Express Settlement	450.00
Sub-Total	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS LONPAC INSURANCE BHD	Ref:	CD/LPC24080026/Uma3q2
300 BEACH ROAD	Date:	17/10/2024
#17-04/07 THE CONCOURSE SINGAPORE 199555	Code:	LPC2

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	GBE 743P	Veh. Inspected	SKK 633K
Policy No.	Z23VC05019485	Coverage	0
Claim No.	23/24/24/VC05/029625	Excess	\$0.00
Assign From	CHARMAINE KONG	Assign Date	02/08/2024

2. Vehicle Details

Make & Model	MINI ONE 3DR HB (LCI)	C.C	1499
Engine No.	F409H929B38A15A	Year of Reg.	26/11/2018
Chassis No.	WMWXR12030TE87510	Colour	GREEN
Odometer	88421 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: SPORTS RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	215/45R17	VREDESTEIN	6
L/H Front Tyre	215/45R17	VREDESTEIN	6
R/H Rear Tyre	215/45R17	VREDESTEIN	6
L/H Rear Tyre	215/45R17	VREDESTEIN	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	31/07/2024	Inspection Date	02/08/2024
Survey held at	ZOOM AUTOWERKS PTE LTD 130 BEDOK RESERVOIR ROAD #08-1339 EUNOS SPRING		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 4 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SKK 633K

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	FRONT BONNET	DENTED / BENT	\$1,150.00	\$1,150.00
1	SET FRONT BONNET STRIP STICKER	NECESSARY	\$296.00	\$296.00
1	FRONT BONNET LOCK	NOT NECESSARY	\$145.00	\$0.00
1	FRONT BONNET SIDE ARCH GARNISH	NOT NECESSARY	\$255.00	\$0.00
1	FRONT HEADLAMP RH	CRACKED	\$1,455.00	\$1,455.00
1	FRONT HEADLAMP CHROME RIM	CRACKED	\$285.00	\$285.00
1	FRONT GRILLE ASSY	NOT NECESSARY	\$425.00	\$0.00
1	FRONT BUMPER	CUT/ TORN	\$855.00	\$855.00
1	FRONT BUMPER FOG LAMP	NOT NECESSARY	\$255.00	\$0.00
1	FRONT BUMPER FOG LAMP COVER	NOT NECESSARY	\$125.00	\$0.00
1	FRONT BUMPER SIDE RETAINER	NOT NECESSARY	\$58.00	\$0.00
1	FRONT FENDER RH	TO REPAIR SEE LABOUR	\$535.00	\$0.00
1	FRONT FENDER OUTER ABSORBER RH	CUT	\$165.00	\$165.00
1	FRONT FENDER EMBLEM	NOT NECESSARY	\$98.00	\$0.00
1	FRONT WHEEL RIM	TO REPAIR SEE LABOUR	\$1,020.00	\$0.00
1	FRONT WHEEL HUB WITH BEARING	NOT NECESSARY	\$620.00	\$0.00
1	FRONT SHOCK ABSORBER	NOT NECESSARY	\$750.00	\$0.00
1	FRONT KNUCKLE ARM	NOT NECESSARY	\$580.00	\$0.00
1	FRONT LOWER ARM	NOT NECESSARY	\$520.00	\$0.00
	LESS 5.00% DISCOUNT		(\$479.60)	(\$210.30)
			\$9,112.40	\$3,995.70

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	\$80.00	\$40.00
1	SET FRONT FENDER INNER SHIELD CLIP (SN)	NOT NECESSARY	\$50.00	\$0.00
1	FRONT TYRE	NOT NECESSARY	\$450.00	\$0.00
			\$580.00	\$40.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO CHECK WIRING AND RESET HEADLAMPS FOCUSING		\$80.00	\$20.00
	TO REMOVE AND REFIT FRONT UNDERCARRIAGE	NOT NECESSARY	\$250.00	\$0.00
	TO CONDUCT WHEEL ALIGNMENT	NOT NECESSARY	\$150.00	\$0.00
	TO APPLY UNDERCOATING		\$100.00	\$40.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT FENDER RH AND FRONT WHEEL RIM.		\$1,300.00	\$400.00
	TO RESPRAY PAINTING ON THE AFFECTED AREAS		\$1,200.00	\$650.00
			\$3,080.00	\$1,110.00
GRAND TOTAL			\$12,772.40	\$5,145.70
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			\$4,100.00
Report Ref No: CD/LPC24080026/Uma3q2				

CKS

MARCUS CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 3 of 18)

PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K




PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K

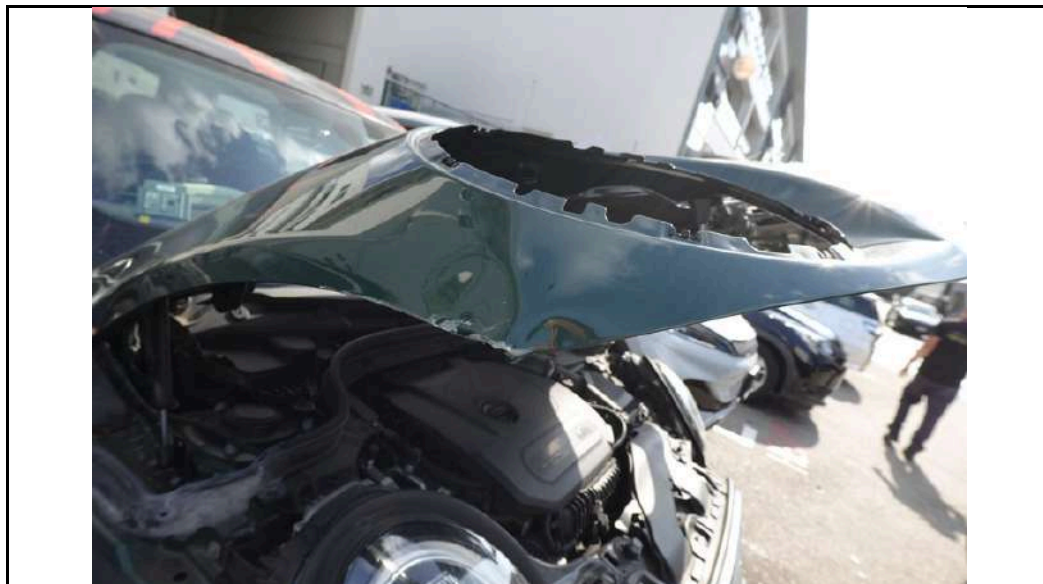

PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K




PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K

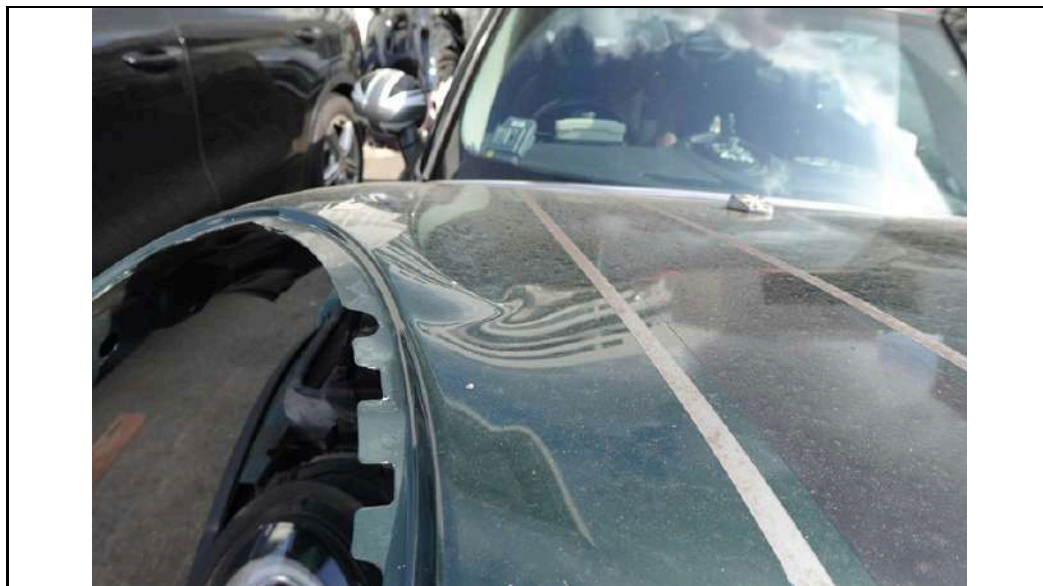

PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 6)

PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K



PHOTOGRAPHS FOR VEHICLE NO. : SKK 633K

