



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2507856

3 ANSON ROAD #16-00

INV Date 17/11/2025

SPRINGLEAF TOWER

Reference CD/CTI24080126/Kpa3q2

SINGAPORE 079909

Code CTI

ATTN: Pauline Tham

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 910H

Insured Veh. SKK 9237L

Claim No. SNM24D204394

Policy No. DMPCSNW00059792400

Accident Date 01/08/2024

Inspection Date 06/08/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909 ATTN: Pauline Tham			Ref: CD/CTI24080126/Kpa3q2(N) Date: 17/11/2025 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SKK 9237L	Veh. Inspected	SHD 910H
	Policy No.	DMPCSNW00059792400	Coverage (\$)	0.00
	Claim No.	SNM24D204394	Excess (\$)	0.00
	Assign From	PAULINE THAM	Assign Date	06/08/2024
2. Vehicle Particulars & Condition				
	Make & Model	RENAULT LATITUDE (A)	c.c	1995
	Engine No.	HIDDEN	Year of Reg.	2017
	Chassis No.	VF1ABL15AUC283392	Colour	M.P. WHITE / RED
	Odometer	347754 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/60 R16	ARISUN	7 mm
	L/H Front Tyre	215/60 R16	ARISUN	7 mm
	R/H Rear Tyre	215/60 R16	ARISUN	9 mm
	L/H Rear Tyre	215/60 R16	ARISUN	9 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	01/08/2024	Inspection Date	06/08/2024
	Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 910H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT	BUCKLED / CRACKED	747.20	747.20
1	BUMPER BRACKET KIT FRT RH	SERVICEABLE	101.40	-
1	BUMPER RETAINER FRT RH	CRACKED	101.40	101.40
1	BUMPER FOG LAMP GRILLE RH	SERVICEABLE	207.21	-
1	RADIATOR GRILLE FRAME	SERVICEABLE	686.00	-
1	FRAME FULL SUPPORT PANEL	SERVICEABLE	592.70	-
1	FENDER PANEL FRT RH	BENT	437.10	437.10
1	FENDER PANEL INNER FRT RH	TO REPAIR SEE LABOUR	838.40	-
1	WHEELARCH FRT RH	DISTORTED	191.40	191.40
1	WIPER RESERVOIR	DENTED	179.60	179.60
1	HEADLAMP RH	MOUNTING CRACKED	743.60	743.60
	LESS 10% DISCOUNT		-482.60	-240.03
			4,343.41	2,160.27
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	FENDER LINER CLIP (SN)	NECESSARY	65.00	65.00
			131.00	131.00
	<u>LABOUR</u>			
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		3,000.00	440.00
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF FENDER PANEL INNER FRT RH.		3,000.00	400.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	30.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
			6,560.00	950.00
	GRAND TOTAL		11,034.41	3,241.27

Report Ref No. CD/CTI24080126/Kpa3q2(N)



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,600.00
---	--	--	-----------------

Report Ref No. CD/CTI24080126/Kpa3q2(N)

KONG SENG CHEONG

Licensed Appraiser


DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SHD 910H



PHOTOGRAPHS FOR VEHICLE NO. : SHD 910H

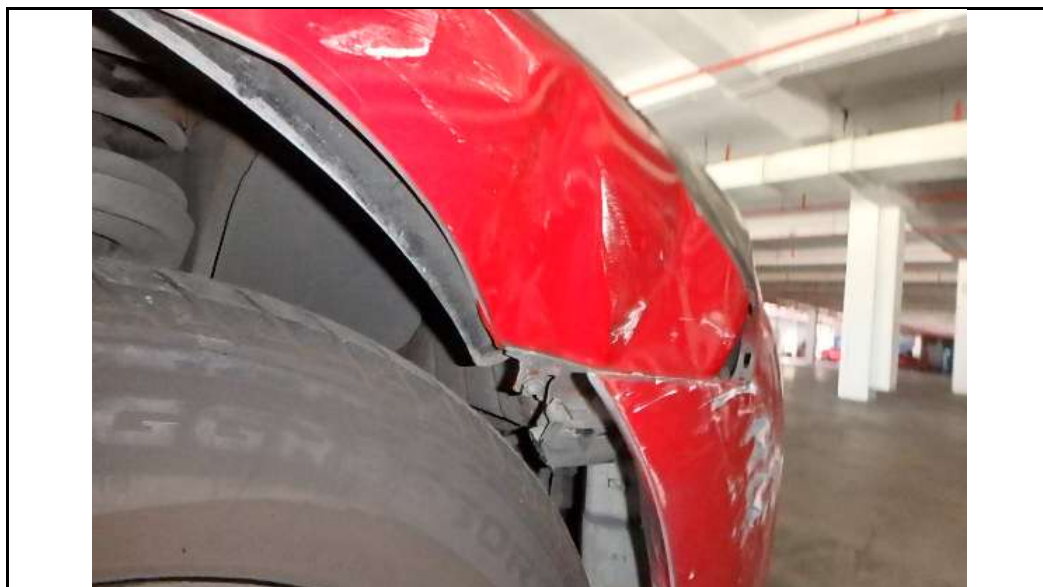

PHOTOGRAPHS FOR VEHICLE NO. : SHD 910H



PHOTOGRAPHS FOR VEHICLE NO. : SHD 910H





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SHD 910H



PHOTOGRAPHS FOR VEHICLE NO. : SHD 910H

