

105

ASS. REC. BY:

REF:

162/ TP

CS/TP1700 7633/Krbn2

Janice

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

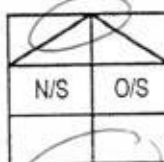

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 30 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: 314B9797U Yr Regn: 07, 13

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Perant Caribide c.c. 1995

Colour M. White / Red A/C: Insured / Std / NI / NA

Sp. Reading 841877 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: VFIABL15AUC 273417

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 215/60R16

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Long Long

Front 2 mm Rear 2 mm

R/Bal. 2 mm L/Bal. 2 mm

L/Bal. 2 mm D.O.A. 6/4/17 D.O.I. 10/4/17

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

& M

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
1914	At 1914 to Colborne
	SHB 9797U - 003/171616011066/Kub3q2
	to summt 61 Long & 311c
	Red: \$68.80 @ 23, 69% 170 + 1695
	50
	51
	80
	2046
	89x15 = 1335
	170 + 1335
	50
	51
	80
	1686

Date/Time, File Pass to?

☐ : Preli. Report

1) typist

☒ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: 30

Resurvey No. of Trip: -

Add Fee: ☐ : Site Insp (\$)

☐ : Interview (\$)

☐ : Tech. Invs (\$)

☐ : Weekend (\$)

Survey Fee:

Transportation:

\$ + RS. SI

Photos

Others

TOTAL

Report Format: TP - 1 dependent

Lump Sum / L.B.1: (\$ 3112)

89x15 = 1335

170 + 1335

50

51

80

1686



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
TRANS-CAB AUTO SERVICES PTE LTD		Ref : CS/TP17007633/Krb	
NO.2 ANG MO KIO STREET 63SINGAPORE 569111		Date : 19-04-2017	
		Code : TP378	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	Veh. Inspected		SHB 9797U
Policy No.	Coverage (\$)		0.00
Claim No.	Excess (\$)		0.00
Assign From	Assign Date		10/04/2017
2. Vehicle Particulars & Condition			
Make & Model	c.c		0
Engine No. HIDDEN	Year of Reg.		
Chassis No.	Colour		
Odometer	Steering		
Brakes	Modification		
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	06/04/2017	Inspection Date	10/04/2017
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	07/04/2017 10:45
Date Of Accident	06/04/2017 20:30
Exact Location Of Accident	TPE (SLE) BEFORE EXIT 5
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB9797U
Insured/Policyholder	
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Co Reg No	200303878K
Email Address	CLAIMS@TRANSCAB.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-62876666

Vehicle Particulars

Manufacturer	RENAULT
Model	LATITUDE-2.0 D DCI (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	VPX/P1680520
Cover Note Number	

Driver

Name of Driver	NG YONG SEAH
NRIC No	S1218255D
Date Of Birth	12/09/1956
Occupation	OUTDOOR
Date Of Driving Pass	12/09/1956
Driving Experience	60 YEARS AND 6 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90271856
Fax Number	
Contact Number	
EMail Address	NOEMAIL

Address	BLK 458 JURONG WEST STREET 41 #11-720
Postcode	640458
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	- - -
Insurance Company of Driver's Own Vehicle	- - -

General Information of the Accident

Type Of Accident	COLLISION- CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	YES
Foreign Vehicle Registration Number	RM5288 (PRIVATE CAR)
Was any body injured in the Accident?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	TRAFFIC POLICE DIVISION HQ
Police Station Address	ROAD: 10 UBI AVENUE 3 , POSTCODE: 408865 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 65470000 - FAX NO:
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

Please refer to Police Report - T/20170407/2005

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHD7178J
Vehicle Make/Model/Colour	COMFORT TAXI
Details Of Properties	
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Details of Witness

Name

Phone Number

Email Address

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SJK1846T

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

DETAILS OF OTHER VEHICLE PROPERTY 3

Vehicle Registration Number RM5288

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

DETAILS OF OTHER VEHICLE PROPERTY 4

Vehicle Registration Number SHA8352G

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

DETAILS OF OTHER VEHICLE PROPERTY 5

Vehicle Registration Number SLL7783E

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

DETAILS OF OTHER VEHICLE PROPERTY 6

Vehicle Registration Number UNKNOWN

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

Sketch Plan Pg. 1

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Sketch Plan

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

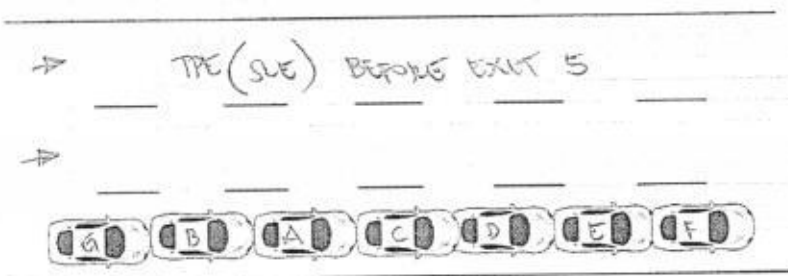

A: SHB9797U

B: SHD7178J

C: SDK1846T

D: RM 5288

E: SHH8352G

F: SLL7783E

G: UNKNOWN

Describe Circumstances of the Accident

PLS REFER TO POLICE REPORT

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date &
Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre
Personnel:



**SINGAPORE
POLICE FORCE**



T/20170407/2005

1 of 3

Police Station Of Origin:
Traffic Police Division HQ
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

Report No. T/20170407/2005

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 07/04/2017 00:48	Vide Report No.: G/20170406/0179	Station Diary No.:
--	-------------------------------------	--------------------

Informant's Particulars			
Name of Informant: NG YONG SEAH		Address: 458 JURONG WEST ST 41 #11-720 HDB JURONG WEST SINGAPORE 640458	
ID Type / ID No.: NRIC NO / S1218255D		Contact No.: Home/Office: Mobile: 90271856	
Nationality: SINGAPORE CITIZEN		Email:	
Sex: Male	Age: 60	Date of Birth: 12/09/1956	Type of Informant: Driver
Race: Chinese		Language:	Institution / School Name:
Occupation: Taxi driver		Driving Licence Information: Class: Date of Expiry:	

General Information of the Accident				
Type of Accident:	Non-Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 06/04/2017 20:30	Type of Location:
Location: Along Road 1 Traveling Toward Road 2 TAMPINES EXPRESSWAY SELETAR EXPRESSWAY BEFORE EXIT 5				
Weather:		Road Surface:	Road Speed Limit:	
Traffic Flow:		Traffic Control:	Traffic Volume:	
Type of Collision:			Anyone conveyed by ambulance: No	

Details of Vehicle Involved						
Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
RM5288	Car				Seriously Damaged	5
SHA8352G	Car				Seriously Damaged	1
SHB9797U	Car				Seriously Damaged	1
SHD7178J	Car				Seriously Damaged	1
SJK1846T	Car				Slightly Damaged	0

**SINGAPORE
POLICE FORCE**

Police Station Of Origin:
Traffic Police Division HQ
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000



T/20170407/2005

2 of 3

Report No. T/20170407/2005

CONTINUATION OF REPORT

Details of Vehicle Involved						
Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SLL2783E	Car				Seriously Damaged	0

Brief Details.

AS ABOVE MENTION DATE TIME AND LOCATION,

I WAS TRAVELLING AT LOCATION MENTION WITH A PASSENGER LADY IN MY TAXI. AT THE TIME BEFORE THE ACCIDENT THE TRAFFIC WAS MOVING AS PER NORMAL, BUT SUDDENLY A CAR INFRONT OF ME SUDDENLY SLOW DOWN AND I TRIED TO BRAKE BUT IT WASN'T ON TIME AND I HIT ONTO THE CAR INFRONT AND FROM THE BACK THE TAXI (SHD7178J) HIT ONTO MY TAXI. MY PASSENGER IN MY TAXI WAS OK BUT SHE TOLD ME THAT SHE WILL GO FOR A CHCEK UP TO CHECK ON HERSELF WHETHER IS SHE REALLY OK OR NOT.



**SINGAPORE
POLICE FORCE**



T/20170407/2005

Police Station Of Origin:
Traffic Police Division HQ
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

3 of 3

Report No. T/20170407/2005

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report:
TP /
MUHAMMAD ALFIE AASRIQ BIN MOHAMMED
IRWAN

Signature Of Interpreter:
Not applicable

Officer In Charge Of Case:
TP / GIT /
Sgt RASHIDAH BINTE AZMAN
Contact No.: 65476216

Authentication Stamp
NP168

Signature Of Informant:

Date/Time:
07/04/2017 00:48

Classification Of Case:



**SINGAPORE
POLICE FORCE**

Signature:

Enquire PARF/COE Rebate for Registered Vehicle**Vehicle Owner Particulars**

Owner ID Type: Company

Owner ID: 3878K

Vehicle Details

Vehicle No.: SHB9797U

Vehicle to be Exported: Yes

Intended De-registration Date: 07 Apr 2017

Vehicle Make: RENAULT

Vehicle Model: LATITUDE 2.0L DCI AUTO D/AB 4DR

Primary Colour: Red

Manufacturing Year: 2013

Engine No.: M9R8839C000395

Chassis No.: VF1ABL15AUC273417

Maximum Power Output: 127.0 kW (170 bhp)

Open Market Value: \$19,998.00

Original Registration Date: 31 Jul 2013

First Registration Date: 31 Jul 2013

Transfer Count: 0

Actual ARF Paid: \$12,498.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 30 Jul 2021

PARF Rebate Amount: \$9,373.00

Intended COE Rebate Details

COE Expiry Date: 30 Jul 2021

COE Category: A - Car (1600cc & below)

COE Period(Years): 8

PQP Paid: \$51,810.00

COE Rebate Amount: \$27,924.00

Total Rebate Amount: \$37,297.00**Message**

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 07 Apr 2017

OK

Land Transport Authority

Please read through the Privacy Statement, Terms of Use and Disclaimer.

Please do not use the **Back** or **Forward** buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 6.0 SP3 and above, 1024 X 768 resolution

Copyright © 2017 LTA | [Privacy Statement](#) | [Terms of Use](#) | [Disclaimer](#) | [Rate the Website](#) | [Rate this e-Service](#)

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHB9797U - FCILNot Authorised
21 Aug 87

1704-083

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHB9797U - ROEL

VF1ABL15AUC273417

RENAULT

LATITUDE

06.04.2017

FCIL

		PART		LIST
1	1	BUMPER COVER FRT	\$	MIS 968.79 ✓
2	1	BUMPER SPOILER FRT	\$	MIS 139.81 ✓
3	1	BUMPER ABSORBER FRT	\$	T 303.60 ✓
4	1	BUMPER BRACKET FRT LH	\$	B 116.47 ✓
5	1	BUMPER RETAINER FRT LH	\$	CM 18.37 ✓
6	1	BUMPER BRACKET FRT RH	\$	B 115.98 ✓
7	1	BUMPER RETAINER FRT RH	\$	CM 18.37 ✓
8	1	BUMPER UNDERTRAY FRT	\$	CK 363.71 ✓
9	1	BUMPER GRILLE LOWER FRT	\$	MIS 205.23 ✓
10	1	BUMPER FOG LAMP GRILLE LH	\$	MIS 159.39 ✓
11	1	BUMPER FOG LAMP GRILLE RH	\$	MIS 159.39 ✓
12	1	BUMPER BEAM FRT	\$	B 703.14 ✓
13	1	RADIATOR GRILLE	\$	CM 1,313.68 ✓
14	1	RADIATOR GRILLE BADGE 'RENAULT'	\$	RM 173.36 ✓
15	1	RADIATOR GRILLE FRAME	\$	B.2 1,041.35 ✓
16	1	FRAME FULL SUPPORT PANEL	\$	CM 473.77 ✓
17	1	FRAME FULL SUPPORT BRACKET	\$	B 69.07 ✓
18	1	FRONT BRACE PANEL	\$	B 136.32 ✓
19	1	SUBFRAME OUTER FRT	\$	SL 2,040.34 X
20	1	SUBFRAME INNER FRT (crossmember)	\$	K 1,757.54 X
21	1	SUBFRAME SUPPORT INNER	\$	K 71.04 ✓
22	1	SUBFRAME BRACKET OUTER LH	\$	K 71.04 X
23	1	SUBFRAME BRACKET OUTER RH	\$	K 71.04 X
24	1	SUBFRAME BRACKET INNER LH	\$	K 138.44 X
25	1	SUBFRAME BRACKET INNER RH	\$	K 138.44 X
26	1	LOWER ARM RH	\$	SL 527.51 X
27	1	BRAKE DISC FRT	\$	SL 211.91 X
28	1	KUNCKLE ARM RH	\$	SL 651.53 X
29	1	KUNCKLE HUB+BEARING RH	\$	SL 382.84 X
30	1	KUNCKLE ARM SHIELD RH	\$	SL 101.10 X
31	1	KUNCKLE ARM PLATE RH	\$	SL 133.89 X

12776.46

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHB9797U - FCIL

1704-083

32	1	BRAKE DISC FRT	\$	211.91	
33	1	ABSORBER FRT RH	\$	277.34	
34	1	ABSORBER MOUNTING KIT RH	\$	338.97	
35	1	ABSORBER DUST COVER	\$	175.94	
36	1	STABILIZER BAR FRT	\$	465.12	
37	1	STABILIZER LINK FRT	\$	90.17	
38	1	BRAKE CALIPER FRT RH	\$	505.34	
39	1	BRAKE CALIPER BRACKET FRT RH	\$	427.01	
40	1	ABS SENSOR FRT RH	\$	196.73	
41	1	BRAKE HOSE FRT RH	\$	96.70	
42	1	DRIVESHAFT RH	\$	1,344.19	
43	1	LOWER ARM LH	\$	527.51	
44	1	BRAKE DISC FRT	\$	211.91	
45	1	KUNCKLE ARM LH	\$	651.53	
46	1	KUNCKLE HUB+BEARING LH	\$	382.84	
47	1	KUNCKLE ARM SHIELD LH	\$	101.10	
48	1	KUNCKLE ARM PLATE LH	\$	133.89	
49	1	BRAKE DISC FRT	\$	211.91	
50	1	ABSORBER FRT LH	\$	277.34	
51	1	ABSORBER MOUNTING KIT LH	\$	338.97	
52	1	ABSORBER DUST COVER	\$	175.94	
53	1	STABILIZER BAR FRT	\$	465.12	
54	1	STABILIZER LINK FRT	\$	90.17	
55	1	BRAKE CALIPER FRT LH	\$	505.34	
56	1	BRAKE CALIPER BRACKET FRT LH	\$	427.01	
57	1	ABS SENSOR FRT LH	\$	196.73	
58	1	BRAKE HOSE FRT LH	\$	96.70	
59	1	DRIVESHAFT LH	\$	1,344.19	
60	1	SEATBELT BUCKLE RH	\$	730.61	x
61	1	SEATBELT RH	\$	2,250.28	✓
62	1	SEATBELT BUCKLE LH	\$	730.61	x
63	1	SEATBELT LH	\$	2,250.28	✓
64	1	PASSENGER AIRBAG	\$	2,624.93	✓
65	1	PASSENGER AIRBAG COMPUTER	\$	969.09	✓
66	1	PASSENGER AIRBAG SENSOR	\$	557.41	✓
67	1	STEERING AIRBAG	\$	1,942.89	✓
68	1	STEERING AIRBAG SENSOR	\$	222.54	✓
69	1	STEERING AIRBAG COMPUTER	\$	969.09	x
70	1	ROTARY SWITCH	\$	963.93	✓

24429.28

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHB9797U - FCIL**1704-083**

71	1	DASHBOARD	\$	3,769.65	✓
72	1	GLOVE BOX	\$	Sm 799.83	✓
73	1	GLOVE BOX FLAP	\$	Sm 983.82	✓
74	1	HEADLAMP LH	\$	Bu 911.10	✓
75	1	HEADLAMP RH	\$	Bu 911.10	✓
76	1	HEADLAMP HARNESS RH	\$	R 714.07	✓
77	1	HEADLAMP HARNESS LH	\$	R 714.07	✓
78	1	HEADLAMP PANEL FRT RH	\$	R 134.59	✓
79	1	HEADLAMP PANEL FRT LH	\$	R 134.59	✓
80	1	BONNET	\$	R 1,493.56	✓
81	1	BONNET INSULATOR	\$	Reform 312.10	✓
82	1	BONNET STRUT LH	\$	Pr 166.29	✓
83	1	BONNET STRUT RH	\$	Pr 166.29	✓
84	1	BONNET HINGE LH	\$	D.Y 267.93	✓
85	1	BONNET HINGE RH	\$	D.Y 267.93	✓
86	1	BAL HOOD	\$	R 75.60	✓
87	1	BONNET LOCK	\$	B 234.99	✓
88	1	BONNET CABLE	\$	Tu 91.69	✓
89	1	BONNET CABLE COVER	\$	M 123.87	✓
90	1	BONNET SEAL OUTER	\$	W 71.04	✓
91	1	FENDER PANEL FRT LH	\$	Bu 602.95	✓
92	1	FENDER PANEL FRT RH	\$	Bu 602.95	✓
93	1	FENDER WHEELARCH FRT LH (Linner)	\$	Tu 107.32	✓
94	1	FENDER WHEELARCH FRT RH (Linner)	\$	Tu 214.49	✓
95	1	FENDER INSULATOR RH	\$	R 100.64	✓
96	1	FENDER INSULATOR LH	\$	R 100.64	✓
97	1	FENDER PANEL BRACKET FRT RH	\$	R 161.52	✓
98	1	FENDER PANEL BRACKET FRT LH	\$	R 161.52	✓
99	1	WHEEL HOUSING PANEL FRT RH	\$	R 3,601.61	✓
100	1	WHEEL HOUSING PANEL FRT LH	\$	R 3,601.61	✓
101	1	FENDERCHASSIS REINFORCEMENT FRT LH	\$	K 765.90	✓
102	1	FENDERCHASSIS REINFORCEMENT FRT RH	\$	R 765.90	✓
103	1	RADIATOR	\$	B 924.77	✓
104	1	RADIATOR FAN COWLING	\$	CM 573.80	✓
105	1	RADIATOR FAN MOTOR LH	\$	R 676.48	✓
106	1	RADIATOR FAN MOTOR RH	\$	R 676.48	✓
107	1	RADIATOR HOSE UPPER	\$	R 168.22	✓
108	1	RADIATOR HOSE LOWER	\$	R 343.48	✓
109	1	AIR CLEANER HOSE	\$	R 58.57	✓

26552.96

26553.27

TRANS-CAB AUTO SERVICES PTE LTD**1704-083**

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHB9797U - FCIL

110	1	AIR CLEANER LOWER	\$	<i>Sum</i> 311.95 X
111	1	ENGINE UNDERTRAY	\$	<i>Revised</i> 434.60 X
112	1	A/C CONDENSER	\$	<i>Revised</i> 1,554.13 ✓
113	1	A/C CONDENSER GARNISH LH UPPER	\$	<i>Sum</i> 27.74 ✓
114	1	A/C CONDENSER GARNISH RH UPPER	\$	<i>Sum</i> 27.74 ✓
115	1	A/C CONDENSER GARNISH LH	\$	<i>Sum</i> 41.12 ✓
116	1	A/C CONDENSER GARNISH RH	\$	<i>Sum</i> 41.68 ✓
117	1	A/C PIPE CONDENSER TO COMPRESSOR	\$	<i>Sum</i> 145.73 ✓
118	1	A/C PIPE CONDENSER TO EXPENSION VALVE	\$	<i>Sum</i> 460.64 ✓
119	1	A/C PIPE COMPRESSOR	\$	<i>Sum</i> 233.77 ✓
120	1	A/C PIPE	\$	<i>Sum</i> 460.64 ✓
121	1	TRANSMISSION COOLER	\$	<i>Sum</i> 852.66 X
122	1	AIR INTERCOOLER HOSE (LONG)	\$	<i>Sum</i> 709.18 ✓
123	1	AIR INTERCOOLER HOSE (Short)	\$	<i>Sum</i> 262.34 X
124	1	STEERING PUMP ELECTRIC	\$	<i>Sum</i> 1,543.08 X
125	1	STERING HOSE LOW PRESSURE LONG	\$	<i>Sum</i> 442.50 ✓
126	1	STERING HOSE LOW PRESSURE	\$	<i>Sum</i> 247.18 X
127	1	WINDSCREEN FRT	\$	<i>CNT</i> 1,005.56 ✓
128	1	WIPER RESERVOIR	\$	<i>Sum</i> 190.96 X
129	1	WIPER RESERVOIR NECK	\$	<i>Sum</i> 27.78 X
130	1	WIPER RESERVOIR MOTOR	\$	<i>Sum</i> 100.95 X
131	1	DOOR PANEL FRT LH	\$	<i>Revised</i> 2,188.20 X
132	1	DOOR MIRROR LH	\$	<i>Sum</i> 1,141.08 X
133	1	DOOR SEAL FRT LH	\$	<i>Sum</i> 50.92 X
134	1	DOOR PANEL FRT RH	\$	<i>Revised</i> 2,188.20 X
135	1	DOOR MIRROR RH	\$	<i>Sum</i> 1,141.08 X
136	1	DOOR SEAL FRT RH	\$	<i>Sum</i> 50.92 X
137	1	BUMPER COVER REAR	\$	<i>Revised</i> 852.66 ✓
138	1	BUMPER BRACKET CTR REAR	\$	<i>CNT</i> 87.29 ✓
139	1	BUMEPR BRACKET SIDE LH REAR (Taillamp lower)	\$	<i>CNT</i> 34.61 ✓
140	1	BUMEPR RETAINER LH REAR	\$	<i>CNT</i> 104.59 ✓
141	1	BUMEPR BRACKET SIDE RH REAR (Taillamp lower)	\$	<i>CNT</i> 34.61 ✓
142	1	BUMEPR RETAINER RH REAR	\$	<i>CNT</i> 104.59 ✓
143	1	BUMPER LOWER REAR	\$	<i>Sum</i> 591.41 ✓
144	1	BUMPER BEAM REAR	\$	<i>Revised</i> 598.08 ✓
145	1	BUMPER BEAM BRACKET LH REAR	\$	<i>Revised</i> 173.81 ✓
146	1	BUMPER BEAM BRACKET RH REAR	\$	<i>Revised</i> 173.81 ✓
147	1	BUMPER REFLECTOR LH	\$	<i>CNT</i> 33.55 ✓
148	1	BUMPER REFLECTOR RH	\$	<i>CNT</i> 33.55 ✓

18704.89

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHB9797U - FCIL**1704-083**

149	1	BOOT REAR	\$	R ₁	2,209.75	✓
150	1	BOOT FINISHER	\$	S ₁	361.58	X
151	1	BOOT LOCK	\$	R ₁	155.90	✓
152	1	BOOT LOCK CATCH	\$	R ₁	57.23	✓
153	1	BOOT WHEATERSTRIP	\$	C ₁	248.50	✓
154	1	BOOT REFLECTOR LAMP LH	\$	R ₁	379.50	✓
155	1	BOOT REFLECTOR LAMP RH	\$	S ₁	379.50	X
156	1	BOOT BADGE 'RENAULT'	\$	R ₁	173.35	✓
157	1	BOOT BADGE	\$	R ₁	173.35	✓
158	1	BOOT STRUT LH	\$	S ₁	212.36	X
159	1	BOOT STRUT RH	\$	S ₁	212.36	X
160	1	BOOT HINGE LH	\$	R	282.96	X
161	1	BOOT HINGE RH	\$	R	282.96	X
162	1	BOOT RUBBER PLUG	\$	S ₁	170.63	X
163	1	TAILLAMP LH	\$	M ₁ C ₁ R ₁	425.04	✓
164	1	TAILLAMP PANEL LH	\$	R	759.00	X
165	1	TAILLAMP RH	\$	M ₁ C ₁ R ₁	425.04	✓
166	1	TAILLAMP PANEL RH	\$	R ₁	759.00	✓
167	1	FENDER PANEL REAR LH	\$	R	2,537.80	X
168	1	FENDER PANEL REAR RH	\$	R ₁	2,537.80	✓
169	1	FENDER WHEELARCH REAR LH (Linner)	\$	S ₁	418.06	✓
170	1	FENDER WHEELARCH REAR RH (Linner)	\$	S ₁	418.06	X
171	1	SPARE WHEEL PANEL (Luggage Floor Panel)	\$	R ₁ R ₁	1,684.52	✓
172	1	SPARE WHEEL PANEL TRIM (Luggage Floor Panel)	\$	R ₁	470.93	✓
173	1	OUTER PANEL REAR (End Panel)	\$	R ₁	1,132.13	✓
174	1	OUTER PANEL REAR (End Panel)TRIM	\$	C ₁ R ₁	308.48	✓
175	1	EXHAUST REAR	\$	R ₁	5,760.00	✓
176	1	EXHAUST CAP REAR	\$	R ₁	177.30	✓

23113.09

TOTAL	\$	79,690.98	10562.668
10%	\$	7,969.10	
	\$	71,721.88	95064.01

Specical Nett

1	1SET	RADIATOR GRILLE FRAME CLIP	\$	R ₁	52.00	✓
2	1SET	BUMPER CLIP FRT	\$	R ₁	66.00	✓
3	1	TOW COVER FRT	\$	M ₁ S	14.50	✓
4	1SET	RADIATOR GRILLE SCREW	\$	R ₁	16.00	✓
5	1SET	BUMPER GRILLE LOWER CLIP	\$	R ₁	69.00	✓

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHB9797U - FCIL**1704-083**

6	1SET	FRAME FULL SUPPORT PANEL CLIP	\$	70.00	✓
7	2	FRAME FULL SUPPORT PANEL NUT	\$	20.00	✓
8	2	FRAME FULL SUPPORT PANEL STUD	\$	30.00	✓
9	2	BONNET CABLE CLIP	\$	6.40	✓
10	1SET	WHEELARCH CLIP LH	\$	30.50	✓
11	1SET	WHEELARCH CLIP RH	\$	29.40	✓
12	2	Front windscreen sealant	\$	80.00	4052
13	2	Front windscreen moulding	\$	100.00	✓
14	2	"E.R.P" Sticker	\$	65.00	2612
15	1	DOOR STICKER "Trans-cab"	\$	80.00	✓
16	1	DOOR STICKER "Classic"	\$	30.00	✓
17	1	DOOR STICKER "6555-3333"	\$	80.00	✓
18	1SET	NUMBER PLATE WITH HOLDER	\$	140.00	4512
19	1	DASHBOARD SCREW	\$	55.55	✓
20	1	CAP HUB RH FRT	\$	35.00	✓
21	1	RIM RH FRT	\$	385.00	✓
22	1	TYRE RH FRT	\$	330.00	✓
23	1	CAP HUB LH FRT	\$	35.00	✓
24	1	RIM LH FRT	\$	385.00	✓
25	1	TYRE LH FRT	\$	330.00	✓
26	1	CAP HUB LH RR	\$	35.00	✓
27	1	RIM LH RR	\$	385.00	✓
28	1	TYRE LH RR	\$	330.00	✓
29	1	CAP HUB LH RR	\$	35.00	✓
30	1	RIM LH RR	\$	385.00	✓
31	1	TYRE LH RR	\$	330.00	✓

TOTAL	\$	4,034.35
TOTAL PARTS	\$	75,756.23

Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same

\$ 8,400.00 28001

Putty and spray painting of the affected portion.

\$ 9,000.00 26401

To rust-proofing of the affected areas.

\$ 170.00 ✓

Towing Fees.

\$ 120.00 501

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHB9797U - FCIL**1704-083**

To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	380.00	1201
To check steering geometry and computer wheel alignment	\$	220.00	801
To transfer of tire, rim and on wheel balancing.	\$	170.00	X
To lift-up engine with gear box and refit.	\$	440.00	X
To dismantle and refit front end suspension, undercarriage parts, final checking and testing.	\$	380.00	X
To remove and renew engine and gear box mounting.	\$	380.00	X
To dismantle and refit engine cross-member and engine mounting.	\$	380.00	X
To remove and renew power steering pump, oil cooler pipe and final checking and testing.	\$	440.00	X
To remove and refit air bag system and reset.	\$	480.00	2801
To check ABS brake efficiency, final checking and testing.	\$	380.00	X
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	380.00	} 2501
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	380.00	
To Remove And Refit Front W/Screen Glass To Facilitate Bodywork Repair.	\$	170.00	1201
To Check Electrical Lighting Concerned.	\$	170.00	601
To reinstall rear bumper parking sensor.	\$	170.00	601

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHB9797U - FCIL**1704-083**

To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	170.00	} <i>201</i>
To repair and realign rear exhaust pipe.	\$	170.00	
To vacuum, replace, refix and recharge air condenser	\$	380.00	<i>1001</i>
To replace, refix and top up coolant for radiator	\$	170.00	<i>501</i>
To vacuum, replace, refix and recharge Air Intercooler	\$	170.00	<i>501</i>
To dismantle and refit aircon assy and attachment, vacuum and charge-in-gas.	\$	380.00	<i>1001</i>

TOTAL	\$	24,050.00
Over All Total	\$	99,806.23

< parts by parts > Repair Days

30 DAYS ✓

123148.36

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
TRANS-CAB AUTO SERVICES PTE LTD		Ref : CS/TP17007633/Krbn2		
NO.2 ANG MO KIO STREET 63SINGAPORE 569111		Date : 15-05-2018		
		Code : TP378		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	Veh. Inspected		SHB 9797U	
Policy No.	Coverage (\$)		0.00	
Claim No.	Excess (\$)		0.00	
Assign From	Assign Date		10/04/2017	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	VF1ABL15AUC273417	Colour	METALLIC WHITE / RED	
Odometer	841877	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	LING LONG	8 mm	
L/H Front Tyre	215/60 R16	LING LONG	8 mm	
R/H Rear Tyre	215/60 R16	LING LONG	8 mm	
L/H Rear Tyre	215/60 R16	LING LONG	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR AND FRONT PORTION.THE BODY STRUCTURE AFFECTED DUE TO COLLISION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/04/2017	Inspection Date	10/04/2017	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		30 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 9

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 9797U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BUMPER COVER FRT	MISSING	968.79	968.79
1	BUMPER SPOILER FRT	MISSING	139.81	139.81
1	BUMPER ABSORBER FRT	TORN	303.60	303.60
1	BUMPER BRACKET FRT LH	BENT	116.47	116.47
1	BUMPER RETAINER FRT LH	CRACKED	18.37	18.37
1	BUMPER BRACKET FRT RH	BENT	115.98	115.98
1	BUMPER RETAINER FRT RH	CRACKED	18.37	18.37
1	BUMPER UNDERTRAY FRT	CRACKED	363.71	363.71
1	BUMPER GRILLE LOWER FRT	MISSING	205.23	205.23
1	BUMPER FOG LAMP GRILLE LH	MISSING	159.39	159.39
1	BUMPER FOG LAMP GRILLE RH	MISSING	159.39	159.39
1	BUMPER BEAM FRT	BENT	703.14	703.14
1	RADIATOR GRILLE	CRACKED	1,313.68	1,313.68
1	RADIATOR GRILLE BADGE 'RENAULT'	NECESSARY	173.36	173.36
1	RADIATOR GRILLE FRAME	BROKEN	1,041.35	1,041.35
1	FRAME FULL SUPPORT PANEL	CRACKED	473.77	473.77
1	FRAME FULL SUPPORT BRACKET	BENT	69.07	69.07
1	FRONT BRACE PANEL	BENT	136.32	136.32
1	SUBFRAME OUTER FRT	SERVICEABLE	2,040.34	-
1	SUBFRAME INNER FRT (CROSSMEMBER)	TO REPAIR SEE LABOUR	1,757.54	-
1	SUBFRAME SUPPORT INNER	TO REPAIR SEE LABOUR	71.04	-
1	SUBFRAME BRACKET OUTER LH	TO REPAIR SEE LABOUR	71.04	-
1	SUBFRAME BRACKET OUTER RH	TO REPAIR SEE LABOUR	71.04	-
1	SUBFRAME BRACKET INNER LH	TO REPAIR SEE LABOUR	138.44	-
1	SUBFRAME BRACKET INNER RH	TO REPAIR SEE LABOUR	138.44	-
1	LOWER ARM RH	SERVICEABLE	527.51	-
1	BRAKE DISC FRT	SERVICEABLE	211.91	-

Report Ref No. CS/TP17007633/Krbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 9

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	KNUCKLE ARM RH	SERVICEABLE	651.53	-
1	KNUCKLE HUB+BEARING RH	SERVICEABLE	382.84	-
1	KNUCKLE ARM SHIELD RH	SERVICEABLE	101.10	-
1	KNUCKLE ARM PLATE RH	SERVICEABLE	133.89	-
1	BRAKE DISC FRT	SERVICEABLE	211.91	-
1	ABSORBER FRT RH	SERVICEABLE	277.34	-
1	ABSORBER MOUNTING KIT RH	SERVICEABLE	338.97	-
1	ABSORBER DUST COVER	SERVICEABLE	175.94	-
1	STABILIZER BAR FRT	SERVICEABLE	465.12	-
1	STABILIZER LINK FRT	SERVICEABLE	90.17	-
1	BRAKE CALIPER FRT RH	SERVICEABLE	505.34	-
1	BRAKE CALIPER BRACKET FRT RH	TO REPAIR SEE LABOUR	427.01	-
1	ABS SENSOR FRT RH	SERVICEABLE	196.73	-
1	BRAKE HOSE FRT RH	SERVICEABLE	96.70	-
1	DRIVESHAFT RH	TO REPAIR SEE LABOUR	1,344.19	-
1	LOWER ARM LH	SERVICEABLE	527.51	-
1	BRAKE DISC FRT	SERVICEABLE	211.91	-
1	KNUCKLE ARM LH	SERVICEABLE	651.53	-
1	KNUCKLE HUB+BEARING LH	SERVICEABLE	382.84	-
1	KNUCKLE ARM SHIELD LH	SERVICEABLE	101.10	-
1	KNUCKLE ARM PLATE LH	SERVICEABLE	133.89	-
1	BRAKE DISC FRT	SERVICEABLE	211.91	-
1	ABSORBER FRT LH	SERVICEABLE	277.34	-
1	ABSORBER MOUNTING KIT LH	SERVICEABLE	338.97	-
1	ABSORBER DUST COVER	SERVICEABLE	175.94	-
1	STABILIZER BAR FRT	SERVICEABLE	465.12	-
1	STABILIZER LINK FRT	SERVICEABLE	90.17	-
1	BRAKE CALIPER FRT LH	SERVICEABLE	505.34	-
1	BRAKE CALIPER BRACKET FRT LH	SERVICEABLE	427.01	-
1	ABS SENSOR FRT LH	SERVICEABLE	196.73	-
1	BRAKE HOSE FRT LH	SERVICEABLE	96.70	-

Report Ref No. CS/TP17007633/Krbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 9

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DRIVESHAFT LH	TO REPAIR SEE LABOUR	1,344.19	-
1	SEATBELT BUCKLE RH	SERVICEABLE	730.61	-
1	SEATBELT RH	JAMMED	2,250.28	2,250.28
1	SEATBELT BUCKLE LH	SERVICEABLE	730.61	-
1	SEATBELT LH	JAMMED	2,250.28	2,250.28
1	PASSENGER AIRBAG	BURST	2,624.93	2,624.93
1	PASSENGER AIRBAG COMPUTER	NECESSARY	969.09	969.09
1	PASSENGER AIRBAG SENSOR	NECESSARY	557.41	557.41
1	STEERING AIRBAG	BURST	1,942.89	1,942.89
1	STEERING AIRBAG SENSOR	NECESSARY	222.54	222.54
1	STEERING AIRBAG COMPUTER	REPEATED	969.09	-
1	ROTARY SWITCH	NECESSARY	963.93	963.93
1	DASHBOARD	TORN	3,769.65	3,769.65
1	GLOVE BOX	SERVICEABLE	799.83	-
1	GLOVE BOX FLAP	SERVICEABLE	983.82	-
1	HEADLAMP LH	BROKEN	911.10	911.10
1	HEADLAMP RH	BROKEN	911.10	911.10
1	HEADLAMP HARNESS RH	TO REPAIR SEE LABOUR	714.07	-
1	HEADLAMP HARNESS LH	TO REPAIR SEE LABOUR	714.07	-
1	HEADLAMP PANEL FRT RH	BENT	134.59	134.59
1	HEADLAMP PANEL FRT LH	BENT	134.59	134.59
1	BONNET	BENT	1,493.56	1,493.56
1	BONNET INSULATOR	DEFORMED	312.10	312.10
1	BONNET STRUT LH	PUNCTURE	166.29	166.29
1	BONNET STRUT RH	PUNCTURE	166.29	166.29
1	BONNET HINGE LH	DISTORTED	267.93	267.93
1	BONNET HINGE RH	DISTORTED	267.93	267.93
1	BAL HOOD	TO REPAIR SEE LABOUR	75.60	-
1	BONNET LOCK	BENT	234.99	234.99
1	BONNET CABLE	JAMMED	91.69	91.69

Report Ref No. CS/TP17007633/Krnb2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 9

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET CABLE COVER	MISSING	123.87	123.87
1	BONNET SEAL OUTER	CUT	71.04	71.04
1	FENDER PANEL FRT LH	BUCKLED	602.95	602.95
1	FENDER PANEL FRT RH	BUCKLED	602.95	602.95
1	FENDER WHEELARCH FRT LH (LINER)	TORN	107.32	107.32
1	FENDER WHEELARCH FRT RH (LINER)	TORN	214.49	214.49
1	FENDER INSULATOR RH	SERVICEABLE	100.64	-
1	FENDER INSULATOR LH	SERVICEABLE	100.64	-
1	FENDER PANEL BRACKET FRT RH	TO REPAIR SEE LABOUR	161.52	-
1	FENDER PANEL BRACKET FRT LH	TO REPAIR SEE LABOUR	161.52	-
1	WHEEL HOUSING PANEL FRT RH	TO REPAIR SEE LABOUR	3,601.61	-
1	WHEEL HOUSING PANEL FRT LH	TO REPAIR SEE LABOUR	3,601.61	-
1	FENDER CHASSIS REINFORCEMENT FRT LH	TO REPAIR SEE LABOUR	765.90	-
1	FENDER CHASSIS REINFORCEMENT FRT RH	TO REPAIR SEE LABOUR	765.90	-
1	RADIATOR	BENT	924.77	924.77
1	RADIATOR FAN COWLING	CRACKED	573.80	573.80
1	RADIATOR FAN MOTOR LH	SERVICEABLE	676.48	-
1	RADIATOR FAN MOTOR RH	SERVICEABLE	676.48	-
1	RADIATOR HOSE UPPER	SERVICEABLE	168.22	-
1	RADIATOR HOSE LOWER	SERVICEABLE	343.48	-
1	AIR CLEANER HOSE	SERVICEABLE	58.57	-
1	AIR CLEANER LOWER	SERVICEABLE	311.95	-
1	ENGINE UNDERTRAY	REPEATED	434.60	-
1	A/C CONDENSER	BENT	1,554.13	1,554.13
1	A/C CONDENSER GARNISH LH UPPER	SERVICEABLE	27.74	-
1	A/C CONDENSER GARNISH RH UPPER	SERVICEABLE	27.74	-
1	A/C CONDENSER GARNISH LH	SERVICEABLE	41.12	-
1	A/C CONDENSER GARNISH RH	SERVICEABLE	41.68	-
1	A/C PIPE CONDENSER TO COMPRESSOR	SERVICEABLE	145.73	-

Report Ref No. CS/TP17007633/Krbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 5 of 9

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	A/C PIPE CONDENSER TO EXPENSION VALVE	SERVICEABLE	460.64	-
1	A/C PIPE COMPRESSOR	SERVICEABLE	233.77	-
1	A/C PIPE	SERVICEABLE	460.64	-
1	TRANSMISSION COOLER	SERVICEABLE	852.66	-
1	AIR INTERCOOLER HOSE (LONG)	SERVICEABLE	709.18	-
1	AIR INTERCOOLER HOSE (SHORT)	SERVICEABLE	262.34	-
1	STEERING PUMP ELECTRIC	SERVICEABLE	1,543.08	-
1	STEERING HOSE LOW PRESSURE LONG	SERVICEABLE	442.50	-
1	STEERING HOSE LOW PRESSURE	SERVICEABLE	247.18	-
1	WINDSCREEN FRT	CRACKED	1,005.56	1,005.56
1	WIPER RESERVOIR	SERVICEABLE	190.96	-
1	WIPER RESERVOIR NECK	SERVICEABLE	27.78	-
1	WIPER RESERVOIR MOTOR	SERVICEABLE	100.95	-
1	DOOR PANEL FRT LH	TO REPAIR SEE LABOUR	2,188.20	-
1	DOOR MIRROR LH	SERVICEABLE	1,141.08	-
1	DOOR SEAL FRT LH	SERVICEABLE	50.92	-
1	DOOR PANEL FRT RH	TO REPAIR SEE LABOUR	2,188.20	-
1	DOOR MIRROR RH	SERVICEABLE	1,141.08	-
1	DOOR SEAL FRT RH	SERVICEABLE	50.92	-
1	BUMPER COVER REAR	BENT	852.66	852.66
1	BUMPER BRACKET CTR REAR	CRACKED	87.29	87.29
1	BUMPER BRACKET SIDE LH REAR (TAILLAMP LOWER)	CRACKED	34.61	34.61
1	BUMPER RETAINER LH REAR	CRACKED	104.59	104.59
1	BUMPER BRACKET SIDE RH REAR (TAILLAMP LOWER)	CRACKED	34.61	34.61
1	BUMPER RETAINER RH REAR	CRACKED	104.59	104.59
1	BUMPER LOWER REAR	MISSING	591.41	591.41
1	BUMPER BEAM REAR	BENT	598.08	598.08
1	BUMPER BEAM BRACKET LH REAR	BENT	173.81	173.81
1	BUMPER BEAM BRACKET RH REAR	BENT	173.81	173.81
1	BUMPER REFLECTOR LH	CRACKED	33.55	33.55
1	BUMPER REFLECTOR RH	CRACKED	33.55	33.55
1	BOOT REAR	BENT	2,209.75	2,209.75

Report Ref No. CS/TP17007633/Krnb2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 6 of 9

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOT FINISHER	SERVICEABLE	361.58	-
1	BOOT LOCK	DENTED	155.90	155.90
1	BOOT LOCK CATCH	BENT	57.23	57.23
1	BOOT WEATHERSTRIP	CUT	248.50	248.50
1	BOOT REFLECTOR LAMP LH	DENTED	379.50	379.50
1	BOOT REFLECTOR LAMP RH	SERVICEABLE	379.50	-
1	BOOT BADGE "RENAULT"	NECESSARY	173.35	173.35
1	BOOT BADGE	NECESSARY	173.35	173.35
1	BOOT STRUT LH	SERVICEABLE	212.36	-
1	BOOT STRUT RH	SERVICEABLE	212.36	-
1	BOOT HINGE LH	TO REPAIR SEE LABOUR	282.96	-
1	BOOT HINGE RH	TO REPAIR SEE LABOUR	282.96	-
1	BOOT RUBBER PLUG	SERVICEABLE	170.63	-
1	TAILLAMP LH	MTG CRACKED	425.04	425.04
1	TAILLAMP PANEL LH	TO REPAIR SEE LABOUR	759.00	-
1	TAILLAMP RH	MTG CRACKED	425.04	425.04
1	TAILLAMP PANEL RH	BENT	759.00	759.00
1	FENDER PANEL REAR LH	TO REPAIR SEE LABOUR	2,537.80	-
1	FENDER PANEL REAR RH	BUCKLED	2,537.80	2,537.80
1	FENDER WHEELARCH REAR LH (LINER)	SERVICEABLE	418.06	-
1	FENDER WHEELARCH REAR RH (LINER)	SERVICEABLE	418.06	-
1	SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL)	BENT / BUCKLED	1,684.52	1,684.52
1	SPARE WHEEL PANEL TRIM (LUGGAGE FLOOR PANEL)	BUCKLED	470.93	470.93
1	OUTER PANEL REAR (END PANEL)	BENT	1,132.13	1,132.13
1	OUTER PANEL REAR (END PANEL) TRIM	CRACKED	308.48	308.48
1	EXHAUST REAR	BENT	5,760.00	5,760.00
1	EXHAUST CAP REAR	DENTED	177.30	177.30
	LESS 10% DISCOUNT		-10,562.67	-5,280.44
			95,064.01	47,523.78

Report Ref No. CS/TP17007633/Krbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:7 of 9

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NECESSARY	52.00	52.00
1	SET BUMPER CLIP FRT (SN)	NECESSARY	66.00	66.00
1	TOW COVER FRT (SN)	MISSING	14.50	14.50
1	SET RADIATOR GRILLE SCREW (SN)	NECESSARY	16.00	16.00
1	SET BUMPER GRILLE LOWER CLIP (SN)	NECESSARY	69.00	69.00
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NECESSARY	70.00	70.00
2	FRAME FULL SUPPORT PANEL NUT (SN)	SERVICEABLE	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	SERVICEABLE	30.00	-
2	BONNET CABLE CLIP (SN)	NOT NECESSARY	6.40	-
1	SET WHEELARCH CLIP LH (SN)	NECESSARY	30.50	30.50
1	SET WHEELARCH CLIP RH (SN)	NECESSARY	29.40	29.40
2	FRONT WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
2	FRONT WINDSCREEN MOULDING (SN)	NECESSARY	100.00	100.00
2	E.R.P STICKER (SN)	NECESSARY	65.00	26.00
1	DOOR STICKER "TRANS-CAB" (SN)	NOT NECESSARY	80.00	-
1	DOOR STICKER "CLASSIC" (SN)	NOT NECESSARY	30.00	-
1	DOOR STICKER "6555-3333" (SN)	NOT NECESSARY	80.00	-
1	SET NUMBER PLATE WITH HOLDER (SN)	MISSING	140.00	45.00
1	DASHBOARD SCREW (SN)	NOT NECESSARY	55.55	-
1	CAP HUB RH FRT (SN)	SERVICEABLE	35.00	-
1	RIM RH FRT (SN)	SERVICEABLE	385.00	-
1	TYRE RH FRT (SN)	SERVICEABLE	330.00	-
1	CAP HUB LH FRT (SN)	SERVICEABLE	35.00	-
1	RIM LH FRT (SN)	SERVICEABLE	385.00	-
1	TYRE LH FRT (SN)	SERVICEABLE	330.00	-
1	CAP HUB LH RR (SN)	SERVICEABLE	35.00	-
1	RIM LH RR (SN)	SERVICEABLE	385.00	-
1	TYRE LH RR (SN)	SERVICEABLE	330.00	-
1	CAP HUB LH RR (SN)	SERVICEABLE	35.00	-
1	RIM LH RR (SN)	SERVICEABLE	385.00	-
1	TYRE LH RR (SN)	SERVICEABLE	330.00	-
			4,034.35	558.40

Report Ref No. CS/TP17007633/Krbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 8 of 9

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME, INCLUSIVE OF THE REPAIR OF SUBFRAME INNER FRT (CROSSMEMBER), SUBFRAME SUPPORT INNER, SUBFRAME BRACKET OUTER LH, SUBFRAME BRACKET OUTER RH, SUBFRAME BRACKET INNER LH, SUBFRAME BRACKET INNER RH. }		8,400.00	2,800.00
	BRAKE CALIPER BRACKET FRT RH, DRIVESHAFT RH, DRIVESHAFT LH, HEADLAMP HARNESS RH, HEADLAMP HARNESS LH, BAL HOOD, FENDER PANEL BRACKET FRT RH, FENDER PANEL BRACKET FRT LH, WHEEL HOUSING PANEL FRT RH, WHEEL HOUSING PANEL FRT LH, FENDER CHASSIS REINFORCEMENT FRT LH, FENDER CHASSIS REINFORCEMENT FRT RH, DOOR PANEL FRT LH, DOOR PANEL FRT RH, BOOT HINGE LH, BOOT HINGE RH, TAILLAMP PANEL LH AND FENDER PANEL REAR LH. }		-	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		9,000.00	2,640.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	170.00
	TOWING FEES.		120.00	50.00
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.		380.00	120.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	80.00
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO LIFT-UP ENGINE WITH GEAR BOX AND REFIT.	NOT NECESSARY	440.00	-
	TO DISMANTLE AND REFIT FRONT END SUSPENSION, UNDERCARRIAGE PARTS, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO REMOVE AND RENEW ENGINE AND GEAR BOX MOUNTING.	NOT NECESSARY	380.00	-
	TO DISMANTLE AND REFIT ENGINE CROSS-MEMBER AND ENGINE MOUNTING.	NOT NECESSARY	380.00	-
	TO REMOVE AND RENEW POWER STEERING PUMP, OIL COOLER PIPE AND FINAL CHECKING AND TESTING.	NOT NECESSARY	440.00	-
	TO REMOVE AND REFIT AIR BAG SYSTEM AND RESET.		480.00	280.00

Report Ref No. CS/TP17007633/Krbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:9 of 9

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK ABS BRAKE EFFICIENCY,FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO PULL AND JACK CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK. }		380.00	250.00
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH,TO FACILITATE REPAIR. }		380.00	-
	TO REMOVE AND REFIT FRONT W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.		170.00	120.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	60.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00
	TO DROP REAR EXHAUST BOX,RENEW THE SAME,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE. }		170.00	80.00
	TO REPAIR AND REALIGN REAR EXHAUST PIPE. }		170.00	-
	TO VACUUM,REPLACE,REFIX AND RECHARGE AIR CONDENSER.		380.00	100.00
	TO REPLACE,REFIX AND TOP UP COOLANT FOR RADIATOR.		170.00	50.00
	TO VACUUM,REPLACE,REFIX AND RECHARGE AIR INTERCOOLER.		170.00	50.00
	TO DISMANTLE AND REFIT AIRCON ASSY AND ATTACHMENT,VACUUM AND CHARGE-IN-GAS.		380.00	100.00
			24,050.00	7,010.00
GRAND TOTAL			123,148.36	55,092.18
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				31,000.00

Report Ref No. CS/TP17007633/Krbn2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.