



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2100387

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 18/01/2021
Reference CC3/CTI17018651/Kea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 9532S
Insured Veh. SLA 2981H
Claim No. SNM17D05597/C03/1
Policy No. DMPCSN1712311700
Accident Date 23/09/2017
Inspection Date 26/09/2017

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD			Ref:	CC3/CTI17018651/Kea3q2
3 ANSON ROAD #16-00			Date:	18/01/2021
SPRINGLEAF TOWERSINGAPORE 079909			Code:	CTI
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLA 2981H	Veh. Inspected	SHB 9532S	
Policy No.	DMPCSN1712311700	Coverage (\$)	0.00	
Claim No.	SNM17D05597/C03/1	Excess (\$)	0.00	
Assign From		Assign Date	26/09/2017	
2. Vehicle Particulars & Condition				
Make & Model	CHEVROLET EPICA (A)	c.c	1991	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	KL1LA69RJBB122525	Colour	WHITE / RED	
Odometer	682470 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	GITI	8 mm	
L/H Front Tyre	195/65 R15	GITI	8 mm	
R/H Rear Tyre	195/65 R15	GITI	6 mm	
L/H Rear Tyre	195/65 R15	GITI	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S AND FRONT PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/09/2017	Inspection Date	26/09/2017	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			28 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 11

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 9532S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	BUCKLED / CRACKED	1,202.00	1,202.00
1	FRONT BUMPER RETAINER RH	CRACKED	102.00	102.00
1	FRONT BUMPER RETAINER LH	SERVICEABLE	102.00	-
1	FRONT BUMPER REINFORCEMENT	BENT	295.25	295.25
1	FRONT BUMPER LOWER ABSORBER	CRACKED	180.00	180.00
1	FRONT BUMPER LOWER STIFFENER	TO REPAIR SEE LABOUR	134.37	-
1	FRONT BUMPER LOWER GRILLE	SERVICEABLE	78.00	-
1	FRONT HEADLAMP RH	BROKEN	816.00	816.00
1	FRONT HEADLAMP LH	SERVICEABLE	816.00	-
1	FRONT BUMPER FOG LAMP OUTER COVER LH	SERVICEABLE	32.40	-
1	FRONT BUMPER FOG LAMP OUTER COVER RH	SERVICEABLE	32.40	-
1	FRONT SUPPORT PANEL ASSY (PANEL A-FRT)	BENT	1,222.32	1,222.32
1	BONNET (PANEL A-HOOD)	BUCKLED	1,250.00	1,250.00
1	CENTRE 'CHEVROLET' LOGO BADGE	NECESSARY	144.30	144.30
1	BONNET MOULDING	DENTED	257.00	257.00
1	BONNET INSULATOR	SERVICEABLE	84.63	-
1	BONNET HINGE RH	TO REPAIR SEE LABOUR	36.00	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	36.00	-
1	BONNET CABLE	SERVICEABLE	150.00	-
1	BONNET LOCK	DISTORTED	200.00	200.00
2	HORN LH	SERVICEABLE	320.00	-
1	RADIATOR GRILLE (GRILL A-RAD)	CRACKED	367.00	367.00
1	RADIATOR GRILLE TOP COVER	DISTORTED	45.02	45.02
1	RADIATOR ASSEMBLY (RADIATOR A)	HOUS BROKEN	618.00	618.00
1	RADIATOR UPPER HOSE	PUNCTURE	30.00	30.00
1	RADIATOR LOWER HOSE	SERVICEABLE	120.00	-
1	RADIATOR EXPANSION TANK	DENTED	45.00	45.00
1	AIRCON CONDENSER (CONDENSER A)	PUNCTURE	600.00	600.00

Report Ref No. CC3/CTI17018651/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 11

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIRCON HOSE-CONDENSER TO COMPRESSOR	SERVICEABLE	215.40	-
1	AIRCON HOSE-COMPRESSOR TO EVAPORATOR	SERVICEABLE	316.20	-
1	AIRCON HOSE-CONDENSER TO EVAPORATOR	SERVICEABLE	332.10	-
1	AIRCON COMPRESSOR-PUMP	SERVICEABLE	1,847.95	-
1	AIRCON COMPRESSOR BRACKET	TO REPAIR SEE LABOUR	245.30	-
1	AIR CLEANER ASSEMBLY	SERVICEABLE	112.00	-
1	AIR INTERCOOLER	SERVICEABLE	652.00	-
1	FAN BLADE (SMALL)	CRACKED	536.00	536.00
1	FAN BLADE (BIG)	SERVICEABLE	634.00	-
1	WINDSCREEN WASHER TANK -FILLER NECK	DENTED	4.80	4.80
1	WINDSCREEN WASHER TANK -(RESERVOIR A-W/SHIELD)	SERVICEABLE	62.00	-
1	WINDSCREEN WASHER TANK MOTOR (PUMP WSWA)	SERVICEABLE	51.00	-
1	TANK ,WIPER HOSE	SERVICEABLE	21.00	-
1	POWER STEERING PUMP	SERVICEABLE	1,755.31	-
1	POWER STEERING RESERVOIR TANK	SERVICEABLE	120.00	-
1	POWER STEERING INLET/OUTLET PIPE	SERVICEABLE	65.00	-
1	POWER STEERING PUMP PULLEY	SERVICEABLE	66.00	-
1	POWER STEERING HOSE-PRESSURE	SERVICEABLE	256.00	-
1	POWER STEERING HOSE-NON PRESSURE	SERVICEABLE	312.11	-
1	FRONT FENDER LH	TO REPAIR SEE LABOUR	837.60	-
1	FRONT FENDER RH	BUCKLED	837.60	837.60
1	FRONT FENDER LINER LH	SERVICEABLE	47.00	-
1	FRONT FENDER LINER RH	DISTORTED	47.00	47.00
1	FRONT DOOR LH	BENT	1,133.00	1,133.00
1	FRONT DOOR RH	TO REPAIR SEE LABOUR	1,133.00	-
1	FRONT DOOR HINGE UPPER RH	TO REPAIR SEE LABOUR	65.00	-
1	FRONT DOOR HINGE LOWER RH	TO REPAIR SEE LABOUR	65.00	-
1	FRONT DOOR HINGE UPPER LH	TO REPAIR SEE LABOUR	65.00	-

Report Ref No. CC3/CTI17018651/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 11

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT DOOR HINGE LOWER LH	TO REPAIR SEE LABOUR	65.00	-
1	FRONT SIDE VIEW MIRROR RH	SERVICEABLE	939.00	-
1	FRONT SIDE VIEW MIRROR LH	SERVICEABLE	939.00	-
1	FRONT WINDSCREEN	SERVICEABLE	1,304.00	-
1	FRONT WINDSCREEN MOULDING	SERVICEABLE	196.00	-
1	REAR BUMPER	TORN	1,202.00	1,202.00
1	REAR BUMPER BEAM	BENT	239.94	239.94
1	REAR BUMPER CENTRE ABSORBER	CRACKED	260.00	260.00
1	REAR BUMPER SIDE RETAINER RH	CRACKED	68.76	68.76
1	REAR BUMPER SIDE RETAINER LH	CRACKED	68.76	68.76
1	REAR BUMPER SIDE SUPPORT RH	CRACKED	25.00	25.00
1	REAR BUMPER SIDE SUPPORT LH	CRACKED	25.00	25.00
1	REAR BUMPER REFLECTOR RH	BROKEN	119.74	119.74
1	REAR BUMPER REFLECTOR LH	BROKEN	119.74	119.74
1	REAR BUMPER STAY RH	SERVICEABLE	35.00	-
1	REAR BUMPER STAY LH	SERVICEABLE	35.00	-
1	REAR BUMPER TOW HOOK COVER	MISSING	93.00	93.00
1	REAR LUGGAGE FLOOR PANEL	BENT	973.00	973.00
1	REAR LUGGAGE FLOOR PANEL INSULATOR	NECESSARY	63.50	63.50
1	REAR LUGGAGE FLOOR PANEL TRIM BOARD	NOT NECESSARY	378.00	-
1	REAR END PANEL INNER	BENT	336.84	336.84
1	REAR END PANEL OUTER	BENT	623.76	623.76
1	REAR END PANEL INNER TRIM	CRACKED	263.84	263.84
1	BOOTLID	BENT	973.00	973.00
1	BOOTLID INNER TRIM BOARD	SERVICEABLE	400.00	-
1	BOOTLID LOCK -TOP	DENTED	466.56	466.56
1	BOOTLID LOCK-BOTTOM	TO REPAIR SEE LABOUR	39.40	-
1	BOOTLID 'CHEVROLET' BADGE	NECESSARY	120.62	120.62
1	BOOTLID LOGO	NECESSARY	138.84	138.84
1	BOOTLID 'EPICA LT' BADGE	NECESSARY	119.84	119.84
1	BOOTLID INNER HANDLE	SERVICEABLE	45.55	-
1	BOOTLID REFLECTOR CENTRE	CRACKED	217.97	217.97

Report Ref No. CC3/CTI17018651/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 11

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOTLID REFLECTOR RH	CRACKED	128.40	128.40
1	BOOTLID REFLECTOR LH	CRACKED	128.40	128.40
1	BOOTLID HINGE RH	BENT	120.00	120.00
1	BOOTLID HINGE LH	TO REPAIR SEE LABOUR	120.00	-
1	REAR GAS T/GATE SPRING RH	SERVICEABLE	286.90	-
1	REAR GAS T/GATE SPRING LH	SERVICEABLE	286.90	-
1	REAR NUMBER PLATE LAMP RH	SERVICEABLE	25.00	-
1	REAR NUMBER PLATE LAMP LH	SERVICEABLE	25.00	-
1	THIRD BRAKE LIGHT	SERVICEABLE	350.64	-
1	REAR TAIL LAMP RH	BROKEN	479.30	479.30
1	REAR TAIL LAMP PANEL RH	BENT	359.00	359.00
1	REAR TAIL LAMP LH	MTG CRACKED	479.30	479.30
1	REAR TAIL LAMP PANEL LH	DISTORTED	359.00	359.00
1	REAR EXHAUST PIPE	TO REPAIR SEE LABOUR	1,110.00	-
1	REAR EXHAUST BOX (MUFFLER A-EXH ,RR)	TO REPAIR SEE LABOUR	1,110.00	-
1	CENTRE EXHAUST PIPE	TO REPAIR SEE LABOUR	403.00	-
1	REAR FENDER RH	BENT	1,145.00	1,145.00
1	REAR FENDER INNER COWLING RH	CRACKED	298.00	298.00
1	REAR FENDER INNER TRIM RH	DEFORMED	418.44	418.44
1	REAR FENDER INNER WHEEL HOUSE PANEL LH	TO REPAIR SEE LABOUR	2,556.35	-
1	REAR FENDER LH	BUCKLED	1,145.00	1,145.00
1	REAR FENDER INNER COWLING LH	CRACKED	298.00	298.00
1	REAR FENDER INNER TRIM LH	CRACKED	418.44	418.44
1	REAR FENDER INNER WHEEL HOUSE PANEL RH	TO REPAIR SEE LABOUR	2,556.35	-
1	REAR DOOR LH (PANEL A-RR DR RH)	TO REPAIR SEE LABOUR	1,133.00	-
1	REAR DOOR LH (PANEL A-RR DR LH)	TO REPAIR SEE LABOUR	1,133.00	-
1	REAR DOOR WEATHERSTRIP -INNER RH	SERVICEABLE	41.40	-
1	REAR DOR WEATHERSTRIP -2ND FRAME RH	SERVICEABLE	25.90	-

Report Ref No. CC3/CTI17018651/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 11

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR DOOR TOP HINGE RH	TO REPAIR SEE LABOUR	35.00	-
1	REAR DOOR BOTTOM HINGE RH	TO REPAIR SEE LABOUR	35.00	-
1	REAR DOOR INNER LOCK RH	TO REPAIR SEE LABOUR	425.00	-
1	REAR DOOR CHECK /ARRESTOR RH	SERVICEABLE	65.00	-
1	REAR DOOR OUTER WEATHERSTRIP MOULDING RH	SERVICEABLE	85.00	-
1	REAR DOOR OUTER HANDLE RH	SERVICEABLE	60.00	-
1	REAR DOOR OUTER HANDLE -RUBBER SEAL RH	SERVICEABLE	25.00	-
1	REAR DOOR INNER TRIM BOARD RH	SERVICEABLE	455.69	-
1	REAR DOOR WINDOW GLASS CHANNEL WEATHERSTRIP	SERVICEABLE	143.25	-
1	REAR DOOR WINDOW GLASS CHANNEL HOLDER	SERVICEABLE	205.60	-
1	REAR DOOR CHANNEL WEATHERSTRIP /FELT	SERVICEABLE	89.50	-
1	REAR DOOR POWER WINDOW MOTOR (MASTER)	SERVICEABLE	274.97	-
1	REAR WINDSCREEN GLASS WITH MOULDING	SERVICEABLE	1,647.00	-
1	REAR WINDSCREEN WEATHERSTRIP SEAL	SERVICEABLE	68.50	-
1	REAR WINDSCREEN INNER GARNISH SIDE RH	SERVICEABLE	185.00	-
1	REAR WINDSCREEN INNER GARNISH SIDE LH	SERVICEABLE	185.00	-
1	REAR WINDSCREEN INNER TOP GARNISH	SERVICEABLE	80.00	-
1	TYRE MECHANICAL JACK	TO REPAIR SEE LABOUR	220.00	-
1	TYRE MECHANICAL JACK HOLDER BRACKET	TO REPAIR SEE LABOUR	24.81	-
1	REAR SHOCK ABSORBER LH	SERVICEABLE	243.57	-
1	REAR SHOCK ABSORBER TOP MOUNTING LH	SERVICEABLE	51.65	-
1	REAR SHOCK ABSORBER RH	SERVICEABLE	243.57	-
1	REAR SHOCK ABSORBER TOP MOUNTING RH	SERVICEABLE	51.65	-
1	UPR ARM RH (ARM A-UPR RH)	SERVICEABLE	343.00	-
1	UPR ARM LH (ARM A-UPR LH)	SERVICEABLE	343.00	-
1	REAR KNUCKLE ARM LH	SERVICEABLE	350.00	-
1	REAR KNUCKLE ARM RH	SERVICEABLE	350.00	-
1	REAR AXLE HOUSING (AXLE A-RR)	SERVICEABLE	711.00	-
1	PARALLEL LINK RR (LINK A-PARALLEL RR)	SERVICEABLE	93.00	-

Report Ref No. CC3/CTI17018651/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 11

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	PARALLEL LINK FRT (LINK A-PARALLEL FRT)	SERVICEABLE	93.00	-
1	STABILIZER BAR RR (BAR RR STABILIZER)	SERVICEABLE	97.00	-
1	TRAILING LINK RR RH (LINK A-TRAILING RR RH)	SERVICEABLE	90.00	-
1	TRAILING LINK RR LH (LINK A-TRAILING RR LH)	SERVICEABLE	90.00	-
1	REAR SEAT LOWER	SERVICEABLE	734.50	-
1	REAR SEAT GARNISH TOPPER	SERVICEABLE	1,012.35	-
1	DIESEL TANK (TANK A-FUEL)	SERVICEABLE	717.00	-
1	DIESEL TANK FILLER PIPE (TUBE A FUEL FILLER)	SERVICEABLE	157.00	-
1	DIESEL TANK CAP (CAP A FUEL FILLER)	SERVICEABLE	46.00	-
1	DIESEL TANK DOOR PANEL (DOOR A FUEL FILLER)	SERVICEABLE	75.00	-
1	HOLDER A FUEL FILLER	SERVICEABLE	50.00	-
1	CABLE A FUEL FILLER	SERVICEABLE	160.00	-
1	CABLE LOCK A FUEL FILLER	SERVICEABLE	25.00	-
1	LONGITUDINAL A-RR LH	SERVICEABLE	709.20	-
1	LONGITUDINAL A-RR RH	SERVICEABLE	709.20	-
1	PANEL A-ROOF	SERVICEABLE	1,800.00	-
1	ROOF SIDE MOULDING -ROOF GULTER LH	SERVICEABLE	45.00	-
1	ROOF SIDE MOULDING -ROOF GULTER RH	SERVICEABLE	45.00	-
1	ROOF LINING	SERVICEABLE	1,345.60	-
1	REAR ROOF SIDE PANEL INNER RH	TO REPAIR SEE LABOUR	450.00	-
1	REAR ROOF SIDE PANEL OUTER RH	TO REPAIR SEE LABOUR	480.00	-
1	PANEL A-BACK UPR (UNDER WINDSCREEN)	TO REPAIR SEE LABOUR	800.00	-
1	SHELF A-BACK UPR INCL (TRIM)	SERVICEABLE	400.00	-
1	REAR HAND BRAKE CABLE	SERVICEABLE	1,021.90	-
1	REAR HAND BRAKE CABLE O/S	SERVICEABLE	231.90	-
1	REAR WINDSCREEN GLASS	SERVICEABLE	960.00	-
	LESS 10% DISCOUNT		-6,841.99	-2,222.83
			61,577.86	20,005.45
1	BOOTLID WEATHERSTRIP (50%) (SN)	CUT	344.28	172.14

Report Ref No. CC3/CTI17018651/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:7 of 11

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-34.43	-
			309.85	172.14
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER FASTENER CLIP (SN)	NECESSARY	24.00	24.00
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	CRACKED	192.00	45.00
2	FRONT WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	FRONT WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	100.00	-
2	FRONT ERP STICKER (SN)	NOT NECESSARY	40.00	-
1	SET BONNET INSULATOR CLIP (SN)	NECESSARY	40.00	40.00
1	SET RADIATOR GRILLE CLIP (SN)	NECESSARY	18.00	18.00
1	SET RADIATOR GRILLE TOP COVER CLIP (SN)	NOT NECESSARY	10.00	-
1	SET FRONT FENDER LINER CLIP LH (SN)	NOT NECESSARY	40.00	-
1	SET FRONT FENDER LINER CLIP RH(SN)	NECESSARY	40.00	40.00
1	SET ENGINE SPLASH COVER CLIP RH (SN)	NOT NECESSARY	12.00	-
1	SET ENGINE SPLASH COVER CLIP LH (SN)	NOT NECESSARY	12.00	-
1	SET REAR BUMPER PARKING SENSOR (SN)	TORN	300.00	300.00
1	SET REAR BUMPER FASTENER CLIP (SN)	NECESSARY	30.00	30.00
2	SET REAR FENDER INNER COWLING CLIP LH (SN)	NOT NECESSARY	30.00	-
2	SET REAR FENDER INNER COWLING CLIP RH (SN)	NECESSARY	30.00	30.00
1	SET REAR FENDER INNER TRIM CLIP RH (SN)	NECESSARY	30.00	30.00
1	SET REAR FENDER INNER TRIM CLIP LH (SN)	NOT NECESSARY	30.00	-
1	SET REAR BUMPER END DUST COVER CLIP (SN)	NOT NECESSARY	30.00	-
1	REAR BOOT STICKER 'TRANS-CAB' (SN)	NECESSARY	30.00	30.00
1	REAR BOOT STICKER '6555-3333' (SN)	NECESSARY	30.00	30.00
1	SET BOOTLID INNER TRIM BOARD CLIP (SN)	NOT NECESSARY	40.00	-
1	DOOR STICKER 'TRANS-CAB' LH (SN)	NECESSARY	80.00	60.00
1	DOOR STICKER 'TRANS-CAB' RH (SN)	NOT NECESSARY	80.00	-
1	REAR DOOR STICKER '6555-3333' LH (SN)	NOT NECESSARY	30.00	-
1	REAR DOOR STICKER '6555-3333' RH (SN)	NOT NECESSARY	30.00	-
1	SET REAR DOOR INNER TRIM BOARD CLIP RH (SN)	NOT NECESSARY	45.00	-
1	FRONT SIDE ROCKER PANEL GARNISH CLIP LH (SN)	NOT NECESSARY	25.00	-

Report Ref No. CC3/CTI17018651/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:8 of 11

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT SIDE ROCKER PANEL GARNISH CLIP RH (SN)	NOT NECESSARY	25.00	-
2	REAR EXHAUST MOUNTING (SN)	SERVICEABLE	40.00	-
1	REAR BUMPER END SEALANT (SN)	NOT NECESSARY	80.00	-
1	FRONT TYRE LH (SN)	SERVICEABLE	180.00	-
1	FRONT WHEEL RIM LH (SN)	SERVICEABLE	126.74	-
1	FRONT TYRE RH (SN)	SERVICEABLE	180.00	-
1	FRONT WHEEL RIM RH (SN)	SERVICEABLE	126.74	-
1	REAR TYRE LH (SN)	SERVICEABLE	180.00	-
1	REAR WHEEL RIM LH (SN)	SERVICEABLE	126.74	-
1	REAR TYRE RH (SN) (60%)	PUNCTURE	180.00	108.00
1	REAR WHEEL RIM RH (SN)	BENT	126.74	50.00
1	SPARE TYRE (SN)	SERVICEABLE	180.00	-
1	SPARE WHEEL RIM (SN)	SERVICEABLE	126.74	-
1	SPARE TYRE BOARD (SN)	SERVICEABLE	10.00	-
1	SPARE TYRE FASTENER BOLT (SN)	SERVICEABLE	65.00	-
2	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	100.00	30.00
1	SET SHELF A-BACK UPR INCL (TRIM) CLIP (SN)	NOT NECESSARY	20.00	-
1	SET ROOF SIDE MOULDING -ROOF GULTER CLIP LH (SN)	NOT NECESSARY	10.00	-
1	SET ROOF SIDE MOULDING -ROOF GULTER CLIP RH (SN)	NOT NECESSARY	10.00	-
1	ROOF LINING CLIP (SN)	NOT NECESSARY	40.00	-
1	REAR EXHAUST HEAT SHIELD (SN)	TO REPAIR SEE LABOUR	57.00	-
1	REAR EXHAUST BOX -J HOOK (SN)	SERVICEABLE	25.00	-
1	REAR EXHAUST BOX CHROME PIPE (SN)	TO REPAIR SEE LABOUR	791.00	-
1	REAR EXHAUST MOUNTING BRACKET (SN)	TO REPAIR SEE LABOUR	27.00	-
1	CENTRE EXHAUST PIPE (SN)	TO REPAIR SEE LABOUR	403.00	-
			4,794.70	905.00

Report Ref No. CC3/CTI17018651/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:9 of 11

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF BONNET HINGE RH,BONNET HINGE LH,AIRCON COMPRESSOR BRACKET,FRONT FENDER LH,FRONT DOOR RH,FRONT DOOR HINGE UPPER RH,FRONT DOOR HINGE LOWER RH,FRONT DOOR HINGE UPPER LH,FRONT DOOR HINGE LOWER LH,BOOTLID LOCK-BOTTOM,BOOTLID HINGE LH,}		8,100.00	3,000.00
	REAR EXHAUST PIPE,REAR EXHAUST BOX (MUFFLER A-EXH,RR),CENTRE EXHAUST PIPE,REAR FENDER INNER WHEEL HOUSE PANEL LH,REAR FENDER INNER WHEEL HOUSE PANEL RH,REAR DOOR LH (PANEL A-RR DR RH),REAR DOOR RH (PANEL A-RR DR LH),REAR DOOR TOP HINGE RH,REAR DOOR BOTTOM HINGE RH,REAR DOOR INNER LOCK RH,TYRE MECHANICAL JACK,TYRE MECHANICAL JACK HOLDER BRACKET,REAR ROOF SIDE PANEL INNER RH,}		-	-
	REAR ROOF SIDE PANEL OUTER RH,PANEL A-BACK UPR (UNDER WINDSCREEN),REAR EXHAUST HEAT SHIELD,REAR EXHAUST BOX CHROME PIPE,REAR EXHAUST MOUNTING BRACKET AND CENTRE EXHAUST PIPE. }		-	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	40.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	170.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED.		8,400.00	2,200.00
	TO REMOVE AND REFIT FRONT W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	170.00	-
	TO DISMANTLE AD REFIT REAR UNDERCARRIAGE PARTS ,FINAL CHECKING AND TESTING.}		380.00	240.00
	TO DISMANTLE AND REFIT REAR AXLE HOUSING ASSY,REMOVE AND RENEWAL OF PARTS ,FINAL CHECKING AND .}		380.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH ,TO FACILITATE REPAIR.		380.00	250.00
	TO DROP REAR EXHAUST BOX ,RENEW THE SAME ,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.}		170.00	60.00
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.}		170.00	-
	TO REINSTALL REAR BUMPER PARKING SENSOR .		170.00	60.00
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK.	NOT NECESSARY	380.00	-

Report Ref No. CC3/CTI17018651/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:10 of 11

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING.}		380.00	120.00
	TO TRANSFER OF END PANEL FITTINGS AND CONDUCT WATER SEEPAGE TEST.}		170.00	-
	TO TRANSFER OF LUGGAGE FLOOR PANEL FITTINGS AND CONDUCT WATER SEEPAGE TEST.}		170.00	-
	TO TRANSFER OF BOOT FITTINGS AND CONDUCT WATER SEEPAGE TEST.		170.00	60.00
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO TRANSFER OF FENDER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
	TO REMOVE AND REFIT REAR W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.		170.00	120.00
	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING.		170.00	20.00
	TO CHECK ABS BRAKE EFFICIENCY ,FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO VACUUM ,REPLACE ,REFIX AND RECHARGE AIR.		380.00	100.00
	TO REPLACE ,REFIX AND TOP UP COOLANT FOR RADIATOR.		170.00	50.00
	TO VACUUM ,REPLACE ,REFIX AND RECHARGE AIR.	NOT NECESSARY	170.00	-
	TOWING FEES.		120.00	50.00
	TO TRANSFER OF DOOR FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO DISMANTLE AND REFIT SEAT ,BACKREST,TRIMINGS ,GARNISH ,ROOF -LINING ,SPEAKER SHELFBOARD,CARPETING AND OTHER TO ENABLE BODY WORK REPAIR.	NOT NECESSARY	380.00	-
	TO REMOVE AND RENEW POWER STEERING PUMP ,OIL COOLER PIPE AND FINAL CHECKING AND TESTING.	NOT NECESSARY	440.00	-
	TO DROP DIESEL TANK ,PIPES ,HOSES TO FACILITATE BODYWORK REPAIR,FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
			23,630.00	6,660.00
GRAND TOTAL			90,312.41	27,742.59

Report Ref No. CC3/CTI17018651/Kea3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			13,800.00
---	--	--	------------------

Report Ref No. CC3/CTI17018651/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 9532S

INSPECTION

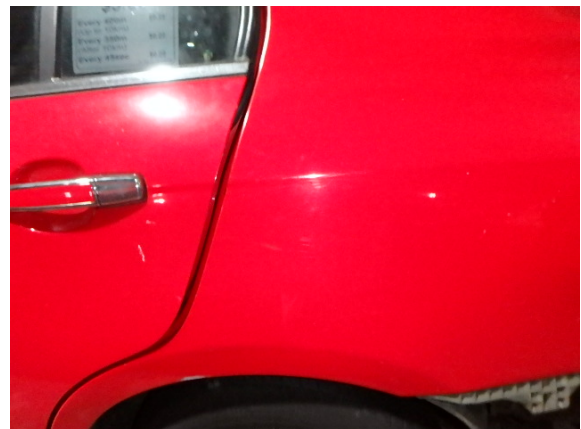



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

