

(09/11/17)

Surveyor

REF:

NG/INC17020021/RHbe2

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured: SJQ 586T

Policy No. 5080410794-01 180517-220418

Claims No. MT/0965903-003


Sum Insured: Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

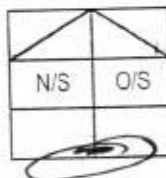

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: SHF 210J

Yr Regn: 2012 / MUK

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: CHEVROLET EALIA o.c 1991

Colour: MAROON A/C: Insured / Std / NI / NA

Sp. Reading: 658685 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No: KL1LW69RSBB/33429

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or FALKEN

Front

Rear

R/Bal. S mm R/Bal. S mm

L/Bal. S mm L/Bal. S mm

D.O.A. 15/10/17 D.O.I. 17/10/17

Survey held at SMRT

Des. of Damages: Fr / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

SHF 210J - NG/INC16020705 / Kithm2

DWT: 23/10/16

10/17/2083

SJQ 586T - X

NTUC

Lump Sum \$17,600/- (Ref: 10,193.26 (36%))

SJQ 586T

RECEIVED 29 NOV 2017

Date/Time, File Pass to?

11/29/17 Typist

Date/Time, File Return to?

2)

☐ : Preli. Report☒ : Final Report

Days Of Repair: 14

Resurvey No. of Trip: -

Survey Fee:

Transportation:

Add Fee:

☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

) \$+RS, SI

) Photos

) Others

TOTAL

Report Format: TP

Lump Sum / I.B.I: (\$ 17600/-)

160

35

195



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC17020021/R1tb

73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 19-10-2017
189556



Code: INC4

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SJQ 586T	Veh. Inspected	SHF 210J
Policy No.	5080410774-01	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	17/10/2017

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	15/10/2017	Inspection Date	17/10/2017
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

Denise Tay (LKKAUTO)

From: mtreg <mtreg@income.com.sg>
Sent: Wednesday, 29 November, 2017 12:43 PM
To: Denise Tay (LKKAUTO)
Subject: REQUEST CLAIM NUMBER

Hi,

All claims created.

Samsia
Senior Admin Assistant, Motor Insurance
www.income.com.sg



From: Denise Tay (LKKAUTO) [mailto:denisetay@lkkauto.com]
Sent: Wednesday, November 29, 2017 10:51 AM
To: mtreg <mtreg@income.com.sg>
Subject: REQUEST CLAIM NUMBER

Dear Sir,

TP Claims against NTUC Income: Follow-Through Survey

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date
1	MT/0971613-001	SMRT TAXIS PTE LTD	SHB 535T	FBG 907Z	
2	MT/0971616-001	SMRT TAXIS PTE LTD	SHC 4736Z	SJA 2764S	
3	MT/0969589-002	SMRT TAXIS PTE LTD	SHB 736E	FY 4059C	
4	MT/0971621-001	SMRT TAXIS PTE LTD	SHB 5261A	FY 8785M	
5	MT/0965908-003	SMRT TAXIS PTE LTD	SHF 210J	SJQ 586T	

eBaoTech

GeneralClaim

Hello, NAC_PAYA_UBI_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No.		Date of Accident	15/10/2017 15:44						
Vehicle No.(For Motor)	SJQ586T								
Search									
Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
☒	5080410774-01	CHUA CHONG LIN IVAN (CAI CHANGLIN)	S8702983B	GPC	Third Party	SJQ586T	SJQ586T	18/05/2017	22/04/2018
Continue									

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type	Company
Owner ID	5369K
Vehicle Details	
Vehicle No.	SHF210J
Vehicle to be Exported	No
Intended De-registration Date	29 Nov 2017
Vehicle Make	CHEVROLET
Vehicle Model	EPICA 2.0DSL AT ABS D/AB 2WD 4DR TURBO
Primary Colour	Maroon
Manufacturing Year	2012
Engine No.	Z20S1463178K
Chassis No.	KL1LA69RJBB133429
Maximum Power Output	110.0 kW (147 bhp)
Open Market Value	\$14,475.00
Original Registration Date	08 Aug 2012
First Registration Date	08 Aug 2012
Transfer Count	0
Actual ARF Paid	\$14,475.00
Intended PARF Rebate Details	
PARF Eligibility	Yes
PARF Eligibility Expiry Date	07 Aug 2020
PARF Rebate Amount	\$10,132.00
Intended COE Rebate Details	
COE Expiry Date	07 Aug 2020
COE Category	A - Car (1600cc & below)
COE Period(Years)	8
QP Paid	\$46,801.00
COE Rebate Amount	\$15,741.00
Total Rebate Amount	\$25,873.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 29 Nov 2017

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	16/10/2017 09:35
Date Of Accident	15/10/2017 10:40
Exact Location Of Accident	PIE TOWARDS CHANGI
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHF210J
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	CHEVROLET
Model	EPICA-2.0 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-17087562MFSH
Cover Note Number	

Driver

Name of Driver	NORMAN BIN AHMAD
NRIC No	S0109927B
Date Of Birth	08/08/1954
Occupation	OUTDOOR
Date Of Driving Pass	07/02/1983
Driving Experience	34 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address

Postcode

Was driver an employee of the Insured's Company NO

If No, Relationship of the Driver with the Insured OTHER - HIRER

Vehicle Registration Number of Driver's Own Vehicle -

Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Was any body injured in the Accident? NO

Was any other material or property damaged? YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 2

Details of Police Action

Was the accident reported to the police? NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

I WAS TRAVELLING ALONG PIE AT THE SECOND RIGHT LANE WITH A PASSENGER ON BOARD AND HAD SLOWED DOWN TO A STOP UPON SEEING THE FRONT VEHICLE STOPPING. OUT OF A SUDDEN, THE VEHICLE SJQ586T FROM BEHIND COLLIDED ONTO THE REAR PORTION OF MY TAXI.

Attachment(s)

Are accident photos available for attachment? YES

Was there any video captured by Car Camera? YES

Remarks/ Reasons: FILE TOO LARGE

Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SJQ586T

Vehicle Make/Model/Colour HONDA JAZZ

Details Of Properties

Name of Driver IVAN CHUA

NRIC/Passport Number S8702983B

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

Describe Circumstances of the Accident

[illegible]

Declaration

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date & Time

Nashwan 16.10.2017
Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre
Personnel

also 16/10/2012

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF210J
 Ref. No : TAX/10/17/2083
 Reg. Date : 08/08/2012
 Vehicle Type : TAXI
 Make : CHEVROLET EPICA 2.0 VCDI
 Model : EPICA-2.0
 Name of Driver : NORMAN BIN AHMAD
 Type of Accident : HEAD TO REAR
 Date / Time of Accident : 15/10/2017 10:40:00 AM
 Accident Reported Date / Time : 16/10/2017 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by :
 Vehicle is Towed Back? : Yes
 Towed Back Date/Time : 15/10/2017
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024092562
 Special Instruction to ARC, if any :
 TOWED \$80 / SJQ586T - NTUC IDAC / Resurvey after repair
 Prepared Date : 16/10/2017 10:00:10 AM / Require book value



LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : KL1LA69RJBB133429

Mileage :


0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,859.00	0.00
Total Spray Painting Charges	: 4,248.00	0.00
Total Material Charges	: 19,434.26	19,434.26
Other Charges	: 2,252.00	0.00
TOTAL	: 27,793.26	0.00
Lum Sum Total	: 27,800.00	0.00
No. of Repair Days	: 12.00	0.00
Prepared / Adjusted By	:	12 days / Lumpsum
Arc / Surveyor Sign Off Date	: 17/10/2017 12:57:36 PM	01/01/1900 12:00:00 AM

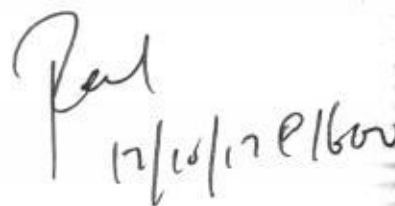
12/10/17 P/Bou

Prepared / Adjusted Date :

Remarks :

Prepared Date : 17/10/2017 12:55:58 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :

Invoice No :

Quotation Date :

Invoice Date :

Invoice Amount : 0.00

Prepared Date : 10/17/2017 12:57:18 PM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	1,859.00	0.00 1400 1800
Total Labour	1,859.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00 200
TO RESPRAY REAR BOOT LID	378.00	0.00 200
TO RESPRAY REAR PANEL	180.00	0.00 100
TO RESPRAY REAR SPARE TYRE PANEL	180.00	0.00 100
TO RESPRAY FLOOR CORNER PANEL LH	180.00	0.00 80
TO RESPRAY FLOOR CORNER PANEL RH	180.00	0.00 80
TO RESPRAY REAR CHASSIS LH	180.00	0.00 100
TO RESPRAY REAR CHASSIS RH	180.00	0.00 100
TO RESPRAY REAR RH WHEEL HOUSE	180.00	0.00 100
TO RESPRAY REAR LH WHEEL HOUSE	180.00	0.00 100
TO RESPRAY REAR SPEAKER PANEL	180.00	0.00 X
TO RESPRAY TAIL LAMP PANEL LH	180.00	0.00 50
TO RESPRAY TAIL LAMP PANEL RH	180.00	0.00 50
TO RESPRAY REAR FENDER RH	378.00	0.00 200
TO RESPRAY REAR FENDER LH	378.00	0.00 200
TO RESPRAY REAR DOOR LH	378.00	0.00 200
TO RESPRAY RH REAR DOOR	378.00	0.00 X
Total Spray Painting & Panel Beating	4,248.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	112.00	0.00 X
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 60
TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	0.00 160
TO REMOVE / REFIT SEAT	120.00	0.00 60
TO REMOVE & REFIT EXHAUST	120.00	0.00 60
TO REMOVE & REFIT FUEL TANK	120.00	0.00 60
TO ALIGN CHASSIS	350.00	0.00 300
TO TRANSFER REAR TAILGATE MECHANISM	120.00	0.00 60
TO REMOVE AND REFIT WIRE HARDESS	250.00	0.00 X
TO REMOVE AND REFIX REAR WINDSCREEN	120.00	0.00 120
TO PROVIDE LABOUR & MATERIAL TO REPLACE SHIELD REAR BUMPER (NET)	140.00	0.00 140
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00 60
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0.00 60
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	0.00 60
TO REPLACE SUNDRY PARTS	100.00	0.00 20
TO WASH AND VACUUM	60.00	0.00 40
Total Other Costs	2,252.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
93745100	REAR	6504569	BUMPER RR	1	1,238.00	10.00	1,114.20	Replace	Replace <i>DE</i>	No
96873838	REAR		ABSORBER ENGY RR BUMPER	1	70.00	10.00	63.00	Replace	Replace <i>DE</i>	No
96941154	REAR	6504571	BEAM RR BUMPER IMPACT	1	1,221.00	10.00	1,098.90	Replace	Replace <i>DE</i>	No
	REAR		BRACKET RR BUMPER SIDE LH	1	49.00	10.00	44.10	Replace	Replace <i>DE</i>	No
96633534	REAR		BRACKET RR BUMPER SIDE RH	1	49.00	10.00	44.10	Replace	Replace <i>DE</i>	No
	REAR		SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace <i>DE</i>	No
96858575		6504584	REFLECTOR REFLEX RR LH	1	264.00	10.00	237.60	Replace	Replace <i>DE</i>	No
96858576	REAR	6504586	REFLECTOR REFLEX RR RH	1	264.00	10.00	237.60	Replace	Replace <i>DE</i>	No
96873820	REAR		COVER TOWING EYE RR	1	21.00	10.00	18.90	Replace	Replace <i>DE</i>	No
96647117	COMMON		W/HARNESS RR BPR	1	227.34	10.00	204.61	Replace	Replace <i>DE</i>	No
			EXHAUST PIPE MOUNTING, REAR	2	4.40	10.00	7.92	Replace	Replace <i>DE</i>	No
96418400			MUFFLER A-EXH,RR	1	2,909.00	10.00	2,618.10	Replace	Replace <i>DE</i>	No
96636630	REAR	6504631	REAR BOOT LID	1	974.00	10.00	876.60	Replace	Replace <i>DE</i>	No
96636677	REAR	6504634	REAR BOOT LOCK	1	77.00	10.00	69.30	Replace	Replace <i>DE</i>	No
96976171	REAR	6504635	REAR BOOT REFLECTOR	1	165.00	10.00	148.50	Replace	Replace <i>DE</i>	No
96474968	REAR		REAR BOOT SPRING GAS	2	144.00	10.00	259.20	Replace	Replace <i>DE</i>	No
96636502	REAR		REAR BOOT HINGE	2	92.00	10.00	165.60	Replace	Replace <i>DE</i>	No
96636426	REAR	6504633	REAR BOOT STRIKER	1	15.00	10.00	13.50	Replace	Replace <i>DE</i>	No
96632854	REAR	6504632	REAR BOOT WEATHERSTRIP	1	49.00	10.00	44.10	Replace	Replace <i>DE</i>	No
96993921	REAR	6504578	TRIM TAIL LID	1	71.00	10.00	63.90	Replace	Replace <i>DE</i>	No
96851766	REAR	6504583	LAMP BACK UP RH	1	122.00	10.00	109.80	Replace	Replace <i>DE</i>	No
96851765	REAR	6504566	LAMP BACK UP LH	1	151.00	10.00	135.90	Replace	Replace <i>DE</i>	No
96634023	REAR	6504567	EMBLEM REAR	1	44.00	10.00	39.60	Replace	Replace <i>DE</i>	No
96190751	REAR		LAMP LICENSE	2	56.00	10.00	100.80	Replace	Replace <i>DE</i>	No
96634035	REAR	6504564	LETTERING:"CHEVR OLET"	1	29.00	10.00	26.10	Replace	Replace <i>DE</i>	No
96634897	REAR	6504565	LETTERING:"EPICA LT"	1	28.00	10.00	25.20	Replace	Replace <i>DE</i>	No
96646491	COMMON		W/HARNESS T / LID	1	83.52	10.00	75.17	Replace	Replace <i>DE</i>	No
	COMMON		NUMBER PLATE	1	15.00	0.00	15.00	Replace	Replace <i>DE</i>	No
	COMMON		NUMBER PLATE FRAME	1	12.00	0.00	12.00	Replace	Replace <i>DE</i>	No
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace <i>DE</i>	No
	COMMON		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace <i>DE</i>	No
96632015	REAR	6504636	PANEL END REAR	1	255.00	10.00	229.50	Replace	Replace <i>DE</i>	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
	COMMON		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace <i>no</i>	No
			LINER RH REAR FENDER (PROTECTOR)	1	65.00	10.00	58.50	Replace	Replace <i>DC</i>	No
96632652	REAR	6504619	MOLDING WINDSCREEN REAR	1	45.00	10.00	40.50	Replace	Replace <i>no</i>	No
	COMMON		SEALANT W/SCREEN	2	37.00	0.00	74.00	Replace	Replace <i>no</i>	No
			FUEL CAP	1	40.00	10.00	36.00	Replace	Replace <i>X</i>	No
96632638	BODY		FUEL LID COVER	1	54.00	10.00	48.60	Replace	Replace <i>X</i>	No
96636455	BODY		FUEL LID COVER CABLE	1	91.00	10.00	81.90	Replace	Replace <i>X</i>	No
96632713	BODY		FUEL LID LOCK	1	17.00	10.00	15.30	Replace	Replace <i>X</i>	No
			FUEL NECK	1	54.87	10.00	49.38	Replace	Replace <i>X</i>	No
			FUEL NECK COVER	1	45.78	10.00	41.20	Replace	Replace <i>X</i>	No
96635655	DOOR	6504603	PANEL LH REAR DOOR	1	1,863.00	10.00	1,676.70	Replace	Replace <i>Repair</i>	No
	COMMON		STICKER DECAL 6555 8888 (DOOR)	1	60.00	0.00	60.00	Replace	Replace <i>no</i>	No
96635656	DOOR	6504604	PANEL RH REAR DOOR	1	1,863.00	10.00	1,676.70	Replace	Replace <i>X</i>	No
	COMMON		STICKER DECAL 6555 8888 (DOOR)	1	60.00	0.00	60.00	Replace	Replace <i>X</i>	No
	COMMON		AIR DUCT REAR	2	45.00	10.00	81.00	Replace	Replace <i>?</i>	No
TOTAL MATERIALS								24,292.84	24,292.83	
TOTAL MATERIALS(Discounted)								19,434.26	19,434.26	

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									



Drive
8-11-17 / 14:16
9-11-17 / 07:11
+2 DAYS

60 Woodlands Industrial Park E4, Singapore 757705

FAX Number : 63685592

Estimator Telephone Number : 68662623


Accident Reporting Number : 68662672

SMRT Accident Vehicle Repair Estimates

26-10-17 / 07:11

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF210J
 Ref. No : TAX/10/17/2083
 Reg. Date : 08/08/2012
 Vehicle Type : TAXI
 Make : CHEVROLET EPICA 2.0 VCDI
 Model : EPICA-2.0
 Name of Driver : NORMAN BIN AHMAD
 Type of Accident : HEAD TO REAR
 Date / Time of Accident : 15/10/2017 10:40:00 AM
 Accident Reported Date / Time : 16/10/2017 12:00:00 PM
 Surveyor is Required? : Yes
 Survey by : *Rasul*
 Vehicle is Towed Back? : Yes
 Towed Back Date/Time : 15/10/2017
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024092562
 Special Instruction to ARC, if any :

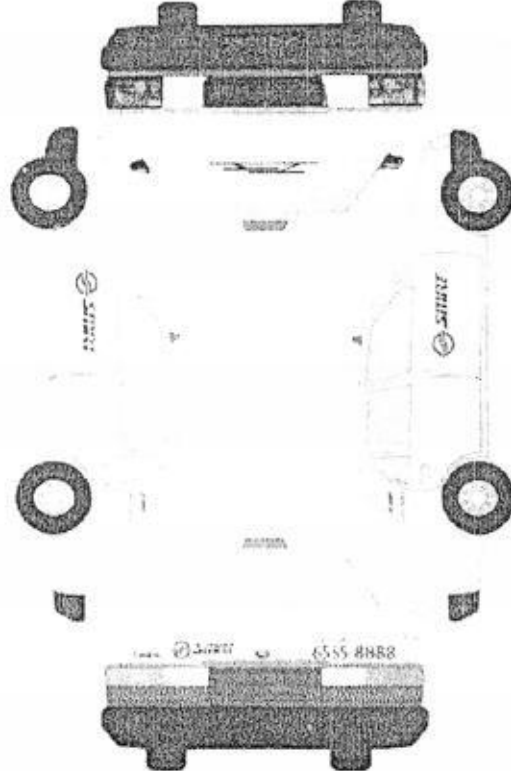

SJQ586T - NTUC IDAC *45*

Before paint photo, After repair photo FOR CHECK ITEM and REPLACE ITEM PLEASE CALL SURVEYOR *RASUL*
 / HP : 9001 0068. email: *rasul@lkkauto.com*
 TOWED \$80 / LUMP SUM REPAIR

Prepared Date : 16/10/2017 10:00:10 AM


9172 9794 Norman 1140X
1310X

Recording Camera

Radio Antenna

1st witness

2nd witness

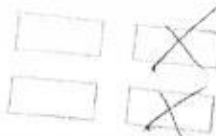

Date : *26-10-17*
 Date :

E 1/2 F
 KM *658684*

Attached
 Supplementary

Vehicle to Woga Date In: *26/10*

Towing: *✓*

Time In: *1300*

Driver:

Woga Job No: *13656/10*

Vehicle sent to SMRT Date In: *9/11/17*

Towing:

Time In: *1405*

Driver: *✓*

Received by (SMRT):

10/11/17 12:00 Reject RAR Render Repair & Spray
Sensor Reverse check Breakdown Sign crack
110/17/2083 13/11/17 11.39 PM SS

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : KL1LA69RJBB133429

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,859.00	1,750.00
Total Spray Painting Charges	: 4,428.00	1,960.00
Total Material Charges	: 11,152.47	17,009.51
Other Charges	: 2,140.00	-3,119.51
TOTAL	: 19,579.47	17,600.00
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 15.00	14.00
Prepared / Adjusted By	:	RASUL (LKK)
Arc / Surveyor Sign Off Date	: 17/10/2017 12:57:36 PM	17/10/2017 04:29:19 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 17/10/2017 12:55:58 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : QN-1711-0372

Invoice No :

Quotation Date : 16/11

Invoice Date :

Invoice Amount : 0.00

Prepared Date : 10/17/2017 12:57:18 PM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	1,859.00	1,750.00
Total Labour	1,859.00	1,750.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	200.00
TO RESPRAY REAR BOOT LID	378.00	200.00
TO RESPRAY REAR PANEL	180.00	100.00
TO RESPRAY REAR SPARE TYRE PANEL	180.00	100.00
TO RESPRAY FLOOR CORNER PANEL LH	180.00	80.00
TO RESPRAY FLOOR CORNER PANEL RH	180.00	80.00
TO RESPRAY REAR CHASSIS LH	180.00	100.00
TO RESPRAY REAR CHASSIS RH	180.00	100.00
TO RESPRAY REAR RH WHEEL HOUSE	180.00	100.00
TO RESPRAY REAR LH WHEEL HOUSE	180.00	100.00
TO RESPRAY REAR SPEAKER PANEL	180.00	0.00 <i>Xan</i>
TO RESPRAY TAIL LAMP PANEL LH	180.00	50.00
TO RESPRAY TAIL LAMP PANEL RH	180.00	50.00
TO RESPRAY REAR FENDER RH	378.00	200.00
TO RESPRAY REAR FENDER LH	378.00	200.00
TO RESPRAY REAR DOOR LH	378.00	200.00
TO RESPRAY RH REAR DOOR	378.00	0.00 <i>Xan</i>
TO RESPRAY REAR SPEAKER PANEL	180.00	100.00
Total Spray Painting & Panel Beating	4,428.00	1,960.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

36120 69

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	60.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	160.00
TO REMOVE / REFIT SEAT	120.00	60.00
TO REMOVE & REFIT EXHAUST	120.00	60.00
TO REMOVE & REFIT FUEL TANK	120.00	60.00
TO ALIGN CHASSIS	350.00	300.00
TO TRANSFER REAR TAILGATE MECHANISM	120.00	60.00
TO REMOVE AND REFIT WIRE HARDESS	250.00	0.00 <i>X 17</i>
TO REMOVE AND REFIX REAR WINDSCREEN	120.00	120.00
TO PROVIDE LABOUR & MATERIAL TO REPLACE SHIELD REAR BUMPER (NET)	140.00	140.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	60.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	60.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	60.00
TO REPLACE SUNDRY PARTS	100.00	20.00
TO WASH AND VACUUM	60.00	40.00
Lump Sum Adjustment by Surveyor	0.00	-4,379.51
Total Other Costs	2,140.00	-3,119.51

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
93745100	REAR	6504569	BUMPER RR	1	1,238.00	10.00	1,114.20	Replace	Replace	No <i>DE</i>
96873838	REAR		ABSORBER ENGY RR BUMPER	1	70.00	10.00	63.00	Replace	Replace	No <i>DE</i>
96941154	REAR	6504571	BEAM RR BUMPER IMPACT	1	1,221.00	10.00	1,098.90	Replace	Replace	No <i>DE</i>
	REAR		BRACKET RR BUMPER SIDE LH	1	49.00	10.00	44.10	Replace	Replace	No <i>DE</i>
96633534	REAR		BRACKET RR BUMPER SIDE RH	1	49.00	10.00	44.10	Replace	Replace	No <i>DE</i>
	REAR		SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No <i>DE</i>
96858575		6504584	REFLECTOR REFLEX RR LH	1	264.00	10.00	237.60	Replace	Replace	No <i>DE</i>
96858576	REAR	6504586	REFLECTOR REFLEX RR RH	1	264.00	10.00	237.60	Replace	Replace	No <i>CR</i>
96873820	REAR		COVER TOWING EYE RR	0	21.00	10.00	0.00	Replace	Not given	No <i>CR</i>
96647117	COMMON		W/HARNESS RR BPR	0	227.34	10.00	0.00	Replace	Not given	No <i>X</i>
			EXHAUST PIPE MOUNTING, REAR	2	4.40	10.00	7.92	Replace	Replace	No <i>X</i>
96418400			MUFFLER A-EXH,RR	1	2,909.00	10.00	2,618.10	Replace	Replace	No <i>DE</i>
96636630	REAR	6504631	REAR BOOT LID	1	974.00	10.00	876.60	Replace	Replace	No <i>DE</i>
96636677	REAR	6504634	REAR BOOT LOCK	1	77.00	10.00	69.30	Replace	Replace	No <i>DE</i>
96976171	REAR	6504635	REAR BOOT REFLECTOR	1	165.00	10.00	148.50	Replace	Check	No <i>DE</i>
96474968	REAR		REAR BOOT SPRING GAS	0	144.00	10.00	0.00	Replace	Not given	No <i>X</i>
96636502	REAR		REAR BOOT HINGE	0	92.00	10.00	0.00	Replace	Not given	No <i>X</i>
96636426	REAR	6504633	REAR BOOT STRIKER	1	15.00	10.00	13.50	Replace	Replace	No <i>DE</i>
96632854	REAR	6504632	REAR BOOT WEATHERSTRIP	1	49.00	10.00	44.10	Replace	Replace	No <i>DE</i>
96993921	REAR	6504578	TRIM TAIL LID	1	71.00	10.00	63.90	Replace	Replace	No <i>DE</i>
96851766	REAR	6504583	LAMP BACK UP RH	1	122.00	10.00	109.80	Replace	Replace	No <i>CR</i>
96851765	REAR	6504566	LAMP BACK UP LH	1	151.00	10.00	135.90	Replace	Replace	No <i>CR</i>
96634023	REAR	6504567	EMBLEM REAR	1	44.00	10.00	39.60	Replace	Replace	No <i>CR</i>
96190751	REAR		LAMP LICENSE	2	56.00	10.00	100.80	Replace	Check	No <i>X</i>
96634035	REAR	6504564	LETTERING:"CHEVR OLET"	1	29.00	10.00	26.10	Replace	Replace	No <i>DE</i>
96634897	REAR	6504565	LETTERING:"EPICA LT"	1	28.00	10.00	25.20	Replace	Replace	No <i>DE</i>
96646491	COMMON		W/HARNESS T / LID	0	83.52	10.00	0.00	Replace	Not given	No <i>X</i>
	COMMON		NUMBER PLATE	1	15.00	0.00	15.00	Replace	Replace	No <i>DE</i>
	COMMON		NUMBER PLATE FRAME	1	12.00	0.00	12.00	Replace	Replace	No <i>DE</i>
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No <i>DE</i>
	COMMON		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No <i>DE</i>
96632015	REAR	6504636	PANEL END REAR	1	255.00	10.00	229.50	Replace	Replace	No <i>DE</i>

8969.06

7335.42

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
94503739			CLIP, TRIM	4	1.00 (4)	10.00	3.60	Replace	Replace	No <i>nee</i>
96637759	REAR	6504579	TRIM REAR END PANEL	1	114.00	10.00	102.60	Replace	Replace	No <i>De</i>
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No <i>nee</i>
96515711			PANEL SPARE TYRE	1	2,299.00	10.00	2,069.10	Replace	Replace	No <i>nee</i>
	COMMON		SPARE TYRE STUD	1	56.59	10.00	50.93	Replace	Check	No <i>Xsu</i>
			INSULATOR SHEET	1	41.48	10.00	37.33	Replace	Replace	No <i>nee</i>
	COMMON		BREAKDOWN SIGN	1	35.00	0.00	35.00	Replace	Check	No <i>Xsu</i>
	BODY		CHASSIS MEMBER RR LH	1	525.38	10.00	472.84	Replace	Replace	No <i>nee</i>
	BODY		CHASSIS MEMBER RR RH	1	525.38	100.00	0.00	Replace	Repair	No <i>R</i>
	BODY		PNL SIDE LH SPARE TYRE	1	650.00	10.00	585.00	Replace	Replace	No <i>nee</i>
	BODY		PNL SIDE RH SPARE TYRE	1	650.00	10.00	585.00	Replace	Replace	No <i>nee</i>
96996179			PANEL A-SIDE, INR, RR RH	1	830.00	10.00	747.00	Replace	Replace	No <i>nee</i>
96996179			PANEL A-SIDE, INR, RR RH	1	830.00	10.00	747.00	Replace	Replace	No <i>nee</i>
96632584	BODY		WHEEL HOUSE INNER RH	1	734.27	100.00	0.00	Replace	Repair	No <i>R</i>
96632596	REAR		WHEELHOUSE A-RR LH	1	464.00	10.00	417.60	Replace	Replace	No <i>nee</i>
96632621	REAR		PANEL UPPER RR (SPEAKER PANEL)	0	497.00	10.00	0.00	Replace	Not given	No <i>X</i>
			JACK CARRIER	0	12.95	10.00	0.00	Replace	Not given	No <i>X</i>
			JACK FOAM COVER	0	35.00	10.00	0.00	Replace	Not given	No <i>X</i>
96932979			COVER BAORD SPARE TYRE	0	661.00	10.00	0.00	Replace	Not given	No <i>X</i>
			TRIM BOARD REAR SPEAKER PANEL	0	205.87	10.00	0.00	Replace	Not given	No <i>X</i>
96399775	COMMON		W/HARNESS RR DEFOG	0	7.72	10.00	0.00	Replace	Not given	No <i>X</i>
96646502	COMMON		W/HARNESS TRK ROOM	0	51.74	10.00	0.00	Replace	Not given	No <i>X</i>
96851763	REAR	6504563	LAMP RR COMBINATION LH	1	415.00	10.00	373.50	Replace	Replace	No <i>CR</i>
			PANEL TAIL LAMP, LH	1	143.40	10.00	129.06	Replace	Replace	No <i>PA</i>
96632799	LEFT	6504637	FENDER LH REAR	1	1,191.00	10.00	1,071.90	Replace	Replace	No <i>nee</i>
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No <i>nee</i>
	COMMON		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No <i>nee</i>
96633557	REAR	6504575	LINER LH REAR FENDER (PROTECTOR)	1	201.00	10.00	180.90	Replace	Replace	No <i>De</i>
96851764	REAR	6504511	LAMP RR COMBINATION RH	1	415.00	10.00	373.50	Replace	Replace	No <i>CR</i>
			PANEL TAIL LAMP, RH	1	143.40	10.00	129.06	Replace	Replace	No <i>PA</i>
96632800	REAR	6504638	FENDER RH REAR	1	1,467.00	10.00	1,320.30	Replace	Replace	No <i>BT</i>
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No <i>nee</i>

13280-38

9419.49

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
	COMMON		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No <i>nu</i>
			LINER RH REAR FENDER (PROTECTOR)	1	65.00	10.00	58.50	Replace	Replace	No <i>st</i>
96632652	REAR	6504619	MOLDING WINDSCREEN REAR	1	45.00	10.00	40.50	Replace	Replace	No <i>nu</i>
	COMMON		SEALANT W/SCREEN	2	37.00 (74)	0.00	74.00	Replace	Replace	No <i>nu</i>
			FUEL CAP	0	40.00	10.00	0.00	Replace	Not given	No <i>X</i>
96632638	BODY		FUEL LID COVER	0	54.00	10.00	0.00	Replace	Not given	No <i>X</i>
96636455	BODY		FUEL LID COVER CABLE	0	91.00	10.00	0.00	Replace	Not given	No <i>X</i>
96632713	BODY		FUEL LID LOCK	0	17.00	10.00	0.00	Replace	Not given	No <i>X</i>
			FUEL NECK	0	54.87	10.00	0.00	Replace	Not given	No <i>X</i>
			FUEL NECK COVER	0	45.78	10.00	0.00	Replace	Not given	No <i>X</i>
96635655	DOOR	6504603	PANEL LH REAR DOOR	1	1,863.00	100.00	0.00	Replace	Repair	No <i>rl</i>
	COMMON		STICKER DECAL 6555 8888 (DOOR)	1	60.00	0.00	60.00	Replace	Replace	No <i>nu</i>
96635656	DOOR	6504604	PANEL RH REAR DOOR	0	1,863.00	10.00	0.00	Replace	Not given	No <i>X</i>
	COMMON		STICKER DECAL 6555 8888 (DOOR)	0	60.00	0.00	0.00	Replace	Not given	No <i>X</i>
	COMMON		AIR DUCT REAR	2	45.00	10.00	81.00	Replace	Check	No <i>X</i>
TOTAL MATERIALS							17,425.75	17,009.51		
TOTAL MATERIALS(Discounted)							11,152.47	17,009.51		

Added Spare Parts / Material Usage After Surveyor Signed off

254.60

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

17,009.51
 + 1,750.00
 + 3,220.00

 21,979.51
 - 20%

 17,583.61
 45 \$17,600/-
 14 days

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Thatcham escribe

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC17020021/R1tbe2

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 22-12-2017

189556



Code: INC4

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SJQ 586T	Veh. Inspected	SHF 210J
Policy No.	5080410774-01	Coverage (\$)	0.00
Claim No.	MT/0965908-003	Excess (\$)	0.00
Assign From		Assign Date	17/10/2017

2. Vehicle Particulars & Condition

Make & Model	CHEVROLET EPICA	c.c	1991
Engine No.	HIDDEN	Year of Reg.	2012
Chassis No.	KL1LA69RJBB133429	Colour	MAROON
Odometer	658685	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/65 R15	FALKEN	5 mm
L/H Front Tyre	205/65 R15	FALKEN	5 mm
R/H Rear Tyre	205/65 R15	FALKEN	5 mm
L/H Rear Tyre	205/65 R15	FALKEN	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	15/10/2017	Inspection Date	17/10/2017
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	14 Working Days
-------------------------------------	-----------------

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 210J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BUMPER RR (DISC 10%)	DEFORMED	1,238.00	1,114.20
1	ABSORBER ENGY RR BUMPER (DISC 10%)	DEFORMED	70.00	63.00
1	BEAM RR BUMPER IMPACT (DISC 10%)	BENT	1,221.00	1,098.90
1	BRACKET RR BUMPER SIDE LH (DISC 10%)	NECESSARY	49.00	44.10
1	BRACKET RR BUMPER SIDE RH (DISC 10%)	NECESSARY	49.00	44.10
1	REFLECTOR REFLEX RR LH (DISC 10%)	CRACKED	264.00	237.60
1	REFLECTOR REFLEX RR RH (DISC 10%)	CRACKED	264.00	237.60
2	EXHAUST PIPE MOUNTING, REAR @\$4.40 (DISC 10%)	BENT	8.80	7.92
1	MUFFLER A-EXH, RR (DISC 10%)	BENT	2,909.00	2,618.10
1	REAR BOOT LID (DISC 10%)	BENT	974.00	876.60
1	REAR BOOT LOCK (DISC 10%)	BENT	77.00	69.30
1	REAR BOOT STRIKER (DISC 10%)	BENT	15.00	13.50
1	REAR BOOT WEATHERSTRIP (DISC 10%)	NECESSARY	49.00	44.10
1	TRIM TAIL LID (DISC 10%)	DEFORMED	71.00	63.90
1	LAMP BACK UP RH (DISC 10%)	CRACKED	122.00	109.80
1	LAMP BACK UP LH (DISC 10%)	CRACKED	151.00	135.90
1	EMBLEM REAR (DISC 10%)	NECESSARY	44.00	39.60
1	LETTERING:"CHEVROLET" (DISC 10%)	NECESSARY	29.00	26.10
1	LETTERING:"EPICALT" (DISC 10%)	NECESSARY	28.00	25.20
1	PANEL END REAR (DISC 10%)	BUCKLED	255.00	229.50
4	CLIP, TRIM @\$1.00 (DISC 10%)	NECESSARY	4.00	3.60
1	TRIM REAR END PANEL (DISC 10%)	DEFORMED	114.00	102.60
1	PANEL SPARE TYRE (DISC 10%)	BUCKLED	2,299.00	2,069.10
1	INSULATOR SHEET (DISC 10%)	NECESSARY	41.48	37.33
1	CHASSIS MEMBER RR LH (DISC 10%)	BUCKLED	525.38	472.84
1	PNL SIDE LH SPARE TYRE (DISC 10%)	BUCKLED	650.00	585.00
1	PNL SIDE RH SPARE TYRE (DISC 10%)	BUCKLED	650.00	585.00
1	PANEL A-SIDE, INR, RR RH (DISC 10%)	BUCKLED	830.00	747.00
1	PANEL A-SIDE, INR, RR RH (DISC 10%)	BUCKLED	830.00	747.00
1	WHEELHOUSE A-RR LH (DISC 10%)	BUCKLED	464.00	417.60

Report Ref No. NS/INC17020021/R1tbe2

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	LAMP RR COMBINATION LH (DISC 10%)	CRACKED	415.00	373.50
1	PANEL TAIL LAMP, LH (DISC 10%)	BENT	143.40	129.06
1	FENDER LH REAR (DISC 10%)	BUCKLED	1,191.00	1,071.90
1	LINER LH FENDER (PROTECTOR) (DISC 10%)	DEFORMED	201.00	180.90
1	LAMP RR COMBINATION RH (DISC 10%)	CRACKED	415.00	373.50
1	PANEL TAIL LAMP, RH (DISC 10%)	BENT	143.40	129.06
1	FENDER RH REAR (DISC 10%)	BENT	1,467.00	1,320.30
1	LINER RH REAR FENDER (PROTECTOR) (DISC 10%)	CUT	65.00	58.50
1	MOLDING WINDSCREEN REAR (DISC 10%)	NECESSARY	45.00	40.50
1	SENSOR REVERSE (SN)	NOT WORKING	180.00	180.00
1	NUMBER PLATE (SN)	SCRATCHED	15.00	15.00
1	NUMBER PLATE FRAME (SN)	SCRATCHED	12.00	12.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	SEALANT SIKAFLEX (SN)	NECESSARY	37.00	37.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
2	SEALANT W/SCREEN @\$37.00 (SN)	NECESSARY	74.00	74.00
1	STICKER DECAL 6555 8888 (DOOR) (SN)	NECESSARY	60.00	60.00
1	COVER TOWING EYE RR	SERVICEABLE	21.00	-
1	W/HARNESS RR BPR	SERVICEABLE	227.34	-
1	REAR BOOT REFLECTOR	SERVICEABLE	165.00	-
1	REAR BOOT SPRING GAS	SERVICEABLE	144.00	-
1	REAR BOOT HINGE	SERVICEABLE	92.00	-
2	LAMP LICENSE @\$56.00	SERVICEABLE	112.00	-
1	W/HARNESS T / LID	SERVICEABLE	83.52	-
1	SPARE TYRE STUD	SERVICEABLE	56.59	-
1	BREAKDOWN SIGN	SERVICEABLE	35.00	-
1	PANEL UPPER RR (SPEAKER PANEL)	SERVICEABLE	497.00	-
1	JACK CARRIER	SERVICEABLE	12.95	-
1	JACK FOAM COVER	SERVICEABLE	35.00	-

Report Ref No. NS/INC17020021/R1tbe2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	COVER BOARD SPARE TYRE	SERVICEABLE	661.00	-
1	TRIM BOARD REAR SPEAKER PANEL	SERVICEABLE	205.87	-
1	W/HARNESS RR DEFOG	SERVICEABLE	7.72	-
1	W/HARNESS TRK ROOM	SERVICEABLE	51.74	-
1	FUEL CAP	SERVICEABLE	40.00	-
1	FUEL LID COVER	SERVICEABLE	54.00	-
1	FUEL LID COVER CABLE	SERVICEABLE	91.00	-
1	FUEL LID LOCK	SERVICEABLE	17.00	-
1	FUEL NECK	SERVICEABLE	54.87	-
1	FUEL NECK COVER	SERVICEABLE	45.78	-
1	PANEL RH REAR DOOR	SERVICEABLE	1,863.00	-
1	STICKER DECAL 6555 8888 (DOOR)	SERVICEABLE	60.00	-
2	AIR DUCT REAR @\$45.00	SERVICEABLE	90.00	-
1	CHASSIS MEMBER RR RH	TO REPAIR	525.38	-
1	WHEEL HOUSE INNER RH	TO REPAIR	734.27	-
1	PANEL LH REAR DOOR	TO REPAIR	1,863.00	-
			26,693.69	17,009.51
	LABOUR			
	THATCHAM STANDARD REPAIR TIME ON BODY WORKS.		3,639.00	2,790.00
	THATCHAM TTS STANDARD SPRAY PAINTING COST AND LABOUR.		4,628.00	2,120.00
	TO REPLACE SUNDRY PARTS.		100.00	20.00
	TO WASH AND VACUUM.		60.00	40.00
			8,427.00	4,970.00
	GRAND TOTAL		35,120.69	21,979.51
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)			17,600.00

Report Ref No. NS/INC17020021/R1tbe2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons), B.Bus, MBA, PEng, PE,
MInstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.