

Signature

REF:

NS/INC17020935/Sqber

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

GBF 662XX

Policy No.

5087918595 090217 - 080218

Claims No.

MT/0967919-002

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

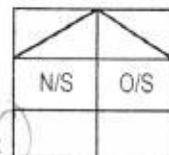

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

5

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHF 4724

Yr Regn:

30/7/2014

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota Prius

cc 1798

Colour

Maroon

A/C: Insured / Std / NI / NA

Sp. Reading

32896

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTDKN3C4205751738

Gen. Cond: Good / Fair / Poor / Burnt

Steering: InOrder / Jammed / Leaked / Burnt or

Brake: InOrder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 195 / 65 R15

R: "

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Fallen

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

31/10/2017

D.O.I.

1/11/2017

Survey held at

SMRT

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time | Action / Instruction

SHF 4724 - X

GBF 662XX - X

TAX / 10/17/2017

LKR.

NTUC.

US \$ 7650, 5 days (Red \$ 444.90, 63%)

RECEIVED 20 NOV 2017

Date/Time, File Pass to?



Preli. Report



Final Report

Date/Time, File Return to?

2)

Report Format :

Lump Sum / I.B.I. (\$) 7650

Days Of Repair: 5

Resurvey No. of Trip: 2

Add Fee:



Site Insp (\$

) \$ + RS. \$



Interview (\$

) Photos



Tech. Invs (\$

) Others



Weekend (\$

)

TOTAL

160

35

195



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC17020933/Sqb

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 02-11-2017

189556



Code: INC4

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBF 6529Y	Veh. Inspected	SHF 472U
Policy No.	5087918595	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	01/11/2017

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	31/10/2017	Inspection Date	01/11/2017
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

Survey Department Check List (Case Handler)

Reference No.: *NS/INC17020433/Sq*
 Policy Type: *OD / TP / TP RES / TL / EVA*

SAT 4724

Case Handler

Typist

Admin (*Cathy*): Case handler to make sure all Information created by the assignment team are **ACCURATE**.

(1) Office Assign Form

- C Reference No.
- C Customer Code
- N Assign From
- C Assign Date
- C Veh No (Inspected)
- C Veh No (Insured)
- C D.O.A
- C Policy No
- C Claim No
- C Insurance Authorisation (CA /REV/REP)
- C Report Type
- C Weekend Charges
- N Survey held at/Repairer.
- C Excess

Y-Date	N-Date	Y-Date	N-Date
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			

Surveyor (*Sebastian*): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form

- C Vehicle No
- C Regn Month/Year
- N Vehicle Type
- N Make & Model
- C Engine Capacity. (C.C)
- N Colour
- C Odometer. (Sp.Reading)
- C Chassis No
- N General Condition
- N Steering
- N Brake
- N Modification (Modi)
- C Tyre Size
- N Tyre Make
- C Tyre Balance
- C Date of Inspection
- N Survey held
- N Des.of Damages

<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			
<i>✓</i>			

(2) System - (Views/Merimen)

- C Damaged Vehicle Photographs Uploaded

<i>✓</i>			
----------	--	--	--

(3) Workshop Estimate/Assignment Form

- N ALL Parts condition
- C Market Value for OD cases
- C Estimate Repair Cost for PRI (RSI, TMI, MSIG)
- C Days of repair
- C Finalised Amount
- C Re-inspection Cases to Finalize within 5 Days

<i>✓</i>			
<i>✓</i>			

(4) System - (Views/Merimen)

- C Resurvey photo Uploaded

<i>✓</i>			
----------	--	--	--

Check By: *[Signature]* *20/11/17*
 Case Handler Date

TP Claims against NTUC Income: Follow-Through Survey

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.
1	MT/0967919-002	SMRT TAXIS PTE LTD	SHF 472U	GBF 6529Y
2	MT/0962029-002	SMRT BUSES LTD	SMB 1572U	SKX 6335M
3	MT/0968532-003	SMRT TAXIS PTE LTD	SHB 1953M	SDB 6808P
4	MT/0969143-002	SMRT TAXIS PTE LTD	SHD 6476E	SJK 7469J
5	MT/0912702-002	SMRT BUSES LTD	SMB 1630K	FQ 8465D
6	MT/0970438-001	SMRT TAXIS PTE LTD	SHB5851Y	SLQ 3128P
7	MT/0970441-001	SMRT TAXIS PTE LTD	SHB 1960S	SKM 5998P
8	MT/0959634-002	SMRT BUSES LTD	SMB 1580X	SLD 9017E
9	MT/0968476-002	SMRT TAXIS PTE LTD	SHB 5800U	SHD 2021K
10	MT/0953202-003	SMRT TAXIS PTE LTD	SHC 4540X	WC3406E

eBaoTech

General Claim

Hello, NAC_PAYA_UBI_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No.		Date of Accident	31/10/2017 10:23						
Vehicle No. (For Motor)	GBF6529Y								
Search									
Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
☒	5087918595	ECREATIVE CATERING	53101680C	GCV	Comprehensive	GBF6529Y	GBF6529Y	09/02/2017	08/02/2018
Continue									

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type	Company
Owner ID	5369K
Vehicle Details	
Vehicle No.	SHF472U
Vehicle to be Exported	No
Intended De-registration Date	02 Nov 2017
Vehicle Make	TOYOTA
Vehicle Model	PRIUS TAXI (SMRT)
Primary Colour	Maroon
Manufacturing Year	2014
Engine No.	2ZR6191065
Chassis No.	JTDKN36U205751738
Maximum Power Output	100.0 kW (134 bhp)
Open Market Value	\$32,920.00
Original Registration Date	30 Sep 2014
First Registration Date	30 Sep 2014
Transfer Count	0
Actual ARF Paid	\$8,088.00
Intended PARF Rebate Details	
PARF Eligibility	Yes
PARF Eligibility Expiry Date	29 Sep 2022
PARF Rebate Amount	\$6,066.00
Intended COE Rebate Details	
COE Expiry Date	29 Sep 2022
COE Category	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years)	8
PQP Paid	\$50,704.00
COE Rebate Amount	\$31,109.00
Total Rebate Amount	\$37,175.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 02 Nov 2017

OK



Please read through the [Privacy Statement](#), [Terms of Use](#), and [Disclaimer](#).

Please do not use the Back or Forward buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 10 and above, Chrome, Firefox, and Safari.

Copyright 2017 LTA [Privacy Statement](#) [Terms of Use](#) [Disclaimer](#) [Rate the Website](#) [Rate this e-Service](#)

Last updated on 13 Oct 2017 at 07:07 PM

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	31/10/2017 13:50
Date Of Accident	31/10/2017 12:00
Exact Location Of Accident	DRIVE WAY NEAR BLK 477 SEMBAWANG DRIVE
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHF472U
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-17087562MFSH
Cover Note Number	

Driver

Name of Driver	LOW SOON HIN
NRIC No	S1417213J
Date Of Birth	09/03/1960
Occupation	OUTDOOR
Date Of Driving Pass	06/05/2002
Driving Experience	15 YEARS AND 5 MONTHS
Gender	MALE
Mobile Number	
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address

Postcode

Was driver an employee of the Insured's Company NO

If No, Relationship of the Driver with the Insured OTHER - HIRER

Vehicle Registration Number of Driver's Own Vehicle

Insurance Company of Driver's Own Vehicle

General Information of the Accident

Type Of Accident SIDE SWIPE

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Was any body injured in the Accident? NO

Was any other material or property damaged? YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

AFTER I HAD ALIGHTED MY PASSENGER AND COMPLETED THE 3 POINT TURN. BEFORE I COULD MOVE FORWARD, SUDDENLY THE VEHICLE GBF6529Y REVERSED OUT FROM THE LOADING BAY AND IT'S LEFT FRONT PORTION COLLIDED ONTO THE LEFT REAR PORTION OF MY TAXI.

Attachment(s)

Are accident photos available for attachment? YES

Was there any video captured by Car Camera? YES

Remarks/ Reasons: FILE TOO LARGE

Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number GBF6529Y

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver KALIYAPERUMAL VINOTH

NRIC/Passport Number G2313244W

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that :
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



Policyholder's Signature / Date & Time


Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

2LK 476A MSCP

A-SHF 4724
B-GSF 6529Y

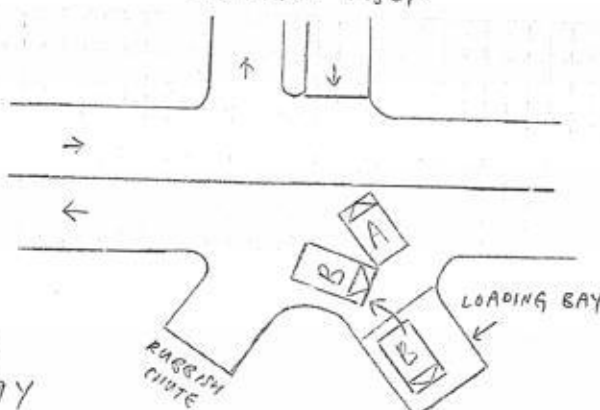

Describe Circumstances of the Accident

This image shows a single sheet of white paper with horizontal blue or grey ruling lines. The lines are evenly spaced and run across the width of the page. There is no handwriting or other markings on the paper.

Declaration

We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date &
Time

Driver's Signature (If driver is not the policyholder) / Date
& Time

Witnessed by Reporting Centre
Personnel

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF472U
 Ref. No : TAX/10/17/2171
 Reg. Date : 30/09/2014
 Vehicle Type : TAXI
 Make : TOYOTA PRIUS
 Model : PRIUS
 Name of Driver : LOW SOON HIN
 Type of Accident : SIDE SWIPE
 Date / Time of Accident : 31/10/2017 12:00:00 PM
 Accident Reported Date / Time : 31/10/2017 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by :
 Vehicle is Towed Back? : Yes
 Towed Back Date/Time : 31/10/2017
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024092835
 Special Instruction to ARC, if any :
 TOWED \$40 / GBF6529Y - NTUC IDAC
 Prepared Date : 31/10/2017 02:28:54 PM



LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Sebastian

1/11/2017

- Lump Sum Repair.
- Question Mark Item Photo
- Photo After Paint.



31/1/17

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U205751738

Mileage :

0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,014.00	0.00
Total Spray Painting Charges	: 1,116.00	0.00
Total Material Charges	: 2,389.90	2,389.90
Other Charges	: 1,265.00	0.00
TOTAL	: 5,784.90	0.00
Lum Sum Total	: 5,800.00	0.00
No. of Repair Days	: 6.00	0.00
Prepared / Adjusted By	:	4 days
Arc / Surveyor Sign Off Date	: 31/10/2017 04:05:55 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 31/10/2017 04:05:31 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :

Invoice No :

Quotation Date :

Invoice Date :

Invoice Amount :

Prepared Date :

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR LH REAR PORTION	1,014.00	0.00 700
Total Labour	1,014.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00 200
TO RESPRAY TROUGH BACK DOOR LH	180.00	0.00 X
TO RESPRAY REAR FENDER LH	378.00	0.00 200
TO RESPRAY REAR PANEL	180.00	0.00
Total Spray Painting & Panel Beating	1,116.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	80.00	0.00 X
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 30
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00 30
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	0.00 ✓
TO REMOVE & REFIT REAR QUARTER GLASS LH	120.00	0.00 60
TO REMOVE & REFIT FUEL TANK	120.00	0.00 X
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0.00 50
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00 X
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	0.00 30
TO REPLACE SUNDRY PARTS	100.00	0.00 20
TO WASH AND VACUUM	60.00	0.00 X
TO REMOVE / REFIT SEAT	120.00	0.00 60
Total Other Costs	1,265.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No
76088-47020		6505617	BUMPER LIP COVER RR/LH	1	72.20	25.00	54.15	Replace	Replace	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace	No
52592-47021			BUMPER SEAL, RR LH	1	88.90	25.00	66.67	Replace	Replace	No
52563-47010			TAIL LAMP BRACKET, LH	1	30.70	25.00	23.02	Replace	Replace	No
81561-47170		6505461	TAIL LAMP LH	1	548.40	10.00	493.56	Replace	Replace	No
61622-47030			TROUGH, BACK DOOR LH	1	110.90	10.00	99.81	Replace	Replace	No
61602-47091		6505476	FENDER RR/LH	1	766.80	25.00	575.10	Replace	Replace	No
	COMMO N		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No
			STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No
62720-47031			QUARTER GLASS RR/LH	1	168.10	25.00	126.07	Replace	Replace	No
	COMMO N		SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace	No
65638-47021		6505477	FENDER LINER RR/LH	1	141.30	25.00	105.97	Replace	Replace	No
77350-47030			LID ASSY, FUEL	1	102.00	25.00	76.50	Replace	Replace	No
77300-52030			CAP ASSY, FUEL TANK	1	68.10	25.00	51.07	Replace	Replace	No
77377-75010			RETAINER, FUEL LID CABLE	1	5.90	25.00	4.42	Replace	Replace	No
77035-47090			CABLE SUB-ASSY, FUEL LID	1	63.90	25.00	47.92	Replace	Replace	No
77201-47250			PIPE SUB-ASSY, FUEL NECK	1	230.80	25.00	173.10	Replace	Replace	No
58307-47060		6505522	END PANEL	1	602.10	25.00	451.57	Replace	Replace	No
	COMMO N	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No
TOTAL MATERIALS								2,987.42	2,987.38	
TOTAL MATERIALS(Discounted)								2,389.90	2,389.90	

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									



+ 1 Day BP
6-11-17 / 10:22
6-11-17 / 14:22

Quen

Attached Supplementary


SMRT AUTOMOTIVE SERVICE PTE LTD
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662623
Accident Reporting Number : 68662672

SMRT Accident Vehicle Repair Estimates

1-11-17 / 14:22

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF472U
Ref. No : TAX/10/17/2171
Reg. Date : 30/09/2014
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : LOW SOON HIN
Type of Accident : SIDE SWIPE
Date / Time of Accident : 31/10/2017 12:00:00 PM
Accident Reported Date / Time : 31/10/2017 12:00:00 AM
Surveyor is Required? : Yes
Survey by : Sebastian
Vehicle is Towed Back? : Yes
Towed Back Date/Time : 31/10/2017
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024092835
Special Instruction to ARC, if any :

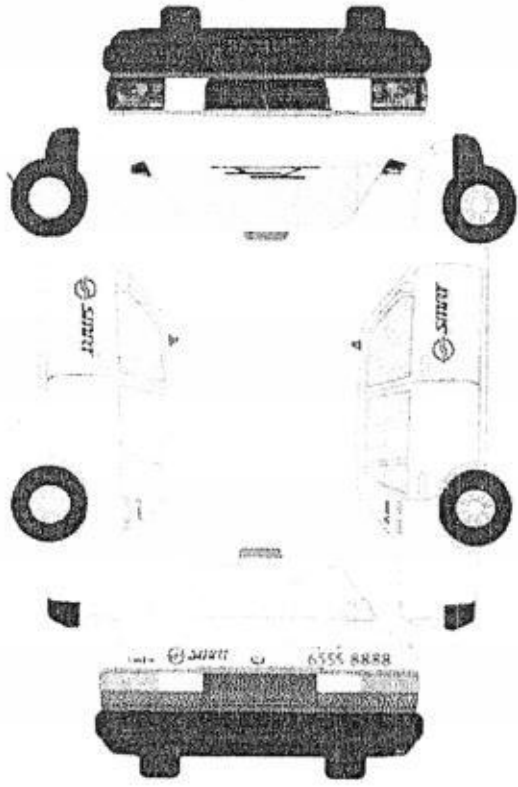

TOWED S40 / GBF6529Y - NTUC IDAC
AFTER PAINT PHOTO FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL SURVEYOR SEBASTIAN (LKK)
& Email : sebastianeang@lkkauto.com HP:90036121
LUMPSUM REPAIR

Prepared Date : 31/10/2017 02:28:54 PM

Recording Camera ☒ ☐
Radio Antenna ☒ ☐
1st witness ☒ Date 6-11-17
2nd witness ☐ Date

4/11/17 1130 Reject RHR Panel Paint Peel
LHR Door weather strip August 7/11/17 11:19

E 1/2 F
KM 328959

Vehicle to Waga Date In: 4/11 Towing:
Time In: 1600 Driver:
Waga Job No: 13682/11
Vehicle sent to SMRT Date In: 4/11 Towing:
Time In: 0925 Driver:
Resolved by (SMRT):

Pass

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U205751738

Mileage

0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates**Quotation from ARC****Adjusted by Surveyor, if applicable**

Total Labour Charges : 1,014.00

700.00

Total Spray Painting Charges : 1,116.00

400.00

Total Material Charges : 1,669.94

1,801.58

Other Charges : 1,185.00

-251.58

TOTAL : **4,984.94****2,650.00**

Lum Sum Total : 0.00

0.00

No. of Repair Days : 6.00

5.00

Prepared / Adjusted By :

SEBASTIAN (LKK)

Arc / Surveyor Sign Off Date : 31/10/2017 04:05:55 AM

01/11/2017 02:22:29 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 31/10/2017 04:05:31 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : QN-1711-0258

Invoice No :

Quotation Date : 10/11

Invoice Date :

Invoice Amount :

Prepared Date :

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR LH REAR PORTION	1,014.00	700.00 /
Total Labour	1,014.00	700.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	200.00 /
TO RESPRAY TROUGH BACK DOOR LH	180.00	0.00
TO RESPRAY REAR FENDER LH	378.00	200.00 /
TO RESPRAY REAR PANEL	180.00	0.00
Total Spray Painting & Panel Beating	1,116.00	400.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00 /
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	30.00 /
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	125.00 /
TO REMOVE & REFIT REAR QUARTER GLASS LH	120.00	60.00 /
TO REMOVE & REFIT FUEL TANK	120.00	0.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	50.00 /
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	30.00 /
TO REPLACE SUNDRY PARTS	100.00	20.00 /
TO WASH AND VACUUM	60.00	0.00
TO REMOVE / REFIT SEAT	120.00	60.00 /
Lump Sum Adjustment by Surveyor	0.00	-656.58
Total Other Costs	1,185.00	-251.58

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached	
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No	CRK
76088-47020		6505617	BUMPER LIP COVER RR/LH	0	72.20	25.00	0.00	Replace	Not given	No	N/C
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No	N/C
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Check	No	X
52592-47021			BUMPER SEAL, RR LH	1	88.90	25.00	66.68	Replace	Check	No	X
52563-47010			TAIL LAMP BRACKET, LH	1	30.70	25.00	23.03	Replace	Check	No	X
81561-47170		6505461	TAIL LAMP LH	1	548.40	10.00	493.56	Replace	Replace	No	CRK
61622-47030			TROUGH, BACK DOOR LH	0	110.90	10.00	0.00	Replace	Not given	No	N/C
61602-47091		6505476	FENDER RR/LH	1	766.80	25.00	575.10	Replace	Replace	No	DT
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No	N/C
			STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No	N/C
62720-47031			QUARTER GLASS RR/LH	1	168.10	25.00	126.07	Replace	Replace	No	N/C
	COMMON		SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace	No	N/C
65638-47021		6505477	FENDER LINER RR/LH	1	141.30	25.00	105.98	Replace	Check	No	X
77350-47030			LID ASSY, FUEL	1	102.00	25.00	76.50	Replace	Replace	No	CRK
77300-52030			CAP ASSY, FUEL TANK	0	68.10	25.00	0.00	Replace	Not given	No	X
77377-75010			RETAINER, FUEL LID CABLE	1	5.90	25.00	4.43	Replace	Check	No	X
77035-47090			CABLE SUB-ASSY, FUEL LID	1	63.90	25.00	47.93	Replace	Check	No	X
77201-47250			PIPE SUB-ASSY, FUEL NECK	0	230.80	25.00	0.00	Replace	Not given	No	X
58307-47060		6505522	END PANEL	1	602.10	25.00	451.58	Replace	Check	No	X
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Check	No	X
TOTAL MATERIALS							2,609.29	1,801.58			
TOTAL MATERIALS(Discounted)							1,669.94	1,801.58			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

1801.58
+ 700.00
+ 805.00

3306.58
- 207

3099.58

45 \$2650
Sebastian
20/11/2017



+ 1 Day BP

6-11-17 / 10:22

6-11-17 / 14:22

Quan

Attached
Supplementary

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Service Pte Ltd

60 Woodlands Industrial Park E4, Singapore 757705

FAX Number : 63685592

Estimator Telephone Number : 68662623

Accident Reporting Number : 68662672


1-11-17 / 14:22

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF472U
 Ref. No : TAX/10/17/2171
 Reg. Date : 30/09/2014
 Vehicle Type : TAXI
 Make : TOYOTA PRIUS
 Model : PRIUS
 Name of Driver : LOW SOON HIN
 Type of Accident : SIDE SWIPE
 Date / Time of Accident : 31/10/2017 12:00:00 PM
 Accident Reported Date / Time : 31/10/2017 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by : Sebastian
 Vehicle is Towed Back? : Yes
 Towed Back Date/Time : 31/10/2017
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024092835
 Special Instruction to ARC, if any :

TOWED \$40 / GBF5529Y - NTUC IDAC
 AFTER PAINT PHOTO FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL SURVEYOR SEBASTIAN (LKK)
 & Email : sebastianyeang @lkkauto.com HP: 90036121
 LUMPSUM REPAIR

Prepared Date : 31/10/2017 02:28:54 PM

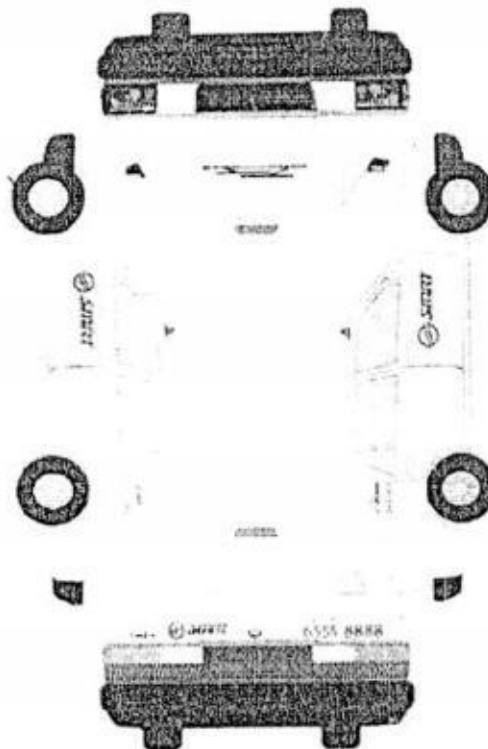

Recording Camera

☒

Radio Antenna

☒1st witness

Date 6-11-17

2nd witness

Date

4/11/17 1130 Reject LHR Paint Peel
 LHR Door weatherstrip August 7/11/17 11:18

Vehicle to Waga Data In: 1/11

Time In: 1600

Driver: LK

Waga Job No: 13682/11

Vehicle sent to SMRT Date In: 4/11/17

Time In: 0925

Driver: LK

Received by (S6137):

E (R) 1/2 F
 KM 328959

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U205751738

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,014.00	700.00
Total Spray Painting Charges	: 1,116.00	400.00
Total Material Charges	: 1,669.94	1,801.58
Other Charges	: 1,185.00	-251.58
TOTAL	: 4,984.94	2,650.00
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 6.00	5.00
Prepared / Adjusted By	:	SEBASTIAN (LKK)
Arc / Surveyor Sing Off Date	: 31/10/2017 04:05:55 AM	01/11/2017 02:22:29 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 31/10/2017 04:05:31 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : *2N-1711-0258* Invoice No :
Quotation Date : *10/11* Invoice Date :
Invoice Amount : Prepared Date :

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR LH REAR PORTION	1,014.00	700.00 /
Total Labour	1,014.00	700.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	200.00 /
TO RESPRAY TROUGH BACK DOOR LH	180.00	0.00
TO RESPRAY REAR FENDER LH	378.00	200.00 /
TO RESPRAY REAR PANEL	180.00	0.00
Total Spray Painting & Panel Beating	1,116.00	400.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00 /
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	30.00 /
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	125.00 /
TO REMOVE & REFIT REAR QUARTER GLASS LH	120.00	60.00 /
TO REMOVE & REFIT FUEL TANK	120.00	0.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	50.00 /
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	30.00 /
TO REPLACE SUNDRY PARTS	100.00	20.00 /
TO WASH AND VACUUM	60.00	0.00 /
TO REMOVE / REFIT SEAT	120.00	60.00 /
Lump Sum Adjustment by Surveyor	0.00	-656.58
Total Other Costs	1,185.00	-251.58

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached	
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No	✓
70088-47020		6505617	BUMPER LIP COVER RR/LH	0	72.20	25.00	0.00	Replace	Not given	No	✗
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No	✓
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Check	No	✗
52592-47021			BUMPER SEAL, RR LH	1	88.90	25.00	66.68	Replace	Check	No	✗
52563-47010			TAIL LAMP BRACKET, LH	1	30.70	25.00	23.03	Replace	Check	No	✗
31561-47170		6505461	TAIL LAMP LH	1	548.40	10.00	493.56	Replace	Replace	No	✓
61622-47030			TROUGH, BACK DOOR LH	0	110.90	10.00	0.00	Replace	Not given	No	✗
61602-47091		6505476	FENDER RR/LH	1	766.80	25.00	575.10	Replace	Replace	No	✓
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No	✓
			STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No	✓
62720-47031			QUARTER GLASS RR/LH	1	168.10	25.00	126.07	Replace	Replace	No	✓
	COMMON		SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace	No	✓
65638-47021		6505477	FENDER LINER RR/LH	1	141.30	25.00	105.98	Replace	Check	No	✗
77350-47030			LID ASSY, FUEL	1	102.00	25.00	76.50	Replace	Replace	No	✓
77300-52030			CAP ASSY, FUEL TANK	0	88.10	25.00	0.00	Replace	Not given	No	✗
77377-75010			RETAINER, FUEL LID CABLE	1	5.90	25.00	4.43	Replace	Check	No	✗
77035-47090			CABLE SUB-ASSY, FUEL LID	1	63.90	25.00	47.93	Replace	Check	No	✗
77201-47250			PIPE SUB-ASSY, FUEL NECK	0	230.80	25.00	0.00	Replace	Not given	No	✗
58307-47060		6505522	END PANEL	1	602.10	25.00	451.58	Replace	Check	No	✗
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Check	No	✗
TOTAL MATERIALS							2,609.29	1,801.58			
TOTAL MATERIALS(Discounted)							1,669.94	1,801.58			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

1801.58
+ 700.00
+ 805.00

3306.58
- 207

3099.58

45 \$2650
7091.90
Sebastian
20/11/2017



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Thatcham escribe

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC17020933/Sqbe2				
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556			Date: 02-11-2017	
Code: INC4				
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBF 6529Y	Veh. Inspected	SHF 472U	
Policy No.	5087918595	Coverage (\$)	0.00	
Claim No.	MT/0967919-002	Excess (\$)	0.00	
Assign From		Assign Date	01/11/2017	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	JTDKN36U205751738	Colour	MAROON	
Odometer	328960	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	FALKEN	6 mm	
L/H Front Tyre	195/65 R15	FALKEN	6 mm	
R/H Rear Tyre	195/65 R15	FALKEN	6 mm	
L/H Rear Tyre	195/65 R15	FALKEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	31/10/2017	Inspection Date	01/11/2017	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days		

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 472U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BUMPER REAR (DISC 25%)	CRACKED	458.60	343.95
1	FENDER RR/LH (DISC 25%)	DENTED	766.80	575.10
1	QUARTER GLASS RR/LH (DISC 25%)	NECESSARY	168.10	126.07
1	LID ASSY, FUEL (DISC 25%)	CUT	102.00	76.50
1	TAIL LAMP LH (DISC 10%)	CRACKED	548.40	493.56
2	PIXEL STICKER (SN)	NECESSARY	120.00	120.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	SEALANT W/SCREEN (SN)	NECESSARY	37.00	37.00
1	BUMPER LIP COVER RR/LH	NOT NECESSARY	72.20	-
1	BUMPER SIDE RETAINER RR/LH	NOT NECESSARY	94.80	-
1	BUMPER SEAL, RR LH	NOT NECESSARY	88.90	-
1	TAIL LAMP BRACKET, LH	NOT NECESSARY	30.70	-
1	TROUGH, BACK DOOR LH	NOT NECESSARY	110.90	-
1	FENDER LINER RR/LH	NOT NECESSARY	141.30	-
1	CAP ASSY, FUEL TANK	NOT NECESSARY	68.10	-
1	RETAINER, FUEL LID CABLE	NOT NECESSARY	5.90	-
1	CABLE SUB-ASSY, FUEL LID	NOT NECESSARY	63.90	-
1	PIPE SUB-ASSY, FUEL NECK	NOT NECESSARY	230.80	-
1	END PANEL	NOT NECESSARY	602.10	-
1	SEALANT SIKAFLEX	NOT NECESSARY	37.00	-
			3,776.90	1,801.58
<u>LABOUR</u>				
	THATCHAM STANDARD REPAIR TIME ON BODY WORKS.		1,939.00	1,055.00
	THATCHAM TTS STANDARD SPRAY PAINTING COST AND LABOUR.		1,216.00	430.00
	TO REPLACE SUNDRY PARTS		100.00	20.00
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
			3,315.00	1,505.00
GRAND TOTAL			7,091.90	3,306.58

Report Ref No. NS/INC17020933/Sqbe2



Page No.:2 of 2

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)			2,650.00
---	--	--	----------

Report Ref No. NS/INC17020933/Sqbe2

YEANG WAI KEEN
Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons), B.Bus, MBA, PEng, PE,
MInstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.