

REPORT

ASS. REC BY

REF CS/FCI17021272/Rlgbnz

Surveyor

Rosul

ASSIGNMENT (Office)

CWS

From (Person)

Jocanne Yong

FCI

Date/Time

3:21pm @ 7/11/2017

Estimated Cost

Bill to

OD / TP RES / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No.

SLH 1903D

Insured

SHA 3357 B

at Workshop m/s

Ding Auto

Tel

9239 4128 / 64589523

of

249 jalan Boon Lay

Policy No.

Claim No.

D17010334 MFSH

Sum Insured

Excess

Make of Vehi

(Client's Record)

D.O.A

4/1/2017

CA / REV / REP. / REV 24 HRS

(wp)

8/11/17 @ morning

H.O.D. Endorsement

Date/Time

3:59pm @ 7/11/17

Person Contacted

Ivonne

Vehicle IN OUT

Date/Time

Action/Instruction (✓) Estimate

SLH 1903D - CS/FCI16024255/K1gh3m2 - D.O.A: 6/12/2016

SHA 3357 B - CS/FCI16016252/H1vbc2 - D.O.A: 29/08/2016

Signature: *Rasou*

REF: FCI

4597K

ASSIGNMENT

From: _____ Date: 8/11/17

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLH 1903D
at Workshop m/s: Ding Auto
of: 249 Jalan Boon Lay

Insured: _____

Policy No: _____


Claims No: _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

Morning

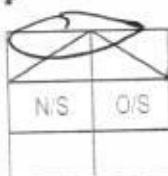

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 8 days Res: Yes or No

Lum Sum: 1-B.1 % 3 Val: Yes or No

CA / REV / REP. / 24 HRS (wp)

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SLH 19030 Yr Regn: 2016 01

Type: ☒ M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA COROLLA 1.6 cc 1598

Colour: GREEN A/C Insured / Std / NI / NA

Sp. Reading: 74125 T.Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: MROS 3REH 1045 58561

Gen. Cond: Good / ☒ Fair / Poor / Burnt

Steering: ☒ In order / Jammed / Leaked / Burnt or

Brake: ☒ In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65 R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA ☒ MLZ / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal: 6 mm

L/Bal: 6 mm

D.O.A: 08/11/17

Survey held at: Ding Auto

Des. of Damages: ☒ Fr / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

10/11/17 email preli to Joanne.

29/12/17 confirmed p/p \$ 10330.74 with Jing Feng.
(Red: 6105.13, 37%).

RECEIVED 29 DEC 2017

Date/Time File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time File Return to?

2)

Days Of Repair: 8

Resurvey No. of Trip: _____

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Insp (\$

☐

: Weekend (\$

Report Format: TP

Lump Sum / ☒ El: (\$ 10330.74

Survey Fee:

Transportation:

Photo:

Other:

Other:

Other:

Other:

7x15 = 105

170 + 105

50

30 + 50

92

517



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

FIRST CAPITAL INSURANCE LTD

Ref : CS/FCI17021272/R1gb

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 07-11-2017

Code : FCI2



1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHA 3357B	Veh. Inspected	SLH 1903D
Policy No.		Coverage (\$)	0.00
Claim No.	D17010334MFSH	Excess (\$)	0.00
Assign From	CWS (JOANNE YONG)	Assign Date	07/11/2017

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--	--

5. General Information

Accident Date	04/11/2017	Inspection Date
Survey held at	249 JALAN BOON LAY	
Repairer	DING AUTO PTE LTD	

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

First Capital Insurance Limited

A FAIRFAX Company

Company Reg. No. 195000106C
GST Reg. No. M2-0001676-9

MOTOR SURVEY ASSIGNMENT

Date	06-11-2017	Our Ref No. D17010334MFSH
Accident Date	04-11-2017	Claim Type. Third Party
Insured Vehicle	SHA3357B	Third Party Vehicle. SLH1903D
Survey Location	249 JALAN BOON LAY BESIDE STA INSPECTION CENTRA	
Contact Person.	YOU JING FENG	
Contact No.	64589523/ 9733583	Fax No. 64534227
Survey Type	WITHOUT PREJUDICE:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	DING AUTO PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	JOANNEY	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Job Sheet (/ClaimWS/Surveyor/JobSheet/229876)



PRI Documents



Close



PRI Header Details

Claim No	D17010334MFSH	Policy No	D-15072701MFSH	Claimant S.No & Name	1 & DING AUT
Workshop Name	DING AUTO PTE LTD (Contact Person : YOU JING FENG)	Survey Location & Contact Details	249 JALAN BOON LAY BESIDE STA INSPECTION CENTRA Mobile: 9733583 , Phone: 64589523 , Fax: 64534227 EmailId: JINGFENG@DINGAUTO.SG		
Our Surveyor	LKK AUTO CONSULTANTS PTE LTD	Instructions To Surveyor	WITHOUT PREJUDICE:		
Insured Name	COMFORT TRANSPORTATION PTE LTD	Insured Vehicle No	SHA3357B	TP Vehicle No	SLH1903D
PRI Recieved Date	06-11-2017 06:34:48 PM	Surveyor Appointed Date	07-11-2017 03:20:51 PM	Surveyor Accept Date	07-11-2017 0

Survey Report Upload

Surveyor Inspection Date *:		Surveyor Report Date	07-11-2017	Upload Survey Report *:	Choose File
-----------------------------	--	----------------------	------------	-------------------------	--

Vehicle Particulars

Make	Please Select Make ▼	Model	Please Select Model ▼	Year	Select Year ▼
Chasis No		Engine No		Mileage	
Color		Cubic Capacity			

Multiple Documents Upload

Upload Multiple Documents	
File Name	Action

Surveyor Job Remarks

Remarks		Save
---------	----------------------	-------------------------------------

Ai Phing (LKKAuto)

From: Ai Phing (LKKAuto)
Sent: Friday, 10 November, 2017 2:30 PM
To: 'Claim Workflow System'
Cc: JOANNEYONG@FIRST-INSURANCE.COM.SG; SUR
Subject: RE: SURVEY ASSESSMENT - D17010334MFSH/1
Attachments: SLH 1903D.pdf

Dear Joanne,

Enclosed with preliminary advise of vehicle SLH 1903D.

Best Regards,

Ai Phing | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #01-25 | S(408933)

From: Admin-D (LKKAuto)
Sent: Tuesday, 7 November, 2017 5:31 PM
To: 'Claim Workflow System' <cwsmotorclaims@first-insurance.com.sg>; assignments <assignments@lkkauto.com>
Cc: JOANNEYONG@FIRST-INSURANCE.COM.SG; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D17010334MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

Best Regards,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claim Workflow System [<mailto:cwsmotorclaims@first-insurance.com.sg>]
Sent: Tuesday, 7 November, 2017 3:21 PM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWSMOTORCLAIMS@FIRST-INSURANCE.COM.SG; JOANNEYONG@FIRST-INSURANCE.COM.SG
Subject: PRI: SURVEY ASSESSMENT - D17010334MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Best Regards,



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D17010334MFSH/1

Date: 08-11-2017

Our Ref: CS/FCI17021272/R1gb

The Motor Claims Department
First Capital Insurance Ltd

Without Prejudice

Dear Sir/Madam,


INITIAL INSPECTION REPORT OF VEHICLE NO. SLH 1903D.

Please be informed that we had conducted the inspection of the above mentioned vehicle on 08-11-2017 at the premises of M/s DING AUTO and have the following to report:-

Workshop Estimate Amount	: S\$ 16,435.87
Revised Estimate Amount	: S\$ 8,576.21
"Check" Items Amount	: S\$ 3,463.38
Market Value	: S\$ -
LTA Reimbursement Value	: S\$ -
Nett Value	: S\$ -

Description of Damage:

The vehicle sustained damages at the front portion.

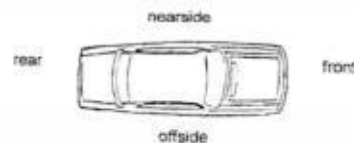

Yours faithfully

Mohamed Rasul
Automotive Assessor

TO :

FAX NO:

ESTIMATE REPORT 1ST Quotation

13/12/2017 10:58

JOB-NO: 85007903

OWNER'S PARTICULARS

NAME: LION CITY RENTALS PTE. LTD

CONTACT: 0

Page 1 of 2

ADDRESS: 50 UBI AVENUE 3

0

#01-12

NIL

SINGAPORE 408866

VEHICLE DETAILS

LICENSE NO: SLH1903D

TRANS: AUTO

CHASSIS: MR053REH104558561

MAKE / MODEL: TOYOTA / Altis Corolla 1.6 (A)

ENGINE: 1ZRY334312

OWNER'S INSURER: AIG ASIA PACIFIC INSURANCE PTE. LTD.

JOB-CODE: TP

SA: Ding Auto User 1

CLAIM DETAILS

DESCRIPTION	QTY	QUOTED COSTS	DISCOUNT	DISC PRICE	IND	SUR.DISP	REV PRICE
<u>LABOUR</u>							
1 STRAIGHTEN AND PANEL BEAT ON ACCIDENT AREAS	1.00	1,500.00	0.00	1,500.00		Y	1100
2 ALIGNMENT FRONT CHASSIS	1.00	450.00	0.00	450.00		Y	200
3 R&R CONDENSER & REFILL AIRCON GAS	1.00	150.00	0.00	150.00		Y	100
4 R&R RADIATOR AND REFILL COOLANT	1.00	150.00	0.00	150.00		Y	60
5 ADJUST HEAD LAMP AIM	1.00	80.00	0.00	80.00		Y	30
6 CHECK WIRING	1.00	80.00	0.00	80.00		Y	30
7 RUSH PROOFING	1.00	100.00	0.00	100.00		Y	60
8 SPRAY FRONT BUMPER	1.00	250.00	0.00	250.00		Y	200
9 SPRAY FRONT FENDER LHS	1.00	250.00	0.00	250.00		Y	200
10 SPRAY FRONT FENDER RHS	1.00	250.00	0.00	250.00		Y	200
11 SPRAY BONNET	1.00	300.00	0.00	300.00		Y	200
12 SPRAY SUPPORT PANEL	1.00	200.00	0.00	200.00		Y	200
13 SPRAY CHASSIS	1.00	150.00	0.00	150.00		Y	100
14 TOWING FEES	1.00	80.00	0.00	80.00		Y	10
TOTAL:		3,990.00	0.00	3,990.00			

MATERIALS

1 BONNET	1.00	1,240.40	310.10	930.30	L	Y	PAVE
2 BONNET HINGE LHS	1.00	62.08	15.52	46.56	L	Y	BT
3 BONNET HINGE RHS	1.00	62.08	15.52	46.56	L	Y	X SVC
4 HEAD LAMP LHS	1.00	894.10	223.53	670.57	L	Y	CR
5 HEAD LAMP CHROME LHS	1.00	894.10	223.53	670.57	L	Y	X SVC
6 HEAD LAMP CHROME RHS	1.00	142.70	35.68	107.02	L	Y	X SVC
7 HEAD LAMP RHS	1.00	894.10	223.53	670.57	L	Y	CR
8 FRONT BUMPER	1.00	611.20	152.80	458.40	L	Y	DE
9 FRONT BUMPER RETAINER LHS	1.00	58.17	14.54	43.63	L	Y	NE
10 FRONT BUMPER RETAINER RHS	1.00	58.17	14.54	43.63	L	Y	NE
11 FRONT BUMPER SPONGE	1.00	142.68	35.67	107.01	L	Y	X SVC
12 FRONT BUMPER REINF	1.00	142.68	35.67	107.01	L	Y	BT
13 FOG LAMP COVER LHS	1.00	78.78	19.70	59.08	L	Y	X SVC
14 FOG LAMP COVER RHS	1.00	78.78	19.70	59.08	L	Y	X SVC
15 BRACE PANEL	1.00	115.70	28.93	86.77	L	Y	BT
16 BONNET LOCK	1.00	162.80	40.70	122.10	L	Y	BT
17 FRONT FENDER LHS	1.00	858.58	214.65	643.93	L	Y	R
18 FRONT FENDER RHS	1.00	858.58	214.65	643.93	L	Y	R
19 FRONT BUMPER LOWER GRILLE	1.00	178.60	44.65	133.95	L	Y	TURN

CLAIM DETAILS

DESCRIPTION	QTY	QUOTED COSTS	DISCOUNT	DISC PRICE	IND	SUR.DISP	REV PRICE
20 FRONT BUMPER LOWER COVER	1.00	211.67 ✓	0.00	211.67	L	Y	NE ✓
21 FRONT FENDER EMBLEM LHS	1.00	44.17 ✓	0.00	44.17	L	Y	NE ✓
22 FRONT FENDER EMBLEM RHS	1.00	44.17 ✓	0.00	44.17	L	Y	NE ✓
23 FRONT FENDER INNER SHIELD LHS	1.00	171.20 ✓	0.00	171.20	L	Y	NE ✓
24 FRONT FENDER INNER SHIELD RHS	1.00	171.20 ✓	0.00	171.20	L	Y	NE ✓
25 SUPPORT PANEL	1.00	1,074.60 ✓	0.00	1,074.60	L	Y	NE ✓
26 RADIATOR	1.00	1,510.90 ✓	0.00	1,510.90	L	Y	NE ✓
27 CONDENSER	1.00	1,289.24 ✓	0.00	1,289.24	L	Y	NE ✓
28 RADIATOR GRILLE	1.00	584.97 ✓	0.00	584.97	L	Y	NE ✓
29 RADIATOR GRILLE TOP COVER	1.00	78.27 ✓	0.00	78.27	L	Y	NE ✓
30 FRONT BUMPER BRACKET LHS	1.00	121.30 ✓	0.00	121.30	L	Y	NE ✓
31 FRONT BUMPER BRACKET RHS	1.00	121.30 ✓	0.00	121.30	L	Y	NE ✓
32 FRONT BUMPER CLIP	1.00	35.00 ✓	0.00	35.00	S	Y	NE ✓
33 FRONT BUMPER LOWER COVER CLIP	1.00	35.00 ✓	0.00	35.00	S	Y	NE ✓
34 RADIATOR GRILLE CLIP	1.00	35.00 ✓	0.00	35.00	S	Y	NE ✓
35 RADIATOR GRILLE TOP COVER CLIP	1.00	20.00 ✓	0.00	20.00	S	Y	NE ✓
36 FRONT FENDER INNERSHIELD CLIP LHS	1.00	35.00 ✓	0.00	35.00	S	Y	NE ✓
37 FRONT FENDER INNERSHIELD CLIP RHS	1.00	35.00 ✓	0.00	35.00	S	Y	NE ✓
38 FRONT NUMBER PLATE WITH FLAME	1.00	45.00 ✓	0.00	45.00 ✓	S	Y	NE ✓
TOTAL:		12,445.87	0.00	12,445.87			
TOTAL PARTS & LABOUR:		16,435.87	0.00	16,435.87			

EXCESS/LOADING:\$ 0.00

No. Of Day:

8 days

RE-SURVEY BEFORE AFTER PAINTING

PART-BY-PART OR LUMP SUM: \$

DATE OF SURVEY:

08 / 11 / 17

SURVEYED BY:

Rasul

CONTACT NO:

90010068

FAX NO:

NOTE: LUMP SUM AMOUNT WOULD BE REVISED IF SUPPLEMENT REPAIR IS REQUIRED

DAuto001

Ding Auto User 1

ESTIMATOR

STA AUTOCENTRE

TEL:

FAX:

LKK Auto Consultants hence notify the Reparer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Signature: _____

Date: _____

Acknowledged by Reparer

TO :

FAX NO:

ESTIMATE REPORT 1ST Quotation

13/12/2017 10:58

OWNER'S PARTICULARS

JOB-NO: 85007903

NAME: LION CITY RENTALS PTE. LTD CONTACT: 0

Page 1 of 2

ADDRESS: 50 UBI AVENUE 3 0
#01-12 NIL
SINGAPORE 408866VEHICLE DETAILS

LICENSE NO: SLH1903D

TRANS: AUTO

CHASSIS: MR053REH104558561

MAKE / MODEL: TOYOTA / Altis Corolla 1.6 (A)

ENGINE: 1ZRY334312

OWNER'S INSURER: AIG ASIA PACIFIC INSURANCE PTE. LTD.

JOB-CODE: TP

SA: Ding Auto User 1

CLAIM DETAILS

DESCRIPTION	QTY	QUOTED COSTS	DISCOUNT	DISC PRICE	IND	SUR.DISP	REV PRICE
<u>LABOUR</u>							
1 STRAIGHTEN AND PANEL BEAT ON ACCIDENT AREAS	1.00	1,500.00	0.00	1,500.00		Y	1000
2 ALIGNMENT FRONT CHASSIS	1.00	450.00	0.00	450.00		Y	200
3 R&R CONDENSER & REFILL AIRCON GAS	1.00	150.00	0.00	150.00		Y	100
4 R&R RADIATOR AND REFILL COOLANT	1.00	150.00	0.00	150.00		Y	60
5 ADJUST HEAD LAMP AIM	1.00	80.00	0.00	80.00		Y	X
6 CHECK WIRING	1.00	80.00	0.00	80.00		Y	30
7 RUSH PROOFING	1.00	100.00	0.00	100.00		Y	60
8 SPRAY FRONT BUMPER	1.00	250.00	0.00	250.00		Y	200
9 SPRAY FRONT FENDER LHS	1.00	250.00	0.00	250.00		Y	200
10 SPRAY FRONT FENDER RHS	1.00	250.00	0.00	250.00		Y	200
11 SPRAY BONNET	1.00	300.00	0.00	300.00		Y	200
12 SPRAY SUPPORT PANEL	1.00	200.00	0.00	200.00		Y	200
13 SPRAY CHASSIS	1.00	150.00	0.00	150.00		Y	200
14 TOWING FEES	1.00	80.00	0.00	80.00		Y	70/receipt
TOTAL:		3,990.00	0.00	3,990.00			

MATERIALS

1 BONNET	1.00	1,240.40	310.10	930.30	L	Y	Puc ✓
2 BONNET HINGE LHS	1.00	62.08	15.52	46.56	L	Y	PA ✓
3 BONNET HINGE RHS	1.00	62.08	15.52	46.56	L	Y	X SVC
4 HEAD LAMP LHS	1.00	894.10	223.53	670.57	L	Y	CRA ✓
5 HEAD LAMP CHROME LHS	1.00	894.10	223.53	670.57	L	Y	X SVC
6 HEAD LAMP CHROME RHS	1.00	142.70	35.68	107.02	L	Y	X SVC
7 HEAD LAMP RHS	1.00	894.10	223.53	670.57	L	Y	CRA ✓
8 FRONT BUMPER	1.00	611.20	152.80	458.40	L	Y	DE ✓
9 FRONT BUMPER RETAINER LHS	1.00	58.17	14.54	43.63	L	Y	new ✓
10 FRONT BUMPER RETAINER RHS	1.00	58.17	14.54	43.63	L	Y	new ✓
11 FRONT BUMPER SPONGE	1.00	142.68	35.67	107.01	L	Y	X SVC
12 FRONT BUMPER REINF	1.00	142.68	35.67	107.01	L	Y	PA ✓
13 FOG LAMP COVER LHS	1.00	78.78	19.70	59.08	L	Y	X SVC
14 FOG LAMP COVER RHS	1.00	78.78	19.70	59.08	L	Y	X SVC
15 BRACE PANEL	1.00	115.70	28.93	86.77	L	Y	PA ✓
16 BONNET LOCK	1.00	162.80	40.70	122.10	L	Y	PA ✓
17 FRONT FENDER LHS	1.00	858.58	214.65	643.93	L	Y	R ✓
18 FRONT FENDER RHS	1.00	858.58	214.65	643.93	L	Y	R ✓
19 FRONT BUMPER LOWER GRILLE	1.00	178.60	44.65	133.95	L	Y	TOR ✓

CLAIM DETAILS

DESCRIPTION	QTY	QUOTED COSTS	DISCOUNT	DISC PRICE	IND	SUR.DISP	REV PRICE
20 FRONT BUMPER LOWER COVER	1.00	211.67	52.92	158.75	L	Y	De/
21 FRONT FENDER EMBLEM LHS	1.00	44.17	11.04	33.13	L	Y	ne/
22 FRONT FENDER EMBLEM RHS	1.00	44.17	11.04	33.13	L	Y	ne/
23 FRONT FENDER INNER SHIELD LHS	1.00	171.20	42.80	128.40	L	Y	De/
24 FRONT FENDER INNER SHIELD RHS	1.00	171.20	42.80	128.40	L	Y	De/
25 SUPPORT PANEL	1.00	1,074.60	268.65	805.95	L	Y	PA/
26 RADIATOR	1.00	1,510.90	377.73	1,133.17	L	Y	? PA/
27 CONDENSER	1.00	1,289.24	322.31	966.93	L	Y	? PA/
28 RADIATOR GRILLE	1.00	584.97	146.24	438.73	L	Y	? CRO/
29 RADIATOR GRILLE TOP COVER	1.00	78.27	19.57	58.70	L	Y	? CRO/
30 FRONT BUMPER BRACKET LHS	1.00	121.30	30.33	90.97	L	Y	ne/
31 FRONT BUMPER BRACKET RHS	1.00	121.30	30.33	90.97	L	Y	ne/
32 FRONT BUMPER CLIP	1.00	35.00	0.00	35.00	S	Y	ne/
33 FRONT BUMPER LOWER COVER CLIP	1.00	35.00	0.00	35.00	S	Y	ne/
34 RADIATOR GRILLE CLIP	1.00	35.00	0.00	35.00	S	Y	ne/
35 RADIATOR GRILLE TOP COVER CLIP	1.00	20.00	0.00	20.00	S	Y	ne/
36 FRONT FENDER INNERSHIELD CLIP LHS	1.00	35.00	0.00	35.00	S	Y	ne/
37 FRONT FENDER INNERSHIELD CLIP RHS	1.00	35.00	0.00	35.00	S	Y	ne/
38 FRONT NUMBER PLATE WITH FLAME	1.00	35.00	0.00	35.00	S	Y	MS/
TOTAL:		13,187.27	239.37	9,947.90			

TOTAL PARTS & LABOUR : 17,177.27 3,239.37 13,937.90

EXCESS/LOADING:\$\$ 0.00

No. Of Day: 8 days

RE-SURVEY: BEFORE/AFTER PAINTING

PART-BY-PART OR LUMP SUM: \$\$

DATE OF SURVEY: 08, 11, 17 @ 1010

SURVEYED BY: Rasul

CONTACT NO: 90010088 FAX NO:

NOTE: LUMP SUM AMOUNT WOULD BE REVISED IF SUPPLEMENT REPAIR IS REQUIRED

DAuto001

Ding Auto User 1

ESTIMATOR

STA AUTOCENTRE

TEL:

FAX:

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI17021272/R1gbn2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 04-01-2018	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 3357B	Veh. Inspected	SLH 1903D	
Policy No.	D-15072701MFSH	Coverage (\$)	0.00	
Claim No.	D17010334MFSH	Excess (\$)	0.00	
Assign From	JOANNE YONG	Assign Date	07/11/2017	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA COROLLA ALTIS 1.6	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	MR053REH104558561	Colour	GREY	
Odometer	74125	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	MICHELIN	6 mm	
L/H Front Tyre	195/65 R15	MICHELIN	6 mm	
R/H Rear Tyre	195/65 R15	MICHELIN	6 mm	
L/H Rear Tyre	195/65 R15	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/11/2017	Inspection Date	08/11/2017	
Survey held at	249 JALAN BOON LAY			
Repairer	DING AUTO PTE LTD			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		8 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLH 1903D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BONNET	BUCKLED	1,240.40	1,240.40
1	BONNET HINGE LHS	BENT	62.08	62.08
1	BONNET HINGE RHS	SERVICEABLE	62.08	-
1	HEAD LAMP LHS	CRACKED	894.10	894.10
1	HEAD LAMP CHROME LHS	SERVICEABLE	894.10	-
1	HEAD LAMP CHROME RHS	SERVICEABLE	142.70	-
1	HEAD LAMP RHS	CRACKED	894.10	894.10
1	FRONT BUMPER	DEFORMED	611.20	611.20
1	FRONT BUMPER RETAINER LHS	NECESSARY	58.17	58.17
1	FRONT BUMPER RETAINER RHS	NECESSARY	58.17	58.17
1	FRONT BUMPER SPONGE	SERVICEABLE	142.68	-
1	FRONT BUMPER REINF	BENT	142.68	142.68
1	FOG LAMP COVER LHS	SERVICEABLE	78.78	-
1	FOG LAMP COVER RHS	SERVICEABLE	78.78	-
1	BRACE PANEL	BENT	115.70	115.70
1	BONNET LOCK	BENT	162.80	162.80
1	FRONT FENDER LHS	TO REPAIR SEE LABOUR	858.58	-
1	FRONT FENDER RHS	TO REPAIR SEE LABOUR	858.58	-
1	FRONT BUMPER LOWER GRILLE	TORN	178.60	178.60
1	FRONT BUMPER LOWER COVER	DEFORMED	211.67	211.67
1	FRONT FENDER EMBLEM LHS	NECESSARY	44.17	44.17
1	FRONT FENDER EMBLEM RHS	NECESSARY	44.17	44.17
1	FRONT FENDER INNER SHIELD LHS	DEFORMED	171.20	171.20
1	FRONT FENDER INNER SHIELD RHS	DEFORMED	171.20	171.20
1	SUPPORT PANEL	BENT	1,074.60	1,074.60
1	RADIATOR	BENT	1,510.90	1,510.90
1	CONDENSER	BENT	1,289.24	1,289.24
1	RADIATOR GRILLE	CRACKED	584.97	584.97
1	RADIATOR GRILLE TOP COVER	CRACKED	78.27	78.27

Report Ref No. CS/FCI17021272/R1gbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER BRACKET LHS	NECESSARY	121.30	121.30
1	FRONT BUMPER BRACKET RHS	NECESSARY	121.30	121.30
	LESS 25% DISCOUNT		-	-2,460.25
			12,957.27	7,380.74
	SPECIAL NETT ITEMS			
1	FRONT BUMPER CLIP (SN)	NECESSARY	35.00	35.00
1	FRONT BUMPER LOWER COVER CLIP (SN)	NECESSARY	35.00	35.00
1	RADIATOR GRILLE CLIP (SN)	NECESSARY	35.00	35.00
1	RADIATOR GRILLE TOP COVER CLIP (SN)	NECESSARY	20.00	20.00
1	FRONT FENDER INNERSHIELD CLIP LHS (SN)	NECESSARY	35.00	35.00
1	FRONT FENDER INNERSHIELD CLIP RHS (SN)	NECESSARY	35.00	35.00
1	FRONT NUMBER PLATE WITH FLAME (SN)	MISSING	35.00	35.00
			230.00	230.00
	LABOUR			
	STRAIGHTEN AND PANEL BEAT ON ACCIDENT AREAS.INCLUSIVE OF THE REPAIR OF FRONT FENDER LHS AND FRONT FENDER RHS.		1,500.00	1,100.00
	ALIGNMENT FRONT CHASSIS.		450.00	200.00
	R&R CONDENSER & REFILL AIRCON GAS.		150.00	100.00
	R&R RADIATOR AND REFILL COOLANT.		150.00	60.00
	ADJUST HEAD LAMP AIM.	NOT NECESSARY	80.00	-
	CHECK WIRING.		80.00	30.00
	RUST PROOFING.		100.00	60.00
	SPRAY FRONT BUMPER.		250.00	200.00
	SPRAY FRONT FENDER LHS.		250.00	200.00
	SPRAY FRONT FENDER RHS.		250.00	200.00
	SPRAY BONNET.		300.00	200.00
	SPRAY SUPPORT PANEL.		200.00	200.00
	SPRAY CHASSIS.		150.00	100.00
	TOWING FEES.		80.00	70.00
			3,990.00	2,720.00
	GRAND TOTAL		17,177.27	10,330.74



RECOMMENDED COST OF REPAIRS			10,330.74
-----------------------------	--	--	-----------

Report Ref No. CS/FCI17021272/R1gbn2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.