



FormTeam Consultancy Pte Ltd

AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference : RRN17-010041/PRS/AL/ADJ/AL/gh

Your Reference: MT/0928433-002

Date : 17-Mar-17

Attention : Mr Marcus Xiao

TO : Motor Claims Department
NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01 NTUC Trade Union House
Singapore 189556

Assessment of Vehicle No : SDL 190Z
Date of Accident : 29-December-2016
Date of Inspection : 04-January-2017
Address of Inspection : Blk 11 Sin Ming Ind Estate #01-87 S'575655

We have carried out a physical assessment of SDL 190Z at M/S Lian Heng Painter Company according to your instructions on 04-Jan-2017, dismantled items on 06-Jan-2017, post repair survey on 12-Jan-2017 and are pleased to submit our report herewith.

1. VEHICLE PARTICULARS

Registration No. : SDL 190Z
Make & Model : Mercedes SLK280
Year of Registration : 2007
Engine Capacity : 1997 cc
Chassis No. : WDB1714542F174454
Engine No. : 27294230679664
Colour : Red
Mileage (km) : 73539

2. VEHICLE CONDITION

Body Paint : Good
Steering : Serviceable
Foot Brake : Serviceable
Parking Brake : Serviceable

3. TYRE PARTICULARS & CONDITION

Front

RH Make/Size : Pirelli 225/55R16 - 60%
LH Make/Size : Pirelli 225/55R16 - 60%

Rear

RH Make/Size : Pirelli 225/55R16 - 60%
LH Make/Size : Pirelli 225/55R16 - 60%

Note : % denotes the remaining percentage of the tyre


FormTeam Consultancy Pte Ltd

Our Reference : RRN17-010041/PRS/AL/ADJ/AL/gh
Your Reference : MT/0928433-002
Vehicle Number : SDL 190Z

Page No. 2

4. DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **O/S Side** portion. Please see attached scheduled for details.

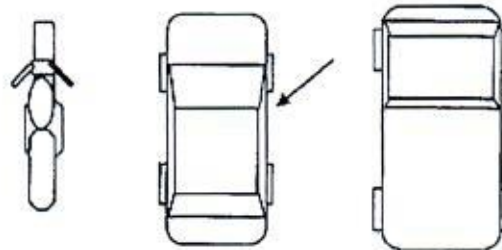

5. REMARKS

Market Value : -
Salvage Value : -
Repair Limit (Nett Loss) : -
Repairer's estimate : **Not Provided**
Nett Saving : -
Excess : -
Sum Insured : -
Our adjusted amount : \$ 9,400.00
Estimated Repair Days : 08 days

Additional photographs will be submitted upon request by our principal.

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.
The assessment was conducted on a "**Without Prejudice**" basis.

If we are not notified of anything to the contrary within **14 days** from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by **FormTeam Consultancy Pte Ltd** for any reliance on this report by any third party, unless with the permission of the addressee.

FormTeam Consultancy Pte Ltd

Our Reference : RRN17-010041/PRS/AL/ADJ/AL/gh
 Your Reference : MT/0928433-002
 Vehicle Number : SDL 190Z

Page No. 3

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
<u>PARTS (LIST ITEMS)</u>				
1	RH Door	Dented		2,740.00
1	RH Door Hinge (Top)	Distorted		125.00
1	RH Door Hinge (Bottom)	Distorted		143.00
1	RH Door Lock	Distorted		460.00
1	RH Door Glass Regulator	Bent		552.00
1	RH Door Glass Regulator Motor	Malfunctioned		695.00
1	RH Door Control Unit	Loop Cracked		420.00
1	RH Door Belt Weather-strip	Necessary		123.00
1	RH Door Weather-strip	Necessary		255.00
1	RH Door Edge Weather-strip	Necessary		56.00
1	RH Door Trim	Deformed/Cracked		985.00
1	Rh Still Panelling	Dented/Cut/Cracked		720.00
1	RH Still Panelling Seal	Necessary		107.00
1	RHR Fender	Dented		2,300.00
			-	9,681.00
	Less Discount :		0% -	10% 968.10
	Parts Total :		-	8,712.90
<u>SPECIAL NETT ITEMS</u>				
1	RHR Sport Rim	Dented/Grazed		600.00
1	Joint Sealant	Necessary		40.00
	Special Nett Total :		-	640.00
	Parts Total :		-	9,352.90


FormTeam Consultancy Pte Ltd


Our Reference : RRN17-010041/PRS/AL/ADJ/AL/gh
 Your Reference : MT/0928433-002
 Vehicle Number : SDL 190Z

Page No. 4

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
	LABOUR		
1	To rewire rear portion.		20.00
2	To remove, refix fuel tank.		80.00
3	To remove, refix door fittings to facilitate repair.		80.00
4	To remove, refix, rear seats, carpet and trims.		180.00
5	To remove, cut out damage portion, jack out, straighten, panel beating, welding, align and renew replaced parts.		1,000.00
6	To putty and respray painting on affected areas.		800.00
7	To apply underscaling.		80.00
	Labour Total :	-	2,240.00
	TOTAL (PARTS & LABOUR) :	-	11,592.90

The final adjusted Lump Sum contract amount is \$9,400.00
 (SINGAPORE DOLLARS NINE THOUSAND AND FOUR HUNDRED ONLY)


 Frankie Pang
 AMSAE(AUST), AMIRTE, AMSOE,
 MASPACI, MSAAA
 Licensed Appraiser


 Axel Lee
 Automobile Appraiser