

ASSIGNED BY

REF CS/CT117022345 /Arbez

Merimen

Adnan

ASSIGNMENT OFFICE

From/Person

Chong Boon Sen

CT1

22-11-2017 746pm

Estimated Cost

BLK

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No

SEJ 67Y

Insured

at Workshop no

SMRT Automotive

Tel

6555 5556

of

60 Woodlands Ind Park E4

Policy No

DMPCSN1304371704

Claim No

SNM17D06587C01

Sum Insured

Excess

\$0

Make of Veh

(Client's Record)

D.O.A

13.11.2017

CA / REX / REP. / REV 24 HRS

Blk 1 Kaki Bukit Ave 6 #01-60

H.O.D. Enforcement

Date/Time

23-11-2017 11:40am

Person Contacted

Esther

Vehicle IN/OUT

Date/Time

Action/Instruction (✓) Estimate

SEJ 67Y. x

21/11/17

Revert by merimen

Mandate approve; Inform Esther through phone and email

22/11/18

Remandate E/s \$5000

24/11/18

Mandate approve

REF:

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

Bal. or Market Value: 72K.

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lump Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SG167Y Reg: 2011 Feb
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prima Mover /
 Truck / Trailer or
 Make: BMW 523i No: 2497
 Colour: Black A.O. Insured / Std / NI / NA
 Sp. Reading: 165693 T. Radio: Insured / Std / NI / NA
 Eng. No: _____
 C. No: WBAFP32090C546795
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or
 Brake: Inorder / Jammed / Leaked / Burnt or
 Modi: NI / S/Rim / STD A/Rim or
 Tyre Size: F: 245/40R19.
 R: 245/40R19.

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Continental.

Front	Rear
R/Bal. <u>06</u> mm	R/Bal. <u>06</u> mm
L/Bal. <u>06</u> mm	L/Bal. <u>06</u> mm
D.O.A. _____	D.O.I. <u>23/11/17.</u>

Survey held at SMRT.Des. of Damages Frnt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

OD Chimer.

Confirm \$5000.00, 9 days
 (Red - 88938.02, 64%)

RECEIVED 2 JAN 2018

Date/Time File Pass to?

☐ : Preli. Report
☒ : Final Report

Date/Time File Return to?

C)

Days Of Repair: 9Resurvey No. of Trip: 3

Survey Fee

Transaction

____ \$ - RS ____ \$

Photos

Drawn

TOTAL

Add Fee: ☐ Site Insp. \$☐ Interview \$☐ Tech. Ins. \$☐ Weekend \$Report Format: ODLump Sum / H.B. \$ 5000

200

200



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CS/CTI17022345/Arb

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 23-11-2017



Code : CTI

1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	SGJ 67Y
Policy No.	DMPCSN1304371704	Coverage (\$)	0.00
Claim No.	SNM17D06587C01	Excess (\$)	0.00
Assign From	MERIMEN (CHONG BOON SEN)	Assign Date	22/11/2017

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--	--

5. General Information

Accident Date	13/11/2017	Inspection Date	23/11/2017
Survey held at	1 KAKI BUKIT AVE 6 #01-60		
Repairer	SMRT AUTOMOTIVE SERVICES PTE LTD		

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

Janice Lee (LKKAUTO)

From: Janice Lee (LKKAUTO)
Sent: Monday, November 27, 2017 4:11 PM
To: 'teychorkeng@smrt.com.sg'
Cc: SUR
Subject: SGJ 67Y OD CTI DOA : 13.11.2017

Dear Esther,

As instructed by our client , please proceed to repair the insured vehicle **SGJ 67Y (excess \$0/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Thank you.

Best Regards,

Janice Lee (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: janicelee@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Print Received Message

This mail is associated with :

SGJ67Y (SNM17D06587C01)

OD

Nov 13 2017 10:00AM

[CHEW SOO ANN]

SMRT Automotive Services Pte Ltd

From China Taiping Insurance (Singapore) Pte. Ltd. (HQ) (CHINA_TAIPING), sent on 27/11/2017 14:53 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$4900.00) - SGJ67Y - Claim Handler: Chong Boon Sen

Approved:4900.00:Please proceed to authorize repairs at \$4,900.00. RE-INSPECTION OF VEHICLE required.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type	Singapore NRIC
Owner ID	5066H

Vehicle Details

Vehicle No.	SGJ67Y
Vehicle to be Exported	No
Intended De-registration Date	24 Nov 2017
Vehicle Make	B.M.W.
Vehicle Model	523I A
Primary Colour	Grey
Manufacturing Year	2010
Engine No.	05317591N52B25AF
Chassis No.	WBAFP32090C546795
Maximum Power Output	150.0 kW (201 bhp)
Open Market Value	\$39,026.00
Original Registration Date	25 Feb 2011
First Registration Date	25 Feb 2011
Transfer Count	0
Actual ARF Paid	\$39,026.00

Intended PARF Rebate Details

PARF Eligibility	Yes
PARF Eligibility Expiry Date	24 Feb 2021
PARF Rebate Amount	\$25,366.00

Intended COE Rebate Details

COE Expiry Date	24 Feb 2021
COE Category	B - Car (1601cc & above)
COE Period(Years)	10
QP Paid	\$62,000.00
COE Rebate Amount	\$20,150.00
Total Rebate Amount	\$45,516.00

The information contained herein is correct as at 24 Nov 2017

OK



Please read through the [Privacy Statement](#), [Terms of Use](#), and [Disclaimer](#).



Please do not use the Back or Forward buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 10 and above, Chrome, Firefox, and Safari.


Copyright 2017 LTA [Privacy Statement](#) [Terms of Use](#) [Disclaimer](#) [Rate the Website](#) [Rate this e-Service](#)

Last updated on 19 Nov 2017 at 12:12 AM

Identification Card

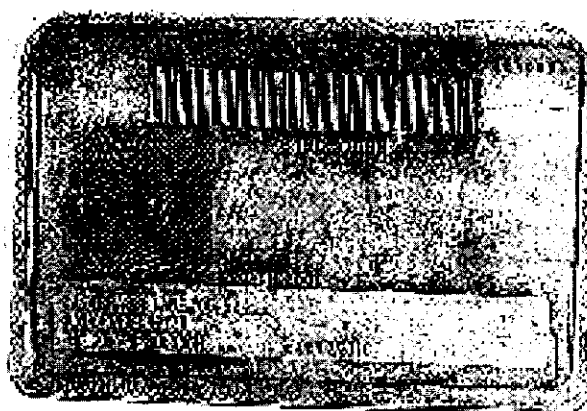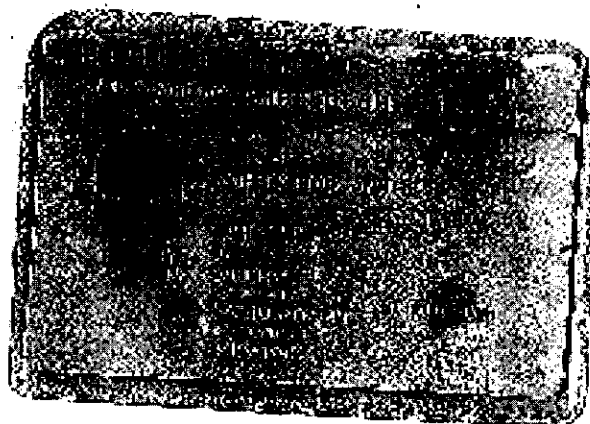

Driving License

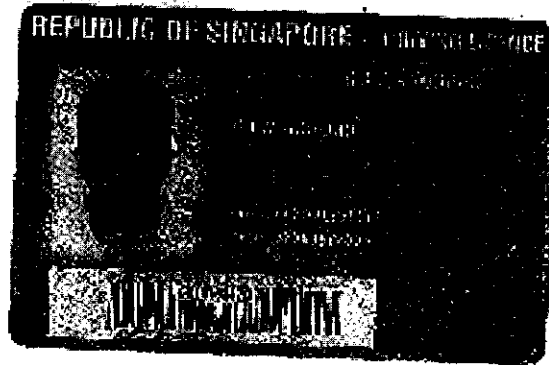

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	14/11/2017 14:18
Date Of Accident	13/11/2017 10:10
Exact Location Of Accident	NORTH BRIDGE ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGJ67Y
Insured/Policyholder	
Name Of Registered Owner	CHEW SOO ANN
NRIC No	S1805066H
Email Address	ANN7367@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-81331211
Alternative Phone No	OFFICE-81331211

Vehicle Particulars

Manufacturer	BMW
Model	523I-2.5 (A)
Exact Purpose for which vehicle was being used at time of accident	PTE USE

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPCSN1304371704
Cover Note Number	

Driver

Name of Driver	CHEW SOO ANN
NRIC No	S1805066H
Date Of Birth	07/08/1967
Occupation	INDOOR
Date Of Driving Pass	01/06/1986
Driving Experience	31 YEARS AND 5 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-81331211
Fax Number	
Contact Number	OFFICE-81331211
Email Address	ANN7367@HOTMAIL.COM

Address 29 TERRASSE LANE #05-52
Postcode 544778
Was driver an employee of the Insured's Company NO
If No, Relationship of the Driver with the Insured OWNER
Vehicle Registration Number of Driver's Own Vehicle -
-
-
Insurance Company of Driver's Own Vehicle -
-
-

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
Weather Conditions CLEAR
Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
Was any body injured in the Accident? NO
Was any other material or property damaged? YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
Number of Passengers (Including Driver) 4

Details of Police Action

Was the accident reported to the police? NO
If Yes, Please state which Police Station
Was notice of intended Prosecution given? NO
If Yes, against whom?

Circumstances of Accident

Please refer to attached report

Attachment(s)

Are accident photos available for attachment? YES
Was there any video captured by Car Camera? NO
Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1


Vehicle Registration Number SLD8916S
Vehicle Make/Model/Colour
Details Of Properties
Name of Driver TAN HUI ANN
NRIC/Passport Number S8210419D
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

Details of Witness

Name
Phone Number
Email Address

Sketch Plan

SKETCH PLAN

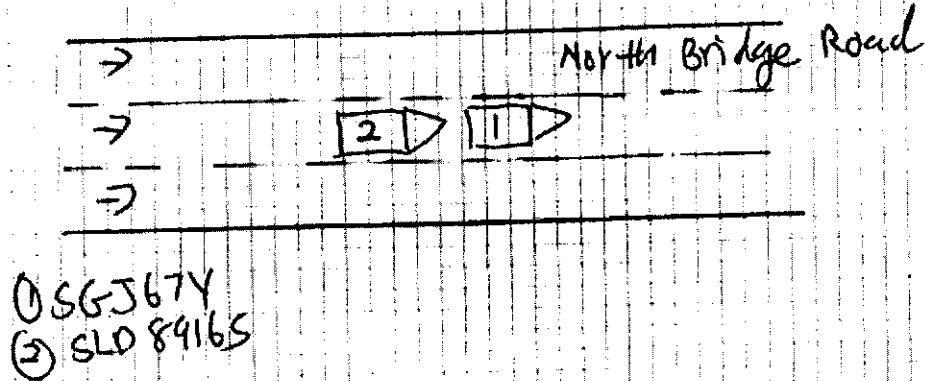

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was driving behind SLD 8916S along North Bridge Road towards Gaylang.

There was a car stopped in front thus vehicle SLD 8916S to filter to the next lane.

As such I follow SLD 8916S and filter to the next lane. However SLD 8916S suddenly stopped. I could not stop in time and collided to the rear of SLD 8916S.

Nobody is injured.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan #2

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time:


Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No:

**SMRT AUTOMOTIVE
SERVICES PTE LTD
60 WOODLANDS
INDUSTRIAL PARK E4
757705**

Claim Reference: WL/NOV2017/002
Assessment Number: CTI10121
Version: SMRTAUTO/3
Date Calculated: 21/11/2017 09:03

Full Report - V1
Registration: SGJ67Y
Printed: 21/11/2017 17:07

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	yew chung smrt	Date of Incident:	13/11/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	WL/NOV2017/002	Estimated Repair Time:	
Policy Number:	DMPCSN1304371704	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	BMW
Model:	5 Series
Sub Model:	523 I
Model Sheet Number:	145 04
Registration:	SGJ67Y
Registration Month:	
Registration Year:	2011
VIN Number:	
Manufacture Month:	February
Manufacture Year:	2010
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

HEADLAMP WASHERS	4-DOOR
PARK DISTANCE CONT	3.0 LTR 225 KW
TWO COAT PEARL/MICA	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	17/11/2017
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

SMRT AUTOMOTIVE SERVICES PTE LTD

Claim Reference: WL/NOV2017/002

Full Report - V1



Assessment Number: CTI10121

Registration: SGJ67Y

Version: SMRTAUTO/3

Printed: 21/11/2017 17:07

Date Calculated: 21/11/2017 09:03

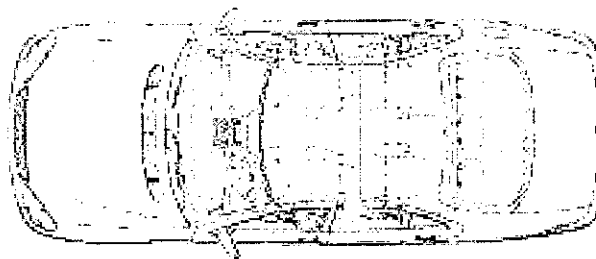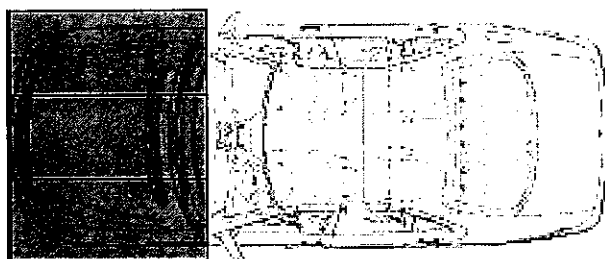**Addresses****Cost Summary**

Total Labour	\$867.87
Total Paint/Material	\$194.64
Total Parts	\$12,833.51
Total of Additional Costs	\$42.00
Excess:	TBA
Grand Total Exc GST:	\$13,938.02
7 % GST:	\$975.66
Grand Total Inc GST:	\$14,913.68

Repair Information**LABOUR**

Time Basis 12 WU = 1 HR. Price/CL 1 = \$46.00/HR

Price/Dent = \$46.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
NO NUMBER	ADD/TIME FOR MAIN WORK	2.0	7.67
51 23 610	R + R LEFT BONNET LOCK	1.0	3.83
51 23 600	R + R RIGHT BONNET LOCK	3.0	11.50
51 23 716)	R + R BONNET CABLE	2.0	7.67
51 11 656	R + R FRONT BUMPER	5.0	19.17
51 11 551	R + R FRONT BUMPER CARRIER	3.0	11.50
66 20 522	R + R L/F ULTRASONIC CONVERTER (FRONT BUMPER REMOVED)	1.0	3.83
66 20 522	R + R R/F ULTRASONIC CONVERTER (FRONT BUMPER REMOVED)	1.0	3.83
51 11 592	RENEW FRONT BUMPER COVER (FRONT BUMPER REMOVED)	9.0	34.50
61 67 802	HEADLIGHT WASHER UNIT - SUPPLEMENTARY OPERATION INCLUDES: REMOVE/REFIT WASHER NOZZLES	5.0	19.17
66 20 610	ADD/WORK PARK DISTANCE CONTROL	4.0	15.33
51 11 701	RENEW L/F BUMPER BRACKET (REMOVED)	1.0	3.83
51 11 701	RENEW R/F BUMPER BRACKET (REMOVED)	1.0	3.83
63 12 820)	R + R BOTH HEADLAMPS	8.0	30.67
63 99 503	RENEW R/HEADLAMP BULB	2.0	7.67
63 12 950	ADD: RENEW BRACKET	2.0	7.67
51 71 540	R + R L/F WHEELHOUSE COVER	6.0	23.00
51 71 540	R + R R/F WHEELHOUSE COVER	6.0	23.00
41 61 600	R + R BONNET	4.0	15.33
41 61 501	REPLACE BONNET (WITH BONNET REMOVED)	6.0	23.00
51 23 504)	ADJUST BONNET LOCK	2.0	7.67
17 11 510	R + R RADIATOR	16.0	61.33

SMRT AUTOMOTIVE SERVICES PTE LTD

Claim Reference: WL/NOV2017/002

Assessment Number: CTI10121

Version: SMRTAUTO/3

Date Calculated: 21/11/2017 09:03

Full Report - V1

Registration: SGJ67Y

Printed: 21/11/2017 17:07

17 11 546)	R + R FRONT RETAINING FRAME	8.0	30.67
17 11 536)	RENEW FAN SHROUD (FAN REMOVED)	1.0	3.83
11 53 762	RENEW LOWER WATER HOSE	1.0	3.83
11 53 765	RENEW UPPWE WATER HOSE	1.0	3.83
NO NUMBER	RENEW WATER HOSE	2.0	7.67
17 11 610)	R + R HEAT EXCHANGER	1.0	3.83
9973	KN TEST DRIVE	6.0*	23.00

LABOUR COST

Total Work Units	110.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	9.2HRS	\$421.67
Labour Markup	(0.0 %)	\$0.00
Paint Labour	9.7HRS	\$446.20
Total Labour	18.9HRS	\$867.87

NOTE TIME BASIS = 12 WU / HOUR

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT PEARL/MICA		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER REPAIR PAINT PLASTIC	17.0	
471	BONNET REPAIR PAINTING <50%	31.0	

LABOUR COST - PAINT

TIME(PAINT)	68.0	
Preparation Main Work Metal	21.0	
Preparation Comp. Work Plastic	8.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	97.0	
Total Paintwork Labour	9.7HRS	\$446.20

MATERIAL COST - PAINT

	Cost Price
New Part Painting	\$39.22
Repair Painting	\$67.51
Repair Painting Plastic	\$57.11
Material-Const Main Work Metal	\$18.10
Material-Const Comp. Work Plastic	\$12.70
Total Paint Material Cost	\$194.64

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
257✓	1	FRONT NUMBER PLATE <i>Conf</i>	KNPL3		0%	30.00F ✓
283✓	1	FRONT BUMPER COVER <i>Det</i>	51 11 7 178 079		0%	1,121.75 ✓
301✓	1	FRT BUMPER MNTG RAIL <i>un</i>	51 11 7 063 835		0%	25.00F ✓
303✓	1	FRT BUMPER GRILLE <i>2</i>	51 11 7 178 115		0%	54.20F ✗
305✓	1	FRT CTR BUMPER TRIM <i>un</i>	51 11 7 178 096		0%	33.30F ✗
307✓	1	L/BUMPER AIR GRILLE <i>un</i>	51 11 7 178 097		0%	65.85F ✗
308✓	1	R/BUMPER AIR GRILLE <i>un</i>	51 11 7 178 098		0%	65.85F ✗
317✓	1	L/F BUMPER BRACKET <i>un</i>	51 11 7 178 077		0%	18.15F ✓
318✓	1	R/F BUMPER BRACKET <i>un</i>	51 11 7 178 078		0%	18.15F ✓
336✓	1	FRONT BUMPER SUPPORT <i>un</i>	51 11 7 178 080		0%	641.40F ✓

Price Valid: 01/10/2017

SMRT AUTOMOTIVE SERVICES PTE LTD

Claim Reference: WL/NOV2017/002

Assessment Number: CTI10121

Version: SMRTAUTO/3

Date Calculated: 21/11/2017 09:03

Full Report - V1

Registration: SGJ67Y

Printed: 21/11/2017 17:07

339	1	L/F IMPACT DAMPER	51 11 7 178 081	Bent	0%	53.40F	✓
340	1	R/F IMPACT DAMPER	51 11 7 178 082	Bent	0%	53.40F	✓
347	1	L/OUT U-SONIC SENDER	66 20 9 142 217		0%	363.05	+
348	1	R/OUT U-SONIC SENDER	66 20 9 142 217		0%	363.05	+
349	1	L/INN U-SONIC SENDER	66 20 9 142 217		0%	363.05	✓
350	1	R/INN U-SONIC SENDER	66 20 9 142 217		0%	363.05	✓
391	1	FRONT SPOILER	51 11 7 111 012	new	0%	25.00F	+
415	1	L/F GRILLE	51 13 7 027 061	cut	0%	111.65F	✓
416	1	R/F GRILLE	51 13 7 027 062		0%	111.65F	✓
431	1	GRILLE BADGE	51 14 8 132 375	new	0%	67.80F	✓
471	1	BONNET	41 61 7 111 385	Pyro	0%	2,148.70F	+
503	1	L/BONNET LOCK	51 23 7 008 755	new	0%	105.95F	+
505	1	FRONT BONNET CABLE	51 23 7 184 454	new	0%	35.60F	+
544	1	R/DRIVING LAMP BULB	63 21 7 160 781	new	0%	24.30	+
561	1	LEFT HEADLAMP ASSY	63 12 7 177 729	new	0%	1,322.25F	✓
580	1	R/F INDICATOR BASE	63 12 6 916 102	new	0%	21.60	+
594	1	R/F HEADLAMP BRACKET	63 12 6 936 090	new	0%	26.35	+
595	1	L/UPP HEADLAMP BRKT	63 12 6 949 633	new	0%	6.70F	✓
596	1	R/UPP HEADLAMP BRKT	63 12 6 949 634	new	0%	6.70F	✓
600	1	R/COVER MOULDING	63 12 7 187 270	new	0%	39.85	+
625	1	L/F WASHER JET	61 67 7 038 415	new	0%	162.70	+
626	1	R/F WASHER JET	61 67 7 038 416	new	0%	162.70	+
631	1	L/WASHER JET CARRIER	51 11 7 060 585	new	0%	11.40F	+
632	1	R/WASHER JET CARRIER	51 11 7 060 586	new	0%	11.40F	+
637	1	L/F FOG LAMP	63 17 7 177 711	new	0%	251.85F	+
638	1	R/F FOG LAMP	63 17 7 177 712	new	0%	251.85F	+
841	1	L/F WHEELHOUSE COVER	51 71 7 033 749	new	0%	147.25	+
842	1	R/F WHEELHOUSE COVER	51 71 7 033 750	new	0%	147.25	+
7761	1	RADIATOR	17 11 7 795 879	new	0%	896.60	+
7767	1	FAN SHROUD	17 42 7 569 921	new	0%	293.15	✓
7768	1	UPP RADIATOR BRACKET	17 11 7 560 959	new	0%	50.50	+
7769	1	RADIATOR FRAME	17 11 7 560 958	new	0%	186.90	✓
7770	1	LWR RADIATOR SHROUD	17 11 7 791 180	new	0%	53.95	✓
7771	1	L/LWR RADIATOR BRKT	17 11 7 542 517	new	0%	28.10	+
7773	1	LWR RADIATOR HOSE	17 12 7 565 075	new	0%	94.50	+
7774	1	RETURN PIPE	17 12 7 560 973	new	0%	184.30	+
7776	1	UPPER RADIATOR HOSE	17 12 7 560 968	new	0%	127.60	+
7779	1	OIL COOLER	17 21 7 560 965	new	0%	1,148.15	+
7781	1	OIL OUTLET PIPE	17 22 7 560 979	new	0%	230.25	+
f: OEM Parts					Saving		\$53.40
g: Original					Sub Total		\$12,127.15
h: Secondhand					Mark Up From Cost (5 %)		\$606.36
p: Parallel					Sundry Parts (Fixed)		\$100.00
x: Exchange					Total Parts		\$12,833.51

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AUDATEX FEE	0%	\$42.00
SPECIALIST		
Total Extras		\$42.00

Final Calculation

Total Parts	\$12,833.51
Labour	

SMRT AUTOMOTIVE SERVICES PTE LTD

Claim Reference: WL/NOV2017/002

Assessment Number: CTI10121

Version: SMRTAUTO/3

Date Calculated: 21/11/2017 09:03

Full Report - V1

Registration: SGJ67Y

Printed: 21/11/2017 17:07

Total Panel/Mechanical	1264.50	
Total Paintwork	\$421.67	283.67
Labour Markup (0.0 %)	\$446.20	303.60
	\$0.00	
Total Labour		\$867.87
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$42.00	
Total of Additional Costs		\$42.00
Total Paint/Material Costs		\$194.64 134.08
Grand Total Excludes GST		\$13,938.02
GST @ 7 %		\$975.66
Grand Total Includes GST		\$14,913.68

Assessment Notes

Adrian L
23/11/17
h/s OSRgr.
Not Authorised.
Excess NIL.

LKK Auto Consultants hence notify the Repairer of the following: • To resurvey before/after spray painting • To display damaged part(s) during resurvey • Parts prices are subject to confirmation • Third party survey is on a "Without Prejudice" basis • No illegal modification(s) is allowed • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company Acknowledged by Repairer Signature: Date:
--

Adjusted marking

**CHINA TAIPING
INSURANCE (S) PTE LTD
3 ANSON ROAD
#15-02 SPRINGLEAF
TOWER**

079909

Claim Reference: SNM17D06587C01
Assessment Number: CTI10121
Version: SMRTAUTO/3
Date Calculated: 24/11/2017 08:26

Full Report - V1
Registration: SGJ67Y
Printed: 24/11/2017 16:28

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Mr K.K Lau	Date of Incident:	13/11/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM17D06587C01	Estimated Repair Time:	
Policy Number:	DMPCSN1304371704	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	BMW
Model:	5 Series
Sub Model:	523 I
Model Sheet Number:	145 04
Registration:	SGJ67Y
Registration Month:	
Registration Year:	2011
VIN Number:	
Manufacture Month:	February
Manufacture Year:	2010
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%



Model Specs

HEADLAMP WASHERS	4-DOOR
PARK DISTANCE CONT	3.0 LTR 225 KW
TWO COAT PEARL/MICA	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	17/11/2017
Pre-Accident Damage:	
Tyres Condition:	
Tread Depth LHF:	Tread Depth RHF:
Tread Depth LHR:	Tread Depth RHR:
Damage Areas:	Direction of Impact:

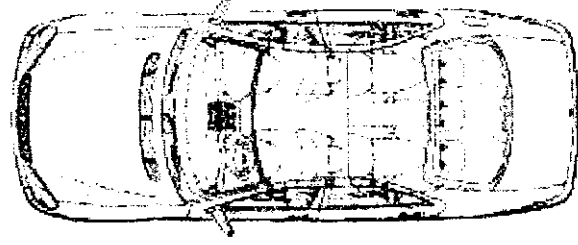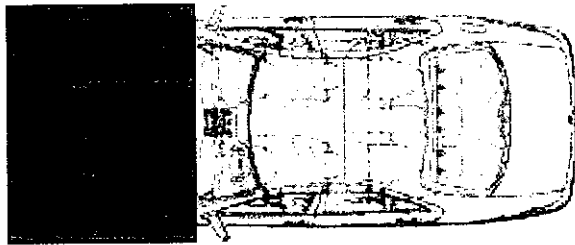CHINA TAIPING INSURANCE (S) PTE LTD**Claim Reference: SNM17D06587C01****Full Report - V1****Assessment Number: CTI10121****Registration: SGJ67Y****Version: SMRTAUTO/3****Printed: 24/11/2017 16:28****Date Calculated: 24/11/2017 08:26****Addresses****Cost Summary**

Total Labour	\$587.27
Total Paint/Material	\$134.08
Total Parts	\$5,389.01
Total of Additional Costs	\$42.00
Excess:	TBA
Grand Total Exc GST:	\$6,152.36
7 % GST:	\$430.67
Grand Total Inc GST:	\$6,583.03

Repair Information**LABOUR**

Time Basis 12 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /**Guide Number Repair Details**

		WU	Cost Price (\$)
NO NUMBER	ADD/TIME FOR MAIN WORK	2.0	7.67
51 11 656	R + R FRONT BUMPER	5.0	19.17
51 11 551	R + R FRONT BUMPER CARRIER	3.0	11.50
66 20 522	R + R L/F ULTRASONIC CONVERTER (FRONT BUMPER REMOVED)	1.0	3.83
66 20 522	R + R R/F ULTRASONIC CONVERTER (FRONT BUMPER REMOVED)	1.0	3.83
51 11 592	RENEW FRONT BUMPER COVER (FRONT BUMPER REMOVED)	9.0	34.50
61 67 802	HEADLIGHT WASHER UNIT - SUPPLEMENTARY OPERATION INCLUDES: REMOVE/REFIT WASHER NOZZLES	5.0	19.17
66 20 610	ADD/WORK PARK DISTANCE CONTROL	4.0	15.33
51 11 701	RENEW L/F BUMPER BRACKET (REMOVED)	1.0	3.83
51 11 701	RENEW R/F BUMPER BRACKET (REMOVED)	1.0	3.83
63 12 820)	R + R BOTH HEADLAMPS	8.0	30.67
63 12 950	ADD: RENEW BRACKET	2.0	7.67
51 14 500	R + R FRONT BMW BADGE	1.0	3.83
17 11 510	R + R RADIATOR	16.0	61.33
17 11 546)	R + R FRONT RETAINING FRAME	8.0	30.67
17 11 536)	RENEW FAN SHROUD (FAN REMOVED)	1.0	3.83
9973	KN TEST DRIVE	6.0*	23.00
LABOUR COST			
Total Work Units		74.0	
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		0.0HRS	0.00

Audatex System Using Manufacturer Times

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D06587C01

Full Report - V1

Assessment Number: CTI10121

Registration: SGJ67Y

Version: SMRTAUTO/3

Printed: 24/11/2017 16:28

Date Calculated: 24/11/2017 08:26

Sub Total		6.2HRS	\$283.67
Labour Markup	(0.0 %)		\$0.00
Paint Labour		6.6HRS	\$303.60
Total Labour		12.8HRS	\$587.27

NOTE TIME BASIS = 12 WU / HOUR

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT PEARL/MICA		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER REPAIR PAINT PLASTIC	17.0	
LABOUR COST - PAINT			
	TIME(PAINT)	37.0	
	Preparation Main Work Plastic	21.0	
	Preparation Comp. Work Metal	8.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	66.0	
	Total Paintwork Labour	6.6HRS	\$303.60
MATERIAL COST - PAINT			Cost Price
	New Part Painting		\$39.22
	Repair Painting Plastic		\$57.11
	Material-Const Main Work Plastic		\$25.05
	Material-Const Comp. Work Metal		\$12.70
	Total Paint Material Cost		\$134.08

PARTS

				Price Valid: 01/10/2017	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
7767	1	FAN SHROUD	17 42 7 569 921		0% 293.15
283	1	FRONT BUMPER COVER	51 11 7 178 079		0% 1,121.75
336	1	FRONT BUMPER SUPPORT	51 11 7 178 080		0% 641.40F
257	1	FRONT NUMBER PLATE	KNPL3		0% 30.00F
301	1	FRT BUMPER MNTG RAIL	51 11 7 063 835		0% 25.00F
431	1	GRILLE BADGE	51 14 8 132 375		0% 67.80F
317	1	L/F BUMPER BRACKET	51 11 7 178 077		0% 18.15F
415	1	L/F GRILLE	51 13 7 027 061		0% 111.65F
339	1	L/F IMPACT DAMPER	51 11 7 178 081		0% 53.40F
625	1	L/F WASHER JET	61 67 7 038 415		0% 162.70
349	1	L/INN U-SONIC SENDER	66 20 9 142 217		0% 363.05
595	1	L/UPP HEADLAMP BRKT	63 12 6 949 633		0% 6.70F
561	1	LEFT HEADLAMP ASSY	63 12 7 177 729		0% 1,322.25F
7770	1	LWR RADIATOR SHROUD	17 11 7 791 180		0% 53.95
318	1	R/F BUMPER BRACKET	51 11 7 178 078		0% 18.15F
416	1	R/F GRILLE	51 13 7 027 062		0% 111.65F
594	1	R/F HEADLAMP BRACKET	63 12 6 936 090		0% 26.35
340	1	R/F IMPACT DAMPER	51 11 7 178 082		0% 53.40F
350	1	R/INN U-SONIC SENDER	66 20 9 142 217		0% 363.05
596	1	R/UPP HEADLAMP BRKT	63 12 6 949 634		0% 6.70F
7769	1	RADIATOR FRAME	17 11 7 560 958		0% 186.90
f: OEM Parts				Saving	\$53.40
g: Original				Sub Total	\$5,037.15
h: Secondhand				Mark Up From Cost (5 %)	\$251.86

CHINA TAIPING INSURANCE (S) PTE LTD**Claim Reference: SNM17D06587C01****Full Report - V1****Assessment Number: CTI10121****Registration: SGJ67Y****Version: SMRTAUTO/3****Printed: 24/11/2017 16:28****Date Calculated: 24/11/2017 08:26**

p: Parallel	Sundry Parts	(Fixed)	\$100.00
x: Exchange	Total Parts		\$5,389.01

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER**Extras**

Description	Betterment	Price
AUDATEX FEE SPECIALIST	0%	\$42.00
	Total Extras	\$42.00

Final Calculation

Total Parts	\$5,389.01
--------------------	-------------------

Labour

Total Panel/Mechanical	\$283.67
Total Paintwork	\$303.60
Labour Markup (0.0 %)	\$0.00

Total Labour	\$587.27
---------------------	-----------------

Additional Costs

Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$42.00

Total of Additional Costs	\$42.00
----------------------------------	----------------

Total Paint/Material Costs	\$134.08
-----------------------------------	-----------------

Grand Total Excludes GST	\$6,152.36
---------------------------------	-------------------

GST @ 7 %	\$430.67
-----------	-----------------

Grand Total Includes GST	\$6,583.03
---------------------------------	-------------------

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

final marking

Claim Reference: WL/NOV2017/002
Assessment Number: CTI10121
Version: SMRTAUTO/3
Date Calculated: 19/01/2018 08:05

Full Report - V1
Registration: SGJ67Y
Printed: 19/01/2018 16:06

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	MR LAU	Date of Incident:	13/11/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	WL/NOV2017/002	Estimated Repair Time:	
Policy Number:	DMPCSN1304371704	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	BMW
Model:	5 Series
Sub Model:	523 I
Model Sheet Number:	145 04
Registration:	SGJ67Y
Registration Month:	
Registration Year:	2011
VIN Number:	
Manufacture Month:	February
Manufacture Year:	2010
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

HEADLAMP WASHERS	4-DOOR
PARK DISTANCE CONT	3.0 LTR 225 KW
TWO COAT PEARL/MICA	



Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	17/11/2017
Place of Inspection:		
Pre-Accident Damage:		

Tyres Condition:

Tread Depth LHF:	Tread Depth RHF:
Tread Depth LHR:	Tread Depth RHR:
Damage Areas:	Direction of Impact:

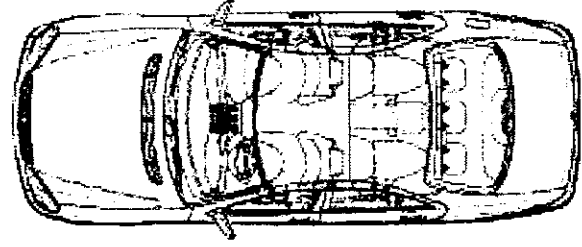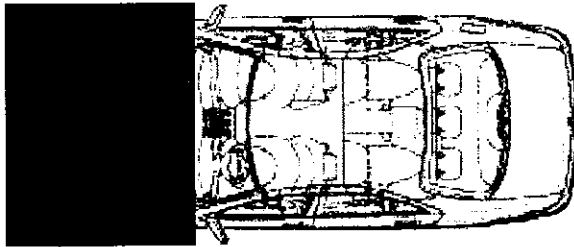

Addresses

Cost Summary

Total Labour	\$568.10
Total Paint/Material	\$134.08
Total Parts	\$5,202.58
Total of Additional Costs	\$42.00
Excess:	TBA
Grand Total Exc GST:	\$5,946.76
7 % GST:	\$416.27
Grand Total Inc GST:	\$6,363.03

Repair Information

LABOUR

Time Basis 12 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
NO NUMBER	ADD/TIME FOR MAIN WORK	2.0	7.67
51 11 656	R + R FRONT BUMPER	5.0	19.17
51 11 551	R + R FRONT BUMPER CARRIER	3.0	11.50
66 20 522	R + R L/F ULTRASONIC CONVERTER (FRONT BUMPER REMOVED)	1.0	3.83
66 20 522	R + R R/F ULTRASONIC CONVERTER (FRONT BUMPER REMOVED)	1.0	3.83
51 11 592	RENEW FRONT BUMPER COVER (FRONT BUMPER REMOVED)	9.0	34.50
61 67 802	HEADLIGHT WASHER UNIT - SUPPLEMENTARY OPERATION INCLUDES: REMOVE/REFIT WASHER NOZZLES	5.0	19.17
66 20 610	ADD/WORK PARK DISTANCE CONTROL	4.0	15.33
51 11 701	RENEW L/F BUMPER BRACKET (REMOVED)	1.0	3.83
51 11 701	RENEW R/F BUMPER BRACKET (REMOVED)	1.0	3.83
63 12 801)	R + R LEFT HEADLAMP	5.0	19.17
51 14 500	R + R FRONT BMW BADGE	1.0	3.83
17 11 510	R + R RADIATOR	16.0	61.33
17 11 546)	R + R FRONT RETAINING FRAME	8.0	30.67
17 11 536)	RENEW FAN SHROUD (FAN REMOVED)	1.0	3.83
9973	KN TEST DRIVE	6.0*	23.00
LABOUR COST			
Total Work Units		69.0	
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		0.0HRS	0.00
Sub Total		5.8HRS	\$264.50
Labour Markup		(0.0 %)	\$0.00
Paint Labour		6.6HRS	\$303.60

Total Labour **12.4HRS** **\$568.10**

NOTE TIME BASIS = 12 WU / HOUR

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT PEARL/MICA		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER REPAIR PAINT PLASTIC	17.0	
LABOUR COST - PAINT			
	TIME(PAINT)	37.0	
	Preparation Main Work Plastic	21.0	
	Preparation Comp. Work Metal	8.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	66.0	
	Total Paintwork Labour	6.6HRS	\$303.60
MATERIAL COST - PAINT			Cost Price
	New Part Painting		\$39.22
	Repair Painting Plastic		\$57.11
	Material-Const Main Work Plastic		\$25.05
	Material-Const Comp. Work Metal		\$12.70
	Total Paint Material Cost		\$134.08

PARTS

Price Valid: 01/01/2018

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
7767	1	FAN SHROUD	17 42 7 569 921		0%	293.15
283	1	FRONT BUMPER COVER	51 11 7 178 079		0%	1,121.75
336	1	FRONT BUMPER SUPPORT	51 11 7 178 080		0%	641.40F
257	1	FRONT NUMBER PLATE	KNPL3		0%	30.00F
301	1	FRT BUMPER MNTG RAIL	51 11 7 063 835		0%	25.00F
431	1	GRILLE BADGE	51 14 8 132 375		0%	67.80F
317	1	L/F BUMPER BRACKET	51 11 7 178 077		0%	18.15F
415	1	L/F GRILLE	51 13 7 027 061		0%	111.65F
339	1	L/F IMPACT DAMPER	51 11 7 178 081		0%	53.40F
349	1	L/INN U-SONIC SENDER	66 20 9 142 217		0%	368.80
595	1	L/UPP HEADLAMP BRKT	63 12 6 949 633		0%	6.70F
561	1	LEFT HEADLAMP ASSY	63 12 7 177 729		0%	1,322.25F
7770	1	LWR RADIATOR SHROUD	17 11 7 791 180		0%	53.95
318	1	R/F BUMPER BRACKET	51 11 7 178 078		0%	18.15F
416	1	R/F GRILLE	51 13 7 027 062		0%	111.65F
340	1	R/F IMPACT DAMPER	51 11 7 178 082		0%	53.40F
350	1	R/INN U-SONIC SENDER	66 20 9 142 217		0%	368.80
596	1	R/UPP HEADLAMP BRKT	63 12 6 949 634		0%	6.70F
7769	1	RADIATOR FRAME	17 11 7 560 958		0%	186.90
f: OEM Parts			Saving			\$53.40
g: Original			Sub Total			\$4,859.60
h: Secondhand			Mark Up From Cost	(5 %)		\$242.98
p: Parallel			Sundry Parts	(Fixed)		\$100.00
x: Exchange			Total Parts			\$5,202.58

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	SPECIALIST	Betterment 0%	Price
AUDATEX FEE			\$42.00
Total Extras			\$42.00
Final Calculation			
Total Parts			\$5,202.58
Labour			
Total Panel/Mechanical		\$264.50	
Total Paintwork		\$303.60	
Labour Markup (0.0 %)		\$0.00	
Total Labour			\$568.10
Additional Costs			
Corr Prot Materials External		\$0.00	
Corr Prot Materials Internal		\$0.00	
Cost of Specialist		\$42.00	
Total of Additional Costs			\$42.00
Total Paint/Material Costs			\$134.08
Grand Total Excludes GST			\$5,946.76
GST @ 7 %			\$416.27
Grand Total Includes GST			\$6,363.03

Assessment Notes

**SMRT AUTOMOTIVE
SERVICES PTE LTD
60 WOODLANDS
INDUSTRIAL PARK E4
757705**

Claim Reference: WL/NOV2017/002
Assessment Number: CTI10121
Version: SMRTAUTO/3
Date Calculated: 21/11/2017 09:03

Full Report - V1
Registration: SGJ67Y
Printed: 21/11/2017 17:07

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	yew chung smrt	Date of Incident:	13/11/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	WL/NOV2017/002	Estimated Repair Time:	
Policy Number:	DMPCSN1304371704	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	BMW
Model:	5 Series
Sub Model:	523 I
Model Sheet Number:	145 04
Registration:	SGJ67Y
Registration Month:	
Registration Year:	2011
VIN Number:	
Manufacture Month:	February
Manufacture Year:	2010
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

HEADLAMP WASHERS	4-DOOR
PARK DISTANCE CONT	3.0 LTR 225 KW
TWO COAT PEARL/MICA	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	17/11/2017
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

SMRT AUTOMOTIVE SERVICES PTE LTD

Claim Reference: WL/NOV2017/002

Assessment Number: CTI10121



Version: SMRTAUTO/3

Date Calculated: 21/11/2017 09:03

Full Report - V1

Registration: SGJ67Y

Printed: 21/11/2017 17:07

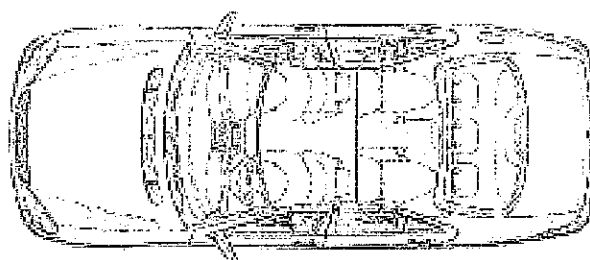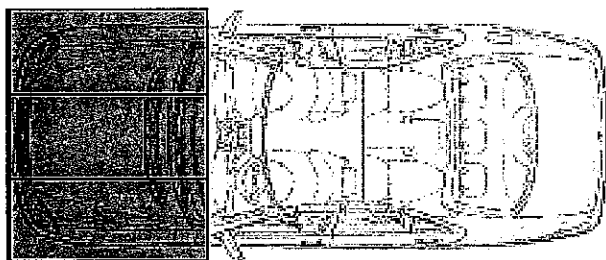**Addresses****Cost Summary**

Total Labour	\$867.87
Total Paint/Material	\$194.64
Total Parts	\$12,833.51
Total of Additional Costs	\$42.00
Excess:	TBA
Grand Total Exc GST:	\$13,938.02
7 % GST:	\$975.66
Grand Total Inc GST:	\$14,913.68

Repair Information**LABOUR**

Time Basis 12 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
NO NUMBER	ADD/TIME FOR MAIN WORK	2.0	7.67
51 23 610	R + R LEFT BONNET LOCK	1.0	3.83
51 23 600	R + R RIGHT BONNET LOCK	3.0	11.50
51 23 716)	R + R BONNET CABLE	2.0	7.67
51 11 656	R + R FRONT BUMPER	5.0	19.17
51 11 551	R + R FRONT BUMPER CARRIER	3.0	11.50
66 20 522	R + R L/F ULTRASONIC CONVERTER (FRONT BUMPER REMOVED)	1.0	3.83
66 20 522	R + R R/F ULTRASONIC CONVERTER (FRONT BUMPER REMOVED)	1.0	3.83
51 11 592	RENEW FRONT BUMPER COVER (FRONT BUMPER REMOVED)	9.0	34.50
61 67 802	HEADLIGHT WASHER UNIT - SUPPLEMENTARY OPERATION INCLUDES: REMOVE/REFIT WASHER NOZZLES	5.0	19.17
66 20 610	ADD/WORK PARK DISTANCE CONTROL	4.0	15.33
51 11 701	RENEW L/F BUMPER BRACKET (REMOVED)	1.0	3.83
51 11 701	RENEW R/F BUMPER BRACKET (REMOVED)	1.0	3.83
63 12 820)	R + R BOTH HEADLAMPS	8.0	30.67
63 99 503	RENEW R/HEADLAMP BULB	2.0	7.67
63 12 950	ADD: RENEW BRACKET	2.0	7.67
51 71 540	R + R L/F WHEELHOUSE COVER	6.0	23.00
51 71 540	R + R R/F WHEELHOUSE COVER	6.0	23.00
41 61 600	R + R BONNET	4.0	15.33
41 61 501	REPLACE BONNET (WITH BONNET REMOVED)	6.0	23.00
51 23 504)	ADJUST BONNET LOCK	2.0	7.67
17 11 510	R + R RADIATOR	16.0	61.33

SMRT AUTOMOTIVE SERVICES PTE LTD

Claim Reference: WL/NOV2017/002

Assessment Number: CTI10121

Version: SMRTAUTO/3

Date Calculated: 21/11/2017 09:03

Full Report - V1

Registration: SGJ67Y

Printed: 21/11/2017 17:07

17 11 546)	R + R FRONT RETAINING FRAME	8.0	30.67
17 11 536)	RENEW FAN SHROUD (FAN REMOVED)	1.0	3.83
11 53 762	RENEW LOWER WATER HOSE	1.0	3.83
11 53 765	RENEW UPPWE WATER HOSE	1.0	3.83
NO NUMBER	RENEW WATER HOSE	2.0	7.67
17 11 610)	R + R HEAT EXCHANGER	1.0	3.83
9973	KN TEST DRIVE	6.0*	23.00

LABOUR COST

Total Work Units	110.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	9.2HRS	\$421.67
Labour Markup	(0.0 %)	\$0.00
Paint Labour	9.7HRS	\$446.20
Total Labour	18.9HRS	\$867.87

NOTE TIME BASIS = 12 WU / HOUR

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT PEARL/MICA		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER REPAIR PAINT PLASTIC	17.0	
471	BONNET REPAIR PAINTING <50%	31.0	

LABOUR COST - PAINT

TIME(PAINT)	68.0	
Preparation Main Work Metal	21.0	
Preparation Comp. Work Plastic	8.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	97.0	
Total Paintwork Labour	9.7HRS	\$446.20

MATERIAL COST - PAINT

	Cost Price
New Part Painting	\$39.22
Repair Painting	\$67.51
Repair Painting Plastic	\$57.11
Material-Const Main Work Metal	\$18.10
Material-Const Comp. Work Plastic	\$12.70
Total Paint Material Cost	\$194.64

PARTS

Price Valid: 01/10/2017

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
257 /	1	FRONT NUMBER PLATE <i>Confid</i>	KNPL3		0%	30.00F ✓
283 /	1	FRONT BUMPER COVER <i>Det</i>	51 11 7 178 079		0%	1,121.75 ✓
301 /	1	FRT BUMPER MNTG RAIL <i>an</i>	51 11 7 063 835		0%	25.00F ✓
303	1	FRT BUMPER GRILLE <i>2</i>	51 11 7 178 115		0%	54.20F ✗
305	1	FRT CTR BUMPER TRIM <i>an</i>	51 11 7 178 096		0%	33.30F ✗
307	1	L/BUMPER AIR GRILLE <i>an</i>	51 11 7 178 097		0%	65.85F ✗
308	1	R/BUMPER AIR GRILLE <i>an</i>	51 11 7 178 098		0%	65.85F ✗
317 /	1	L/F BUMPER BRACKET <i>an</i>	51 11 7 178 077		0%	18.15F ✓
318 /	1	R/F BUMPER BRACKET <i>an</i>	51 11 7 178 078		0%	18.15F ✓
336 /	1	FRONT BUMPER SUPPORT <i>Bent</i>	51 11 7 178 080		0%	641.40F ✓

SMRT AUTOMOTIVE SERVICES PTE LTD

Claim Reference: WL/NOV2017/002

Assessment Number: CTI10121

Version: SMRTAUTO/3

Date Calculated: 21/11/2017 09:03

Full Report - V1

Registration: SGJ67Y

Printed: 21/11/2017 17:07

339	1	L/F IMPACT DAMPER	51 11 7 178 081	0%	53.40F	✓
340	1	R/F IMPACT DAMPER	51 11 7 178 082	0%	53.40F	✓
347	1	L/OUT U-SONIC SENDER	66 20 9 142 217	0%	363.05	+
348	1	R/OUT U-SONIC SENDER	66 20 9 142 217	0%	363.05	+
349	1	L/INN U-SONIC SENDER	66 20 9 142 217	0%	363.05	✓
350	1	R/INN U-SONIC SENDER	66 20 9 142 217	0%	363.05	✓
391	1	FRONT SPOILER	51 11 7 111 012	0%	25.00F	+
415	1	L/F GRILLE	51 13 7 027 061	0%	111.65F	✓
416	1	R/F GRILLE	51 13 7 027 062	0%	111.65F	✓
431	1	GRILLE BADGE	51 14 8 132 375	0%	67.80F	✓
471	1	BONNET	41 61 7 111 385	0%	2,148.70F	+
503	1	L/BONNET LOCK	51 23 7 008 755	0%	105.95F	+
505	1	FRONT BONNET CABLE	51 23 7 184 454	0%	35.60F	+
544	1	R/DRIVING LAMP BULB	63 21 7 160 781	0%	24.30	+
561	1	LEFT HEADLAMP ASSY	63 12 7 177 729	0%	1,322.25F	✓
580	1	R/F INDICATOR BASE	63 12 6 916 102	0%	21.60	+
594	1	R/F HEADLAMP BRACKET	63 12 6 936 090	0%	26.35	+
595	1	L/UPP HEADLAMP BRKT	63 12 6 949 633	0%	6.70F	✓
596	1	R/UPP HEADLAMP BRKT	63 12 6 949 634	0%	6.70F	✓
600	1	R/COVER MOULDING	63 12 7 187 270	0%	39.85	+
625	1	L/F WASHER JET	61 67 7 038 415	0%	162.70	+
626	1	R/F WASHER JET	61 67 7 038 416	0%	162.70	+
631	1	L/WASHER JET CARRIER	51 11 7 060 585	0%	11.40F	+
632	1	R/WASHER JET CARRIER	51 11 7 060 586	0%	11.40F	+
637	1	L/F FOG LAMP	63 17 7 177 711	0%	251.85F	+
638	1	R/F FOG LAMP	63 17 7 177 712	0%	251.85F	+
841	1	L/F WHEELHOUSE COVER	51 71 7 033 749	0%	147.25	+
842	1	R/F WHEELHOUSE COVER	51 71 7 033 750	0%	147.25	+
7761	1	RADIATOR	17 11 7 795 879	0%	896.60	+
7767	1	FAN SHROUD	17 42 7 569 921	0%	293.15	✓
7768	1	UPP RADIATOR BRACKET	17 11 7 560 959	0%	50.50	+
7769	1	RADIATOR FRAME	17 11 7 560 958	0%	186.90	✓
7770	1	LWR RADIATOR SHROUD	17 11 7 791 180	0%	53.95	✓
7771	1	L/LWR RADIATOR BRKT	17 11 7 542 517	0%	28.10	+
7773	1	LWR RADIATOR HOSE	17 12 7 565 075	0%	94.50	+
7774	1	RETURN PIPE	17 12 7 560 973	0%	184.30	+
7776	1	UPPER RADIATOR HOSE	17 12 7 560 968	0%	127.60	+
7779	1	OIL COOLER	17 21 7 560 965	0%	1,148.15	+
7781	1	OIL OUTLET PIPE	17 22 7 560 979	0%	230.25	+

f: OEM Parts

g: Original

h: Secondhand

p: Parallel

x: Exchange

Saving

Sub Total

Mark Up From Cost

(5 %)

Sundry Parts

(Fixed)

Total Parts

\$53.40

\$12,127.15

\$606.36

\$100.00

\$12,833.51

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description

AUDATEX FEE

SPECIALIST

Betterment

0%

Total Extras

Price

\$42.00

\$42.00

Final Calculation

Total Parts

\$12,833.51

Labour

SMRT AUTOMOTIVE SERVICES PTE LTD**Claim Reference: WL/NOV2017/002****Assessment Number: CTI10121****Version: SMRTAUTO/3****Date Calculated: 21/11/2017 09:03****Full Report - V1****Registration: SGJ67Y****Printed: 21/11/2017 17:07**

Total Panel/Mechanical	\$421.67	
Total Paintwork	\$446.20	
Labour Markup (0.0 %)	\$0.00	
Total Labour		\$867.87
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$42.00	
Total of Additional Costs		\$42.00
Total Paint/Material Costs		\$194.64
Grand Total Excludes GST		\$13,938.02
GST @ 7 %		\$975.66
Grand Total Includes GST		\$14,913.68

Assessment Notes

Adrian L
23/11/17.

L/s OSRys.
Not Authorised.

Excess NIL.

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	21 Nov 2017 Sendback Est	21 Nov 2017 17:13 S\$13,945.12	22 Nov 2017 19:46 Edit Adj Rpt	S\$5,000.00 Edit Estimates	S\$5,000.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	-----------------

CLAIM SUBFOLDER DETAILS

Insured:	CHEW SOO ANN, ID: S1805066H		
Vehicle Reg. No.:	SGJ67Y	Date of Loss:	13/11/2017 10:00 - :59
Claim Type:	OD / SNM17D06587C01	Policy/Cover Note No.:	DMPCSN1304371704 (Comprehensive) Coverage: 25/02/2017 - 24/02/2018
		Excess:	S\$0.00
Repairer:	SMRT Automotive Services Pte Ltd (Woodlands) 60 Woodlands Industrial Park E4, 757705 Woodlands - Tel: 68662628		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 01/12/2017]		
Driver/Custodian:	CHEW SOO ANN (/ Male), NRIC: S1805066H		
Adj Asg. Remarks:	survey revert		

ASSOCIATED MAIL RECEIVED

View All | Compose Case Mail

- CHINA_TAIPING (24/01/2018): Alert - Adj Mandate Approved (S\$5000.00) - SGJ67Y - Claim Handler: Chong Boon Se...
- CHINA_TAIPING (27/11/2017): Alert - Adj Mandate Approved (S\$4900.00) - SGJ67Y - Claim Handler: Chong Boon Se...

ALL ASSOCIATED TASKS

View All | Search Tasks | Create New Task | Complete

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

SGJ67Y (SNM17D06587C01)
OD
Nov 13 2017 10:00AM
[CHEW SOO ANN]
SMRT Automotive Services Pte Ltd

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)
View
[View in Browser](#)

Assessment Reports			1 per page	☒
No	Finalized On	SMRT Automotive Services Pte Ltd (Woodlands)	Thumbnail	Print
1	21/11/17 17:13	Repairer Estimates	 Load HTM	☐
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	24/11/17 16:48	Adjuster Immediate Advice	 Load HTM	☐
2	22/01/18 12:10	Adjuster Immediate Advice	 Load HTM	☐
Photos/Images			3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	24/11/17 16:56	General View	 Load JPG	☒
2	24/11/17 16:56	General View	 Load JPG	☒
3	24/11/17 16:56	General View	 Load JPG	☒
4	24/11/17 16:56	General View	 Load JPG	☒
5	24/11/17 16:56	General View	 Load JPG	☒
6	24/11/17 16:56	General View	 Load JPG	☒
7	24/11/17 16:56	General View	 Load JPG	☒
8	24/11/17 16:56	General View	 Load JPG	☒
9	24/11/17 16:56	General View	 Load JPG	☒
10	24/11/17 16:56	General View	 Load JPG	☒
11	24/11/17 16:56	General View	 Load JPG	☒
12	24/11/17 16:56	General View	 Load JPG	☒
13	24/11/17 16:56	General View	 Load JPG	☒
14	24/11/17 16:56	General View	 Load JPG	☒
15	24/11/17 16:56	General View	 Load JPG	☒
16	24/11/17 16:56	General View	 Load JPG	☒
17	24/11/17 16:56	General View	 Load JPG	☒
18	24/11/17 16:56	General View	 Load JPG	☒
19	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
20	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
21	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
22	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
23	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
24	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
25	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
26	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
27	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
28	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
29	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
30	19/01/18 17:16	Reinspection Photo	 Load JPG	☒
31	19/01/18 17:16	Reinspection Photo	 Load JPG	☒

32	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
33	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
34	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
35	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
36	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
37	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
38	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
39	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
40	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
41	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
42	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
43	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
44	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
45	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
46	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
47	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
48	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
49	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
50	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
51	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
52	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
53	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
54	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
55	19/01/18 17:16	Reinspection Photo	1	Load JPG	☒
56	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
57	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
58	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
59	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
60	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
61	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
62	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
63	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
64	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
65	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
66	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
67	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
68	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
69	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
70	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
71	19/01/18 17:17	Reinspection Photo	1	Load JPG	☒
Documentation				1 per page v	☒
No	Finalized On	SMRT Automotive Services Pte Ltd (Woodlands)		Thumbnail	Print
1	21/11/17 17:13	Singapore Accident Statement	1	Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	24/11/17 16:49	AUDATEX	1	Load PDF	
2	24/11/17 16:49	SURVEYOR MARKING	1	Load PDF	
3	24/01/18 10:29	SGJ 67Y CTI10121.AudatexMS	1	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST

Reset

Save

Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

^

v

Show Remarks To: ☐ Repairer ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CT117022345/ARBE2**Date:** 01/02/2018REFERENCE

Insured/Claimant: CHEW SOO ANN Policy No: DMPCSN1304371704
Date of Loss: 13/11/2017 Nature of Claim: OD Claim No: SNM17D06587C01

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SGJ67Y**
Make & Model: BMW 523i, 2.5 (A) Engine No: 05317591N52B25AF
Reg. Date: 25/02/2011 (Man. Year: 2010) Chassis No: WBAFP32090C546795
Colour: Black Odometer: 165693 km
Engine Capacity: 2497 cc
Market Value/New Car Price: S\$72,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 245/40 R19 Rear Tyre Size: 245/40 R19
Front Left Side: Continental 6 mm Rear Left Side: Continental 6 mm
Front Right Side: Continental 6 mm Rear Right Side: Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	12,882.61	5,244.58	7,638.03	59.29
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,062.51	702.18	360.33	33.91
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	13,945.12	5,946.76	7,998.36	57.36
Approved Total (Overridden) (S\$)		5,000.00		
(S\$)	13,945.12	5,000.00	8,945.12	64.15
+ GST 7.00/7.00% (S\$)	976.16	350.00	626.16	64.15
Nett Amount (S\$)	14,921.28	5,350.00	9,571.28	64.15

INSPECTION

Date of Assignment: 22/11/2017 Present Location: SMRT Automotive Services Pte Ltd (Woodlands)
Date Inspected: 23/11/2017 Inspected At: 60 Woodlands Industrial Park E4 Singapore 757705
Estimated Period of Repair: 9.0 days

Adjuster: ADRIAN LING**Manager:** Janice Lee Si Hua

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 01 Feb 2018)
Parts: 143 BMW 523I 2.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SGJ67Y)
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*BONNET (WCP)	Repair	2,148.70 F	*- F
2	1	NA	*FAN SHROUD (WCP)	Cracked	293.15 F	*293.15 F
3	1	NA	*FRONT BONNET CABLE (WCP)	Not Necessary	35.60 F	*- F
4	1	NA	*FRONT BUMPER COVER (WCP)	Deformed	1,121.75 F	*1,121.75 F
5	1	NA	*FRONT BUMPER SUPPORT (WCP)	Bent	641.40 F	*641.40 F
6	1	NA	*FRONT NUMBER PLATE (WCP)	Cracked	30.00 F	*30.00 F
7	1	NA	*FRONT SPOILER (WCP)	Not Necessary	25.00 F	*- F
8	1	NA	*FRT BUMPER GRILLE (WCP)	Not Necessary	54.20 F	*- F
9	1	NA	*FRT BUMPER MNTG RAIL (WCP)	Necessary	25.00 F	*25.00 F
10	1	NA	*FRT CTR BUMPER TRIM (WCP)	Not Necessary	33.30 F	*- F
11	1	NA	*GRILLE BADGE (WCP)	Necessary	67.80 F	*67.80 F
12	1	NA	*L/BONNET LOCK (WCP)	Not Necessary	105.95 F	*- F
13	1	NA	*L/BUMPER AIR GRILLE (WCP)	Not Necessary	65.85 F	*- F
14	1	NA	*L/F BUMPER BRACKET (WCP)	Necessary	18.15 F	*18.15 F
15	1	NA	*L/F FOG LAMP (WCP)	Not Necessary	251.85 F	*- F
16	1	NA	*L/F GRILLE (WCP)	Cut	111.65 F	*111.65 F
17	1	NA	*L/F IMPACT DAMPER (WCP)	Bent	53.40 F	*53.40 F
18	1	NA	*L/F WASHER JET (WCP)	Not Necessary	162.70 F	*- F
19	1	NA	*L/F WHEELHOUSE COVER (WCP)	Not Necessary	147.25 F	*- F
20	1	NA	*L/INN U-SONIC SENDER (WCP)	Damaged	363.05 F	*368.80 F
21	1	NA	*L/LWR RADIATOR BRKT (WCP)	Not Necessary	28.10 F	*- F
22	1	NA	*L/OUT U-SONIC SENDER (WCP)	Not Necessary	363.05 F	*- F
23	1	NA	*L/UPP HEADLAMP BRKT (WCP)	Cracked	6.70 F	*6.70 F
24	1	NA		Not Necessary	11.40 F	*- F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
			*L/WASHER JET CARRIER (WCP)			
25	1	NA	*LEFT HEADLAMP ASSY (WCP)	Cracked	1,322.25 F	*1,322.25 F
26	1	NA	*LWR RADIATOR HOSE (WCP)	Not Necessary	94.50 F	*- F
27	1	NA	*LWR RADIATOR SHROUD (WCP)	Deformed	53.95 F	*53.95 F
28	1	NA	*OIL COOLER (WCP)	Not Necessary	1,148.15 F	*- F
29	1	NA	*OIL OUTLET PIPE (WCP)	Not Necessary	230.25 F	*- F
30	1	NA	*R/BUMPER AIR GRILLE (WCP)	Not Necessary	65.85 F	*- F
31	1	NA	*R/COVER MOULDING (WCP)	Not Necessary	39.85 F	*- F
32	1	NA	*R/DRIVING LAMP BULB (WCP)	Not Necessary	24.30 F	*- F
33	1	NA	*R/F BUMPER BRACKET (WCP)	Necessary	18.15 F	*18.15 F
34	1	NA	*R/F FOG LAMP (WCP)	Not Necessary	251.85 F	*- F
35	1	NA	*R/F GRILLE (WCP)	Cut	111.65 F	*111.65 F
36	1	NA	*R/F HEADLAMP BRACKET (WCP)	Not Necessary	26.35 F	*- F
37	1	NA	*R/F IMPACT DAMPER (WCP)	Bent	53.40 F	*53.40 F
38	1	NA	*R/F INDICATOR BASE (WCP)	Not Necessary	21.60 F	*- F
39	1	NA	*R/F WASHER JET (WCP)	Not Necessary	162.70 F	*- F
40	1	NA	*R/F WHEELHOUSE COVER (WCP)	Not Necessary	147.25 F	*- F
41	1	NA	*R/INN U-SONIC SENDER (WCP)	Damaged	363.05 F	*368.80 F
42	1	NA	*R/OUT U-SONIC SENDER (WCP)	Not Necessary	363.05 F	*- F
43	1	NA	*R/UPP HEADLAMP BRKT (WCP)	Cracked	6.70 F	*6.70 F
44	1	NA	*R/WASHER JET CARRIER (WCP)	Not Necessary	11.40 F	*- F
45	1	NA	*RADIATOR (WCP)	Not Necessary	896.60 F	*- F
46	1	NA	*RADIATOR FRAME (WCP)	Cracked	186.90 F	*186.90 F
47	1	NA	*RETURN PIPE (WCP)	Not Necessary	184.30 F	*- F
48	1	NA	*SPECIALIST AUDATEX FEE		42.00 F	*42.00 FS
49	1	NA	*SUNDRY PARTS	Necessary	100.00 F	*100.00 FS
50	1	NA	*UPP RADIATOR BRACKET (WCP)	Not Necessary	50.50 F	*- F
51	1	NA	*UPPER RADIATOR HOSE (WCP)	Not Necessary	127.60 F	*- F

F=Franchise part. S=SpcNett.

Sub Total (\$\$)	12,269.15	5,001.60
+ Margin on L,N Items 5.00/5.00% (\$\$)	613.46	242.98
Total Parts (\$\$)	12,882.61	5,244.58

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	446.20	303.60
2	Total Paint Materials	New	194.64	134.08
3	Total Panel/Mechanical Labour	New	421.67	264.50
Gross Labour Cost (S\$)			1,062.51	702.18

Report was unsubmitted during this print-out.

< END OF ESTIMATES >