

22/03/2002

SS REC. BY:

REF: CS/CT117023757/Kvd30k Special Instruction:

Surveyor: Kenneth Menmen ASSIGNMENT (Office)From (Person): Chong Boon Sen of CTI Date/Time: 14/12/17 @ 1:08 pm

Estimated Cost: _____ Bill to: _____

☒ TP / WS / TP RES / OD RES / EVA / INV / MV / CSTo Inspect Vehicle No: SFZ 6955 Y Insured: _____at Workshop m/s Lai Huch (Meng Kee) Tel: 645 38110of 160 Sin Ming Drive # 04-81Policy No: DMPCSN 3065261700 Claim No: SNM17D07042C01Sum Insured: _____ Excess: \$1,000-00Make of Veh: _____ D.O.A. 9/12/2017
(Client's Record)CA / ☒ REV / REP. / REV 24 HRSDate/Time: 2:21 pm @ 14/12/17 Person Contacted: Jenny H.O.D. Endorsement: _____Vehicle ☒ IN ☐ OUT

Date/Time	Action/Instruction
	<u>(L) Estimate</u>
	<u>SFZ 6955 Y - X</u>
<u>15/12/17</u>	<u>Revert by merimen</u>
<u>18/12/17</u>	<u>Revert by merimen - LS \$ 16,200</u>
<u>19/12/17</u>	<u>Mandate approved by Susan</u>
<u>19/12/17</u>	<u>@ 2.15 pm spoke & email to Jenny, CA, Ex: 1000</u>

ASS. REC. BY:

REF: C72/

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 842k

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: 16 days

Res.: Yes or No

Lum Sum: 20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: S-7 89554Yr Regn: CP, CPType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: VolkswagenColour: M. BlackSp. Reading: 109061

Eng/No: _____

C/No: WVWZZZ1KZ AWO26078Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModl: NII / Std / STD A/Rim orTyre Size: F: 225/40R18

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front

R/Bal. 6 mmL/Bal. 6 mmD.O.A. 9/12/17

Rear

R/Bal. 4 mmL/Bal. 4 mmD.O.I. 14/12/17

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S body & O/S

The U/C / Chassis-frame / Body Structure affected due to collision

Date / Time

Action / Instruction

15/12

File sent to Catherine

16/5/18

LS \$ 15,900 confirmed by email (Ref 5001.51, 2410)

RECEIVED 13 MAY 2018

Date/Time, File Pass to?

☐

Prel. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

16/5-18 pmt

Days Of Repair: 16Resurvey No. of Trlp: 1

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Survey Fee: 220

Transportation: _____

S + RS \$1

Photos

Others

TOTAL

220

Report Format :

menimen

Lump Sum / I.B.I. (\$

15,900p

Survey Department Check List (Case Handler)

Reference No. : CS/CTI17023757/Kvd3
 Policy Type: OD / TP / TP RES / TL / EVA

Case Handler

Typist

Admin (): Case handler to make sure all information created by the assignment team are **ACCURATE**.

(1) Office Assign Form		Y-Date	N-Date	Y-Date	N-Date
C	Reference No.	✓			
C	Customer Code				
N	Assign From				
C	Assign Date	✓			
C	Veh No (Inspected)	✓			
C	Veh No (Insured)				
C	D.O.A	✓			
C	Policy No	✓			
C	Claim No	✓			
C	Insurance Authorisation (CA /REV/REP)	✓			
C	Report Type	✓			
C	Weekend Charges				
N	Survey held at/Repairer	✓			
C	Excess	✓			

Surveyor (): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form		Y-Date	N-Date	Y-Date	N-Date
C	Vehicle No	✓			
C	Regn Month/Year	✓			
N	Vehicle Type	✓			
N	Make & Model	✓			
C	Engine Capacity. (C.C)	✓			
N	Colour	✓			
C	Odometer. (Sp.Reading)	✓			
C	Chassis No	✓			
N	General Condition	✓			
N	Steering	✓			
N	Brake	✓			
N	Modification (Modi)	✓			
C	Tyre Size	✓			
N	Tyre Make	✓			
C	Tyre Balance	✓			
C	Date of Inspection	✓			
N	Survey held	✓			
N	Des.of Damages	✓			

(2) System - (Views/Merimen)

C	Damaged Vehicle Photographs Uploaded	✓			
---	--------------------------------------	---	--	--	--

(3) Workshop Estimate/Assignment Form

N	ALL Parts condition	✓			
C	Market Value for OD cases	✓			
C	Estimate Repair Cost for PRI (RSI, TMI, MSIG)				
C	Days of repair	✓			
C	Finalised Amount	✓			
C	Re-inspection Cases to Finalize within 5 Days				

(4) System - (Views/Merimen)

C	Resurvey photo Uploaded	✓			
---	-------------------------	---	--	--	--

Check By: VERON 16/5/18
 Case Handler Date

*C: Critical *N: Non-Critical

21/05/2014




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD		Ref : CS/CTI17023757/Kvd3	
3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909		Date : 14-12-2017	
		Code : CTI	
1. Policy Particulars :- OWN DAMAGE			
Insured Veh.		Veh. Inspected	SFZ 6955Y
Policy No.	DMPCSN3065261700	Coverage (\$)	0.00
Claim No.	SNM17D07042C01	Excess (\$)	1,000.00
Assign From	MERIMEN (CHONG BOON SEN)	Assign Date	14/12/2017
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	09/12/2017	Inspection Date	14/12/2017
Survey held at	LAI HUAT (MENG KEE) MOTOR PTE LTD 160 SIN MING DRIVE #04-01/02 SIN MING AUTOCITY SINGAPORE 575722		
5a. Remarks			
A) THE MARKET VALUE IS S\$----- (EST. AVERAGE) B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.			

Ai Phing (LKKAUTO)

From: Ai Phing (LKKAUTO)
Sent: Tuesday, 19 December, 2017 2:09 PM
To: Jenny Lim
Cc: SUR
Subject: SFZ 6955Y CHINA-OD (DOA 09-12-2017)

Dear Jenny,

As instructed by our client, please proceed to repair the insured vehicle **SFZ 6955Y (Excess \$1,000)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Best Regards,

Ai Phing on behalf Veron | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #01-25 | S(408933)

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	14 Dec 2017 01:20	Clim Veh Model Changed	(200963) VOLKSWAGEN GOLF GTI 5 DR 2.0 (A).	[R] Jenny Lim Lai Foong
2	14 Dec 2017 01:20	Clim Created	Reg No: SFZ6955Y. Policy No: DMPCSN3065261700. Acct Date: 2017/12/09. Claim Type: OD. Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ). Workshop: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming). Created from SAS:MLHM17162441	[R] Jenny Lim Lai Foong
3	14 Dec 2017 09:19	Clim Submitted	20851.51.	[R] Jenny Lim Lai Foong
4	14 Dec 2017 13:08	Clim Registration Modified	Excess: -> 1000.00.	[I] Chong Boon Sen
5	14 Dec 2017 13:08	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):SURVEY REVERT	[I] Chong Boon Sen
6	14 Dec 2017 13:08	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/12/26	[I] Chong Boon Sen
7	14 Dec 2017 13:08	Adj Mandate Set	Approved:0.00.	[I] Chong Boon Sen
8	14 Dec 2017 13:33	Assignment 1st Accessed		[A] CATHERINE CHONG KAI LING
9	14 Dec 2017 15:29	Adj Adjuster Assigned	[None] -> KENNETH KONG	[A] Nivitha Govindasamy
10	15 Dec 2017 12:37	Adj Rpt Initiated		[A] VERON CHEN
11	15 Dec 2017 14:03	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2017/12/26	[A] VERON CHEN
12	15 Dec 2017 14:04	Adj Mandate Request	Cur.Reg:16400.00:Damages Consistent Repair Cost Economical	[A] VERON CHEN
13	15 Dec 2017 15:40	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/12/26. Mandate Remarks: PLA (TOTAL 20482.11) DOES NT TALLY AUDATEX (20901.51). PLS ADVISE	[I] Chong Boon Sen
14	15 Dec 2017 15:40	Adj Mandate Set	Maintained:PLA (TOTAL 20482.11) DOES NT TALLY AUDATEX (20901.51). PLS ADVISE	[I] Chong Boon Sen
15	18 Dec 2017 15:59	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2017/12/26	[A] VERON CHEN
16	18 Dec 2017 16:04	Adj Mandate Request	Cur.Reg:16200.00:Damages Consistent Repair Cost Economical	[A] VERON CHEN
17	19 Dec 2017 13:54	Adj Next Rpt Changed	Cur Rpt:Final Rpt. Cur Due Date:2017/12/26. Mandate Remarks: PLA (TOTAL 20482.11) DOES NT TALLY AUDATEX (20901.51). PLS ADVISE	[I] Susan Teo
18	19 Dec 2017 13:54	Adj Mandate Set	Approved:16200.00:PLA (TOTAL 20482.11) DOES NT TALLY AUDATEX (20901.51). PLS ADVISE	[I] Susan Teo

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
1667705	14/12/2017 01:20	Motor	Lai Huat (Meng Kee) Motor Pte Ltd	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)	SFZ6955Y		xx.xx
1669716	15/12/2017 12:37	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SFZ6955Y		10.70

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road
#16-00 Springleaf Tower
Singapore 079909From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Chong Boon Sen

Date: 18 Dec 2017

Preliminary Advice

Vehicle No	: SFZ6955Y	Accident Date	: 09/12/2017
Make	: VOLKSWAGEN GOLF	Policy No.	: DMPCSN3065261700
Assignment Date	: 14/12/2017	Excess	: S\$1,000.00
Date of Inspection	: 14/12/2017	Est. Duration of Repair	: 16.00
Inspection At	: LAI HUAT (MENG KEE) MOTOR PTE LTD (SIN MING) 160 SIN MING DRIVE #04-01, SIN MING AUTOCITY SINGAPORE 575722		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages n/s body and o/s front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	20,901.51
Revised Amount	:S\$	18,198.20
Check Items (Estimated)	:S\$	2,016.26
Total	:S\$	20,214.46
 Lump Sum Repair (ESTIMATED)	 :S\$	 16,200.00

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	42,000.00
COE / PARF Rebate	:S\$	21,033.00
Salvage Value	:S\$	
Margin for Repair	:S\$	20,967.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road
#16-00 Springleaf Tower
Singapore 079909From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Chong Boon Sen

Date: 15 Dec 2017

Preliminary Advice

Vehicle No	: SFZ6955Y	Accident Date	: 09/12/2017
Make	: VOLKSWAGEN GOLF	Policy No.	: DMPCSN3065261700
Assignment Date	: 14/12/2017	Excess	: S\$1,000.00
Date of Inspection	: 14/12/2017	Est. Duration of Repair	: 16.00
Inspection At	: LAI HUAT (MENG KEE) MOTOR PTE LTD (SIN MING) 160 SIN MING DRIVE #04-01, SIN MING AUTOCITY SINGAPORE 575722		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages n/s body and o/s front portion. The undercarriage and body structure affected due to collision parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	20,901.51
Revised Amount	:S\$	18,612.59
Check Items (Estimated)	:S\$	1,869.52
Total	:S\$	20,482.11
 Lump Sum Repair (ESTIMATED)	 :S\$	 16,400.00

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	42,000.00
COE / PARF Rebate	:S\$	21,033.00
Salvage Value	:S\$	
Margin for Repair	:S\$	20,967.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type	Singapore NRIC
Owner ID	6562D

Vehicle Details

Vehicle No.	SFZ6955Y
Vehicle to be Exported	No
Intended De-registration Date	14 Dec 2017
Vehicle Make	VOLKSWAGEN
Vehicle Model	GOLF GTI 2.0L AT 5DR 5K19V3
Primary Colour	Grey
Manufacturing Year	2009
Engine No.	CCZ019163
Chassis No.	WVWZZZ1KZAW026078
Maximum Power Output	155.0 kW (207 bhp)
Open Market Value	\$32,365.00
Original Registration Date	25 Sep 2009
First Registration Date	25 Sep 2009
Transfer Count	1
Actual ARF Paid	\$32,365.00

Intended PARF Rebate Details

PARF Eligibility	Yes
PARF Eligibility Expiry Date	24 Sep 2019
PARF Rebate Amount	\$17,800.00

Intended COE Rebate Details

COE Expiry Date	24 Sep 2019
COE Category	E - Open Category
COE Period(Years)	10
QP Paid	\$18,189.00
COE Rebate Amount	\$3,233.00
Total Rebate Amount	\$21,033.00

The information contained herein is correct as at 14 Dec 2017

OK



Please read through the Privacy Statement, Terms of Use, and Disclaimer.

Please do not use the Back or Forward buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 10 and above, Chrome, Firefox, and Safari.

Copyright 2017 LTA [Privacy Statement](#) [Terms of Use](#) [Disclaimer](#) [Rate the Website](#) [Rate this e-Service](#)

Last updated on 19 Nov 2017 at 12:12 AM

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type	Singapore NRIC
Owner ID	6562D

Vehicle Details

Vehicle No.	SFZ6955Y
Vehicle to be Exported	Yes
Intended De-registration Date	11 Dec 2017
Vehicle Make	VOLKSWAGEN
Vehicle Model	GOLF GTI 2.0L AT 5DR 5K19V3
Primary Colour	Grey
Manufacturing Year	2009
Engine No.	CCZ019163
Chassis No.	WVWZZZ1KZAW026078
Maximum Power Output	155.0 kW (207 bhp)
Open Market Value	\$32,365.00
Original Registration Date	25 Sep 2009
First Registration Date	25 Sep 2009
Transfer Count	1
Actual ARF Paid	\$32,365.00

Intended PARF Rebate Details

PARF Eligibility	Yes
PARF Eligibility Expiry Date	24 Sep 2019
PARF Rebate Amount	\$17,800.00

Intended COE Rebate Details

COE Expiry Date	24 Sep 2019
COE Category	E - Open Category
COE Period(Years)	10
QP Paid	\$18,189.00
COE Rebate Amount	\$3,248.00
Total Rebate Amount	\$21,048.00

The information contained herein is correct as at 11 Dec 2017

OK

A-Assurance
Assurance in Insurance
Car Insurance Expiring?
 We get you the cheapest insurance renewal

[Click to get quote](#)

 Username / Email Add
 password
 Submit Qu
 Connect Sign Up New Account
 Forgot Password

Post an Advertisement
 Sell it yourself! Advertise it at just
\$58 until it's SOLD!
[Post an Ad](#)
[Advertiser Login](#)
[Ways of Selling](#)
May 2014 Land Rover Range Rover Evoque @ \$146,800

 In House Financing Available!
 High ARFI Super Low Mileage!
 Call Now! Price Nego
 StarAd

HIN LUNG AUTO
 Ho Bee Group
One Stop Car Hub
 Finance, Insurance, Workshop
 New and Used Cars
 30 years of car sale

Browse by Category

Sort by Date Posted

20 results/page

18 vehicles

volkswagen golf gti

Advanced Search Submit

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	volkswagen	golf gti	Any	Any	2009	Any	Any	Any	Available


Volkswagen Golf GTI 5DR
\$31,800
\$11,710 /yr
16-Apr-2009
1,984 cc
129,300 km
Sports
Available

GTI Has 200hp And 207 Lbs Of Torque, It Is A Vehicle With Tons Of Power. Contains A 2.0L Turbocharged, Intercooled Direct Fuel Injected 4 Cylinder Engine. It's A Worthy Sports Car In Market Contact Us...

Swee Seng Motors

Posted: 13-Dec-2017

Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen

[Details](#)

Volkswagen Golf GTI 5DR
\$32,800
\$13,910 /yr
10-Mar-2009
1,984 cc
120,000 km
Sports
Available

1.99% Interest Only For You! Cheapest 5DR GTI! 100% Accident Free, Well Taken Care Of By Previous Owner. Non-Smoker! Owner Upgrade To New Car. Call Now For A Free Test Drive With No Obligations! Flex...

Posted: 11-Dec-2017

Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen

[Details](#)

Volkswagen Golf GTI 5DR
\$42,500
\$15,010 /yr
16-Sep-2009
1,984 cc
139,000 km
Sports
Available

 Graded **B** by **STA**

STA Certified Accident Free With 120 Point Check, Buy With A Peace Of Mind! Cheapest In The Market! Fully Stock Agent Unit, High OMV Value, Excellent Condition, Very Well Maintained, Price Negotiable,...

D'Cars

Posted: 09-Dec-2017

Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen

[Details](#)

Volkswagen Golf GTI 5DR
\$38,800
\$17,600 /yr
09-Apr-2009
1,984 cc
-
Sports
Available

2 Owner. Original Condition. Accident Free. Selling Due To Upgrading. Low Mileage Done. Feel Free To Call. Consignment Unit. Price Negotiable.

Posted: 08-Dec-2017

Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen

[Details](#)

Car Buying

Car Selling


Car Aftermarket

 Buying a pre-owned car, but
 Unsure of its Condition?
[Get, STA Car Evaluation](#)

Car Ownership

On The Move

Lifestyle


Volkswagen Golf GTI 5DR
\$38,900
\$16,770 /yr
28-Apr-2009
1,984 cc
167,766 km
Sports
Available

Perfect Car If You Want To Feel Thrilled But Need Practicality, Stage 3 Tuned Producing More Than 400BHP, Worth \$25k Of Mods; Original Paint, Enkel 18inch, PS4 Tyres, Brembo GT6 -6Pot (Front), RS3 Bra...

Prem Roy Motoring

Posted: 08-Dec-2017

Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen

[Details](#)

Volkswagen Golf GTI 5DR
\$36,800
\$15,450 /yr
23-Apr-2009
1,984 cc
80,000 km
Sports
Available

New Michelin PSS Tire, New Air Con Compressor And Servicing Just Done. Expensive Oettinger Body Kits. Call Now For Viewing.

Posted: 04-Dec-2017

Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen

[Details](#)

Volkswagen Golf GTI 5DR
\$39,900
\$13,380 /yr
23-Sep-2009
1,984 cc
105,000 km
Sports
Available

Experience Quick Acceleration Of 207BHP On This Well Maintained 2009' VW Golf GTI Owned By Expat Owner Selling Due To Frequently Not In Town Recently. Prompt Servicing And Maintenance Done At Reputabl...

Posted: 03-Dec-2017

Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen


[Details](#)
Volkswagen Golf GTI 5DR
\$38,388
\$16,150 /yr
07-May-2009
1,984 cc
125,000 km
Sports
Available



Down Payment Of \$6500 Monthly \$1188! Pocket Rocket Is What It's Been Referred To! High Torque To Satisfy Your Expectations! Responsive Pickup And Great In Handling Too! You Will Be Amaze By It's Perfo...

Details

Posted: 01-Dec-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen



Volkswagen Golf GTI SDR **\$41,800** **\$14,250 /yr** **06-Oct-2009** **1,984 cc** **128,397 km** **Sports** **Available**

Responsive 207BHP Engine, New Battery, LTA Approved Jetex Sports Exhausts, No Repair Require, Well Maintain & Excellent Condition, Spacious Boot, Price And Down Payment Negotiable.

Details

Posted: 30-Nov-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen



Volkswagen Golf GTI SDR **\$26,888** **\$12,810 /yr** **02-Jan-2009** **1,984 cc** **-** **Sports** **Available**

Doctor Owner Upgrading. Lowest Depreciation! Always Parked Under Shelter. New Paint Work With Regular Grooming. Regularly Serviced And Maintained With New Battery, Leather Seats. All Wear And Tear It...

PREMIUM AD

Details

Posted: 30-Nov-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen



Volkswagen Golf GTI SDR **\$47,800** **\$17,380 /yr** **08-Dec-2009** **1,984 cc** **121,000 km** **Sports** **Available**

Nicely Done Up Well Maintained GTI. 3M Blue/Purple Colour Flip Vinyl Wrap. Regular Serviced. No Leaks. Recently Changed Oil Seals And Gasket. New Radiator And Fan. Call To Arrange For Viewing.

Details

Posted: 30-Nov-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen



Volkswagen Golf GTI SDR **\$30,500** **\$12,780 /yr** **12-Feb-2009** **1,984 cc** **180,000 km** **Sports** **Available**

Always Parked Under Shelter! Servicing Just Done 2 Weeks Ago. Beautiful White Exterior With Luxurious Black Interior. View To Appreciate! Trade Ins Are Welcomed. Flexible Loans Up To 80%. Why Wait? Ca...

PREMIUM AD

Details

Posted: 28-Nov-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen



Volkswagen Golf GTI SDR **\$42,800** **\$19,310 /yr** **12-May-2009** **1,984 cc** **106,000 km** **Sports** **Available**

Nicely Done Up. Well Maintained. Regular And Just Serviced. Most Competitively Price Gti In Market. Get Back Approx \$16k End Of Coe. Call Now!

EXPIRED OWNER

Details

Posted: 26-Nov-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen



Volkswagen Golf GTI SDR **\$45,800** **\$15,890 /yr** **29-Oct-2009** **1,984 cc** **74,252 km** **Sports** **Available**

Agent Unit, 210BHP, Sunroof, Done 9200Km Per Year, 18" Sports Rims, Auto Xenon Lights, Sport Seats, Paddle Shift, Road Tax Till 04/2018, Black In Colour, Serviced And Maintained By VW.

Details

Posted: 24-Nov-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen




Volkswagen Golf GTI SDR **\$41,888** **\$13,880 /yr** **29-Oct-2009** **1,984 cc** **144,100 km** **Sports** **Available**

Well Maintained By Owner With Wash Every Week, Regularly Serviced Every 3 Months Or 5000km, Only Uses 98 Petrol, Accident Free, Neat And Sporty Interior, Sun Shades Around The Car Maintaining Privacy,...

EXPIRED OWNER

Details

Posted: 20-Nov-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen



Volkswagen Golf GTI 3DR **\$39,900** **\$12,670 /yr** **17-Nov-2009** **1,984 cc** **85,689 km** **Sports** **Available**

Very Well Maintained, Very Low Mileage. Wear And Tear Parts Replaced. Comes With Reliable 6 Speed Gearbox Unlike The Notorious 7 Speed DQ200. Trade Ins Welcomed! Flexible Financing Available! Consignm...

PREMIUM AD

Prem Roy Motoring

Details

Posted: 11-Nov-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen



Volkswagen Golf GTI SDR **\$33,500** **\$11,200 /yr** **08-Jun-2009** **1,984 cc** **162,000 km** **Sports** **Available**

LTA Friendly Quad Exhaust, Upgraded Suspension/Intake, 6Pot AP BBK, Rims And Tyres. Accident Free, Never Tracked, Healthy Engine. Well Maintained And Serviced Regularly. Loan Can Be Arranged.

EXPIRED OWNER

Details

Posted: 08-Nov-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen



Volkswagen Golf GTI SDR **\$34,800** **\$15,690 /yr** **26-Feb-2009** **1,984 cc** **76,800 km** **Sports** **Available**

1.99% Interest Rate Only Or DownPay Merely \$3680, \$1423 For 15mth! Lowest Mileage! Most Competitively Priced GTI On The Market, Minimum Risk! Get Back \$16k End Of COE. 100% Mishap Free, STA Evaluation...

PREMIUM AD

Car Buyers Automotive Pte Ltd

Details

Posted: 14-Oct-2017 Tags: 2009 Volkswagen Golf, 2009 Volkswagen Golf, Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Golf, Used Volkswagen

Save this search criteria, to get email alerts whenever a match is found.

Make Model Price Depreciation Reg Date Eng Cap Mileage Veh Type Status

For old advertisements, view Expired ads

20 results/page

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	11/12/2017 11:19
Date Of Accident	09/12/2017 10:05
Exact Location Of Accident	FROM YONG PENG TOWARDS PALOH
Country/State of Loss	MALAYSIA/JOHOR DARUL TAKZIM

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SFZ6955Y
Insured/Policyholder	
Name Of Registered Owner	HONG BIN
NRIC No	S2696562D
Email Address	HONGBIN_1967@YAHOO.COM.SG
Mobile Phone No	(LOCAL) +65-98322993
Alternative Phone No	OTHERS-98322993

Vehicle Particulars

Manufacturer	VOLKSWAGEN
Model	GOLF 2.0 GTI

Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
--	-------------

Are you claiming under your own insurance policy for repair to your vehicle?	YES
--	-----

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPCSN3065261700
Cover Note Number	

Driver

Name of Driver	HONG BIN
NRIC No	S2696562D
Date Of Birth	08/12/1967
Occupation	OUTDOOR
Date Of Driving Pass	22/06/2007
Driving Experience	10 YEARS AND 5 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98322993
Fax Number	
Contact Number	OTHERS-98322993
Email Address	HONGBIN_1967@YAHOO.COM.SG


SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**


I understand, acknowledge, agree and consent that:


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time:

11 DEC 2017

GIA/NC SketchPlanForm_V3


Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.: Poh Kwee Choo
S6840583A



**SINGAPORE
POLICE FORCE**



J/20171210/2064

1 of 2

POLICE REPORT (NP299)

Report No. J/20171210/2064

Police Station Of Origin
Choa Chu Kang NPP
116 Teck Whye Lane #01-740 SINGAPORE
680116
Tel No: 1800-7629999

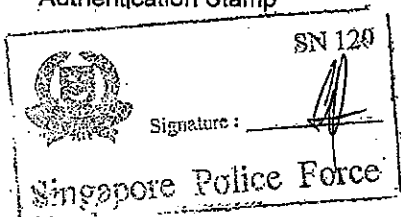
Date/Time Report Made 10/12/2017 15:09	Vide Report No.	Station Diary No. 32		
Name Of Informant HONG BIN	Address APT BLK 212 CHOA CHU KANG CENTRAL #12-138 SINGAPORE 680212			
ID Type / ID No. NRIC NO / S2696562D	Contact No. Home/Office	Mobile 98322993		
Nationality SINGAPORE CITIZEN	Email Address			
Occupation OIL REFINERY TECHNICIAN	Sex Male	Age 50	Date of Birth 08/12/1967	Race Chinese
Institution/School Name	Language			
Date/Time Of Incident 09/12/2017 10:05	Location Of Incident. Yong Peng Towards Paloh MALAYSIA			

Brief details.

On 09/12/2017 at about 1005 hours, I was driving my vehicle bearing plate number SFZ6955Y from Yong Peng towards Paloh approaching a bend, when I suddenly lost control of my vehicle (due to road surface being sandy and filled with small stones), skidded and collided to the divider on the left side of the road. This caused my vehicle to be stuck on the drain at the side of the road.

Due to the accident, Based on my visual assessment, the body of the car is badly damaged. I am unable

Signature Of Officer Recording The Report: J / Sgt 2 ASRAF ZULKARNAIN BIN 'AZIMI	Signature Of Informant:
Signature Of Interpreter: Not applicable	Date/Time: 10/12/2017 15:09
Officer In-Charge Of Case: J / Choa Chu Kang N.P.C / Insp ONG ZHI HAO Contact No.: 67910000	Classification Of Case:

Authentication Stamp

**LAI HUAT (MENG KEE)
MOTOR PTE LTD
SIN MING INDUSTRIAL
ESTATE SECTOR A
BLK 21 #01-58
SINGAPORE 575679**

Claim Reference:
Assessment Number: LHMJ0556
Version: LAI HUAT/3
Date Calculated: 13/12/2017 17:11

Full Report - V1
Registration: SFZ 6955Y
Printed: 14/12/2017 01:12

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Jenny Lim	Date of Incident:	09/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA

Claim Reference:		Estimated Repair Time:	
Policy Number:	DMPCSN3065261700	Quote Due Date:	
Other Reference:	OD CLAIM	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Not Authorized
11 Day @ 7
Perman After Repair
EX @ 10000
16 days

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Golf
Sub Model:	GTI
Model Sheet Number:	6AF 04
Registration:	SFZ 6955Y
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ1KZAW026078
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 05/2009	CHROME PACKAGE
INS PANEL COOLER BOX	DOOR MIRROR W/MEMORY
RAIN SENSOR	ELECTRIC WINDOWS
SAFE SECURITY	SIDE WINDOW/RR SCRNR
ELEC FOLD DR MIRRORS	AUTO DIPPING MIRROR
8 SPEAKER	RADIO RCD 510
XENON HEADLAMPS	FOG LAMPS
PARKING HELP SYSTEM	HEADLAMP WASHERS
ILLUM SUN VISORS	EQUIPM LEATH VIENNA
SPORT SEATS	HEATED FRONT SEATS
STRG WHEEL LEATHER	MULTI FUNC INDICATOR
DOOR TRIM IMIT LEATH	ELECT LUMBAR ADJUST
OIL LEVEL GAUGE	FRONT CENTRE ARMREST
REAR CENTRE ARMREST	SMOKER EQUIPMENT
ALTERNATOR 140A	2.0 LTR 155KW
6 SPEED DSG	SPORTS SUSPENSION
ADAPTIVE SUSPENSION	UPHILL TRACTION CONT
CRUISE CONTROL	TYRES 225/40 WR 18
WHEELS 7.5J X 18 ALU	SPACE SAVER SP-WHEEL
TYRE PRESSURE CHECK	TWO COAT METALLIC

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	13/12/2017

LAI HUAT (MENG KEE) MOTOR PTE LTD**Claim Reference:****Assessment Number: LHMJ0556****Version: LAI HUAT/3****Date Calculated: 13/12/2017 17:11****Full Report - V1****Registration: SFZ 6955Y****Printed: 14/12/2017 01:12**

Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF:

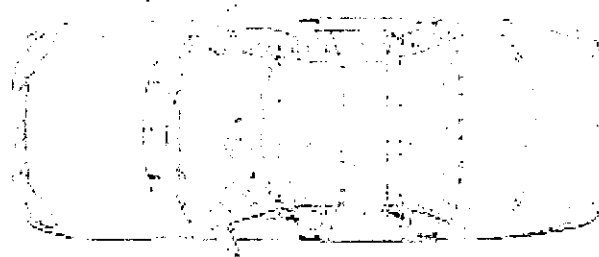
Tread Depth LHR:

Damage Areas:

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

**Addresses****Cost Summary**

Total Labour	\$2,916.40
Total Paint/Material	\$292.76
Total Parts	\$17,180.35
Total of Additional Costs	\$512.00
Repair Cost Exc GST:	\$20,901.51
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,000.00
After Deduction -	
Grand Total Exc GST:	\$19,901.51
7 % GST:	\$1,393.11
Grand Total Inc GST:	\$21,294.62

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /**Guide Number Repair Details**

	WU	Cost Price (\$)
44 95 03 00 ALIGN VEHICLE FRONT AND REAR (BEFORE REPAIRS) INCLUDES: CAMBER AND TOE CHECK , BRKT AND SENSOR REMOVE AND REFIT WITHOUT ADJUSTMENTS	9.0	41.40
97 85 09 50 DETACH + REFIT BATTERY EARTH STRAP	1.0	4.60
50 38 55 50 RENEW FRONT LOCK CARRIER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	7.0	32.20
50 38 19 50 R + R FRONT LOCK CARRIER (BUMPER COVER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMPS	13.0	59.80
66 05 19 00 R + R RADIATOR GRILLE	2.0	9.20
63 29 19 50 R + R FRONT BUMPER COVER (RADIATOR GRILLE REMOVED)	4.0	18.40
63 29 55 69 RENEW FRONT BUMPER COVER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	11.0	50.60
50 55 19 50 R + R L/F WING	9.0	41.40

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

	(BUMPER COVER REMOVED)		
	INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL		
63 29 43 50	DRILL FRONT BUMPER COVER (COMPOSITE WORK) (4 HOLES DRILLED)	3.0	13.80
63 29 41 50	REPAIR FRONT BUMPER COVER (COMPOSITE WORK) (4 BRACKET STUCK)	3.0	13.80
50 55 19 50	R + R R/F WING (BUMPER COVER REMOVED)	9.0	41.40
	INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL		
NO NUMBER	R + R L/F WING STRUT	2.0	9.20
NO NUMBER	R + R R/F WING STRUT	2.0	9.20
94 15 16 10	ADJUST HEADLAMPS	3.0	13.80
94 64 16 00	ALIGN FRONT FOG LAMPS	2.0	9.20
94 15 56 50	RENEW HEADLAMPS (REMOVED)	5.0	23.00
	INCLUDES: CONVERT ATTACHED PARTS		
50 34 19 50	R + R FRONT CROSSMEMBER (COMPOSITE WORK)	3.0	13.80
	(BUMPER COVER REMOVED)		
64 10 55 00	RENEW FRONT SCREEN	22.0	101.20
	INCLUDES: R + R A-PILLAR TRIMS, INTERIOR MIRROR, SUN VISORS AND INTERIOR LAMP		
66 44 19 50	R + R COWL TRIM (WIPER ARMS REMOVED)	2.0	9.20
57 11 19 00	R + R L/F DOOR HANDLE	2.0	9.20
	INCLUDES: R + R LOCK CYLINDER		
58 11 19 00	R + R LEFT REAR DOOR HANDLE	2.0	9.20
66 31 19 00	R + R LEFT SILL TRIM	3.0	13.80
68 05 19 50	R + R L/INN SILL PANEL COVER	1.0	4.60
68 05 19 50	R + R R/INN SILL PANEL COVER	1.0	4.60
69 11 20 50)	R + R BOTH FRONT SEAT BELTS	4.0	18.40
51 90 19 ZAX	R + R L/FLOOR PANEL COVER	2.0	9.20
66 76 19 50	R + R L/R WHEELHOUSE SHELL (WHEEL REMOVED)	2.0	9.20
69 67 55 50	RENEW KNEE BAG (REMOVED)	1.0	4.60
70 28 19 50	R + R LEFT REAR WHEEL HOUSE TRIM	1.0	4.60
70 28 19 50	R + R RIGHT REAR WHEEL HOUSE TRIM	1.0	4.60
70 18 19 00)	R + R INSTRUMENT PANEL (LOWER INSTRUMENT PANEL SHELF, GLOVE BOX AND UPPER A-PILLAR TRIMS REMOVED)	13.0	59.80
	INCLUDES: REMOVE STEERING WHEEL, STEERING COLUMN SWITCH, INSTRUMENT CLUSTER AND KNEE BAG		
NO NUMBER	R + R INSTRUMENT PANEL COVER	1.0	4.60
70 18 55 50	RENEW SWITCH PANEL (REMOVED)	7.0	32.20
	INCLUDES: CONVERT SWITCH PANEL		
68 18 19 50	R + R R/LOWER INSTRUMENT PANEL COVER	2.0	9.20
68 15 19 00)	R + R GLOVE BOX	5.0	23.00
92 60 19 50	R + R WASHER RESERVOIR (BUMPER COVER REMOVED)	2.0	9.20

LAI HUAT (MENG KEE) MOTOR PTE LTD**Claim Reference:****Assessment Number: LHMJ0556****Version: LAI HUAT/3****Date Calculated: 13/12/2017 17:11****Full Report - V1****Registration: SFZ 6955Y****Printed: 14/12/2017 01:12**

92 60 55 50	RENEW WASHER RESERVOIR (REMOVED)	2.0	9.20
69 58 55 50	INCLUDES: CONVERT ATTACHED PARTS RENEW DRIVER AIRBAG UNIT (REMOVED)	1.0	4.60
40 07 19ZAX)	R + R ASSEMBLY CARRIER (NOISE CONTROL PAN, SUPPORT AND WHEELS REMOVED) INCLUDES: DETACH + REFIT STEERING GEAR AND STABILIZER DOES NOT INCLUDE: ALIGN FRONT AND REAR	13.0	59.80
40 85 19 00)	R + R L/F SPRING STRUT (WHEEL REMOVED) DOES NOT INCLUDE: ALIGN FRONT AND REAR	6.0	27.60
40 90 19 50	R + R LEFT FRONT SHOCK ABSORBER (SPRING STRUT REMOVED) INCLUDES: R + R SPRING STRUT MOUNT AND COIL SPRING	2.0	9.20
40 50 19 00)	R + R L/F WHEEL BEARING HOUSING (WHEEL REMOVED) INCLUDES: R + R SPEED SENSOR AND BRAKE DISC, DETACH + REFIT DRIVE SHAFT DOES NOT INCLUDE: ALIGN FRONT AND REAR	9.0	41.40
40 50 55 50	RENEW L/F WHEEL BEARING HOUSING (WHEEL BEARING HOUSING REMOVED) INCLUDES: R + R WHEEL BEARING AND WHEEL HUB	3.0	13.80
94 78 19 00	R + R L/F VEHICLE LEVEL SENSOR DOES NOT INCLUDE: ADJUST HEADLAMPS, READ OUT FAULT MEMORY (SELF-DIAGNOSIS)	3.0	13.80
40 07 19 53)	R + R L/F LOWER AXLE RADIUS ARM CONSOLE	3.0	13.80
44 10 56 50	RENEW BOTH FRONT WHEELS/TYRES (WHEELS REMOVED) INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS	5.0	23.00
44 05 19 00	R + R REAR WHEEL (WHEELS)	2.0	9.20
44 10 56 50	RENEW BOTH REAR WHEELS/TYRES (WHEELS REMOVED) INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS	5.0	23.00
69 59 55 50	RENEW PASSENGER AIRBAG UNIT (REMOVED)	1.0	4.60
44 95 03 00	ALIGN FRONT AND REAR VEHICLE INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR DOES NOT INCLUDE: ADJUSTMENT	9.0	41.40
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK) (FRONT AND REAR ALIGNMENT) INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER	3.0	13.80
44 83 03 ZAX	ALIGN TRANSVERSAL INCLINATION (COMPOSITE WORK) MEASURED VALUE OUT OF TOLERANCE	1.0	4.60

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

44 88 15 50	FRONT WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0	9.20
44 94 15 50	REAR WHEEL CAMBER ALIGNMENT (COMPOSITE WORK)	2.0	9.20
44 93 15 50	REAR WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0	9.20
9852	READ OUT ERROR MEMORY	30.0*	138.00 ✓
9854	READ OUT ERROR MEMORY	15.0*	69.00 ✓
9973	CARRY OUT TEST DRIVE	5 10.0*	46.00
1482	REPAIR RIGHT FRONT DOOR	11 50.0* X	230.00
1781	REPAIR L/R DOOR	10.0*	46.00
2083	REPAIR L/SIDE FRAME	10 20.0*	92.00
2583	REPAIR REAR BUMPER	5 10.0*	46.00
3481	REPAIR L/SIDE PANEL	40 60.0*	276.00
LABOUR COST			
Total Work Units		441.0	
Panel / Mechanical Labour		41.3HRS	\$1,899.80
Visual Alignment Labour		2.8HRS	\$128.80
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		0.0HRS	0.00
Sub Total		44.1HRS	\$2,028.60
Paint Labour		19.3HRS	\$887.80
Total Labour		63.4HRS	\$2,916.40

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	11.0	
293	FRONT BUMPER CAP NEW PART PAINT K1R	3.0	
301	L/F PARKING AID SENSNEW PART PAINT K1R	3.0	
303	L/F CENTRE SENSOR NEW PART PAINT K1R	3.0	
392	FRT CENTRE SPOILER NEW PART PAINT K1R	4.0	
461	L/DUCT COVER NEW PART PAINT K1R	3.0	
462	R/DUCT COVER NEW PART PAINT K1R	3.0	
1781	L/R DOOR REPAIR PAINTING <50%	14.0	
2103	L/OUTER SILL PANEL REPAIR PAINTING <50%	11.0	
2241	LEFT A-PILLAR REPAIR PAINTING <50%	8.0	
2285	L/CENTRE PILLAR REPAIR PAINTING <50%	9.0	
2583	REAR COVER BUMPER REPAIR PAINT PLASTIC	15.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	24.0	
3481	L/SIDE PANEL REPAIR PAINTING >50%	19.0	
302	R/F PARKING AID SENS SURFACE PAINT PLAST.	3.0	
304	R/F CENTRE SENSOR SURFACE PAINT PLAST.	3.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
LABOUR COST - PAINT			
TIME(PAINT)		164.0	
Preparation Main Work Metal		21.0	

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

Preparation Comp. Work Plastic	8.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	193.0	
Total Paintwork Labour	19.3HRS	\$887.80
MATERIAL COST - PAINT		Cost Price
New Part Painting		\$39.22
New Part Painting - Plastic K1R		\$59.03
Surface-/Blend Paint		\$20.17
Surface Paint Plastic		\$0.74
Repair Painting		\$99.46
Repair Painting Plastic		\$43.34
Material-Const Main Work Metal		\$18.10
Material-Const Comp. Work Plastic		\$12.70
Total Excluding Pearlescent Uplift		\$292.76
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$292.76

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
399	1	2-COMP ADHESIVE SENS	D 180 KU2 A1		0% <i>NA</i> 0.00F 7x
1000	1	AC DECAL	Renew		0% <i>NA</i> 6.50* 7x
1405	1	APPLICATOR	D 009 500 25		0% <i>NA</i> 0.00F 7x
398	1	APPLICATOR	D 009 500 25		0% <i>NA</i> 0.00F 7x
1410	1	CLEANING SOLUTION	D 009 401 04		0% <i>NA</i> 0.00F 7x
1409	1	CUTTING FILAMENT	357 853 999 B		0% <i>NA</i> 0.00F 7x
7445	1	DRIVER AIRBAG	5K0 880 201 AE 81U	<i>Burn</i>	0% 1,725.00* ✓
8771	1	ENGINE PROTECTION	1K0 825 235 AE		0% <i>R</i> 81.00* 7x
283	1	FRONT BUMPER	5K0 807 217 CC GRU		0% <i>CN</i> 480.00* ✓
293	1	FRONT BUMPER CAP	5K0 807 241 A ROH		0% <i>Mit</i> 16.00* ✓
339	1	FRT BUMPER C-MEMBER	5K0 807 651 D		0% <i>Ry</i> 117.00* ✓
392	1	FRT CTR BUMP SPOILER	5K0 807 110 GRU		0% <i>Mit</i> 195.00* ✓
930	1	FRT LOCK CARRIER	5K0 805 588 E		0% <i>Ry</i> 520.00* 7x
394	1	FRT LWR BUMP SPOILER	5K0 807 110 A 9B9		0% <i>Mit</i> 195.00* ✓
393	1	FRT SPOILER BRACKET	5K0 805 915 9B9		0% <i>Dit</i> 40.00* ✓
391	1	FRT UPP BUMP SPOILER	5K0 805 903 B 9B9		0% <i>Mit</i> 260.00* ✓
362	1	H/LAMP WASHER VALVE	5K0 955 978 A		0% <i>Mit</i> 27.00* ✓
361	1	H/LAMP WASHER VALVE	5K0 955 978 A		0% <i>Mit</i> 27.00* ✓
1441	1	H-LAMP WASHER PUMP	3B7 955 681		0% <i>Del</i> 77.00* ✓
4331	1	INSTRUMENT PANEL	5K2 857 001 A 81X		0% <i>Tn</i> 2,010.00* ✓
4351	1	KNEE AIRBAG	5K1 880 841 F		0% <i>Burn</i> 785.00* ✓
7009	1	L/ASSY CARRIER CONS	1K0 199 295 E		0% <i>Ry</i> 296.00* 7x
7101	1	L/BUFFER	1K0 412 303 E		0% <i>Del</i> 17.00* 7x
461	1	L/DUCT COVER	5K0 955 109 A GRU		0% <i>Dit</i> 19.00* 7x
297	1	L/F AIR GUIDE GRILLE	5K0 853 665 C 9B9		0% <i>CN</i> 53.00* 7x
303	1	L/F CENTRE SENSOR	1S0 919 275 C GRU		0% <i>Tn</i> 90.00* ✓
321	1	L/F CTR SENSOR BRKT	5K0 919 493 G		0% <i>Mit</i> 13.00* 7x
637	1	L/F FOG LAMP	5K0 941 699 E		0% <i>Mit</i> 115.00* ✓
7061	1	L/F GUIDE JOINT	1K0 407 365 C		0% <i>Dit</i> 60.00* 7x

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

7097	1	L/F LEVEL SENSOR	3C0 412 521 B	0%	Nil	167.00*	—
319	1	L/F OUT BUMPER BRKT	5K0 807 723 A	0%	Bj	18.00*	—
307	1	L/F OUT SENSOR BRKT	5K0 919 491 B	0%	Nil	13.00*	—
301	1	L/F PARKING AID SENS	1S0 919 275 C	0%	Nil	90.00*	—
			GRU				
7095	1	L/F S-ABSORB BRACKET	1K0 412 249 B	0%	Nil	59.00*	7v
4661	1	L/F SEAT BELT	1K4 857 705 BK	0%	Tn	400.00*	—
			RAA				
7087	1	L/F SHOCK ABSORBER	1T0 413 031 HC	0%	Bj	566.00*	—
7091	1	L/F SPRING LEG BRG	1K0 412 331 B	0%	Nil	22.00*	—
7047	1	L/F TRACK CONT ARM	1K0 407 151 AC	0%	Nil	158.00*	—
7227	1	L/F TYRE	225/40 R 18 .. W	0%	Sm	0.00F	X
7201	1	L/F WHEEL	1K0 601 025 BA	0%	Nil	61.50	0.00F X
			FZZ				
7131	1	L/F WHEEL HUB/BRG	5K0 498 621	0%	Bj	198.00*	—
843	1	L/F W-HOUSE FRT CVR	5K0 805 911 G	0%	Bj	50.00*	7v
841	1	L/F W-HOUSE RR COVER	5K0 805 977	0%	Bj	67.00*	7v
741	1	L/F WING	5K6 821 021 B	0%	Bj	232.00*	—
4259	1	L/FLOOR PANEL COVER	1K0 825 201 AE	0%	Nil	103.00*	—
315	1	L/HEADLAMP MOUNTING	5K0 807 261	0%	CM	62.00*	—
2207	1	L/LOWER SILL TRIM	5K0 853 855 F 9B9	0%	CM	256.00*	—
9565	1	L/R TYRE	225/40 R 18 .. W	0%	Sm	0.00F	X
9551	1	L/R WHEEL	1K0 601 025 BA	0%	Nil	61.50	0.00F X
			FZZ				
7753	1	L/RADIATOR AIR GUIDE	5K0 121 283 E	0%	Sm	14.00*	7v
7081	1	L/WHEEL BEARING HSG	1K0 407 255 AA	0%	Bj	285.00*	—
761	1	L/WING STRUT	5K6 821 135	0%	Nil	16.00*	7v
561	1	LEFT HEADLAMP ASSY	5K2 941 753 B	0%	NGC PA	687.00*	—
4325	1	PASSENGER AIRBAG	5K0 880 204 A	0%	Burn	1,765.00*	—
462	1	R/DUCT COVER	5K0 955 110 A	0%	Nil	19.00*	—
			GRU				
298	1	R/F AIR GUIDE GRILLE	5K0 853 666 C 9B9	0%	CM	53.00*	—
322	1	R/F CTR SENSOR BRKT	5K0 919 493 G	0%	Nil	13.00*	7v
638	1	R/F FOG LAMP	5K0 941 700 E	0%	Nil	115.00*	—
320	1	R/F OUT BUMPER BRKT	5K0 807 724 A	0%	Nil	18.00*	—
308	1	R/F OUT SENSOR BRKT	5K0 919 491 B	0%	Nil	13.00*	—
4662	1	R/F SEAT BELT	1K4 857 706 BN	0%	Tn	370.00*	—
			RAA				
7202	1	R/F WHEEL	1K0 601 025 BA	0%	Nil	61.50	0.00F X
			FZZ				
844	1	R/F W-HOUSE FRT CVR	5K0 805 912 E	0%	Nil	50.00*	7v
842	1	R/F W-HOUSE RR COVER	5K0 805 978	0%	CM	67.00*	—
742	1	R/F WING	5K6 821 022 B	0%	Bj	232.00*	—
316	1	R/HEADLAMP MOUNTING	5K0 807 262	0%	CM	62.00*	7v
358	1	R/HEADLAMP WASH JET	5K0 955 104 A	0%	Sm	47.00*	7X
9552	1	R/R WHEEL	1K0 601 025 BA	0%	Nil	61.50	0.00F X
			FZZ				
7754	1	R/RADIATOR AIR GUIDE	5K0 121 284 E	0%	CM	14.00*	—
4952	1	R/UPP B-PILLAR TRIM	1K4 867 244 R 6K8	0%	Nil	160.00*	7v
762	1	R/WING STRUT	5K6 821 136	0%	Sm	16.00*	7X
562	1	RIGHT HEADLAMP ASSY	5K2 941 754 B	0%	NGC PA	687.00*	—
7435	1	SLIP RING	1K0 959 653 C	0%	Nil	170.00*	—
1000	1	SPORT RIM AFTERMKT	Renew	0%	Nil	1,000.00*	—
1000	1	WARNING DECAL	Renew	0%	Nil	6.50*	—

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/3

Date Calculated: 13/12/2017 17:11

Full Report - V1

Registration: SFZ 6955Y

Printed: 14/12/2017 01:12

1436	1	WASHER BOTTLE	5K0 955 453 B	0%	De	75.00*	2
1000	1	WASHER JET HOSE	Renew	0%	Sn	38.00*	7X
1000	1	WASHER JET JOINT 2	Renew	0%	Gr	12.00*	7V
1000	1	WASHER LEVEL SENSOR	Renew	0%	Sn	18.00*	7X
1437	1	WASHER PUMP	1K6 955 651	0%	CPA	61.00*	7V
1000	1	WASHET JET JOINT 1	Renew	0%	nn	8.00*	7V
1401	1	WINDSCREEN	5K0 845 011 AB	0%	CPA	490.00*	7V
			NVB				
1411	1	WINDSCREEN BOND KIT	D 004 660 M2	0%	nn	0.00F	X
1414	1	WINDSCREEN PRIMER	D 009 200 02	0%	nn	0.00F	X
f: OEM Parts			Saving			\$2,510.71	
g: Original			Sub Total			\$16,267.00	
h: Secondhand			Mark Up From Cost (5 %)			\$813.35	
p: Parallel			Sundry Parts (Fixed)			\$100.00	
x: Exchange			Total Parts			\$17,180.35	

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
TOP UP AIRCON GAS SPECIALIST	0%	\$50.00
IU BRACKET SPECIALIST		\$10.00
AUDATEX FEE SPECIALIST	0%	\$42.00
W/S SEALANT SPECIALIST		\$40.00
L/F TYRE SPECIALIST	0%	\$185.00
L/R TYRE SPECIALIST		\$185.00
Total Extras		\$512.00

Final Calculation

Total Parts	\$17,180.35
Labour	
Total Panel/Mechanical	\$1,899.80
Total Paintwork	\$887.80
Total Visual Alignment work	\$128.80
Total Labour	\$2,916.40
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$512.00
Total of Additional Costs	\$512.00
Total Paint/Material Costs	\$292.76
Repair Costs Excludes GST	\$20,901.51
Deductions	
Deduction for Excess (Fixed)	-\$1,000.00
Total Deductions	-\$1,000.00
Grand Total Excludes GST (After Deduction)	\$19,901.51
GST @ 7 %	\$1,393.11
Grand Total Includes GST (After Deduction)	\$21,294.62

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification is allowed
- Supplementary item price is to be surveyed and is subject to final approval from LKK Insurance Company

Acknowledged by Repairer

Signature:

Date:

-\$1,000.00

Assessment Notes

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Full Report - V1

Assessment Number: LHMJ0556

Registration: SFZ 6955Y

Version: LAI HUAT/3

Printed: 14/12/2017 01:12

Date Calculated: 13/12/2017 17:11

**CHINA TAIPING
INSURANCE (S) PTE LTD
3 ANSON ROAD
#15-02 SPRINGLEAF
TOWER**

079909

Revert (1)

**Claim Reference: SNM17D07042C01
Assessment Number: LHMJ0556
Version: LAI HUAT/4
Date Calculated: 15/12/2017 03:46**

**Full Report - V1
Registration: SFZ 6955Y
Printed: 15/12/2017 11:47**

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Mr K.K Lau	Date of Incident:	09/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM17D07042C01	Estimated Repair Time:	
Policy Number:	DMPCSN3065261700	Quote Due Date:	
Other Reference:	OD CLAIM	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Golf
Sub Model:	GTI
Model Sheet Number:	6AF 04
Registration:	SFZ 6955Y
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ1KZAW026078
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 05/2009	CHROME PACKAGE
INS PANEL COOLER BOX	DOOR MIRROR W/MEMORY
RAIN SENSOR	ELECTRIC WINDOWS
SAFE SECURITY	SIDE WINDOW/RR SCRIN
ELEC FOLD DR MIRRORS	AUTO DIPPING MIRROR
8 SPEAKER	RADIO RCD 510
XENON HEADLAMPS	FOG LAMPS
PARKING HELP SYSTEM	HEADLAMP WASHERS
ILLUM SUN VISORS	EQUIPM LEATH VIENNA
SPORT SEATS	HEATED FRONT SEATS
STRG WHEEL LEATHER	MULTI FUNC INDICATOR
DOOR TRIM IMIT LEATH	ELECT LUMBAR ADJUST
OIL LEVEL GAUGE	FRONT CENTRE ARMREST
REAR CENTRE ARMREST	SMOKER EQUIPMENT
ALTERNATOR 140A	2.0 LTR 155KW
6 SPEED DSG	SPORTS SUSPENSION
ADAPTIVE SUSPENSION	UPHILL TRACTION CONT
CRUISE CONTROL	TYRES 225/40 WR 18
WHEELS 7.5J X 18 ALU	SPACE SAVER SP-WHEEL
TYRE PRESSURE CHECK	TWO COAT METALLIC

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	13/12/2017

CHINA TAIPING INSURANCE (S) PTE LTD**Claim Reference: SNM17D07042C01****Assessment Number: LHMJ0556****Version: LAI HUAT/4****Date Calculated: 15/12/2017 03:46****Full Report - V1****Registration: SFZ 6955Y****Printed: 15/12/2017 11:47**

Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF:

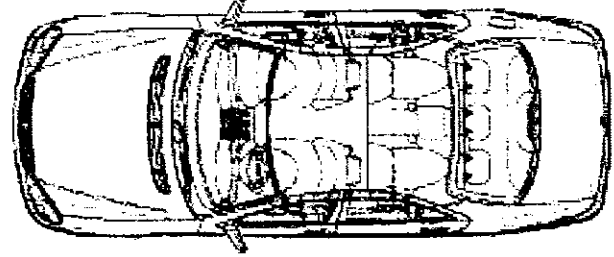
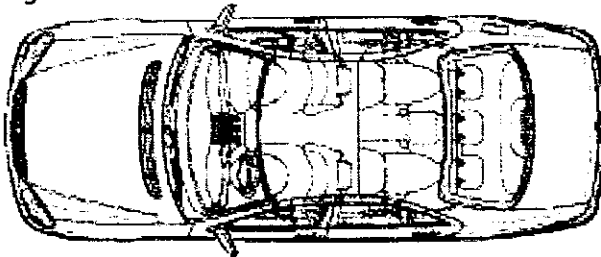
Tread Depth LHR:

Damage Areas:

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

**Addresses****Cost Summary**

Total Labour	\$2,645.00
Total Paint/Material	\$292.76
Total Parts	\$17,180.35
Total of Additional Costs	\$364.00
Repair Cost Exc GST:	\$20,482.11
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,000.00
After Deduction -	
Grand Total Exc GST:	\$19,482.11
7 % GST:	\$1,363.75
Grand Total Inc GST:	\$20,845.86

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /**Guide Number Repair Details**

		WU	Cost Price (\$)
44 95 03 00	ALIGN VEHICLE FRONT AND REAR (BEFORE REPAIRS) INCLUDES: CAMBER AND TOE CHECK , BRKT AND SENSOR REMOVE AND REFIT WITHOUT ADJUSTMENTS	9.0	41.40
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	1.0	4.60
50 38 55 50	RENEW FRONT LOCK CARRIER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	7.0	32.20
50 38 19 50	R + R FRONT LOCK CARRIER (BUMPER COVER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMPS	13.0	59.80
66 05 19 00	R + R RADIATOR GRILLE	2.0	9.20
63 29 19 50	R + R FRONT BUMPER COVER (RADIATOR GRILLE REMOVED)	4.0	18.40
63 29 55 69	RENEW FRONT BUMPER COVER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	11.0	50.60
50 55 19 50	R + R L/F WING	9.0	41.40

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: LAI HUAT/4

Date Calculated: 15/12/2017 03:46

Full Report - V1

Registration: SFZ 6955Y

Printed: 15/12/2017 11:47

	(BUMPER COVER REMOVED)		
	INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL		
63 29 43 50	DRILL FRONT BUMPER COVER (COMPOSITE WORK) (4 HOLES DRILLED)	3.0	13.80
63 29 41 50	REPAIR FRONT BUMPER COVER (COMPOSITE WORK) (4 BRACKET STUCK)	3.0	13.80
50 55 19 50	R + R R/F WING (BUMPER COVER REMOVED)	9.0	41.40
	INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL		
NO NUMBER	R + R L/F WING STRUT	2.0	9.20
NO NUMBER	R + R R/F WING STRUT	2.0	9.20
94 15 16 10	ADJUST HEADLAMPS	3.0	13.80
94 64 16 00	ALIGN FRONT FOG LAMPS	2.0	9.20
94 15 56 50	RENEW HEADLAMPS (REMOVED)	5.0	23.00
	INCLUDES: CONVERT ATTACHED PARTS		
50 34 19 50	R + R FRONT CROSSMEMBER (COMPOSITE WORK)	3.0	13.80
	(BUMPER COVER REMOVED)		
64 10 55 00	RENEW FRONT SCREEN	22.0	101.20
	INCLUDES: R + R A-PILLAR TRIMS, INTERIOR MIRROR, SUN VISORS AND INTERIOR LAMP		
66 44 19 50	R + R COWL TRIM (WIPER ARMS REMOVED)	2.0	9.20
57 11 19 00	R + R L/F DOOR HANDLE	2.0	9.20
	INCLUDES: R + R LOCK CYLINDER		
58 11 19 00	R + R LEFT REAR DOOR HANDLE	2.0	9.20
66 31 19 00	R + R LEFT SILL TRIM	3.0	13.80
68 05 19 50	R + R L/INN SILL PANEL COVER	1.0	4.60
68 05 19 50	R + R R/INN SILL PANEL COVER	1.0	4.60
69 11 20 50)	R + R BOTH FRONT SEAT BELTS	4.0	18.40
51 90 19 ZAX	R + R L/FLOOR PANEL COVER	2.0	9.20
66 76 19 50	R + R L/R WHEELHOUSE SHELL (WHEEL REMOVED)	2.0	9.20
69 67 55 50	RENEW KNEE BAG (REMOVED)	1.0	4.60
70 28 19 50	R + R LEFT REAR WHEEL HOUSE TRIM	1.0	4.60
70 28 19 50	R + R RIGHT REAR WHEEL HOUSE TRIM	1.0	4.60
70 18 19 00)	R + R INSTRUMENT PANEL (LOWER INSTRUMENT PANEL SHELF, GLOVE BOX AND UPPER A-PILLAR TRIMS REMOVED)	13.0	59.80
	INCLUDES: REMOVE STEERING WHEEL, STEERING COLUMN SWITCH, INSTRUMENT CLUSTER AND KNEE BAG		
NO NUMBER	R + R INSTRUMENT PANEL COVER	1.0	4.60
70 18 55 50	RENEW SWITCH PANEL (REMOVED)	7.0	32.20
	INCLUDES: CONVERT SWITCH PANEL		
68 18 19 50	R + R R/LOWER INSTRUMENT PANEL COVER	2.0	9.20
68 15 19 00)	R + R GLOVE BOX	5.0	23.00
92 60 19 50	R + R WASHER RESERVOIR (BUMPER COVER REMOVED)	2.0	9.20

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: LAI HUAT/4

Date Calculated: 15/12/2017 03:46

Full Report - V1

Registration: SFZ 6955Y

Printed: 15/12/2017 11:47

92 60 55 50	RENEW WASHER RESERVOIR (REMOVED)	2.0	9.20
69 58 55 50	INCLUDES: CONVERT ATTACHED PARTS RENEW DRIVER AIRBAG UNIT (REMOVED)	1.0	4.60
40 07 19ZAX)	R + R ASSEMBLY CARRIER (NOISE CONTROL PAN, SUPPORT AND WHEELS REMOVED)	13.0	59.80
40 85 19 00)	INCLUDES: DETACH + REFIT STEERING GEAR AND STABILIZER DOES NOT INCLUDE: ALIGN FRONT AND REAR R + R L/F SPRING STRUT (WHEEL REMOVED)	6.0	27.60
40 90 19 50	DOES NOT INCLUDE: ALIGN FRONT AND REAR R + R LEFT FRONT SHOCK ABSORBER (SPRING STRUT REMOVED)	2.0	9.20
40 50 19 00)	INCLUDES: R + R SPRING STRUT MOUNT AND COIL SPRING R + R L/F WHEEL BEARING HOUSING (WHEEL REMOVED)	9.0	41.40
40 50 55 50	INCLUDES: R + R SPEED SENSOR AND BRAKE DISC, DETACH + REFIT DRIVE SHAFT DOES NOT INCLUDE: ALIGN FRONT AND REAR RENEW L/F WHEEL BEARING HOUSING (WHEEL BEARING HOUSING REMOVED)	3.0	13.80
94 78 19 00	INCLUDES: R + R WHEEL BEARING AND WHEEL HUB R + R L/F VEHICLE LEVEL SENSOR DOES NOT INCLUDE: ADJUST HEADLAMPS, READ OUT FAULT MEMORY (SELF-DIAGNOSIS)	3.0	13.80
40 07 19 53)	R + R L/F LOWER AXLE RADIUS ARM CONSOLE	3.0	13.80
44 10 56 50	RENEW BOTH FRONT WHEELS/TYRES (WHEELS REMOVED)	5.0	23.00
44 05 19 00	INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS R + R REAR WHEEL (WHEELS)	2.0	9.20
44 10 56 50	RENEW BOTH REAR WHEELS/TYRES (WHEELS REMOVED)	5.0	23.00
69 59 55 50	INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS RENEW PASSENGER AIRBAG UNIT (REMOVED)	1.0	4.60
44 95 03 00	ALIGN FRONT AND REAR VEHICLE INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR DOES NOT INCLUDE: ADJUSTMENT	9.0	41.40
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK) (FRONT AND REAR ALIGNMENT)	3.0	13.80
44 83 03 ZAX	INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER ALIGN TRANSVERSAL INCLINATION (COMPOSITE WORK)	1.0	4.60
	MEASURED VALUE OUT OF TOLERANCE		

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: LAI HUAT/4

Date Calculated: 15/12/2017 03:46

Full Report - V1

Registration: SFZ 6955Y

Printed: 15/12/2017 11:47

44 88 15 50	FRONT WHEEL TOE ALIGNMENT (COMPOSITE WORK) (VEHICLE FRONT AND REAR ALIGNMENT)	2.0	9.20
44 94 15 50	REAR WHEEL CAMBER ALIGNMENT (COMPOSITE WORK) (FRONT AND REAR VEHICLE ALIGNMENT)	2.0	9.20
44 93 15 50	REAR WHEEL TOE ALIGNMENT (COMPOSITE WORK) (VEHICLE FRONT AND REAR ALIGNMENT)	2.0	9.20
9852	READ OUT ERROR MEMORY	30.0*	138.00
9854	READ OUT ERROR MEMORY	15.0*	69.00
9973	CARRY OUT TEST DRIVE	5.0*	23.00
1781	REPAIR L/R DOOR	10.0*	46.00
2083	REPAIR L/SIDE FRAME	10.0*	46.00
2583	REPAIR REAR BUMPER	5.0*	23.00
3481	REPAIR L/SIDE PANEL	40.0*	184.00

LABOUR COST

Total Work Units	351.0	
Panel / Mechanical Labour	32.3HRS	\$1,485.80
Visual Alignment Labour	2.8HRS	\$128.80
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	35.1HRS	\$1,614.60
Paint Labour	22.4HRS	\$1,030.40
Total Labour	57.5HRS	\$2,645.00

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	11.0	
293	FRONT BUMPER CAP NEW PART PAINT K1R	3.0	
301	L/F PARKING AID SENSNEW PART PAINT K1R	3.0	
303	L/F CENTRE SENSOR NEW PART PAINT K1R	3.0	
392	FRT CENTRE SPOILER NEW PART PAINT K1R	4.0	
461	L/DUCT COVER NEW PART PAINT K1R	3.0	
462	R/DUCT COVER NEW PART PAINT K1R	3.0	
1781	L/R DOOR REPAIR PAINTING <50%	14.0	
2083	L/SIDE FRAME REPAIR PAINTING <50%	10.0*	
2103	L/OUTER SILL PANEL REPAIR PAINTING <50%	11.0	
2241	LEFT A-PILLAR REPAIR PAINTING <50%	8.0	
2285	L/CENTRE PILLAR REPAIR PAINTING <50%	9.0	
2583	REAR COVER BUMPER REPAIR PAINT PLASTIC	15.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	24.0	
3481	L/SIDE PANEL REPAIR PAINTING >50%	40.0*	
302	R/F PARKING AID SENS SURFACE PAINT PLAST.	3.0	
304	R/F CENTRE SENSOR SURFACE PAINT PLAST.	3.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	

LABOUR COST - PAINT

TIME(PAINT)	195.0
-------------	-------

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: LAI HUAT/4

Date Calculated: 15/12/2017 03:46

Full Report - V1

Registration: SFZ 6955Y

Printed: 15/12/2017 11:47

Preparation Main Work Metal	21.0	
Preparation Comp. Work Plastic	8.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	224.0	
Total Paintwork Labour	22.4HRS	\$1,030.40
MATERIAL COST - PAINT		Cost Price
New Part Painting		\$39.22
New Part Painting - Plastic K1R		\$59.03
Surface-/Blend Paint		\$20.17
Surface Paint Plastic		\$0.74
Repair Painting		\$99.46
Repair Painting Plastic		\$43.34
Material-Const Main Work Metal		\$18.10
Material-Const Comp. Work Plastic		\$12.70
Total Excluding Pearlescent Uplift		\$292.76
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$292.76

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
399	1	2-COMP ADHESIVE SENS	D 180 KU2 A1		0% 0.00F
1000	1	AC DECAL	Renew		0% 6.50*
1405	1	APPLICATOR	D 009 500 25		0% 0.00F
398	1	APPLICATOR	D 009 500 25		0% 0.00F
1410	1	CLEANING SOLUTION	D 009 401 04		0% 0.00F
1409	1	CUTTING FILAMENT	357 853 999 B		0% 0.00F
7445	1	DRIVER AIRBAG	5K0 880 201 AE		0% 1,725.00*
			81U		
8771	1	ENGINE PROTECTION	1K0 825 235 AE		0% 81.00*
283	1	FRONT BUMPER	5K0 807 217 CC		0% 480.00*
			GRU		
293	1	FRONT BUMPER CAP	5K0 807 241 A		0% 16.00*
			ROH		
339	1	FRT BUMPER C-MEMBER	5K0 807 651 D		0% 117.00*
392	1	FRT CTR BUMP SPOILER	5K0 807 110 GRU		0% 195.00*
930	1	FRT. LOCK CARRIER	5K0 805 588 E		0% 520.00*
394	1	FRT LWR BUMP SPOILER	5K0 807 110 A 9B9		0% 195.00*
393	1	FRT SPOILER BRACKET	5K0 805 915 9B9		0% 40.00*
391	1	FRT UPP BUMP SPOILER	5K0 805 903 B 9B9		0% 260.00*
362	1	H/LAMP WASHER VALVE	5K0 955 978 A		0% 27.00*
361	1	H/LAMP WASHER VALVE	5K0 955 978 A		0% 27.00*
1441	1	H-LAMP WASHER PUMP	3B7 955 681		0% 77.00*
4331	1	INSTRUMENT PANEL	5K2 857 001 A 81X		0% 2,010.00*
4351	1	KNEE AIRBAG	5K1 880 841 F		0% 785.00*
7009	1	L/ASSY CARRIER CONS	1K0 199 295 E		0% 296.00*
7101	1	L/BUFFER	1K0 412 303 E		0% 17.00*
461	1	L/DUCT COVER	5K0 955 109 A		0% 19.00*
			GRU		
297	1	L/F AIR GUIDE GRILLE	5K0 853 665 C 9B9		0% 53.00*
303	1	L/F CENTRE SENSOR	1S0 919 275 C		0% 90.00*
			GRU		
321	1	L/F CTR SENSOR BRKT	5K0 919 493 G		0% 13.00*
637	1	L/F FOG LAMP	5K0 941 699 E		0% 115.00*

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: LAI HUAT/4

Date Calculated: 15/12/2017 03:46

Full Report - V1

Registration: SFZ 6955Y

Printed: 15/12/2017 11:47

7061	1	L/F GUIDE JOINT	1K0 407 365 C	0%	60.00*
7097	1	L/F LEVEL SENSOR	3C0 412 521 B	0%	167.00*
319	1	L/F OUT BUMPER BRKT	5K0 807 723 A	0%	18.00*
307	1	L/F OUT SENSOR BRKT	5K0 919 491 B	0%	13.00*
301	1	L/F PARKING AID SENS	1S0 919 275 C	0%	90.00*
			GRU		
7095	1	L/F S-ABSORB BRACKET	1K0 412 249 B	0%	59.00*
4661	1	L/F SEAT BELT	1K4 857 705 BK	0%	400.00*
			RAA		
7087	1	L/F SHOCK ABSORBER	1T0 413 031 HC	0%	566.00*
7091	1	L/F SPRING LEG BRG	1K0 412 331 B	0%	22.00*
7047	1	L/F TRACK CONT ARM	1K0 407 151 AC	0%	158.00*
7227	1	L/F TYRE	225/40 R 18 .. W	0%	0.00F
7201	1	L/F WHEEL	1K0 601 025 BA	0%	0.00F
			FZZ		
7131	1	L/F WHEEL HUB/BRG	5K0 498 621	0%	198.00*
843	1	L/F W-HOUSE FRT CVR	5K0 805 911 G	0%	50.00*
841	1	L/F W-HOUSE RR COVER	5K0 805 977	0%	67.00*
741	1	L/F WING	5K6 821 021 B	0%	232.00*
4259	1	L/FLOOR PANEL COVER	1K0 825 201 AE	0%	103.00*
315	1	L/HEADLAMP MOUNTING	5K0 807 261	0%	62.00*
2207	1	L/LOWER SILL TRIM	5K0 853 855 F 9B9	0%	256.00*
9565	1	L/R TYRE	225/40 R 18 .. W	0%	0.00F
9551	1	L/R WHEEL	1K0 601 025 BA	0%	0.00F
			FZZ		
7753	1	L/RADIATOR AIR GUIDE	5K0 121 283 E	0%	14.00*
7081	1	L/WHEEL BEARING HSG	1K0 407 255 AA	0%	285.00*
761	1	L/WING STRUT	5K6 821 135	0%	16.00*
561	1	LEFT HEADLAMP ASSY	5K2 941 753 B	0%	687.00*
4325	1	PASSENGER AIRBAG	5K0 880 204 A	0%	1,765.00*
462	1	R/DUCT COVER	5K0 955 110 A	0%	19.00*
			GRU		
298	1	R/F AIR GUIDE GRILLE	5K0 853 666 C 9B9	0%	53.00*
322	1	R/F CTR SENSOR BRKT	5K0 919 493 G	0%	13.00*
638	1	R/F FOG LAMP	5K0 941 700 E	0%	115.00*
320	1	R/F OUT BUMPER BRKT	5K0 807 724 A	0%	18.00*
308	1	R/F OUT SENSOR BRKT	5K0 919 491 B	0%	13.00*
4662	1	R/F SEAT BELT	1K4 857 706 BN	0%	370.00*
			RAA		
7202	1	R/F WHEEL	1K0 601 025 BA	0%	0.00F
			FZZ		
844	1	R/F W-HOUSE FRT CVR	5K0 805 912 E	0%	50.00*
842	1	R/F W-HOUSE RR COVER	5K0 805 978	0%	67.00*
742	1	R/F WING	5K6 821 022 B	0%	232.00*
316	1	R/HEADLAMP MOUNTING	5K0 807 262	0%	62.00*
358	1	R/HEADLAMP WASH JET	5K0 955 104 A	0%	47.00*
9552	1	R/R WHEEL	1K0 601 025 BA	0%	0.00F
			FZZ		
7754	1	R/RADIATOR AIR GUIDE	5K0 121 284 E	0%	14.00*
4952	1	R/UPP B-PILLAR TRIM	1K4 867 244 R 6K8	0%	160.00*
762	1	R/WING STRUT	5K6 821 136	0%	16.00*
562	1	RIGHT HEADLAMP ASSY	5K2 941 754 B	0%	687.00*
7435	1	SLIP RING	1K0 959 653 C	0%	170.00*
1000	1	SPORT RIM AFTERMKT	Renew	0%	1,000.00*

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: LAI HUAT/4

Date Calculated: 15/12/2017 03:46

Full Report - V1

Registration: SFZ 6955Y

Printed: 15/12/2017 11:47

1000	1	WARNING DECAL	Renew	0%	6.50*
1436	1	WASHER BOTTLE	5K0 955 453 B	0%	75.00*
1000	1	WASHER JET HOSE	Renew	0%	38.00*
1000	1	WASHER JET JOINT 2	Renew	0%	12.00*
1000	1	WASHER LEVEL SENSOR	Renew	0%	18.00*
1437	1	WASHER PUMP	1K6 955 651	0%	61.00*
1000	1	WASHET JET JOINT 1	Renew	0%	8.00*
1401	1	WINDSCREEN	5K0 845 011 AB	0%	490.00*
			NVB		
1411	1	WINDSCREEN BOND KIT	D 004 660 M2	0%	0.00F
1414	1	WINDSCREEN PRIMER	D 009 200 02	0%	0.00F
f: OEM Parts			Saving		\$2,510.71
g: Original			Sub Total		\$16,267.00
h: Secondhand			Mark Up From Cost	(5 %)	\$813.35
p: Parallel			Sundry Parts	(Fixed)	\$100.00
x: Exchange			Total Parts		\$17,180.35

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
TOP UP AIRCON GAS SPECIALIST	0%	\$50.00
IU BRACKET SPECIALIST		\$10.00
AUDATEX FEE SPECIALIST	0%	\$42.00
W/S SEALANT SPECIALIST		\$40.00
L/F TYRE SPECIALIST	0%	\$111.00
L/R TYRE SPECIALIST		\$111.00
Total Extras		\$364.00

Final Calculation

Total Parts	\$17,180.35
Labour	
Total Panel/Mechanical	\$1,485.80
Total Paintwork	\$1,030.40
Total Visual Alignment work	\$128.80
Total Labour	\$2,645.00
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$364.00
Total of Additional Costs	\$364.00
Total Paint/Material Costs	\$292.76
Repair Costs Excludes GST	\$20,482.11
Deductions	
Deduction for Excess (Fixed)	-\$1,000.00
Total Deductions	-\$1,000.00
Grand Total Excludes GST (After Deduction)	\$19,482.11
GST @ 7 %	\$1,363.75
Grand Total Includes GST (After Deduction)	\$20,845.86

Assessment Notes

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Full Report - V1

Assessment Number: LHMJ0556

Registration: SFZ 6955Y

Version: LAI HUAT/4

Printed: 15/12/2017 11:47

Date Calculated: 15/12/2017 03:46

**CHINA TAIPING
INSURANCE (S) PTE LTD
3 ANSON ROAD
#15-02 SPRINGLEAF
TOWER**

079909

incl Revert

**Claim Reference: SNM17D07042C01
Assessment Number: LHMJ0556
Version: CHINATAI/4
Date Calculated: 18/12/2017 06:39**

**Full Report - V1
Registration: SFZ 6955Y
Printed: 18/12/2017 14:39**

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Mr K.K Lau	Date of Incident:	09/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM17D07042C01	Estimated Repair Time:	
Policy Number:	DMPCSN3065261700	Quote Due Date:	
Other Reference:	OD CLAIM	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Golf
Sub Model:	GTI
Model Sheet Number:	6AF 04
Registration:	SFZ 6955Y
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ1KZAW026078
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

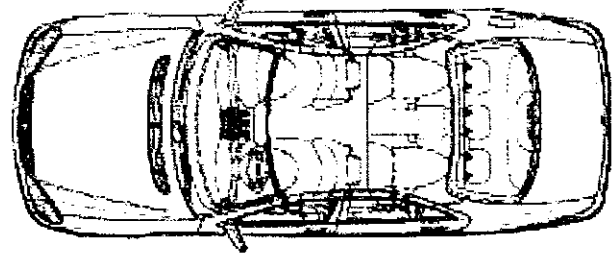
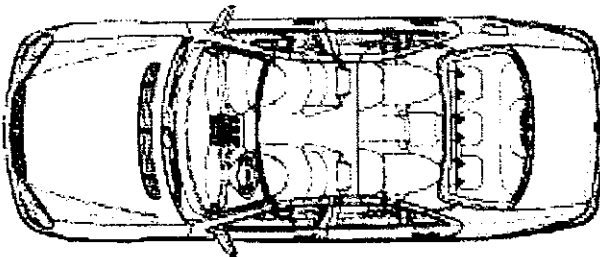
Model Specs

FROM 08/2009	FOG LAMPS
PARKING HELP SYSTEM	HEADLAMP WASHERS
1.4 LTR 59 KW	ADAPTIVE SUSPENSION
TYRE PRESSURE CHECK	STABILITY PROGRAM
ELECTRIC SUNROOF	5-DOOR
WHEELS 6.5J X 16 ALU	TWO COAT METALLIC
PREPARE OFF VEHICLE	FRONT BRAKE 312 X 25

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	13/12/2017
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

CHINA TAIPING INSURANCE (S) PTE LTD**Claim Reference: SNM17D07042C01****Assessment Number: LHMJ0556****Version: CHINATAI/4****Date Calculated: 18/12/2017 06:39****Full Report - V1****Registration: SFZ 6955Y****Printed: 18/12/2017 14:39****Addresses****Cost Summary**

Total Labour	\$2,373.60
Total Paint/Material	\$270.52
Total Parts	\$17,206.34
Total of Additional Costs	\$364.00
Repair Cost Exc GST:	\$20,214.46
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,000.00
After Deduction -	
Grand Total Exc GST:	\$19,214.46
7 % GST:	\$1,345.01
Grand Total Inc GST:	\$20,559.47

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /**Guide Number Repair Details**

		WU	Cost Price (\$)
44 95 03 00	ALIGN VEHICLE FRONT AND REAR (BEFORE REPAIRS) INCLUDES: CAMBER AND TOE CHECK , BRKT AND SENSOR REMOVE AND REFIT WITHOUT ADJUSTMENTS	9.0	41.40
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	1.0	4.60
50 38 55 50	RENEW FRONT LOCK CARRIER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	7.0	32.20
50 38 19 50	R + R FRONT LOCK CARRIER (BUMPER COVER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMPS	13.0	59.80
66 05 19 00	R + R RADIATOR GRILLE	2.0	9.20
63 29 19 50	R + R FRONT BUMPER COVER (RADIATOR GRILLE REMOVED)	4.0	18.40
63 29 55 69	RENEW FRONT BUMPER COVER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	11.0	50.60
50 55 19 50	R + R L/F WING (BUMPER COVER REMOVED) INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL	9.0	41.40
63 29 43 50	DRILL FRONT BUMPER COVER (COMPOSITE WORK) (4 HOLES DRILLED)	3.0	13.80

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: CHINATAI/4

Date Calculated: 18/12/2017 06:39

Full Report - V1

Registration: SFZ 6955Y

Printed: 18/12/2017 14:39

63 29 41 50	REPAIR FRONT BUMPER COVER (COMPOSITE WORK) (4 BRACKET STUCK)	3.0	13.80
50 55 19 50	R + R R/F WING (BUMPER COVER REMOVED) INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL	9.0	41.40
NO NUMBER	R + R L/F WING STRUT	2.0	9.20
NO NUMBER	R + R R/F WING STRUT	2.0	9.20
94 15 16 00	ADJUST HEADLAMPS	3.0	13.80
94 64 16 00	ALIGN FRONT FOG LAMPS	2.0	9.20
50 34 19 50	R + R FRONT CROSSMEMBER (COMPOSITE WORK) (BUMPER COVER REMOVED)	3.0	13.80
64 10 55 00	RENEW FRONT SCREEN INCLUDES: R + R A-PILLAR TRIMS, INTERIOR MIRROR, SUN VISORS AND INTERIOR LAMP	22.0	101.20
66 44 19 50	R + R COWL TRIM (WIPER ARMS REMOVED)	2.0	9.20
57 11 19 00	R + R L/F DOOR HANDLE INCLUDES: R + R LOCK CYLINDER	2.0	9.20
58 11 19 00	R + R LEFT REAR DOOR HANDLE	2.0	9.20
66 31 19 00	R + R LEFT SILL TRIM	3.0	13.80
68 05 19 50	R + R R/INN SILL PANEL COVER	1.0	4.60
69 11 20 50)	R + R BOTH FRONT SEAT BELTS	4.0	18.40
51 90 19 ZAX	R + R L/FLOOR PANEL COVER	2.0	9.20
66 76 19 50	R + R L/R WHEELHOUSE SHELL (WHEEL REMOVED)	2.0	9.20
69 67 55 50	RENEW KNEE BAG (REMOVED)	1.0	4.60
70 28 19 50	R + R RIGHT REAR WHEEL HOUSE TRIM	1.0	4.60
70 18 19 00)	R + R INSTRUMENT PANEL (LOWER INSTRUMENT PANEL SHELF, GLOVE BOX AND UPPER A-PILLAR TRIMS REMOVED) INCLUDES: REMOVE STEERING WHEEL, STEERING COLUMN SWITCH, INSTRUMENT CLUSTER AND KNEE BAG	13.0	59.80
NO NUMBER	R + R INSTRUMENT PANEL COVER	1.0	4.60
70 18 55 50	RENEW SWITCH PANEL (REMOVED) INCLUDES: CONVERT SWITCH PANEL	7.0	32.20
68 18 19 50	R + R R/LOWER INSTRUMENT PANEL COVER	2.0	9.20
68 15 19 00)	R + R GLOVE BOX	5.0	23.00
92 60 19 50	R + R WASHER RESERVOIR (BUMPER COVER REMOVED)	2.0	9.20
92 60 55 50	RENEW WASHER RESERVOIR (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	2.0	9.20
69 58 55 50	RENEW DRIVER AIRBAG UNIT (REMOVED)	1.0	4.60
40 07 19ZAX)	R + R ASSEMBLY CARRIER (NOISE CONTROL PAN, SUPPORT AND WHEELS REMOVED) INCLUDES: DETACH + REFIT STEERING GEAR AND STABILIZER DOES NOT INCLUDE: ALIGN FRONT AND REAR	13.0	59.80

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: CHINATAI/4

Date Calculated: 18/12/2017 06:39

Full Report - V1

Registration: SFZ 6955Y

Printed: 18/12/2017 14:39

40 85 19 00)	R + R L/F SPRING STRUT (WHEEL REMOVED)	6.0	27.60
40 90 19 50	DOES NOT INCLUDE: ALIGN FRONT AND REAR R + R LEFT FRONT SHOCK ABSORBER (SPRING STRUT REMOVED)	2.0	9.20
40 50 19 00)	INCLUDES: R + R SPRING STRUT MOUNT AND COIL SPRING R + R L/F WHEEL BEARING HOUSING (WHEEL REMOVED)	9.0	41.40
40 50 55 50	INCLUDES: R + R SPEED SENSOR AND BRAKE DISC, DETACH + REFIT DRIVE SHAFT DOES NOT INCLUDE: ALIGN FRONT AND REAR RENEW L/F WHEEL BEARING HOUSING (WHEEL BEARING HOUSING REMOVED)	3.0	13.80
94 78 19 00	INCLUDES: R + R WHEEL BEARING AND WHEEL HUB R + R L/F VEHICLE LEVEL SENSOR DOES NOT INCLUDE: ADJUST HEADLAMPS, READ OUT FAULT MEMORY (SELF-DIAGNOSIS)	3.0	13.80
40 07 19 53)	R + R L/F LOWER AXLE RADIUS ARM CONSOLE	3.0	13.80
44 10 56 50	RENEW BOTH FRONT WHEELS/TYRES (WHEELS REMOVED)	5.0	23.00
44 05 19 00	INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS R + R REAR WHEEL (WHEELS)	2.0	9.20
44 10 56 50	RENEW BOTH REAR WHEELS/TYRES (WHEELS REMOVED)	5.0	23.00
69 59 55 50	INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS RENEW PASSENGER AIRBAG UNIT (REMOVED)	1.0	4.60
87 03 17 00	DRAIN + REFILL REFRIGERANT	5.0	23.00
44 95 03 00	ALIGN FRONT AND REAR VEHICLE INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR DOES NOT INCLUDE: ADJUSTMENT	9.0	41.40
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK) (FRONT AND REAR ALIGNMENT)	3.0	13.80
44 83 03 ZAX	INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER ALIGN TRANSVERSAL INCLINATION (COMPOSITE WORK)	1.0	4.60
44 88 15 50	MEASURED VALUE OUT OF TOLERANCE FRONT WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0	9.20
44 94 15 50	(VEHICLE FRONT AND REAR ALIGNMENT) REAR WHEEL CAMBER ALIGNMENT (COMPOSITE WORK)	2.0	9.20
44 93 15 50	(FRONT AND REAR VEHICLE ALIGNMENT) REAR WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0	9.20
9852	(VEHICLE FRONT AND REAR ALIGNMENT) READ OUT ERROR MEMORY	30.0*	138.00

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: CHINATAI/4

Date Calculated: 18/12/2017 06:39

Full Report - V1

Registration: SFZ 6955Y

Printed: 18/12/2017 14:39

9854	READ OUT ERROR MEMORY	15.0*	69.00
9973	CARRY OUT TEST DRIVE	5.0*	23.00
1781	REPAIR L/R DOOR	10.0*	46.00
2083	REPAIR L/SIDE FRAME	10.0*	46.00
2583	REPAIR REAR BUMPER	5.0*	23.00
3481	REPAIR L/SIDE PANEL	40.0*	184.00

LABOUR COST

Total Work Units	349.0	
Panel / Mechanical Labour	32.1HRS	\$1,476.60
Visual Alignment Labour	2.8HRS	\$128.80
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	34.9HRS	\$1,605.40
Paint Labour	16.7HRS	\$768.20
Total Labour	51.6HRS	\$2,373.60

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
	- FRONT BRAKE 312 X 25		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER NEW PART PAINT K1R	11.0	
293	FRONT BUMPER CAP NEW PART PAINT K1R	3.0	
301	L/F PARKING AID SENSNEW PART PAINT K1R	3.0	
303	L/F CENTRE SENSOR NEW PART PAINT K1R	3.0	
392	FRT CTR BUMP SPOILERNEW PART PAINT K1R	4.0	
461	L/DUCT COVER NEW PART PAINT K1R	3.0	
462	R/DUCT COVER NEW PART PAINT K1R	3.0	
1781	L/R DOOR REPAIR PAINTING <50%	14.0	
2103	L/OUTER SILL PANEL REPAIR PAINTING <50%	11.0	
2241	LEFT A-PILLAR REPAIR PAINTING <50%	8.0	
2285	L/CENTRE PILLAR REPAIR PAINTING <50%	9.0	
2583	REAR COVER BUMPER REPAIR PAINT PLASTIC	15.0	
3481	L/SIDE PANEL REPAIR PAINTING >50%	19.0*	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	

LABOUR COST - PAINT

TIME(PAINT)	134.0	
Preparation Main Work Plastic	8.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	167.0	
Total Paintwork Labour	16.7HRS	\$768.20

MATERIAL COST - PAINT

New Part Painting	\$39.22
New Part Painting - Plastic K1R	\$59.03
Material-Constant Main Work Metal	\$28.60
Surface-/Blend Paint	\$20.17
Repair Painting	\$67.46
Repair Painting Plastic	\$43.34
Material-Const Main Work Plastic	\$12.70

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: CHINATAI/4

Date Calculated: 18/12/2017 06:39

Full Report - V1

Registration: SFZ 6955Y

Printed: 18/12/2017 14:39

Total Excluding Pearlescent Uplift

\$270.52

Pearlescent Uplift @ 0.0%

\$0.00

Total Paint Material Cost

\$270.52

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
399	1	2-COMP ADHESIVE SENS	D 180 KU2 A1		0%	24.75F *
1000	1	AC DECAL	Renew		0%	6.50F
1405	1	APPLICATOR	D 009 500 25		0%	0.00F
398	1	APPLICATOR	D 009 500 25		0%	0.00F
1410	1	CLEANING SOLUTION	D 009 401 04		0%	0.00F
1409	1	CUTTING FILAMENT	357 853 999 B		0%	0.00F
7445	1	DRIVER AIRBAG	5K0 880 201 AA		0%	1,725.00F
			81U			
8771	1	ENGINE PROTECTION	1K0 825 235 AE		0%	81.00F
1436	1	FLUID RESERVOIR	5K0 955 453 B		0%	75.00F
283	1	FRONT BUMPER	5K0 807 217 CC		0%	480.00F
			GRU			
293	1	FRONT BUMPER CAP	5K0 807 241 A		0%	16.00F
			ROH			
339	1	FRT BUMPER C-MEMBER	5K0 807 651 D		0%	117.00F
392	1	FRT CTR BUMP SPOILER	5K0 807 110 GRU		0%	195.00F
930	1	FRT LOCK CARRIER	5K0 805 588 F		0%	520.00F
394	1	FRT LWR BUMP SPOILER	5K0 807 110 A 9B9		0%	195.00F
393	1	FRT SPOILER BRACKET	5K0 805 915 9B9		0%	40.00F
391	1	FRT UPP BUMP SPOILER	5K0 805 903 B 9B9		0%	260.00F
361	1	H/LAMP WASHER VALVE	5K0 955 978 A		0%	27.00*
362	1	H/LAMP WASHER VALVE	5K0 955 978 A		0%	27.00F
1441	1	H-LAMP WASHER PUMP	3B7 955 681		0%	77.00F
4331	1	INSTRUMENT PANEL	5K2 857 001 A 81X		0%	2,010.00F
4351	1	KNEE AIRBAG	5K1 880 841 F		0%	785.00F
7009	1	L/ASSY CARRIER CONS	1K0 199 295 E		0%	296.00F
7101	1	L/BUFFER	1K0 412 303 E		0%	17.00F
461	1	L/DUCT COVER	5K0 955 109 A		0%	19.00F
			GRU			
297	1	L/F AIR GUIDE GRILLE	5K0 853 665 C 9B9		0%	53.00F
303	1	L/F CENTRE SENSOR	1S0 919 275 C		0%	90.00F
			GRU			
321	1	L/F CTR SENSOR BRKT	5K0 919 493 G		0%	13.00F
637	1	L/F FOG LAMP	5K0 941 699 E		0%	115.00F
7061	1	L/F GUIDE JOINT	1K0 407 365 C		0%	60.00F
7097	1	L/F LEVEL SENSOR	3C0 412 521 B		0%	167.00F
319	1	L/F OUT BUMPER BRKT	5K0 807 723 A		0%	18.00F
307	1	L/F OUT SENSOR BRKT	5K0 919 491 B		0%	13.00F
301	1	L/F PARKING AID SENS	1S0 919 275 C		0%	90.00F
			GRU			
7095	1	L/F S-ABSORB BRACKET	1K0 412 249 B		0%	59.00F
4661	1	L/F SEAT BELT	1K4 857 705 BK		0%	400.00F
			RAA			
7087	1	L/F SHOCK ABSORBER	1T0 413 031 HC		0%	566.00F
7091	1	L/F SPRING LEG BRG	1K0 412 331 B		0%	22.00F
7047	1	L/F TRACK CONT ARM	1K0 407 151 AC		0%	158.00F
7227	1	L/F TYRE	195/65 R 15 .. T		0%	0.00F

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Assessment Number: LHMJ0556

Version: CHINATAI/4

Date Calculated: 18/12/2017 06:39

Full Report - V1

Registration: SFZ 6955Y

Printed: 18/12/2017 14:39

7201	1	L/F WHEEL	5K0 601 025 AE 8Z8	0%	0.00F
7131	1	L/F WHEEL HUB/BRG	5K0 498 621	0%	198.00F
843	1	L/F W-HOUSE FRT CVR	5K0 805 911 G	0%	50.00F
841	1	L/F W-HOUSE RR COVER	5K0 805 977	0%	67.00F
741	1	L/F WING	5K6 821 021 B	0%	232.00F
4259	1	L/FLOOR PANEL COVER	1K0 825 201 AE	0%	103.00F
315	1	L/HEADLAMP MOUNTING	5K0 807 261	0%	62.00F
2207	1	L/LOWER SILL TRIM	5K0 853 855 F 9B9	0%	256.00F
9565	1	L/R TYRE	195/65 R 15 .. T	0%	0.00F
9551	1	L/R WHEEL	5K0 601 025 AE 8Z8	0%	0.00F
7753	1	L/RADIATOR AIR GUIDE	5K0 121 283 B	0%	14.00F
7081	1	L/WHEEL BEARING HSG	1K0 407 255 AA	0%	285.00F
761	1	L/WING STRUT	5K6 821 135	0%	16.00F
561	1	LEFT HEADLAMP ASSY	5K2 941 005 K	0%	687.00F
4325	1	PASSENGER AIRBAG	5K0 880 204 A	0%	1,765.00F
462	1	R/DUCT COVER	5K0 955 110 A GRU	0%	19.00F
298	1	R/F AIR GUIDE GRILLE	5K0 853 666 C 9B9	0%	53.00F
322	1	R/F CTR SENSOR BRKT	5K0 919 493 G	0%	13.00F
638	1	R/F FOG LAMP	5K0 941 700 E	0%	115.00F
320	1	R/F OUT BUMPER BRKT	5K0 807 724 A	0%	18.00F
308	1	R/F OUT SENSOR BRKT	5K0 919 491 B	0%	13.00F
4662	1	R/F SEAT BELT	1K4 857 706 BN RAA	0%	370.00F
7202	1	R/F WHEEL	5K0 601 025 AE 8Z8	0%	0.00F
844	1	R/F W-HOUSE FRT CVR	5K0 805 912 E	0%	50.00F
842	1	R/F W-HOUSE RR COVER	5K0 805 978	0%	67.00F
742	1	R/F WING	5K6 821 022 B	0%	232.00F
316	1	R/HEADLAMP MOUNTING	5K0 807 262	0%	62.00F
358	1	R/HEADLAMP WASH JET	5K0 955 104 A	0%	47.00F
9552	1	R/R WHEEL	5K0 601 025 AE 8Z8	0%	0.00F
7754	1	R/RADIATOR AIR GUIDE	5K0 121 284 B	0%	14.00F
4952	1	R/UPP B-PILLAR TRIM	1K4 867 244 R 6K8	0%	160.00F
762	1	R/WING STRUT	5K6 821 136	0%	16.00F
562	1	RIGHT HEADLAMP ASSY	5K2 941 006 K	0%	687.00F
7435	1	SLIP RING	1K0 959 653 C	0%	170.00F
1000	1	SPORT RIM AFTERMKT	Renew	0%	1,000.00F
1000	1	WARNING DECAL	Renew	0%	6.50F
1000	1	WASHER JET HOSE	Renew	0%	38.00F
1000	1	WASHER JET JOINT 2	Renew	0%	12.00F
1000	1	WASHER LEVEL SENSOR	Renew	0%	18.00F
1437	1	WASHER PUMP	1K6 955 651	0%	61.00F
1000	1	WASHET JET JOINT 1	Renew	0%	8.00F
1401	1	WINDSCREEN	5K0 845 011 J NVB	0%	490.00F
1411	1	WINDSCREEN BOND KIT	D 004 660 M2	0%	0.00F
1414	1	WINDSCREEN PRIMER	D 009 200 02	0%	0.00F
f: OEM Parts			Saving		\$1,660.91
g: Original			Sub Total		\$16,291.75
h: Secondhand			Mark Up From Cost	(5 %)	\$814.59
p: Parallel			Sundry Parts	(Fixed)	\$100.00

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D07042C01

Full Report - V1

Assessment Number: LHMJ0556

Registration: SFZ 6955Y

Version: CHINATAI/4

Printed: 18/12/2017 14:39

Date Calculated: 18/12/2017 06:39

x: Exchange

Total Parts

\$17,206.34

THIS ASSESSMENT CONTAINS UNPRICED PARTS**NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER****Extras**

Description	Betterment	Price
TOP UP AIRCON GAS SPECIALIST	0%	\$50.00
IU BRACKET SPECIALIST		\$10.00
AUDATEX FEE SPECIALIST	0%	\$42.00
W/S SEALANT SPECIALIST		\$40.00
L/F TYRE SPECIALIST	0%	\$111.00
L/R TYRE SPECIALIST		\$111.00
Total Extras		\$364.00

Final Calculation**Total Parts** **\$17,206.34****Labour**

Total Panel/Mechanical	\$1,476.60
Total Paintwork	\$768.20
Total Visual Alignment work	\$128.80
Total Labour	\$2,373.60

Additional Costs

Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$364.00
Total of Additional Costs	\$364.00

Total Paint/Material Costs **\$270.52****Repair Costs Excludes GST** **\$20,214.46****Deductions**

Deduction for Excess (Fixed)	-\$1,000.00
Total Deductions	-\$1,000.00

Grand Total Excludes GST (After Deduction) **\$19,214.46**GST @ 7 % **\$1,345.01****Grand Total Includes GST (After Deduction)** **\$20,559.47****Assessment Notes**

Kenneth Kong (LKKAUTO)

From: Jenny Lim <jenny.lim@laihuat.com.sg>
Sent: Friday, 27 April, 2018 10:10 AM
To: Kenneth Kong (LKKAUTO)
Subject: Finalisation - SFZ 6955Y / Volkswagen Golf GTi
Attachments: SFZ 6955Y.pdf; IMG_9346.jpg; IMG_9347.jpg; IMG_9348.jpg; IMG_9349.jpg; IMG_3672.jpg; IMG_3673.jpg; IMG_3674.jpg; IMG_6245.jpg; IMG_6246.jpg; IMG_6247.jpg; IMG_6328.jpg; IMG_6329.jpg; IMG_6330.jpg; IMG_6331.jpg; IMG_6332.jpg; IMG_6333.jpg; IMG_6334.jpg; IMG_6335.jpg; IMG_6336.jpg; IMG_6337.jpg; IMG_6338.jpg; IMG_6339.jpg; IMG_6340.jpg; IMG_6341.jpg; IMG_6342.jpg; IMG_6343.jpg; IMG_6344.jpg; IMG_6345.jpg; IMG_6346.jpg; IMG_6347.jpg; IMG_6348.jpg; IMG_6349.jpg; IMG_6378.jpg; IMG_6379.jpg; IMG_6380.jpg; IMG_6381.jpg

Dear Sir

For your confirmation, please:

- Parts: \$16,053.00
- 5%: \$ 802.65
- SN: \$ 464.00
- L&P: \$ 2,714.33

Sub-total: \$20,033.98

LS-20%: \$ 4,006.80 = \$16,027.18

Lump sum: \$16,000.00 / Excess cost: \$1,000.00

Supporting documents and photographs are enclosed for your reference.

Thank you.

Kind regards.

Jenny Lim
for LAI HUAT (MENG KEE) MOTOR PTE LTD
160 Sin Ming Drive
#04-01, #04-02 & #07-03
Sin Ming Autocity
Singapore 575722
Tel: 64538110
Fax: 64596267

**LAI HUAT (MENG KEE)
MOTOR PTE LTD
SIN MING INDUSTRIAL
ESTATE SECTOR A
BLK 21 #01-58
SINGAPORE 575679**

Claim Reference:
Assessment Number: LHMJ0556
Version: LAI HUAT/5
Date Calculated: 11/01/2018 17:42

Full Report - V1
Registration: SFZ 6955Y
Printed: 12/01/2018 01:43

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Jenny Lim	Date of Incident:	09/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	DMPCSN3065261700	Quote Due Date:	
Other Reference:	OD CLAIM	Actual Repair Days:	
Thrd Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Golf
Sub Model:	GTI
Model Sheet Number:	6AF 04
Registration:	SFZ 6955Y
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ1KZAW026078
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 05/2009	CHROME PACKAGE
INS PANEL COOLER BOX	DOOR MIRROR W/MEMORY
RAIN SENSOR	ELECTRIC WINDOWS
SAFE SECURITY	SIDE WINDOW/RR SCRNR
ELEC FOLD DR MIRRORS	AUTO DIPPING MIRROR
8 SPEAKER	RADIO RCD 510
XENON HEADLAMPS	FOG LAMPS
PARKING HELP SYSTEM	HEADLAMP WASHERS
ILLUM SUN VISORS	EQUIPM LEATH VIENNA
SPORT SEATS	HEATED FRONT SEATS
STRG WHEEL LEATHER	MULTI FUNC INDICATOR
DOOR TRIM IMIT LEATH	ELECT LUMBAR ADJUST
OIL LEVEL GAUGE	FRONT CENTRE ARMREST
REAR CENTRE ARMREST	SMOKER EQUIPMENT
ALTERNATOR 140A	2.0 LTR 155KW
6 SPEED DSG	SPORTS SUSPENSION
ADAPTIVE SUSPENSION	UPHILL TRACTION CONT
CRUISE CONTROL	TYRES 225/40 WR 18
WHEELS 7.5J X 18 ALU	SPACE SAVER SP-WHEEL
TYRE PRESSURE CHECK	TWO COAT METALLIC

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	13/12/2017

LAI HUAT (MENG KEE) MOTOR PTE LTD**Claim Reference:****Assessment Number: LHMJ0556****Version: LAI HUAT/5****Date Calculated: 11/01/2018 17:42****Full Report - V1****Registration: SFZ 6955Y****Printed: 12/01/2018 01:43**

Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF:

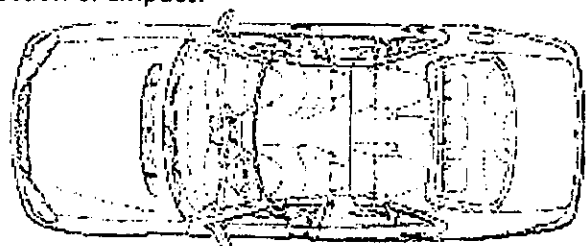
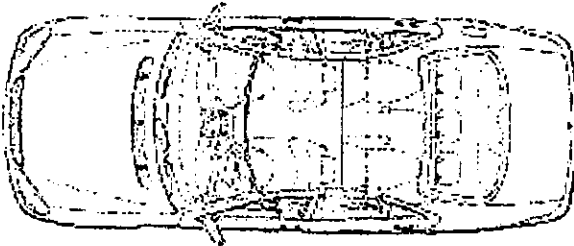
Tread Depth LHR:

Damage Areas:

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

**Addresses****Cost Summary**

Total Labour	\$2,433.40
Total Paint/Material	\$280.93
Total Parts	\$16,955.65
Total of Additional Costs	\$364.00
Repair Cost Exc GST:	\$20,033.98
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,000.00
After Deduction -	
Grand Total Exc GST:	\$19,033.98
7 % GST:	\$1,332.38
Grand Total Inc GST:	\$20,366.36

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /**Guide Number Repair Details**

		WU	Cost Price (\$)
44 95 03 00	ALIGN VEHICLE FRONT AND REAR (BEFORE REPAIRS) INCLUDES: CAMBER AND TOE CHECK , BRKT AND SENSOR REMOVE AND REFIT WITHOUT ADJUSTMENTS	9.0	41.40
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	1.0	4.60
50 38 55 50	RENEW FRONT LOCK CARRIER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	7.0	32.20
50 38 19 50	R + R FRONT LOCK CARRIER (BUMPER COVER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMPS	13.0	59.80
66 05 19 00	R + R RADIATOR GRILLE	2.0	9.20
63 29 19 50	R + R FRONT BUMPER COVER (RADIATOR GRILLE REMOVED)	4.0	18.40
63 29 55 69	RENEW FRONT BUMPER COVER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	11.0	50.60
50 55 19 50	R + R L/F WING	9.0	41.40

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/5

Date Calculated: 11/01/2018 17:42

Full Report - V1

Registration: SFZ 6955Y

Printed: 12/01/2018 01:43

	(BUMPER COVER REMOVED)		
	INCLUDES: R + R HEADLAMP, WHEELHOUSE		
	LINER AND WHEEL		
63 29 43 50	DRILL FRONT BUMPER COVER	3.0	13.80
	(COMPOSITE WORK)		
	(4 HOLES DRILLED)		
63 29 41 50	REPAIR FRONT BUMPER COVER	3.0	13.80
	(COMPOSITE WORK)		
	(4 BRACKET STUCK)		
50 55 19 50	R + R R/F WING	9.0	41.40
	(BUMPER COVER REMOVED)		
	INCLUDES: R + R HEADLAMP, WHEELHOUSE		
	LINER AND WHEEL		
NO NUMBER	R + R L/F WING STRUT	2.0	9.20
94 15 16 10	ADJUST HEADLAMPS	3.0	13.80
94 64 16 00	ALIGN FRONT FOG LAMPS	2.0	9.20
94 15 56 50	RENEW HEADLAMPS	5.0	23.00
	(REMOVED)		
	INCLUDES: CONVERT ATTACHED PARTS		
50 34 19 50	R + R FRONT CROSSMEMBER (COMPOSITE	3.0	13.80
	WORK)		
	(BUMPER COVER REMOVED)		
64 10 55 00	RENEW FRONT SCREEN	22.0	101.20
	INCLUDES: R + R A-PILLAR TRIMS, INTERIOR		
	MIRROR, SUN VISORS AND INTERIOR LAMP		
66 44 19 50	R + R COWL TRIM	2.0	9.20
	(WIPER ARMS REMOVED)		
57 11 19 00	R + R L/F DOOR HANDLE	2.0	9.20
	INCLUDES: R + R LOCK CYLINDER		
58 11 19 00	R + R LEFT REAR DOOR HANDLE	2.0	9.20
66 31 19 00	R + R LEFT SILL TRIM	3.0	13.80
68 05 19 50	R + R R/INN SILL PANEL COVER	1.0	4.60
69 11 20 50)	R + R BOTH FRONT SEAT BELTS	4.0	18.40
51 90 19 ZAX	R + R L/FLOOR PANEL COVER	2.0	9.20
66 76 19 50	R + R L/R WHEELHOUSE SHELL	2.0	9.20
	(WHEEL REMOVED)		
69 67 55 50	RENEW KNEE BAG (REMOVED)	1.0	4.60
70 28 19 50	R + R RIGHT REAR WHEEL HOUSE TRIM	1.0	4.60
70 18 19 00)	R + R INSTRUMENT PANEL	13.0	59.80
	(LOWER INSTRUMENT PANEL SHELF, GLOVE BOX		
	AND UPPER A-PILLAR TRIMS REMOVED)		
	INCLUDES: REMOVE STEERING WHEEL,		
	STEERING COLUMN SWITCH, INSTRUMENT		
	CLUSTER AND KNEE BAG		
NO NUMBER	R + R INSTRUMENT PANEL COVER	1.0	4.60
70 18 55 50	RENEW SWITCH PANEL (REMOVED)	7.0	32.20
	INCLUDES: CONVERT SWITCH PANEL		
68 18 19 50	R + R R/LOWER INSTRUMENT PANEL COVER	2.0	9.20
68 15 19 00)	R + R GLOVE BOX	5.0	23.00
92 60 19 50	R + R WASHER RESERVOIR	2.0	9.20
	(BUMPER COVER REMOVED)		
92 60 55 50	RENEW WASHER RESERVOIR	2.0	9.20
	(REMOVED)		
	INCLUDES: CONVERT ATTACHED PARTS		

LAI HUAT (MENG KEE) MOTOR PTE LTD**Claim Reference:****Assessment Number: LHMJ0556****Version: LAI HUAT/5****Date Calculated: 11/01/2018 17:42****Full Report - V1****Registration: SFZ 6955Y****Printed: 12/01/2018 01:43**

69 58 55 50	RENEW DRIVER AIRBAG UNIT (REMOVED)	1.0	4.60
40 07 19ZAX)	R + R ASSEMBLY CARRIER (NOISE CONTROL PAN, SUPPORT AND WHEELS REMOVED) INCLUDES: DETACH + REFIT STEERING GEAR AND STABILIZER DOES NOT INCLUDE: ALIGN FRONT AND REAR	13.0	59.80
40 85 19 00)	R + R L/F SPRING STRUT (WHEEL REMOVED) DOES NOT INCLUDE: ALIGN FRONT AND REAR	6.0	27.60
40 90 19 50	R + R LEFT FRONT SHOCK ABSORBER (SPRING STRUT REMOVED) INCLUDES: R + R SPRING STRUT MOUNT AND COIL SPRING	2.0	9.20
40 50 19 00)	R + R L/F WHEEL BEARING HOUSING (WHEEL REMOVED) INCLUDES: R + R SPEED SENSOR AND BRAKE DISC, DETACH + REFIT DRIVE SHAFT DOES NOT INCLUDE: ALIGN FRONT AND REAR	9.0	41.40
40 50 55 50	RENEW L/F WHEEL BEARING HOUSING (WHEEL BEARING HOUSING REMOVED) INCLUDES: R + R WHEEL BEARING AND WHEEL HUB	3.0	13.80
94 78 19 00	R + R L/F VEHICLE LEVEL SENSOR DOES NOT INCLUDE: ADJUST HEADLAMPS, READ OUT FAULT MEMORY (SELF-DIAGNOSIS)	3.0	13.80
40 07 19 53)	R + R L/F LOWER AXLE RADIUS ARM CONSOLE	3.0	13.80
44 10 56 50	RENEW BOTH FRONT WHEELS/TYRES (WHEELS REMOVED) INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS	5.0	23.00
44 05 19 00	R + R REAR WHEEL (WHEELS)	2.0	9.20
44 10 56 50	RENEW BOTH REAR WHEELS/TYRES (WHEELS REMOVED) INCLUDES: R + R TYRES, FIT VALVES AND BALANCE WHEELS	5.0	23.00
69 59 55 50	RENEW PASSENGER AIRBAG UNIT (REMOVED)	1.0	4.60
87 03 17 00	DRAIN + REFILL REFRIGERANT	5.0	23.00
44 95 03 00	ALIGN FRONT AND REAR VEHICLE INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR DOES NOT INCLUDE: ADJUSTMENT	9.0	41.40
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK) (FRONT AND REAR ALIGNMENT) INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER	3.0	13.80
44 83 03 ZAX	ALIGN TRANSVERSAL INCLINATION (COMPOSITE WORK) MEASURED VALUE OUT OF TOLERANCE	1.0	4.60
44 88 15 50	FRONT WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0	9.20

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/5

Date Calculated: 11/01/2018 17:42

Full Report - V1

Registration: SFZ 6955Y

Printed: 12/01/2018 01:43

44 94 15 50	(VEHICLE FRONT AND REAR ALIGNMENT) REAR WHEEL CAMBER ALIGNMENT (COMPOSITE WORK)	2.0	9.20
44 93 15 50	(FRONT AND REAR VEHICLE ALIGNMENT) REAR WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0	9.20
9852	(VEHICLE FRONT AND REAR ALIGNMENT) READ OUT ERROR MEMORY	30.0*	138.00
9854	READ OUT ERROR MEMORY	15.0*	69.00
9973	CARRY OUT TEST DRIVE	5.0*	23.00
1781	REPAIR L/R DOOR	10.0*	46.00
2083	REPAIR L/SIDE FRAME	10.0*	46.00
2583	REPAIR REAR BUMPER	5.0*	23.00
3481	REPAIR L/SIDE PANEL	40.0*	184.00
LABOUR COST			
	Total Work Units	352.0	
	Panel / Mechanical Labour	32.4HRS	\$1,490.40
	Visual Alignment Labour	2.8HRS	\$128.80
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	35.2HRS	\$1,619.20
	Paint Labour	17.7HRS	\$814.20
	Total Labour	52.9HRS	\$2,433.40

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER NEW PART PAINT K1R	11.0	
293	FRONT BUMPER CAP NEW PART PAINT K1R	3.0	
301	L/F PARKING AID SENSNEW PART PAINT K1R	3.0	
303	L/F CENTRE SENSOR NEW PART PAINT K1R	3.0	
392	FRT CTR BUMP SPOILERNEW PART PAINT K1R	4.0	
461	L/DUCT COVER NEW PART PAINT K1R	3.0	
462	R/DUCT COVER NEW PART PAINT K1R	3.0	
1781	L/R DOOR REPAIR PAINTING <50%	14.0	
2103	L/OUTER SILL PANEL REPAIR PAINTING <50%	11.0	
2241	LEFT A-PILLAR REPAIR PAINTING <50%	8.0	
2285	L/CENTRE PILLAR REPAIR PAINTING <50%	9.0	
2583	REAR COVER BUMPER REPAIR PAINT PLASTIC	15.0	
3481	L/SIDE PANEL REPAIR PAINTING >50%	19.0	
302	R/F PARKING AID SENS SURFACE PAINT PLAST.	3.0	
304	R/F CENTRE SENSOR SURFACE PAINT PLAST.	3.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	8.0	
LABOUR COST - PAINT			
	TIME(PAINT)	148.0	
	Preparation Main Work Metal	21.0	
	Preparation Comp. Work Plastic	8.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	177.0	

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/5

Date Calculated: 11/01/2018 17:42

Full Report - V1

Registration: SFZ 6955Y

Printed: 12/01/2018 01:43

Total Paintwork Labour	17.7HRS	\$814.20
MATERIAL COST - PAINT		Cost Price
New Part Painting		\$39.22
New Part Painting - Plastic K1R		\$59.03
Surface-/Blend Paint		\$40.34
Surface Paint Plastic		\$0.74
Repair Painting		\$67.46
Repair Painting Plastic		\$43.34
Material-Const Main Work Metal		\$18.10
Material-Const Comp. Work Plastic		\$12.70
Total Excluding Pearlescent Uplift		\$280.93
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$280.93

PARTS

Guide No. Qty		Description	Part Number	Supplier	Price Valid: 01/06/2015	
					Bet.	Price (\$)
399	1	2-COMP ADHESIVE SENS	D 180 KU2 A1		0%	0.00F
1000	1	AC DECAL	Renew		0%	6.50*
398	1	APPLICATOR	D 009 500 25		0%	0.00F
1405	1	APPLICATOR	D 009 500 25		0%	0.00F
1410	1	CLEANING SOLUTION	D 009 401 04		0%	0.00F
1409	1	CUTTING FILAMENT	357 853 999 B		0%	0.00F
7445	1	DRIVER AIRBAG	5K0 880 201 AE		0%	1,725.00*
			81U			
1436	1	FLUID RESERVOIR	5K0 955 453 B		0%	75.00*
283	1	FRONT BUMPER	5K0 807 217 CC		0%	480.00*
			GRU			
293	1	FRONT BUMPER CAP	5K0 807 241 A		0%	16.00*
			ROH			
339	1	FRT BUMPER C-MEMBER	5K0 807 651 D		0%	117.00*
392	1	FRT CTR BUMP SPOILER	5K0 807 110 GRU		0%	195.00*
930	1	FRT LOCK CARRIER	5K0 805 588 E		0%	520.00*
394	1	FRT LWR BUMP SPOILER	5K0 807 110 A 9B9		0%	195.00*
393	1	FRT SPOILER BRACKET	5K0 805 915 9B9		0%	40.00*
391	1	FRT UPP BUMP SPOILER	5K0 805 903 B 9B9		0%	260.00*
362	1	H/LAMP WASHER VALVE	5K0 955 978 A		0%	27.00*
361	1	H/LAMP WASHER VALVE	5K0 955 978 A		0%	27.00*
1441	1	H-LAMP WASHER PUMP	3B7 955 681		0%	77.00*
4331	1	INSTRUMENT PANEL	5K2 857 001 A 81X		0%	2,010.00*
4351	1	KNEE AIRBAG	5K1 880 841 F		0%	785.00*
7009	1	L/ASSY CARRIER CONS	1K0 199 295 E		0%	296.00*
7101	1	L/BUFFER	1K0 412 303 E		0%	17.00*
461	1	L/DUCT COVER	5K0 955 109 A		0%	19.00*
			GRU			
297	1	L/F AIR GUIDE GRILLE	5K0 853 665 C 9B9		0%	53.00*
303	1	L/F CENTRE SENSOR	1S0 919 275 C		0%	90.00*
			GRU			
321	1	L/F CTR SENSOR BRKT	5K0 919 493 G		0%	13.00*
637	1	L/F FOG LAMP	5K0 941 699 E		0%	115.00*
7061	1	L/F GUIDE JOINT	1K0 407 365 C		0%	60.00*
7097	1	L/F LEVEL SENSOR	3C0 412 521 B		0%	167.00*
319	1	L/F OUT BUMPER BRKT	5K0 807 723 A		0%	18.00*
307	1	L/F OUT SENSOR BRKT	5K0 919 491 B		0%	13.00*

LAI HUAT (MENG KEE) MOTOR PTE LTD

Claim Reference:

Assessment Number: LHMJ0556

Version: LAI HUAT/5

Date Calculated: 11/01/2018 17:42

Full Report - V1

Registration: SFZ 6955Y

Printed: 12/01/2018 01:43

301	1	L/F PARKING AID SENS	1S0 919 275 C	0%	90.00*
			GRU		
7095	1	L/F S-ABSORB BRACKET	1K0 412 249 B	0%	59.00*
4661	1	L/F SEAT BELT	1K4 857 705 BK	0%	400.00*
			RAA		
7087	1	L/F SHOCK ABSORBER	1T0 413 031 HC	0%	566.00*
7091	1	L/F SPRING LEG BRG	1K0 412 331 B	0%	22.00*
7047	1	L/F TRACK CONT ARM	1K0 407 151 AC	0%	158.00*
7227	1	L/F TYRE	225/40 R 18 .. W	0%	0.00F
7201	1	L/F WHEEL	1K0 601 025 BA	0%	0.00F
			FZZ		
7131	1	L/F WHEEL HUB/BRG	5K0 498 621	0%	198.00*
843	1	L/F W-HOUSE FRT CVR	5K0 805 911 G	0%	50.00*
841	1	L/F W-HOUSE RR COVER	5K0 805 977	0%	67.00*
741	1	L/F WING	5K6 821 021 B	0%	232.00*
4259	1	L/FLOOR PANEL COVER	1K0 825 201 AE	0%	103.00*
315	1	L/HEADLAMP MOUNTING	5K0 807 261	0%	62.00*
2207	1	L/LOWER SILL TRIM	5K0 853 855 F 9B9	0%	256.00*
9565	1	L/R TYRE	225/40 R 18 .. W	0%	0.00F
9551	1	L/R WHEEL	1K0 601 025 BA	0%	0.00F
			FZZ		
7081	1	L/WHEEL BEARING HSG	1K0 407 255 AA	0%	285.00*
761	1	L/WING STRUT	5K6 821 135	0%	16.00*
561	1	LEFT HEADLAMP ASSY	5K2 941 753 B	0%	687.00*
4325	1	PASSENGER AIRBAG	5K0 880 204 A	0%	1,765.00*
462	1	R/DUCT COVER	5K0 955 110 A	0%	19.00*
			GRU		
298	1	R/F AIR GUIDE GRILLE	5K0 853 666 C 9B9	0%	53.00*
322	1	R/F CTR SENSOR BRKT	5K0 919 493 G	0%	13.00*
638	1	R/F FOG LAMP	5K0 941 700 E	0%	115.00*
320	1	R/F OUT BUMPER BRKT	5K0 807 724 A	0%	18.00*
308	1	R/F OUT SENSOR BRKT	5K0 919 491 B	0%	13.00*
4662	1	R/F SEAT BELT	1K4 857 706 BN	0%	370.00*
			RAA		
7202	1	R/F WHEEL	1K0 601 025 BA	0%	0.00F
			FZZ		
844	1	R/F W-HOUSE FRT CVR	5K0 805 912 E	0%	50.00*
842	1	R/F W-HOUSE RR COVER	5K0 805 978	0%	67.00*
742	1	R/F WING	5K6 821 022 B	0%	232.00*
316	1	R/HEADLAMP MOUNTING	5K0 807 262	0%	62.00*
9552	1	R/R WHEEL	1K0 601 025 BA	0%	0.00F
			FZZ		
7754	1	R/RADIATOR AIR GUIDE	5K0 121 284 E	0%	14.00*
4952	1	R/UPP B-PILLAR TRIM	1K4 867 244 R 6K8	0%	160.00*
562	1	RIGHT HEADLAMP ASSY	5K2 941 754 B	0%	687.00*
7435	1	SLIP RING	1K0 959 653 C	0%	170.00*
1000	1	SPORT RIM AFTERMKT	Renew	0%	1,000.00*
1000	1	WARNING DECAL	Renew	0%	6.50*
1000	1	WASHER JET JOINT 2	Renew	0%	12.00*
1437	1	WASHER PUMP	1K6 955 651	0%	61.00*
1000	1	WASHET JET JOINT 1	Renew	0%	8.00*
1401	1	WINDSCREEN	5K0 845 011 AB	0%	490.00*
			NVB		
1411	1	WINDSCREEN BOND KIT	D 004 660 M2	0%	0.00F

LAI HUAT (MENG KEE) MOTOR PTE LTD**Claim Reference:****Full Report - V1****Assessment Number: LHMJ0556****Registration: SFZ 6955Y****Version: LAI HUAT/5****Printed: 12/01/2018 01:43****Date Calculated: 11/01/2018 17:42**

1414	1	WINDSCREEN PRIMER	D 009 200 02	0%	0.00F
f: OEM Parts			Saving		\$2,510.71
g: Original			Sub Total		\$16,053.00
h: Secondhand			Mark Up From Cost (5 %)		\$802.65
p: Parallel			Sundry Parts (Fixed)		\$100.00
x: Exchange			Total Parts		\$16,955.65

THIS ASSESSMENT CONTAINS UNPRICED PARTS**NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER****Extras**

Description	Betterment	Price
TOP UP AIRCON GAS SPECIALIST	0%	\$50.00
IU BRACKET SPECIALIST		\$10.00
AUDATEX FEE SPECIALIST	0%	\$42.00
W/S SEALANT SPECIALIST		\$40.00
L/F TYRE SPECIALIST	0%	\$111.00
L/R TYRE SPECIALIST		\$111.00
Total Extras		\$364.00

Final Calculation

Total Parts		\$16,955.65
Labour		
Total Panel/Mechanical	\$1,490.40	
Total Paintwork	\$814.20	
Total Visual Alignment work	\$128.80	
Total Labour		\$2,433.40
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$364.00	
Total of Additional Costs		\$364.00
Total Paint/Material Costs		\$280.93
Repair Costs Excludes GST		\$20,033.98
Deductions		
Deduction for Excess (Fixed)	-\$1,000.00	
Total Deductions		-\$1,000.00
Grand Total Excludes GST (After Deduction)		\$19,033.98
GST @ 7 %		\$1,332.38
Grand Total Includes GST (After Deduction)		\$20,366.36

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Finalised

Claim Reference: SNM17D07042C01
Assessment Number: LHMJ0556
Version: CHINATAI/6
Date Calculated: 16/05/2018 02:27

Full Report - V1
Registration: SFZ 6955Y
Printed: 16/05/2018 09:29

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	09/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM17D07042C01	Estimated Repair Time:	
Policy Number:	DMPCSN3065261700	Quote Due Date:	
Other Reference:	OD CLAIM	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Golf
Sub Model:	GTI
Model Sheet Number:	6AF 04
Registration:	SFZ 6955Y
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ1KZAW026078
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

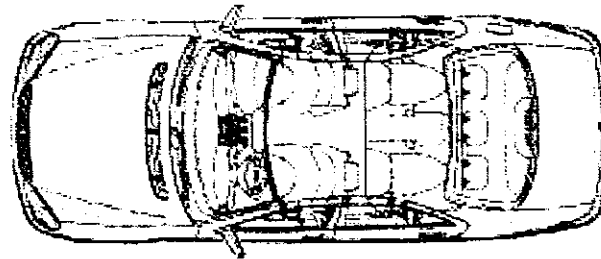
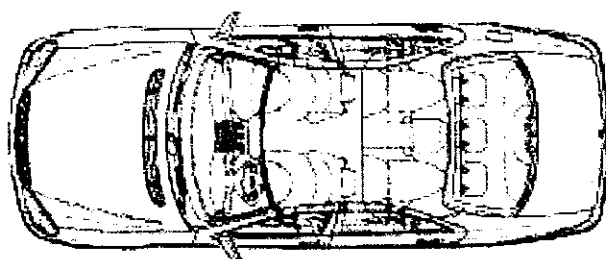
Model Specs

FROM 08/2009	FOG LAMPS
PARKING HELP SYSTEM	HEADLAMP WASHERS
1.4 LTR 59 KW	ADAPTIVE SUSPENSION
TYRE PRESSURE CHECK	STABILITY PROGRAM
ELECTRIC SUNROOF	5-DOOR
WHEELS 6.5J X 16 ALU	TWO COAT METALLIC
PREPARE OFF VEHICLE	FRONT BRAKE 312 X 25

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	13/12/2017
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	



Addresses

Cost Summary

Total Labour	\$2,327.60
Total Paint/Material	\$270.03
Total Parts	\$16,955.65
Total of Additional Costs	\$364.00
Repair Cost Exc GST:	\$19,917.28
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,000.00
After Deduction -	
Grand Total Exc GST:	\$18,917.28
7 % GST:	\$1,324.21
Grand Total Inc GST:	\$20,241.49

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR

Price/Dent = \$46.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
44 95 03 00	ALIGN VEHICLE FRONT AND REAR (BEFORE REPAIRS) INCLUDES: CAMBER AND TOE CHECK , BRKT AND SENSOR REMOVE AND REFIT WITHOUT ADJUSTMENTS	9.0	41.40
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	1.0	4.60
50 38 55 50	RENEW FRONT LOCK CARRIER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	7.0	32.20
50 38 19 50	R + R FRONT LOCK CARRIER (BUMPER COVER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMPS	13.0	59.80
66 05 19 00	R + R RADIATOR GRILLE	2.0	9.20
63 29 19 50	R + R FRONT BUMPER COVER (RADIATOR GRILLE REMOVED)	4.0	18.40
63 29 55 83	RENEW FRONT BUMPER COVER (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	16.0	73.60
50 55 19 50	R + R L/F WING (BUMPER COVER REMOVED) INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL	9.0	41.40
63 29 43 50	DRILL FRONT BUMPER COVER (COMPOSITE WORK) (4 HOLES DRILLED)	3.0	13.80
63 29 41 50	REPAIR FRONT BUMPER COVER (COMPOSITE WORK)	3.0	13.80

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM17D07042C01

Full Report - V1

Assessment Number: LHMJ0556

Registration: SFZ 6955Y

Version: CHINATAI/6

Printed: 16/05/2018 09:29

Date Calculated: 16/05/2018 02:27

50 55 19 50	(4 BRACKET STUCK) R + R R/F WING (BUMPER COVER REMOVED) INCLUDES: R + R HEADLAMP, WHEELHOUSE LINER AND WHEEL	9.0	41.40
NO NUMBER	R + R L/F WING STRUT	2.0	9.20
94 15 16 00	ADJUST HEADLAMPS	3.0	13.80
94 64 16 00	ALIGN FRONT FOG LAMPS	2.0	9.20
50 34 19 50	R + R FRONT CROSSMEMBER (COMPOSITE WORK) (BUMPER COVER REMOVED)	3.0	13.80
64 10 55 00	RENEW FRONT SCREEN INCLUDES: R + R A-PILLAR TRIMS, INTERIOR MIRROR, SUN VISORS AND INTERIOR LAMP	22.0	101.20
66 44 19 50	R + R COWL TRIM (WIPER ARMS REMOVED)	2.0	9.20
57 11 19 00	R + R L/F DOOR HANDLE INCLUDES: R + R LOCK CYLINDER	2.0	9.20
58 11 19 00	R + R LEFT REAR DOOR HANDLE	2.0	9.20
66 31 19 00	R + R LEFT SILL TRIM	3.0	13.80
68 05 19 50	R + R R/INN SILL PANEL COVER	1.0	4.60
69 11 20 50)	R + R BOTH FRONT SEAT BELTS	4.0	18.40
51 90 19 ZAX	R + R L/FLOOR PANEL COVER	2.0	9.20
66 76 19 50	R + R L/R WHEELHOUSE SHELL (WHEEL REMOVED)	2.0	9.20
69 67 55 50	RENEW KNEE BAG (REMOVED)	1.0	4.60
70 28 19 50	R + R RIGHT REAR WHEEL HOUSE TRIM	1.0	4.60
70 18 19 00)	R + R INSTRUMENT PANEL (LOWER INSTRUMENT PANEL SHELF, GLOVE BOX AND UPPER A-PILLAR TRIMS REMOVED) INCLUDES: REMOVE STEERING WHEEL, STEERING COLUMN SWITCH, INSTRUMENT CLUSTER AND KNEE BAG	13.0	59.80
NO NUMBER	R + R INSTRUMENT PANEL COVER	1.0	4.60
70 18 55 50	RENEW SWITCH PANEL (REMOVED) INCLUDES: CONVERT SWITCH PANEL	7.0	32.20
68 18 19 50	R + R R/LOWER INSTRUMENT PANEL COVER	2.0	9.20
68 15 19 00)	R + R GLOVE BOX	5.0	23.00
92 60 19 50	R + R WASHER RESERVOIR (BUMPER COVER REMOVED)	2.0	9.20
92 60 55 50	RENEW WASHER RESERVOIR (REMOVED) INCLUDES: CONVERT ATTACHED PARTS	2.0	9.20
69 58 55 50	RENEW DRIVER AIRBAG UNIT (REMOVED)	1.0	4.60
40 07 19ZAX)	R + R ASSEMBLY CARRIER (NOISE CONTROL PAN, SUPPORT AND WHEELS REMOVED) INCLUDES: DETACH + REFIT STEERING GEAR AND STABILIZER DOES NOT INCLUDE: ALIGN FRONT AND REAR	13.0	59.80
40 85 19 00)	R + R L/F SPRING STRUT	6.0	27.60

	(WHEEL REMOVED)		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR		
40 90 19 50	R + R LEFT FRONT SHOCK ABSORBER	2.0	9.20
	(SPRING STRUT REMOVED)		
	INCLUDES: R + R SPRING STRUT MOUNT AND		
	COIL SPRING		
40 50 19 00)	R + R L/F WHEEL BEARING HOUSING	9.0	41.40
	(WHEEL REMOVED)		
	INCLUDES: R + R SPEED SENSOR AND BRAKE		
	DISC,		
	DETACH + REFIT DRIVE SHAFT		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR		
40 50 55 50	RENEW L/F WHEEL BEARING HOUSING	3.0	13.80
	(WHEEL BEARING HOUSING REMOVED)		
	INCLUDES: R + R WHEEL BEARING AND WHEEL		
	HUB		
94 78 19 00	R + R L/F VEHICLE LEVEL SENSOR	3.0	13.80
	DOES NOT INCLUDE: ADJUST HEADLAMPS,		
	READ OUT FAULT MEMORY (SELF-DIAGNOSIS)		
40 07 19 53)	R + R L/F LOWER CONTROL ARM CONSOLE	3.0	13.80
44 05 19 00	R + R REAR WHEEL (WHEELS)	2.0	9.20
69 59 55 50	RENEW PASSENGER AIRBAG UNIT	1.0	4.60
	(REMOVED)		
87 03 17 00	DRAIN + REFILL REFRIGERANT	5.0	23.00
44 95 03 00	ALIGN FRONT AND REAR VEHICLE	9.0	41.40
	INCLUDES: CHECK TOE AND CAMBER,		
	R + R BRACKET AND ALIGNMENT SENSOR		
	DOES NOT INCLUDE: ADJUSTMENT		
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK)	3.0	13.80
	(FRONT AND REAR ALIGNMENT)		
	INCLUDES: DETACH + REFIT ASSEMBLIES		
	CARRIER		
44 83 03 ZAX	ALIGN TRANSVERSAL INCLINATION	1.0	4.60
	(COMPOSITE WORK)		
	MEASURED VALUE OUT OF TOLERANCE		
44 88 15 50	FRONT WHEEL TOE ALIGNMENT	2.0	9.20
	(COMPOSITE WORK)		
	(VEHICLE FRONT AND REAR ALIGNMENT)		
44 94 15 50	REAR WHEEL CAMBER ALIGNMENT	2.0	9.20
	(COMPOSITE WORK)		
	(FRONT AND REAR VEHICLE ALIGNMENT)		
44 93 15 50	REAR WHEEL TOE ALIGNMENT	2.0	9.20
	(COMPOSITE WORK)		
	(VEHICLE FRONT AND REAR ALIGNMENT)		
9852	READ OUT ERROR MEMORY	30.0*	138.00
9854	READ OUT ERROR MEMORY	15.0*	69.00
9973	CARRY OUT TEST DRIVE	5.0*	23.00
1781	REPAIR L/R DOOR	10.0*	46.00
2083	REPAIR L/SIDE FRAME	10.0*	46.00
2583	REPAIR REAR BUMPER	5.0*	23.00
3481	REPAIR L/SIDE PANEL	40.0*	184.00

LABOUR COST

Total Work Units	342.0	
Panel / Mechanical Labour	31.4HRS	\$1,444.40
Visual Alignment Labour	2.8HRS	\$128.80
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	34.2HRS	\$1,573.20
Paint Labour	16.4HRS	\$754.40
Total Labour	50.6HRS	\$2,327.60

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
	- FRONT BRAKE 312 X 25		
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER NEW PART PAINT K1R	11.0	
301	L/F PARKING AID SENS NEW PART PAINT K1R	3.0	
303	L/F CENTRE SENSOR NEW PART PAINT K1R	3.0	
392	FRT CTR BUMP SPOILER NEW PART PAINT K1R	4.0	
461	L/DUCT COVER NEW PART PAINT K1R	3.0	
462	R/DUCT COVER NEW PART PAINT K1R	3.0	
1781	L/R DOOR REPAIR PAINTING <50%	14.0	
2103	L/OUTER SILL PANEL REPAIR PAINTING <50%	11.0	
2241	LEFT A-PILLAR REPAIR PAINTING <50%	8.0	
2285	LEFT B-PILLAR REPAIR PAINTING <50%	9.0	
2583	REAR COVER BUMPER REPAIR PAINT PLASTIC	15.0	
3481	L/SIDE PANEL REPAIR PAINTING >50%	19.0*	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
LABOUR COST - PAINT			
TIME(PAINT)		131.0	
Preparation Main Work Plastic		8.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		164.0	
Total Paintwork Labour		16.4HRS	\$754.40
MATERIAL COST - PAINT			Cost Price
New Part Painting			\$39.22
New Part Painting - Plastic K1R			\$58.54
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$20.17
Repair Painting			\$67.46
Repair Painting Plastic			\$43.34
Material-Const Main Work Plastic			\$12.70
Total Excluding Pearlescent Uplift			\$270.03
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$270.03

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)
399	1	2-COMP ADHESIVE SENS	D 180 KU2 A1			0%	0.00F

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM17D07042C01

Full Report - V1

Assessment Number: LHMJ0556

Registration: SFZ 6955Y

Version: CHINATAI/6

Printed: 16/05/2018 09:29

Date Calculated: 16/05/2018 02:27

1000	1	AC DECAL	Renew	0%	6.50F
1405	1	APPLICATOR	D 009 500 25	0%	0.00F
398	1	APPLICATOR	D 009 500 25	0%	0.00F
1410	1	CLEANING SOLUTION	D 009 401 04	0%	0.00F
1409	1	CUTTING FILAMENT	357 853 999 B	0%	0.00F
7445	1	DRIVER AIRBAG	5K0 880 201 AA 81U	0%	1,725.00F
1436	1	FLUID RESERVOIR	5K0 955 453 B	0%	75.00F
283	1	FRONT BUMPER	5K0 807 217 CC GRU	0%	480.00F
293	1	FRONT BUMPER CAP	5K0 807 241 A ROH	0%	16.00F
339	1	FRT BUMPER C-MEMBER	5K0 807 651 D	0%	117.00F
392	1	FRT CTR BUMP SPOILER	5K0 807 110 GRU	0%	195.00G
930	1	FRT LOCK CARRIER	5K0 805 588 F	0%	520.00F
394	1	FRT LWR BUMP SPOILER	5K0 807 110 A 9B9	0%	195.00F
393	1	FRT SPOILER BRACKET	5K0 805 915 9B9	0%	40.00F
391	1	FRT UPP BUMP SPOILER	5K0 805 903 B 9B9	0%	260.00F
362	1	H/LAMP WASHER VALVE	5K0 955 978 A	0%	27.00F
361	1	H/LAMP WASHER VALVE	5K0 955 978 A	0%	27.00*
1441	1	H-LAMP WASHER PUMP	3B7 955 681	0%	77.00F
4331	1	INSTRUMENT PANEL	5K2 857 001 A 81X	0%	2,010.00F
4351	1	KNEE AIRBAG	5K1 880 841 F	0%	785.00F
7009	1	L/ASSY CARRIER CONS	1K0 199 295 E	0%	296.00F
7101	1	L/BUFFER	1K0 412 303 E	0%	17.00F
461	1	L/DUCT COVER	5K0 955 109 A GRU	0%	19.00F
297	1	L/F AIR GUIDE GRILLE	5K0 853 665 C 9B9	0%	53.00F
303	1	L/F CENTRE SENSOR	1S0 919 275 C GRU	0%	90.00F
321	1	L/F CTR SENSOR BRKT	5K0 919 493 G	0%	13.00F
637	1	L/F FOG LAMP	5K0 941 699 E	0%	115.00F
7061	1	L/F GUIDE JOINT	1K0 407 365 C	0%	60.00F
7097	1	L/F LEVEL SENSOR	3C0 412 521 B	0%	167.00F
319	1	L/F OUT BUMPER BRKT	5K0 807 723 A	0%	18.00F
307	1	L/F OUT SENSOR BRKT	5K0 919 491 B	0%	13.00G
301	1	L/F PARKING AID SENS	1S0 919 275 C GRU	0%	90.00F
7095	1	L/F S-ABSORB BRACKET	1K0 412 249 B	0%	59.00F
4661	1	L/F SEAT BELT	1K4 857 705 BK RAA	0%	400.00F
7087	1	L/F SHOCK ABSORBER	1T0 413 031 HC	0%	566.00F
7091	1	L/F SPRING LEG BRG	1K0 412 331 B	0%	22.00F
7047	1	L/F TRACK CONT ARM	1K0 407 151 AC	0%	158.00F
7131	1	L/F WHEEL HUB/BRG	5K0 498 621	0%	198.00F
843	1	L/F W-HOUSE FRT CVR	5K0 805 911 G	0%	50.00F
841	1	L/F W-HOUSE RR COVER	5K0 805 977	0%	67.00F
741	1	L/F WING	5K6 821 021 B	0%	232.00F
4259	1	L/FLOOR PANEL COVER	1K0 825 201 AE	0%	103.00F
315	1	L/HEADLAMP MOUNTING	5K0 807 261	0%	62.00G
2207	1	L/LOWER SILL TRIM	5K0 853 855 F 9B9	0%	256.00F
7081	1	L/WHEEL BEARING HSG	1K0 407 255 AA	0%	285.00F

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM17D07042C01

Full Report - V1

Assessment Number: LHMJ0556

Registration: SFZ 6955Y

Version: CHINATAI/6

Printed: 16/05/2018 09:29

Date Calculated: 16/05/2018 02:27

761	1	L/WING STRUT	5K6 821 135	0%	16.00F
561	1	LEFT HEADLAMP ASSY	5K2 941 005 K	0%	687.00F
4325	1	PASSENGER AIRBAG	5K0 880 204 A	0%	1,765.00F
462	1	R/DUCT COVER	5K0 955 110 A	0%	19.00F
			GRU		
298	1	R/F AIR GUIDE GRILLE	5K0 853 666 C 9B9	0%	53.00F
322	1	R/F CTR SENSOR BRKT	5K0 919 493 G	0%	13.00F
638	1	R/F FOG LAMP	5K0 941 700 E	0%	115.00F
320	1	R/F OUT BUMPER BRKT	5K0 807 724 A	0%	18.00F
308	1	R/F OUT SENSOR BRKT	5K0 919 491 B	0%	13.00F
4662	1	R/F SEAT BELT	1K4 857 706 BN	0%	370.00F
			RAA		
844	1	R/F W-HOUSE FRT CVR	5K0 805 912 E	0%	50.00P
842	1	R/F W-HOUSE RR COVER	5K0 805 978	0%	67.00F
742	1	R/F WING	5K6 821 022 B	0%	232.00F
316	1	R/HEADLAMP MOUNTING	5K0 807 262	0%	62.00F
7754	1	R/RADIATOR AIR GUIDE	5K0 121 284 B	0%	14.00F
4952	1	R/UPP B-PILLAR TRIM	1K4 867 244 R BR2	0%	160.00*
562	1	RIGHT HEADLAMP ASSY	5K2 941 006 K	0%	687.00F
7435	1	SLIP RING	1K0 959 653 C	0%	170.00F
1000	1	SPORT RIM AFTERMKT	Renew	0%	1,000.00F
1000	1	WARNING DECAL	Renew	0%	6.50F
1000	1	WASHER JET HOSE	Renew	0%	0.00F
1000	1	WASHER JET JOINT 2	Renew	0%	12.00F
1000	1	WASHER LEVEL SENSOR	Renew	0%	0.00F
1437	1	WASHER PUMP	1K6 955 651	0%	61.00F
1000	1	WASHET JET JOINT 1	Renew	0%	8.00F
1401	1	WINDSCREEN	5K0 845 011 J NVB	0%	490.00F
1411	1	WINDSCREEN BOND KIT	D 004 660 M2	0%	0.00F
1414	1	WINDSCREEN PRIMER	D 009 200 02	0%	0.00F
f: OEM Parts			Saving		\$110.46
g: Original			Sub Total		\$16,053.00
h: Secondhand			Mark Up From Cost (5 %)		\$802.65
p: Parallel			Sundry Parts (Fixed)		\$100.00
x: Exchange			Total Parts		\$16,955.65

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
TOP UP AIRCON GAS SPECIALIST	0%	\$50.00
IU BRACKET SPECIALIST		\$10.00
AUDATEX FEE SPECIALIST	0%	\$42.00
W/S SEALANT SPECIALIST		\$40.00
L/F TYRE SPECIALIST	0%	\$111.00
L/R TYRE SPECIALIST		\$111.00
Total Extras		\$364.00

Final Calculation

Total Parts	\$16,955.65
Labour	
Total Panel/Mechanical	\$1,444.40
Total Paintwork	\$754.40
Total Visual Alignment work	\$128.80

Total Labour	\$2,327.60
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$364.00
Total of Additional Costs	\$364.00
Total Paint/Material Costs	\$270.03
Repair Costs Excludes GST	\$19,917.28
Deductions	
Deduction for Excess (Fixed)	-\$1,000.00
Total Deductions	-\$1,000.00
Grand Total Excludes GST (After Deduction)	\$18,917.28
GST @ 7 %	\$1,324.21
Grand Total Includes GST (After Deduction)	\$20,241.49

Assessment Notes

Veron Chen (LKKAUTO)

From: Jenny Lim <jenny.lim@laihuat.com.sg>
Sent: Wednesday, 16 May 2018 2:21 PM
To: Veron Chen (LKKAUTO)
Subject: RE: Finalisation - SFZ 6955Y / Volkswagen Golf GTi

Confirmed with thank, Veron.

Kind regards.

Jenny Lim
for LAI HUAT (MENG KEE) MOTOR PTE LTD
160 Sin Ming Drive
#04-01, #04-02 & #07-03
Sin Ming Autocity
Singapore 575722
Tel: 64538110
Fax: 64596267

From: Veron Chen (LKKAUTO) [mailto:veronchen@lkkauto.com]
Sent: Wednesday, 16 May, 2018 2:13 PM
To: Jenny Lim
Cc: SUR
Subject: RE: Finalisation - SFZ 6955Y / Volkswagen Golf GTi

Dear Jenny,

Offer Lump Sum \$15,900 before excess \$1000 @ 16 working days.

Please confirmed.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Kenneth Kong (LKKAUTO)
Sent: Wednesday, 9 May 2018 7:59 AM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>
Subject: FW: Finalisation - SFZ 6955Y / Volkswagen Golf GTi

From: Jenny Lim [mailto:jenny.lim@laihuat.com.sg]
Sent: Friday, 27 April, 2018 10:10 AM
To: Kenneth Kong (LKKAUTO)
Subject: Finalisation - SFZ 6955Y / Volkswagen Golf GTi

Dear Sir

For your confirmation, please:

- Parts: \$16,053.00
- 5%: \$ 802.65
- SN: \$ 464.00
- L&P: \$ 2,714.33

Sub-total: \$20,033.98

LS-20%: \$ 4,006.80 = \$16,027.18

Lump sum: \$16,000.00 / Excess cost: \$1,000.00

Supporting documents and photographs are enclose for your reference.

Thank you.

Kind regards.

Jenny Lim
for LAI HUAT (MENG KEE) MOTOR PTE LTD
160 Sin Ming Drive
#04-01, #04-02 & #07-03
Sin Ming Autocity
Singapore 575722
Tel: 64538110
Fax: 64596267

...CLAIM SUBFOLDER...(Pending for Survey Report)








CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	14 Dec 2017 Sendback Est	14 Dec 2017 09:19 \$20,851.51	14 Dec 2017 13:08 Edit Adj Rpt	\$15,900.00 Edit Estimates	\$15,900.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured:	HONG BIN, ID: S2696562D, Tel: +6598322993, Email: HONGBIN_1967@YAHOO.COM.SG								
Vehicle Reg. No.:	SFZ6955Y	Date of Loss:	09/12/2017 10:00 - :59 [98 Months and 14 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / SNM17D07042C01	Policy/Cover Note No.:	DMPCSN3065261700 (Comprehensive)						
		Excess:	S\$1,000.00						
Repairer:	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming) 160 Sin Ming Drive #04-01, Sin Ming AutoCity, 575722 Sin Ming - Tel: 64538110								
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by KENNETH KONG] ... [Final Rpt due 26/12/2017]								
Driver/Custodian:	HONG BIN (50 / Male), NRIC: S2696562D, Tel: +6598322993								
Adj Asg. Remarks:	SURVEY REVERT								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
<ul style="list-style-type: none"> CHINA_TAIPING (19/12/2017): Alert - Adj Mandate Approved (S\$16200.00) - SFZ6955Y - Claim Handler: Chong Boon... CHINA_TAIPING (15/12/2017): Alert - Adj Mandate Maintained - SFZ6955Y - Claim Handler: Chong Boon Sen 									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									
















Claim Documents

SFZ6955Y (SNM17D07042C01)
OD
Dec 9 2017 10:00AM
[HONG BIN]
Lai Huat (Meng Kee) Motor Pte Ltd

Upload Documents Upload Photos Compose New Letter		View View in Browser		
Assessment Reports		1 per page	<input checked="" type="checkbox"/>	
No	Finalized On	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)	Thumbnail	Print
1	11/12/17 18:07	Accident Statement	Load HTM	<input type="checkbox"/>
2	14/12/17 09:19	Repairer Estimates	Load HTM	<input type="checkbox"/>
LKK Auto Consultants Pte Ltd (HQ)			Thumbnail	Print
1	15/12/17 14:03	Adjuster Immediate Advice	Load HTM	<input type="checkbox"/>
2	18/12/17 15:59	Adjuster Immediate Advice	Load HTM	<input type="checkbox"/>
Photos/Images		3 per page	<input checked="" type="checkbox"/>	
No	Finalized On	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)	Thumbnail	Print
1	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
2	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
3	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
4	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
5	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
6	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
7	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
8	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
9	11/12/17 18:06	CHASSIS NUMBER [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
10	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
11	11/12/17 18:06	Accident Photo [Linked Accident Report Documents]	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
12	14/12/17 01:31	Front View Left	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
13	14/12/17 01:31	Front View Left	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
14	14/12/17 01:31	Front View Left	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
15	14/12/17 01:31	Front View Left	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
16	14/12/17 01:31	Front windscreen	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
17	14/12/17 01:31	Front View Right	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
18	14/12/17 01:31	Airbags (x2)	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
19	14/12/17 01:31	Chassis Number	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
20	14/12/17 01:31	Rear View Left	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
21	14/12/17 01:31	Rear View Left	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
22	14/12/17 01:31	Rear View Right	Load JPG <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
LKK Auto Consultants Pte Ltd (HQ)			Thumbnail	Print
1	15/12/17 14:08	SURVEY PHOTOS	Load PDF	<input type="checkbox"/>
2	11/05/18 16:21	Reinspection Photo	Load PDF	<input type="checkbox"/>
Documentation		1 per page	<input checked="" type="checkbox"/>	
No	Finalized On	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)	Thumbnail	Print
1	11/12/17 11:51	Sketch Plan [Linked Accident Report Documents]	Load TIF	<input type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)	Thumbnail	Print
2	11/12/17 11:52	INSURANCE CERTIFICATE [Linked Accident Report Documents]	 Load TIF	
3	11/12/17 11:52	DRIVER NRIC & DRIVING LICENCE [Linked Accident Report Documents]	 Load TIF	
4	14/12/17 09:18	E-filed GIA report	 Load PDF	
5	14/12/17 09:18	Driver's NRIC + Driving License	 Load PDF	
6	14/12/17 09:18	Enquire PARF / COE Rebate for Registered Vehicle	 Load PDF	
7	15/12/17 10:55	Malaysia Towing Receipt	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	15/12/17 14:05	SURVEYOR MARKING	 Load PDF	

Linked Accident Report Documents

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)	Thumbnail	Print
1	11/12/17 18:07	Accident Statement	 Load HTM	
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)	Thumbnail	Print
1	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
2	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
3	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
4	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
5	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
6	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
7	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
8	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
9	11/12/17 18:06	CHASSIS NUMBER	 Load JPG	<input checked="" type="checkbox"/>
10	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
11	11/12/17 18:06	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)	Thumbnail	Print
1	11/12/17 11:51	Sketch Plan	 Load TIF	
2	11/12/17 11:52	INSURANCE CERTIFICATE	 Load TIF	
3	11/12/17 11:52	DRIVER NRIC & DRIVING LICENCE	 Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST		Reset	Save	Print
There are no document checklists configured.				
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; margin-top: 5px;"></div>				
Show Remarks To: <input type="checkbox"/> Repairer <input type="checkbox"/> Handling Insurer Note: Remarks are private unless you show it to other parties.				

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CT117023757/KVD3E2**Date:** 23/05/2018**REFERENCE****Insured/Claimant:** HONG BIN **Policy No:** DMPCSN3065261700**Date of Loss:** 09/12/2017 **Nature of Claim:** OD **Claim No:** SNM17D07042C01**DESCRIPTION & IDENTIFICATION OF VEHICLE****Reg No:** SFZ6955Y**Make & Model:** VOLKSWAGEN GOLF, GTI 5 DR 2.0 (A)**Engine No:** CCZ019163**Reg. Date:** 25/09/2009 (Man. Year: 2009)**Chassis No:** WWWZZZ1KZAW026078**Colour:** Metallic Black**Odometer:** 109061 km**Engine Capacity:** 1984 cc**Market Value/New Car Price:** S\$42,000.00**Sum Insured (S\$):** Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition: Steering (Serviceable): Yes **Footbrake (Serviceable):** Yes
Handbrake (Serviceable): Yes **Engine Modification:** No **Pre-accident Condition:**

CONDITION OF TYRES**Front Tyre Size:** 225/40 R18**Rear Tyre Size:** 225/40 R18**Front Left Side:** Bridgestone 6 mm**Rear Left Side:** Bridgestone 4 mm**Front Right Side:** Bridgestone 6 mm**Rear Right Side:** Bridgestone 4 mm*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,130.35	15,905.65	224.70	1.39
Miscellaneous Items	1,512.00	1,414.00	98.00	6.48
Labour	3,209.16	2,597.63	611.53	19.06
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	20,851.51	19,917.28	934.23	4.48
Approved Total (Overridden) (S\$)		15,900.00		
- Excess (S\$)	1,000.00	1,000.00	0.00	0.00
(S\$)	19,851.51	14,900.00	4,951.51	24.94
+ GST 7.00/7.00% (S\$)	1,389.61	1,043.00	346.61	24.94
Nett Amount (S\$)	21,241.12	15,943.00	5,298.12	24.94

INSPECTION**Date of Assignment:** 14/12/2017 **Present Location:**

Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)

Date Inspected: 14/12/2017 **Inspected At:**160 Sin Ming Drive #04-01, Sin Ming AutoCity
Singapore 575722**Estimated Period of Repair:** 16.0 days

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 23 May 2018)
Parts: 144 VOLKSWAGEN GOLF GTI 5 DR 2.0 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SFZ6955Y)
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*AC DECAL (WCP)	Necessary	6.50 F	*6.50 F
2	1	NA	*DRIVER AIRBAG (WCP)	Burnt	1,725.00 F	*1,725.00 F
3	1	NA	*ENGINE PROTECTION (WCP)	Repair	81.00 F	*- F
4	1	NA	*FRONT BUMPER (WCP)	Cracked	480.00 F	*480.00 F
5	1	NA	*FRONT BUMPER CAP (WCP)	Missing	16.00 F	*16.00 F
6	1	NA	*FRT BUMPER C-MEMBER (WCP)	Bent	117.00 F	*117.00 F
7	1	NA	*FRT CTR BUMP SPOILER (WCP)	Missing	195.00 F	*195.00 F
8	1	NA	*FRT LOCK CARRIER (WCP)	Bent	520.00 F	*520.00 F
9	1	NA	*FRT LWR BUMP SPOILER (WCP)	Missing	195.00 F	*195.00 F
10	1	NA	*FRT SPOILER BRACKET (WCP)	Distorted	40.00 F	*40.00 F
11	1	NA	*FRT UPP BUMP SPOILER (WCP)	Missing	260.00 F	*260.00 F
12	1	NA	*H/LAMP WASHER VALVE (WCP)	Missing	27.00 F	*27.00 F
13	1	NA	*H/LAMP WASHER VALVE (WCP)	Missing	27.00 F	*27.00 F
14	1	NA	*H-LAMP WASHER PUMP (WCP)	Dented	77.00 F	*77.00 F
15	1	NA	*INSTRUMENT PANEL (WCP)	Torn	2,010.00 F	*2,010.00 F
16	1	NA	*KNEE AIRBAG (WCP)	Burnt	785.00 F	*785.00 F
17	1	NA	*L/ASSY CARRIER CONS (WCP)	Bent	296.00 F	*296.00 F
18	1	NA	*L/BUFFER (WCP)	Dented	17.00 F	*17.00 F
19	1	NA	*L/DUCT COVER (WCP)	Distorted	19.00 F	*19.00 F
20	1	NA	*L/F AIR GUIDE GRILLE (WCP)	Cracked	53.00 F	*53.00 F
21	1	NA	*L/F CENTRE SENSOR (WCP)	Torn	90.00 F	*90.00 F
22	1	NA	*L/F CTR SENSOR BRKT (WCP)	Necessary	13.00 F	*13.00 F
23	1	NA	*L/F FOG LAMP (WCP)	Missing	115.00 F	*115.00 F
24	1	NA		Distorted	60.00 F	*60.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
			*L/F GUIDE JOINT (WCP)			
25	1	NA	*L/F LEVEL SENSOR (WCP)	Missing	167.00 F	*167.00 F
26	1	NA	*L/F OUT BUMPER BRKT (WCP)	Bent	18.00 F	*18.00 F
27	1	NA	*L/F OUT SENSOR BRKT (WCP)	Missing	13.00 F	*13.00 F
28	1	NA	*L/F PARKING AID SENS (WCP)	Missing	90.00 F	*90.00 F
29	1	NA	*L/F S-ABSORB BRACKET (WCP)	Distorted	59.00 F	*59.00 F
30	1	NA	*L/F SEAT BELT (WCP)	Jammed	400.00 F	*400.00 F
31	1	NA	*L/F SHOCK ABSORBER (WCP)	Bent	566.00 F	*566.00 F
32	1	NA	*L/F SPRING LEG BRG (WCP)	Necessary	22.00 F	*22.00 F
33	1	NA	*L/F TRACK CONT ARM (WCP)	Distorted	158.00 F	*158.00 F
34	1	NA	*L/F WHEEL HUB/BRG (WCP)	Bent	198.00 F	*198.00 F
35	1	NA	*L/F W-HOUSE FRT CVR (WCP)	Bent	50.00 F	*50.00 F
36	1	NA	*L/F W-HOUSE RR COVER (WCP)	Bent	67.00 F	*67.00 F
37	1	NA	*L/F WING (WCP)	Bent	232.00 F	*232.00 F
38	1	NA	*L/FLOOR PANEL COVER (WCP)	Missing	103.00 F	*103.00 F
39	1	NA	*L/HEADLAMP MOUNTING (WCP)	Cracked	62.00 F	*62.00 F
40	1	NA	*L/LOWER SILL TRIM (WCP)	Cracked	256.00 F	*256.00 F
41	1	NA	*L/RADIATOR AIR GUIDE (WCP)	Serviceable	14.00 F	*- F
42	1	NA	*L/WHEEL BEARING HSG (WCP)	Bent	285.00 F	*285.00 F
43	1	NA	*L/WING STRUT (WCP)	Distorted	16.00 F	*16.00 F
44	1	NA	*LEFT HEADLAMP ASSY (WCP)	MTG Cracked	687.00 F	*687.00 F
45	1	NA	*PASSENGER AIRBAG (WCP)	Burnt	1,765.00 F	*1,765.00 F
46	1	NA	*R/DUCT COVER (WCP)	Missing	19.00 F	*19.00 F
47	1	NA	*R/F AIR GUIDE GRILLE (WCP)	Cracked	53.00 F	*53.00 F
48	1	NA	*R/F CTR SENSOR BRKT (WCP)	Necessary	13.00 F	*13.00 F
49	1	NA	*R/F FOG LAMP (WCP)	Missing	115.00 F	*115.00 F
50	1	NA	*R/F OUT BUMPER BRKT (WCP)	Distorted	18.00 F	*18.00 F
51	1	NA	*R/F OUT SENSOR BRKT (WCP)	Distorted	13.00 F	*13.00 F
52	1	NA	*R/F SEAT BELT (WCP)	Jammed	370.00 F	*370.00 F
53	1	NA	*R/F W-HOUSE FRT CVR (WCP)	Cut	50.00 F	*50.00 F
54	1	NA	*R/F W-HOUSE RR COVER (WCP)	Cracked	67.00 F	*67.00 F
55	1	NA	*R/F WING (WCP)	Bent	232.00 F	*232.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
56	1	NA	*R/HEADLAMP MOUNTING (WCP)	Cracked	62.00 F	*62.00 F
57	1	NA	*R/HEADLAMP WASH JET (WCP)	Serviceable	47.00 F	*- F
58	1	NA	*R/RADIATOR AIR GUIDE (WCP)	Cracked	14.00 F	*14.00 F
59	1	NA	*R/UPP B-PILLAR TRIM (WCP)	Dented	160.00 F	*160.00 F
60	1	NA	*R/WING STRUT (WCP)	Serviceable	16.00 F	*- F
61	1	NA	*RIGHT HEADLAMP ASSY (WCP)	MTG Cracked	687.00 F	*687.00 F
62	1	NA	*SLIP RING (WCP)	Necessary	170.00 F	*170.00 F
63	1	NA	*SUNDRY PARTS	Necessary	100.00 FS	*100.00 FS
64	1	NA	*WARNING DECAL (WCP)	Necessary	6.50 F	*6.50 F
65	1	NA	*WASHER BOTTLE (WCP)	Dented	75.00 F	*75.00 F
66	1	NA	*WASHER JET HOSE (WCP)	Serviceable	38.00 F	*- F
67	1	NA	*WASHER JET JOINT 2 (WCP)	Cut	12.00 F	*12.00 F
68	1	NA	*WASHER LEVEL SENSOR (WCP)	Serviceable	18.00 F	*- F
69	1	NA	*WASHER PUMP (WCP)	Cracked	61.00 F	*61.00 F
70	1	NA	*WASHET JET JOINT 1 (WCP)	Necessary	8.00 F	*8.00 F
71	1	NA	*WINDSCREEN (WCP)	Cracked	490.00 F	*490.00 F

F=Franchise part. S=SpcNett.

Sub Total (\$\$)	15,367.00	15,153.00
+ Margin on L,N Items 5.00/5.00% (\$\$)	763.35	752.65
Total Parts (\$\$)	16,130.35	15,905.65

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	AIR CON GAS	50.00	50.00
2	1	AUDATEX FEE	42.00	42.00
3	1	IU BRACKET	10.00	10.00
4	1	L/F TYRE (PUNCTURED) (60%)	185.00	111.00
5	1	L/R TYRE (CUT) (60%)	185.00	111.00
6	1	SPORT RIM (AFTER MARKET) (DENTED)(WCP)	1,000.00	1,050.00
7	1	W/S SEALANT (NECESSARY)	40.00	40.00
Sub Total (S\$)			1,512.00	1,414.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	887.80	754.40
2	Total Paint Materials	New	292.76	270.03
3	Total Panel/Mechanical Labour	New	2,028.60	1,573.20
Gross Labour Cost (S\$)			3,209.16	2,597.63

Report was unsubmitted during this print-out.

< END OF ESTIMATES >