

ASS. REC. BY:

REF: CS/SPF18000586/Tirber

Special Instruction:

SENAJOY:

ASSIGNMENT (Office)From (Person): Lim Wei Yea of SPF Date/Time: 10012018 1009am

Estimated Cost: _____ Bill to: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV/CSTo Inspect Vehicle No: GBC 7544L Insured: _____at Workshop m/s SMRT Tel: _____of 60 Woodland Ind Park EllPolicy No: _____ Claim No: H0MSPFETQ16000399

Sum Insured: _____ Excess: _____

Make of Veh: _____ D.O.A. _____
(Client's Record)

CA / REV / REP. / REV 24 HRS

12.01.2017

H.O.D. Endorsement: _____

Date/Time: _____ Person Contacted: _____ Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	<u>GBC 7544L - CS/SPF1703793 / Ag</u> <u>DOB: 13-12-2017</u>
<u>16/1/18</u>	<u>Sent pm to Wei Yea</u>
<u>18/1/18</u>	<u>Wei Yea called to justify condition "cut" and "unconfirm"</u>
	<u>According Wei Yea, they will ask repairer to proceed and will arrange</u>
	<u>resurvey with us.</u>

Tanph

SPF

Mr Kong 98576861

Date 11/01/2018

GBC 7544L

Estimate No.

① 11/01/2018

Vehicle Make

GBC 7544L

Vehicle Model

SMRT

60 Woodlands Ind. Prk. E4

Vehicle

Registration

Damage

Substance


Excess

Damage Report

Date of Loss

Policy Condition

Remarks: The vehicle had commenced its
recall at the time of inspection

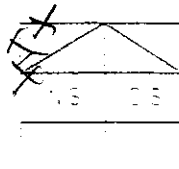

Estimate/Repair

DAG Accident Report

Consistent? Yes or No

DAG Rep. Seen

Consistent? Yes or No

Est. Repairs

days

Repair

Yes or No

Est. Sum

days

Repair

Yes or No

Est. Rep.

Rep.

21/1/18

Vehicle Amount

Date

Person Contacted

Date Time

Person Contacted

Vehicle

Make

Mercedes Benz Vito

2143

Color

White

Registration

44116

Engine

Drive

WDF 6396032380390

Body Type

Steering: Power Jammed Leaked Burnt

Brake: Power Jammed Leaked Burnt

Wheels: ① SPH STD 4.5

Tire Size

225/60R16

Front

BS: DUN EXNO. 4 34 FS L24 MO C-76L PP SUV

TOYO YOKO

Finanz

Exterior

Front

6

Left

6

Right

6

Survey Report

Des of Damages: Fr. Rear DS NS LC Roofhood

Fr + N/S, 4/L

The L/C: Inside frame Body Structure affected

Accordingly Uni Year, we can submit report

Submit parts \$ 24,610.95, man-hour 133.50 hour

RECEIVED 11/01/2018

Final Report



Final Report

Final Report

Days Of Repair

Resurvey, No. of Times

350

Add Fee



Final Report

Final Report

Final Report

Final Report

Final Report

350



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTOMOTIVE ENGINEERING & MGT DIVISION

Ref : CS/SPF18000586/T1rb

CONTRACT MANAGEMENT SECTION
(SINGAPORE POLICE FORCE)

1 MOUNT PLEASANT ROAD

BLK 8 OLD POLICE ACADEMYSINGAPORE 298333

Date : 10-01-2018



Code : SPF3

1. Policy Particulars - OWN DAMAGE

Insured Veh.	Veh. Inspected	GBC 7544L
Policy No.	Coverage (\$)	0.00
Claim No. HOMSPFETQ16000399	Excess (\$)	0.00
Assign From LIM WEI YEA	Assign Date	10/01/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No. HIDDEN	Year of Reg.	
Chassis No.	Colour	
Odometer	Steering	
Brakes	Modification	
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	Inspection Date	11/01/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705	

5a. Remarks

- A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

Catherine Chong (LKK Auto)

From: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>
Sent: Wednesday, 10 January, 2018 10:07 AM
To: assignments
Cc: Kim Pang CHAY (SPF); Kwee Huat TAN (SPF); Perry HE (SPF); Bernard SEAH (SPF); Peng Seng NG (SPF); Rashid ABU HASAN (SPF); 'Ai Phing (LKKAuto)'; 'Shiau Chan (LKKAuto)'
Subject: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (GBC7544L)
Attachments: GBC7544L.xlsx

Hi Catherine,

Please provide Appraisal Services for SPF vehicle, **GBC 7544L (MB Vito)**, at SMRT Automotive Services. In attached, please find the recommended Parts and Labour for the repair of this vehicle.

Kindly contact the following SMRT personnel for viewing of the damaged vehicle:

- Mr Kong Sew Kui
- Mr Jason Yeo

Thank you and best regards,



WeiYea LIM
Contract Management
AEMD, PLD
Singapore Police Force
DID: (65) 6478 4844 | FAX: (65) 6478 4838



Together We Keep Our Home Safe and Secure

Join us at the **HOME TEAM SHOW & FESTIVAL**
at the Singapore Sports Hub from 3 – 7 May.
Find out more at www.htfest2017.sg

WARNING "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	BONNET	1	BENT	\$596.70	\$596.70	
1.2	L/H BONNET HINGE	1	BENT	\$76.05	\$76.05	
1.3	R/H BONNET HINGE	1	BENT	\$76.05	\$76.05	
1.4	FRONT BUMPER	1	DENT	\$409.50	\$409.50	
1.5	FRONT BUMPER RETAINER LH & RH	2	NECESSARY	\$40.95	\$81.90	
1.6	FRONT BUMPER SUPPORT	1	CRACKED	\$754.65	\$754.65	
1.7	FRONT BUMPER CENTRE GARNISH	1	CRACKED	\$491.40	\$491.40	
1.8	RADIATOR GRILL	1	CUT	\$99.45	\$99.45	
1.9	FRONT SUPPORT PANEL	1	DISTORTED	\$585.00	\$585.00	
1.10	L/H HEAD LAMP	1	CRACKED	\$702.00	\$702.00	
1.11	L/H FENDER	1	BUCKLED	\$637.65	\$637.65	
1.12	L/H FENDER SIGNAL	1	CRACKED	\$29.25	\$29.25	
1.13	L/H FENDER PANEL	1	BENT	\$438.75	\$438.75	
1.14	L/H DOOR SHELL	1	BENT	\$1,170.00	\$1,170.00	
1.15	L/H DOOR PROTECTOR	1	CUT	\$140.40	\$140.40	
1.16	L/H DOOR UPPER HINGE	1	UNCONFIRM	\$134.55	\$134.55	
1.17	L/H DOOR LOWER HINGE	1	UNCONFIRM	\$134.55	\$134.55	
1.18	L/H QUARTER GLASS MOULDING	1	DENT	\$52.65	\$52.65	
1.19	AIR CON PIPE	2	UNCONFIRM	\$210.60	\$421.20	
1.20	ECU CONTROL UNIT BOX	1	CRACKED	\$339.30	\$339.30	
1.21	FRONT TYRE	2	UNCONFIRM	\$169.65	\$339.30	
1.22	L/H RIM	1	BENT	\$468.00	\$468.00	
1.23	L/H WHEEL CAP	1	CRACKED	\$216.45	\$216.45	
1.24	L/H SHOCK ABSORBER	1	UNCONFIRM	\$555.75	\$555.75	
1.25	L/H LOWER ARM	1	UNCONFIRM	\$1,006.20	\$1,006.20	
1.26	L/H KNUCKLE ARM AND BEARING	1	UNCONFIRM	\$1,807.65	\$1,807.65	
1.27	STABILIZER BAR	1	UNCONFIRM	\$333.45	\$333.45	
1.28	STABILIZER BAR LINK	1	UNCONFIRM	\$93.60	\$93.60	
1.29	STEERING RACK	1	UNCONFIRM	\$5,019.30	\$5,019.30	
1.30	TIE ROD END	1	UNCONFIRM	\$152.10	\$152.10	
1.31	STEERING AIR BAG	1	CUT	\$2,340.00	\$2,340.00	
1.32	STEERING AIR BAG CLOCK SPRING	1	CUT	\$286.65	\$286.65	
1.33	PASSENGER AIR BAG	1	CUT	\$2,340.00	\$2,340.00	
1.34	DASH BOARD	1	CUT	\$1,638.00	\$1,638.00	
1.35	PASSENGER SAFETY BELT	1	NOT NECESSARY	\$643.50		
1.36	DRIVER SAFETY BELT	1	CUT	\$643.50	\$643.50	
	COSTING		TOTAL PARTS COST		\$24,610.95	

2	SCOPE OF REPAIRS				
2.1	Front Bonnet				12
	Remove and replace bonnet				
	Remove and replace both bonnet hinge				
	Putty and spray paint bonnet (3 colour)				
2.2	Front Bumper				10
	Remove and replace front bumper				
	Remove and replace both front bumper retainer				
	Remove and replace front bumper support				
	Replace front bumper centre garnish				
	Putty and spray paint front bumper				
2.3	Remove and replace radiator grill				0.50
2.4	Remove and replace L/H head lamp				1
2.5	Front Fender				8
	Remove and replace L/H fender				
	Remove and replace L/H fender signal				
	Remove and replace L/H panel				
	Putty and spray paint L/H fender and panel				
2.6	Front Door LH				26
	Remove and replace L/H door shell				
	Remove and transfer L/H door existing door accessory to new door				
	Panel beat and align L/H door pillar				
	Remove and replace L/H door upper and lower hinge				
	Replace L/H door protector				
	Putty and spray paint L/H door				
2.7	Panel beat L/H door rocker panel				8
	Putty and spray paint L/H door rocker panel				
2.8	Front Quarter Glass LH				2
	Remove and re-install quarter glass				
	Replace quarter glass moulding				
2.9	Vehicle Air Con				3
	Remove and replace air con pipe				
	Top up air con gas				
2.10	ECU				13
	Remove and replace ECU control unit box				
	Labour for wiring				
	Computerise reprogramming				
2.11	Undercarriage		UNCONFIRM		15
	Remove and replace front both tyre				
	Replace L/H tyre rim cap				
	Remove and replace L/H shock absorber				
	Remove and replace L/H shock upper arm				
	Remove and replace L/H knuckle arm and bearing				
	Remove and replace stabilizer bar				
	Remove and replace stabilizer bar link				
2.12	Steering Assy		UNCONFIRM		6
	Remove and replace steering rack				
	Remove and replace tie rock end				
2.13	Air Bags				10
	Remove and replace steering air bag				
	Remove and replace steering clock spring				
	Remove and replace passenger air bag				
	Computerise reprogramming				
2.14	Remove and replace dash board				12
2.15	Safety Belt Assy				1
	Remove and replace passenger safety belt				
	Remove and replace driver safety belt				
2.16	Labour for wheel alignment				3
2.17	Diagnose & reset all wiring				3
	COSTING		TOTAL MAN-HOUR		133.50



Scope Of Work
Home Team Agency

SCOPE OF WORK


1 To provide labour, materials, transportation, tools and parts and others deemed necessary to carry out the following repairs:

CONTRACTOR	SMRT	VEH TYPE :	VAN	UNIT	D/ST
VEH NO :	GBC 7544 L				
VEH MAKE/MODEL	MERCEDES BENZ VITO				
		REPAIR TYPE:	ACCIDENT		
		ODOMETER:	44116		

Reference No.
7544/SPF/4W/18/01/08

S/N	PARTS DESCRIPTION	PART COST (\$)	QTY	Mark Up Rate	Parts Cost Per Unit After Mark	Total Parts Cost Per Unit After Mark Up (\$)
1	Scope Of Repairs					
1.1	Honnet	\$510.00	1	17%	596.70	596.70
1.2	LH bonnet hinge	\$65.00	1	17%	76.05	76.05
1.3	RH bonnet hinge	\$65.00	1	17%	76.05	76.05
1.4	Front bumper	\$350.00	1	17%	409.50	409.50
1.5	Front bumper retainer LH & RH	\$35.00	2	17%	40.95	81.90
1.6	Front bumper support	\$645.00	1	17%	754.65	754.65
1.7	Front bumper centre garnish	\$420.00	1	17%	491.40	491.40
1.8	Radiator grill	\$85.00	1	17%	99.45	99.45
1.9	Front support panel	\$500.00	1	17%	585.00	585.00
1.10	LH head lamp	\$600.00	1	17%	702.00	702.00
1.11	LH fender	\$545.00	1	17%	637.65	637.65
1.12	LH fender signal	\$25.00	1	17%	29.25	29.25
1.13	LH fender panel	\$375.00	1	17%	438.75	438.75
1.14	LH door shell	\$1,000.00	1	17%	1,170.00	1,170.00
1.15	LH door protector	\$120.00	1	17%	140.40	140.40
1.16	LH door upper hinge	\$115.00	1	17%	134.55	134.55
1.17	LH door lower hinge	\$115.00	1	17%	134.55	134.55
1.18	LH quarter glass moulding	\$45.00	1	17%	52.65	52.65
1.19	Air con pipe	\$180.00	2	17%	210.60	421.20
1.20	ECU control unit box	\$290.00	1	17%	339.30	339.30
1.21	Front tyre	\$145.00	2	17%	169.65	339.30
1.22	LH rim	\$400.00	1	17%	468.00	468.00
1.23	LH wheel cap	\$185.00	1	17%	216.45	216.45
1.24	LH shock absorber	\$475.00	1	17%	555.75	555.75
1.25	LH lower arm	\$860.00	1	17%	1,006.20	1,006.20
1.26	LH knuckle arm and bearing	\$1,545.00	1	17%	1,807.65	1,807.65
1.27	Stabilizer bar	\$285.00	1	17%	333.45	333.45
1.28	Stabilizer bar link	\$80.00	1	17%	93.60	93.60
1.29	Steering rack	\$4,290.00	1	17%	5,019.30	5,019.30
1.30	Tie rod end	\$130.00	1	17%	152.10	152.10
1.31	Steering air bag	\$2,000.00	1	17%	2,340.00	2,340.00
1.32	Steering air bag clock spring	\$245.00	1	17%	286.65	286.65
1.33	Passenger air bag	\$2,000.00	1	17%	2,340.00	2,340.00
1.34	Dash board	\$1,400.00	1	17%	1,638.00	1,638.00
1.35	Passenger safety belt	\$550.00	1	17%	643.50	643.50
1.36	Driver safety belt	\$550.00	1	17%	643.50	643.50
2	Additional Services					
2.1	NA			0%	0.00	0.00
Remarks:					Parts Total:	23,546.45

S/N	LABOUR DESCRIPTION	Man-Hour Rate (\$)	Man-Hour Qty	Total Man-Hour Cost (\$)
1	Scope Of Repairs			
1.1	Front Bonnet	59.00	12	826.00
	Remove and replace bonnet			
	Remove and replace both bonnet hinge			
	Putty and spray paint bonnet (3 colour)			
1.2	Front Bumper	59.00	10	708.00
	Remove and replace front bumper			
	Remove and replace both front bumper retainer			
	Remove and replace front bumper support			
	Replace front bumper centre garnish			
	Putty and spray paint front bumper			
1.3	Remove and replace radiator grill	59.00	0.5	59.00
1.4	Remove and replace LH head lamp	59.00	1	59.00
1.5	Front Fender	59.00	8	472.00
	Remove and replace L.H fender			
	Remove and replace L.H fender signal			
	Remove and replace L.H panel			
	Putty and spray paint L.H fender and panel (2 colour)			
1.6	Front Door LH	59.00	26	1770.00
	Remove and replace L.H door shell			
	Remove and transfer L.H door existing door accessory to new door			
	Panel beat and align L.H door pillar			
	Remove and replace L.H door upper and lower hinge			
	Replace L.H door protector			
	Putty and spray paint L.H door			

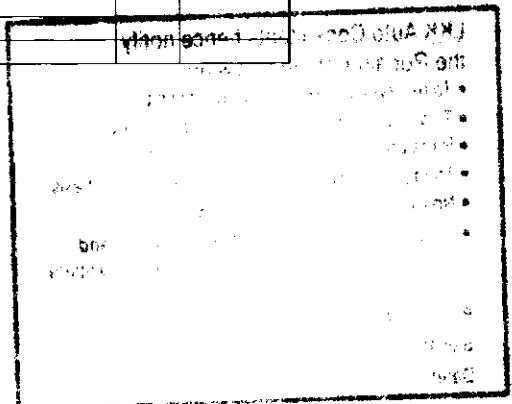

Janice Lee (LKKAUTO)

From: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>
Sent: Thursday, January 18, 2018 2:27 PM
To: Janice Lee (LKKAUTO)
Cc: Kim Pang CHAY (SPF); Kwee Huat TAN (SPF); Perry HE (SPF); Bernard SEAH (SPF); Peng Seng NG (SPF); Rashid ABU HASAN (SPF); assignments; SUR
Subject: RE: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX46R & GBC7544L)
Attachments: GBC 7544L.xls

Hi Janice,

In the excel table, I saw that you have indicated "Cut" and "Unconfirm" under the "Condition" column in the Material section.

Need your kind help to understand:

- 1) What is meant by "Cut"?
- 2) How to determine the items, which are "Unconfirm", if it is necessary for them to be changed?

Thanks to advise.

Thank you and best regards,

The description of cut refers to the items being crack/broken/torn ie ~~damaged~~ damaged.

These items will have to be ~~checked~~ further checked

before ~~disassembly~~ dismantling and further checks.

to verify whether need to be changed.



WeiYea LIM
Contract Management
AEMD, PLD
Singapore Police Force
DID: (65) 6478 4844 | FAX: (65) 6478 4838

NS50



Together We Keep Our Home Safe and Secure
Join us at the HOME TEAM SHOW & FESTIVAL
at the Singapore Sports Hub from 3 - 7 May.
Find out more at www.htfest2017.sg

WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

From: Janice Lee (LKKAUTO) [mailto:JaniceLee@lkkauto.com]
Sent: Tuesday, 16 January, 2018 2:13 PM
To: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>
Cc: Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; Perry HE (SPF) <Perry_HE@spf.gov.sg>; Bernard SEAH (SPF) <Bernard_SEAH@spf.gov.sg>; Peng Seng NG (SPF) <NG_Peng_Seng@spf.gov.sg>; Rashid ABU HASAN (SPF) <Rashid_Abu_Hasan@spf.gov.sg>; assignments <assignments@lkkauto.com>; SUR <sur@lkkauto.com>
Subject: RE: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX46R & GBC7544L)

Janice Lee (LKKAUTO)

From: Janice Lee (LKKAUTO)
Sent: Thursday, January 18, 2018 2:44 PM
To: 'Wei Yea LIM (SPF)'
Cc: Kim Pang CHAY (SPF); Kwee Huat TAN (SPF); Perry HE (SPF); Bernard SEAH (SPF); Peng Seng NG (SPF); Rashid ABU HASAN (SPF); assignments; SUR
Subject: RE: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX46R & GBC7544L)

Dear Wei Yea,

- 1) What is meant by "Cut"?
 - The description of cut refers to the items being crack/ broken/ torn. Ie. Damaged
- 2) How to determine the items, which are "Unconfirm", if it is necessary for them to be changed?
 - These items will have to be further check upon dismantling to verify whether need to be changed.

Thank you.

Best Regards,

Janice Lee (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: janicelee@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Wei Yea LIM (SPF) [mailto:LIM_Wei_Yea@spf.gov.sg]
Sent: Thursday, January 18, 2018 2:27 PM
To: Janice Lee (LKKAUTO) <JaniceLee@lkkauto.com>
Cc: Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; Perry HE (SPF) <Perry_HE@spf.gov.sg>; Bernard SEAH (SPF) <Bernard_SEAH@spf.gov.sg>; Peng Seng NG (SPF) <NG_Peng_Seng@spf.gov.sg>; Rashid ABU HASAN (SPF) <Rashid_Abu_Hasan@spf.gov.sg>; assignments <assignments@lkkauto.com>; SUR <sur@lkkauto.com>
Subject: RE: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX46R & GBC7544L)

Hi Janice,

In the excel table, I saw that you have indicated "Cut" and "Unconfirm" under the "Condition" column in the Material section.

Need your kind help to understand:

- 1) What is meant by "Cut"?
- 2) How to determine the items, which are "Unconfirm", if it is necessary for them to be changed?

Thanks to advise.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AUTOMOTIVE ENGINEERING & MGT DIVISION		Ref : CS/SPF18000586/T1rbe2		
CONTRACT MANAGEMENT SECTION (SINGAPORE POLICE FORCE) 1 MOUNT PLEASANT ROAD BLK 8 OLD POLICE ACADEMYSINGAPORE 298333		Date : 21-03-2018		
		Code : SPF3		
1. Policy Particulars :- OWN DAMAGE				
	Insured Veh.	Veh. Inspected	GBC 7544L	
	Policy No.	Coverage (\$)	0.00	
	Claim No. HOMSPFETQ16000399	Excess (\$)	0.00	
	Assign From LIM WEI YEA	Assign Date	10/01/2018	
2. Vehicle Particulars & Condition				
	Make & Model	MERCEDES BENZ VITO	c.c	2143
	Engine No.	HIDDEN	Year of Reg.	2013
	Chassis No.	WDF63960323803790	Colour	WHITE
	Odometer	44116	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	225/60 R16	FIRENZA	6 mm
	L/H Front Tyre	225/60 R16	FIRENZA	6 mm
	R/H Rear Tyre	225/60 R16	FIRENZA	6 mm
	L/H Rear Tyre	225/60 R16	FIRENZA	6 mm
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S AND UNDERCARRIAGE PORTION. DAMAGES SEE DETAILS.				
5. General Information				
	Accident Date	Inspection Date	12/01/2018	
	Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks				



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Registration No. GBC 7544L

S/N	ITEM DESCRIPTION	PARTS				MAN- HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	BONNET	1	BENT	\$596.70	\$596.70	
1.2	L/H BONNET HINGE	1	BENT	\$76.05	\$76.05	
1.3	R/H BONNET HINGE	1	BENT	\$76.05	\$76.05	
1.4	FRONT BUMPER	1	DENT	\$409.50	\$409.50	
1.5	FRONT BUMPER RETAINER LH & RH	2	NECESSARY	\$40.95	\$81.90	
1.6	FRONT BUMPER SUPPORT	1	CRACKED	\$754.65	\$754.65	
1.7	FRONT BUMPER CENTRE GARNISH	1	CRACKED	\$491.40	\$491.40	
1.8	RADIATOR GRILL	1	CUT	\$99.45	\$99.45	
1.9	FRONT SUPPORT PANEL	1	DISTORTED	\$585.00	\$585.00	
1.10	L/H HEAD LAMP	1	CRACKED	\$702.00	\$702.00	
1.11	L/H FENDER	1	BUCKLED	\$637.65	\$637.65	
1.12	L/H FENDER SIGNAL	1	CRACKED	\$29.25	\$29.25	
1.13	L/H FENDER PANEL	1	BENT	\$438.75	\$438.75	
1.14	L/H DOOR SHELL	1	BENT	\$1,170.00	\$1,170.00	
1.15	L/H DOOR PROTECTOR	1	CUT	\$140.40	\$140.40	
1.16	L/H DOOR UPPER HINGE	1	UNCONFIRM	\$134.55	\$134.55	
1.17	L/H DOOR LOWER HINGE	1	UNCONFIRM	\$134.55	\$134.55	
1.18	L/H QUARTER GLASS MOULDING	1	DENT	\$52.65	\$52.65	
1.19	AIR CON PIPE	2	UNCONFIRM	\$210.60	\$421.20	
1.20	ECU CONTROL UNIT BOX	1	CRACKED	\$339.30	\$339.30	
1.21	FRONT TYRE	2	UNCONFIRM	\$169.65	\$339.30	
1.22	L/H RIM	1	BENT	\$468.00	\$468.00	
1.23	L/H WHEEL CAP	1	CRACKED	\$216.45	\$216.45	
1.24	L/H SHOCK ABSORBER	1	UNCONFIRM	\$555.75	\$555.75	
1.25	L/H LOWER ARM	1	UNCONFIRM	\$1,006.20	\$1,006.20	
1.26	L/H KNUCKLE ARM AND BEARING	1	UNCONFIRM	\$1,807.65	\$1,807.65	
1.27	STABILIZER BAR	1	UNCONFIRM	\$333.45	\$333.45	
1.28	STABILIZER BAR LINK	1	UNCONFIRM	\$93.60	\$93.60	

1.29	STEERING RACK	1	UNCONFIRM	\$5,019.30	\$5,019.30	
1.30	TIE ROD END	1	UNCONFIRM	\$152.10	\$152.10	
1.31	STEERING AIR BAG	1	CUT	\$2,340.00	\$2,340.00	
1.32	STEERING AIR BAG CLOCK SPRING	1	CUT	\$286.65	\$286.65	
1.33	PASSENGER AIR BAG	1	CUT	\$2,340.00	\$2,340.00	
1.34	DASH BOARD	1	CUT	\$1,638.00	\$1,638.00	
1.35	PASSENGER SAFETY BELT	1	NOT NECESSARY	\$643.50		
1.36	DRIVER SAFETY BELT	1	CUT	\$643.50	\$643.50	
	COSTING		TOTAL PARTS COST		\$24,610.95	
2	SCOPE OF REPAIRS					
2.1	Front Bonnet					12
	Remove and replace bonnet					
	Remove and replace both bonnet hinge					
	Putty and spray paint bonnet (3 colour)					
2.2	Front Bumper					10
	Remove and replace front bumper					
	Remove and replace both front bumper retainer					
	Remove and replace front bumper support					
	Replace front bumper centre garnish					
	Putty and spray paint front bumper					
2.3	Remove and replace radiator grill					0.50
2.4	Remove and replace L/H head lamp					1
2.5	Front Fender					8
	Remove and replace L/H fender					
	Remove and replace L/H fender signal					
	Remove and replace L/H panel					
	Putty and spray paint L/H fender and panel					
2.6	Front Door LH					26
	Remove and replace L/H door shell					
	Remove and transfer L/H door existing door accessory to new door					
	Panel beat and align L/H door pillar					
	Remove and replace L/H door upper and lower hinge					
	Replace L/H door protector					
	Putty and spray paint L/H door					
2.7	Panel beat L/H door rocker panel					8
	Putty and spray paint L/H door rocker panel					

2.8	Front Quarter Glass LH					2
	Remove and re-install quarter glass					
	Replace quarter glass moulding					
2.9	Vehicle Air Con					3
	Remove and replace air con pipe					
	Top up air con gas					
2.10	ECU					13
	Remove and replace ECU control unit box					
	Labour for wiring					
	Computerise reprogramming					
2.11	Undercarriage		UNCONFIRM			15
	Remove and replace front both tyre					
	Replace L/H tyre rim cap					
	Remove and replace L/H shock absorber					
	Remove and replace L/H shock upper arm					
	Remove and replace L/H knuckle arm and bearing					
	Remove and replace stabilizer bar					
	Remove and replace stabilizer bar link					
2.12	Steering Assy		UNCONFIRM			6
	Remove and replace steering rack					
	Remove and replace tie rock end					
2.13	Air Bags					10
	Remove and replace steering air bag					
	Remove and replace steering clock spring					
	Remove and replace passenger air bag					
	Computerise reprogramming					
2.14	Remove and replace dash board					12
2.15	Safety Belt Assy					1
	Remove and replace passenger safety belt					
	Remove and replace driver safety belt					
2.16	Labour for wheel alignment					3
2.17	Diagnose & reset all wiring					3
COSTING		TOTAL MAN-HOUR				133.50

Registration No. GBC 7544L

Registration No. GBC 7544L

Vehicle Inspected By

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

ADRIAN LING WAI PING

B.Eng, AMSOE, AMIRTE, AMSAE-A, M. MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.