

Accident Photo



Accident Photo



CHASSIS NO



Accident Photo



Accident Photo




Accident Photo



Accident Photo



PRIVATE HIRE

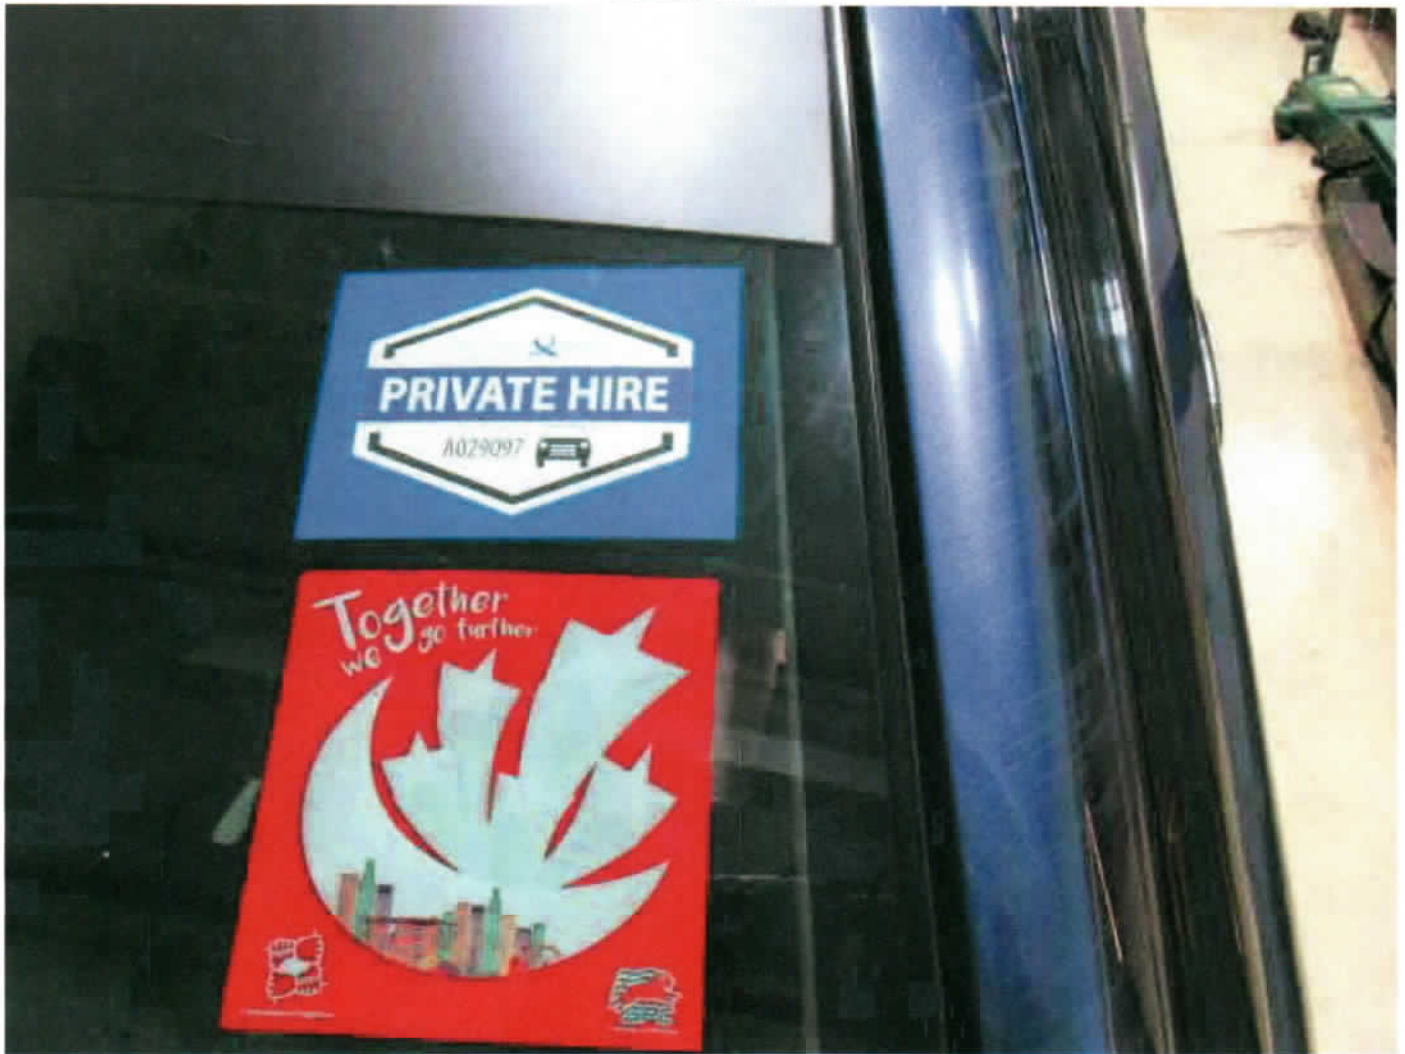




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
ECICS LTD		Ref : CS3/ICS17017860/M1vbe2-1		
7 TEMASEK BOULEVARD #10-01 SUNTEC TOWER ONE SINGAPORE 038987		Date : 31-01-2018		
		Code : ICS		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SGY 1120D	Veh. Inspected	SGE 1969P	
Policy No.	MPU17A00122100	Coverage (\$)	0.00	
Claim No.	DMPU1700495H	Excess (\$)	0.00	
Assign From	LIONEL CHUA	Assign Date	22/01/2018	
2. Vehicle Particulars & Condition				
Make & Model	SUZUKI APV	c.c	1590	
Engine No.	HIDDEN	Year of Reg.	2010	
Chassis No.	MHYGDN71V00302208	Colour	GREY	
Odometer	200095	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/70 R14	YOKOHAMA	8 mm	
L/H Front Tyre	185/70 R14	YOKOHAMA	8 mm	
R/H Rear Tyre	185/70 R14	YOKOHAMA	8 mm	
L/H Rear Tyre	185/70 R14	YOKOHAMA	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	09/09/2017	Inspection Date	18/09/2017	
Survey held at	160 SIN MING DRIVE #06-07 575722			
Repairer	YI MEI MOTOR REPAIR & SPRAY PAINTING			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGE 1969P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BACK DOOR ASSEMBLY	N/S BADLY DENTED	931.65	931.65
1	BACK DOOR S EMBLEM	NECESSARY	16.75	16.75
1	BACK DOOR APV EMBLEM	NECESSARY	18.05	18.05
1	BACK DOOR OUTER CHROME GARNISH	HOLDER CRACKED	138.70	138.70
1	BACK DOOR INNER LOCK	NOT NECESSARY	177.20	-
1	REAR COMBINATION LAMP - N/S	CRACKED	180.85	180.85
1	REAR END OUTER PANEL	N/S BADLY DENTED	147.85	147.85
1	BACK DOOR LOCK STRIKER	NOT NECESSARY	32.95	-
1	BACK DOOR ENTRANCE WEATHER-STRIP	SERVICEABLE	153.00	-
1	REAR BUMPER FACE	DENTED / DEFORMED	665.85	665.85
4	REAR BUMPER CLIP @\$3.50	NECESSARY	14.00	14.00
1	REAR BUMPER REFLECTOR - N/S	SERVICEABLE	14.75	-
1	SPARE WHEEL CARRIER	SERVICEABLE	118.25	-
1	SPARE WHEEL CARRIER LOCKING BOLT	NOT NECESSARY	28.50	-
	LESS 15% DISCOUNT		-395.75	-317.05
			2,242.60	1,796.65
<u>SPECIAL NETT ITEMS</u>				
1	BACK DOOR INNER SEALANT (SN)	NECESSARY	80.00	60.00
1	BACK DOOR WINDSHIELD GLASS SEALANT (SN)	NECESSARY	80.00	60.00
1	BACK DOOR WINDSHIELD RUBBER DAM (SN)	NOT NECESSARY	60.00	-
1	REAR LICENSE PLATE WITH CASING (SN)	NOT NECESSARY	70.00	-
1	REAR END OUTER PANEL JOINT SEALANT (SN)	NECESSARY	80.00	60.00
1	REAR BODY PANEL WINDOW GLASS SEALANT - N/S (SN)	NOT NECESSARY	80.00	-
1	SET REVERSE SENSOR (SN)	N/S DENTED	300.00	220.00
			750.00	400.00
<u>LABOUR</u>				
	TO CUT / WELD REAR END OUTER PANEL TO RENEW AND REPAIR LEFT REAR BODY PANEL INCLUDING REPLACEMENT OF THE LEFT REAR ACCIDENT DAMAGED PARTS.		1,500.00	800.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE / INSTALL BACK DOOR WINDSHIELD GLASS TO FACILITATE THE REPLACEMENT OF THE BACK DOOR PANEL INCLUDE PERFORMING WATER LEAKAGE TEST.		150.00	100.00
	TO TRANSFER BACK DOOR LOCKING MECHANISM AND OTHER COMPONENTS TO NEW BACK DOOR PANEL INCLUDE CHECKING COMPONENTS FOR FUNCTION.		120.00	60.00
	TO REMOVE /INSTALL TRUNK COMPARTMENT PANEL TRIM FINISHERS, GARNISHES AND UPHOLSTERY TO FACILITATE THE REPLACEMENT OF THE REAR END OUTER PANEL.	NOT NECESSARY	300.00	-
	TO CHECK REAR LIGHTINGS AND ELECTRICAL WIRING SYSTEMS INCLUDE PERFORMING WATER LEAKAGE TEST.		80.00	30.00
	TO REMOVE / INSTALL LEFT REAR BODY PANEL WINDOW GLASS TO FACILITATE THE REPAIRING OF THE LEFT REAR BODY PANEL INCLUDE PERFORMING WATER LEAKAGE TEST.	NOT NECESSARY	120.00	-
	TO INSTALL REAR BUMPER REVERSE SENSORS TO NEW BUMPER FACE INCLUDE TESTING FOR FUNCTIONS.		80.00	60.00
	TO PUTTY AND RE-SPRAY PAINTING ON BACK DOOR, REAR END OUTER PANEL, LEFT REAR BODY PANEL AND REAR BUMPER FACE.		1,120.00	700.00
	RUST-PROOFING ON THE LEFT REAR ACCIDENT AFFECTED PORTIONS.		120.00	40.00
			3,590.00	1,790.00
	GRAND TOTAL		6,582.60	3,986.65
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,200.00

Report Ref No. CS3/ICS17017860/M1vbe2-1

MA CHIN FOOK

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.