

A.S.S. R.F.C. BY:

REF: CS/CTU8005298/Kvbz

Special Instruction:

Survivor:
Merimen

Kenneth

ASSIGNMENT (Office)

From (Person):

Adeline Ching

of

CTU

Date/Time:

21/03/2018 3:22pm

Estimated Cost:

Bill to:

OD / IP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLK 5079 R

Insured:

at Workshop m/s

Cheng Hoe Motor

Tel:

6481 2001

of

Blk 10 Amk Ind Park 2A #01-04

Policy No:

DMHCSN1708051801

Claim No:

SNM18DD01170 C01

Sum Insured:

Excess:

\$ 1000.00

Make of Veh:

D.O.A.

19/03/2018

(Client's Record)

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

21/03/2018 25:44pm

Person Contacted:

Dorlyn

Vehicle (IN) OUT

Date/Time	Action/Instruction (✓) Estimate
	SLK 5079 R - X
22/3/18	Revert by merimen
23/3/18	Rece approved \$7308.09 from Shiang Yi by merimen
23/3/18	@1206pm Informed Dorlyn c/A ex \$1000 by email
6/4/18	Kenneth confirmed \$7101.29 (Red 316, 490)

ASS. REC. BY:

REF: CT11

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: 870k

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 8 days Res.: Yes or No

Lum Sum: 1.31 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLK 5079R Yr Regn: 01, 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Mazda 2 c.c: 1496

Colour: M.P. White A/C: Insured / Std / NI / NA

Sp. Reading: 83452 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: MM 602 25A AG-W 191388

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: NII / S/Rim / STD / Rim or

Tyre Size: P. Maximus 195/60R16

R: Dun

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 9 mm

L/Bal. 9 mm

D.O.A. 19/3/18


Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
22/3	File pass to Corbin

RECEIVED 2 APR 2018

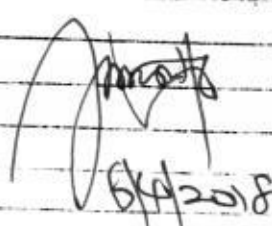

Date/Time, File Pass to?

☐: Prel. Report

1)

☐: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 8

Resurvey No. of Trip: 2

Add Fee: ☐: Site Insp (\$)☐: Interview (\$)☐: Tech Invs (\$)☐: Weekend (\$)

Survey Fee:

Transportation:

\$ + RS. \$

Photos

Others

TOTAL

220

Report Format:

Lump Sum / I.B.I: (\$)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD			Ref : CS/CTI18005298/Kvb	
3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Date : 21-03-2018	
			Code : CTI	
1. Policy Particulars :- OWN DAMAGE				
Insured Veh.			Veh. Inspected	SLK 5079R
Policy No.	DMHCSN1708051801		Coverage (\$)	0.00
Claim No.	SNM18D01470C01		Excess (\$)	1,000.00
Assign From	MERIMEN (ADELINE CHNG)		Assign Date	21/03/2018
2. Vehicle Particulars & Condition				
Make & Model			c.c	0
Engine No.	HIDDEN		Year of Reg.	
Chassis No.			Colour	
Odometer	-		Steering	
Brakes			Modification	
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	19/03/2018	Inspection Date	21/03/2018	
Survey held at	CHENG HOE MOTOR SERVICE 10 ANG MO KIO IND PARK 2A #01-04 ANG MO KIO AUTOPOINT, SINGAPORE 568047			
5a. Remarks				
A) THE MARKET VALUE IS S\$----- (EST. AVERAGE) B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.				

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	20 Mar 2018 Sendback Est	20 Mar 2018 16:06 S\$7,417.29	21 Mar 2018 14:22 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS

Insured:	KIRALY AUTOMOBILE PTE LTD, Co. Reg. No.: 201436970K		
Vehicle Reg. No.:	SLK5079R	Date of Loss:	19/03/2018 07:00 - :59
Claim Type:	OD / SNM18D01470C01	Policy/Cover Note No.:	DMHCSN1708051801 (Comprehensive)
		Excess:	S\$1,000.00
Repairer:	Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A, 768761 Yishun - Tel: 6755 6142		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Adeline Chng Pei Wen]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 02/04/2018]		
Driver/Custodian:	LOW LI NENG (LIU LINENG) (35 / Male), NRIC: S8226805G, Tel: +6590255688		
Adj Asg. Remarks:	survey revert		

ASSOCIATED MAIL RECEIVED
[View All](#)
[Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#)
[Search Tasks](#)
[Create New Task](#)
[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

View Received Message

This mail is associated with :

SLK5079R (SNM18D01470C01)

OD

Mar 19 2018 7:00AM

[KIRALY AUTOMOBILE PTE LTD]

Cheng Hoe Motor Pte Ltd

[Reply](#)[Reply All](#)[Mark as Unread](#)[Print Message](#)[Delete Message](#)[Forward](#)

From China Taiping Insurance (Singapore) Pte. Ltd. (HQ) (CHINA_TAIPING), sent on 23/03/2018 10:58 AM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$7308.09) - SLK5079R - Claim Handler: Adeline Chng Pei Wen

Approved: 7308.09.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To:	China Taiping Insurance (Singapore) Pte. Ltd. 3 Anson Road #16-00 Springleaf Tower Singapore 079909	From:	LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
Attn:	Adeline Chng Pei Wen	Date:	22 Mar 2018

Preliminary Advice

Vehicle No	: SLK5079R	Accident Date	: 19/03/2018
Make	: MAZDA 2	Policy No.	: DMHCSN1708051801
Assignment Date	: 21/03/2018	Excess	: S\$1,000.00
Date of Inspection	: 21/03/2018	Est. Duration of Repair	: 8.00
Inspection At	: CHENG HOE MOTOR PTE LTD (YISHUN) BLK 1019 #01-374/382, YISHUN INDUSTRIAL PARK A SINGAPORE 768761		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	7,417.29
Revised Amount	:S\$	5,316.09
Check Items (Estimated)	:S\$	1,992.00
Total	:S\$	7,308.09

Lump Sum Repair :S\$

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	70,000.00
COE / PARF Rebate	:S\$	53,351.00
Salvage Value	:S\$	
Margin for Repair	:S\$	16,649.00

Brake System : In Order
Steering System : In Order
Tyre Condition (Front) : 9/9 mm
Tyre Condition (Rear) : 2/2 mm

Remarks

(X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.

() The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	6970K
Vehicle Details	
Vehicle No.:	SLK5079R
Vehicle to be Exported:	No
Intended De-registration Date:	19 Mar 2018
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA2 SEDAN 1.5L SP.6EAT (LED)
Primary Colour:	White
Manufacturing Year:	2016
Engine No.:	P520347111
Chassis No.:	MM6DL2SAAGW191588
Maximum Power Output:	85.0 kW (113 bhp)
Open Market Value:	\$17,576.00
Original Registration Date:	18 Jan 2017
First Registration Date:	18 Jan 2017
Transfer Count:	0
Actual ARF Paid:	\$12,576.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	17 Jan 2027
PARF Rebate Amount:	\$9,432.00
Intended COE Rebate Details	
COE Expiry Date:	17 Jan 2027
COE Category:	E - Open Category
COE Period(Years):	10
QP Paid:	\$50,389.00
COE Rebate Amount:	\$43,919.00
Total Rebate Amount:	\$53,351.00

The information contained herein is correct as at 19 Mar 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	19/03/2018 12:15
Date Of Accident	19/03/2018 07:45
Exact Location Of Accident	CTE (BEFORE AMK AVE 1 EXIT)
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLK5079R
Insured/Policyholder	
Name Of Registered Owner	KIRALY AUTOMOBILE PTE LTD
Co Reg No	201436970K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-90255688

Vehicle Particulars

Manufacturer	MAZDA
Model	2-1.5 SEDAN L SP.6EAT (A)
Exact Purpose for which vehicle was being used at time of accident	IN TRANSIT FOR GRAB/ UBER
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE HIRE

Insurance Company

Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMHCSN1708051801
Cover Note Number	18/01/2018 - 17/01/2019

Driver

Name of Driver	LOW LI NENG (LIU LINENG)
NRIC No	S8226805G
Date Of Birth	21/08/1982
Occupation	OUTDOOR
Date Of Driving Pass	25/11/2005
Driving Experience	12 YEARS AND 3 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90255688
Fax Number	
Contact Number	
Email Address	LINENG_LOW@HOTMAIL.SG

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

8

SKETCH PLAN

VEHICLE NO.: SLK 5079R
INSURER : China
DATE & TIME: 19/03/2018 @ 0745

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "**Personal Information**") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "**Insurers**"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (collectively the "**Purposes**")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time:

190318

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name: Danyu (AME)
NRIC/FIN No.:

19/03/18

**CHENG HOE MOTOR PTE
LTD
BLK 1019, YISHUN
INDUSTRIAL PARK A
#01-374/382
SINGAPORE 768761**

Claim Reference:
Assessment Number: CSLK5079
Version: CHENGHOE/1
Date Calculated: 20/03/2018 06:21

Full Report - V1
Registration: SLK5079R
Printed: 20/03/2018 15:57

Summary Information

Claim			
Location:	Singapore (SG)	Currency:	SGD
Printed by:	CHENG HOE MOTOR PTE LTD	Date of Incident:	19/03/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	8 day(s)
Policy Number:	DMHCSN1708051801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle		Model Specs	
Manufacturer:	MAZDA	FROM 04/2015	AIR CONDITIONING
Model:	2	COOLANT R134A	REAR ELECT WINDOWS
Sub Model:	BASE MODEL	CENTRAL LOCKING	ELECT FOLDING MIRROR
Model Sheet Number:	I2M 01	TOE ASSISTANCE	FOG LAMPS
Registration:	SLK5079R	AUTO HEADLAMP LEVEL	PAINTED DOOR MIRRORS
Registration Month:	January	ANTI-THEFT ALARM	REARVIEW CAMERA
Registration Year:	2017	1.5 LTR 85KW	AUTO GEARBOX 6 SPEED
VIN Number:	MM6DL2SAAGW191588	STABILITY PROGRAM	TYRES 185/65 TR 15
Manufacture Year:	2016	WHEELS 5.5J X 15 ALU	I-STOP SYSTEM
Odometer:	Not Known	PASS AIRBAG SWITCH	HEAD AIRBAG
Colour:	White	SIDE AIRBAGS	5-DOOR
Engine Number:		PREPARE OFF VEHICLE	TWO COAT PEARL/MICA
Fuel Level:	%		

Vehicle Condition

Vehicle Status
Pre-Accident Condition:
Steering:

Brakes Pedal Travel:
Place of Inspection:
Pre-Accident Damage:



Tyres Condition:
Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

Severity of Impact:
Vehicle Status on
Inspection:
Date of Inspection:

20/03/2018

LKK Auto Consultants hence notify the Repairer of the following:
• To resurvey before/after spray painting
• To display damaged part(s) during resurvey
• Parts prices are subject to confirmation
• Third party survey is on a "Without Prejudice" basis
• No illegal modification(s) is allowed
• Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

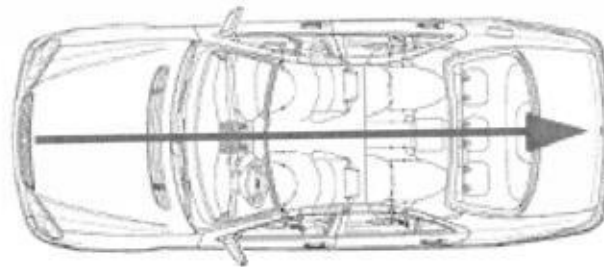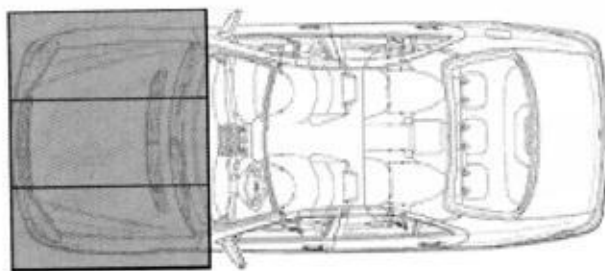CHENG HOE MOTOR PTE LTD**Claim Reference:****Assessment Number: CSLK5079****Version: CHENGHOE/1****Date Calculated: 20/03/2018 06:21****Full Report - V1****Registration: SLK5079R****Printed: 20/03/2018 15:57****Addresses****Repairer**

Name : CHENG HOE MOTOR PTE LTD (AMK)

Address :

10, ANG MO KIO IND PK 2A

01-04

Post Code : 568047

Cost Summary

Total Labour	\$1,012.20
Total Paint/Material	\$277.09
Total Parts	\$6,023.00
Total of Additional Costs	\$105.00
Excess:	TBA
Grand Total Exc GST:	\$7,417.29
7 % GST:	\$519.21
Grand Total Inc GST:	\$7,936.50

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$42.00/HR

Repair /**Guide Number Repair Details**

		WU	Cost Price (\$)
E0201A-R-X	R + R RADIATOR	12.0	50.40
	INCLUDES: R + R FAN		
S0612X-R-X)	R + R FRONT PANEL	9.0	37.80
S0601B-R-X)	R + R LEFT FRONT WING	2.0	8.40
S0601B-R-X)	R + R RIGHT FRONT WING	2.0	8.40
S0201G-R-X	RENEW FRONT BUMPER	9.0	37.80
	INCLUDES: R + R BUMPER AND NECESSARY		
	ATTACHED PARTS		
T0301C-R-X)	R + R BOTH HEADLAMPS	2.0	8.40
S0503X-R-X	RENEW BONNET	5.0	21.00
	INCLUDES: R + R BONNET AND		
	REQUIRED ATTACHED PARTS ASSEMBLE		
S0504B-R-X)	RENEW BONNET HINGE/S	3.0	12.60
F0105X-R-X	R + R AIR CLEANER	3.0	12.60
U0004X-R-X	DRAIN + REFILL AIR CONDITIONING	7.0	29.40
U0707X-R-X)	R + R CONDENSER	1.0	4.20
0245	PANEL WORK FRONT	10 20.0*	84.00
1111	REPAIR L/F SIDE MEMBER CPL	10 20.0*	84.00
1112	REPAIR R/F SIDE MEMBER CPL	10 20.0*	84.00

LABOUR COST

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSLK5079

Version: CHENGHOE/1

Date Calculated: 20/03/2018 06:21

Full Report - V1

Registration: SLK5079R

Printed: 20/03/2018 15:57

Total Work Units	115.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	11.5HRS	\$483.00
Paint Labour	12.6HRS	\$529.20
Total Labour	24.1HRS	\$1,012.20

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
340	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	22.0	
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
1018	LOCK CARR CTR SUPP SURFACE PAINT	4.0	
281	FRONT BUMPER NEW PART PAINT K1R	11.0	
410	GRILLE NEW PART PAINT K1R	4.0	
343	FRT TOWING EYE COVERSURFACE PAINT PLAST.	3.0	
1111	L/F SIDE MEMBER CPL SURFACE PAINT	6.0	
1112	R/F SIDE MEMBER CPL SURFACE PAINT	6.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	8.0	
LABOUR COST - PAINT			
TIME(PAINT)		96.0	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		126.0	
Total Paintwork Labour		12.6HRS	\$529.20
MATERIAL COST - PAINT			Cost Price
New Part Painting			\$109.90
New Part Painting - Plastic K1R			\$61.99
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$67.23
Surface Paint Plastic			\$0.37
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$277.09
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$277.09

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
8402	1	AIR DUCT HOUSING	P53T133AY		0% 42.00* ✓
8403	1	AIR FILTER RESONATOR	P53N13195		0% CRA 70.00* ✓
8401	1	AIR FILTER UPPER HSG	P53T133AX		0% DD 45.00* ✓
471	1	BONNET	DAY05231X		0% Bu 380.00* ✓
493	1	BONNET LOCK	D09K56620		0% D11 80.00* ✓
974	1	BONNET LOCK COVER	DA6T56627		0% D11 18.00* ✓
4465	1	CONDENSER	DF7B61480A		0% BT 420.00* ✓
7787	1	EXPANSION TANK	P53W15351A		0% D11 35.00* ✓
7788	1	EXPANSION TANK CAP	P53W15355		0% D11 15.00* ✓

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSLK5079

Version: CHENGHOE/1

Date Calculated: 20/03/2018 06:21

Full Report - V1

Registration: SLK5079R

Printed: 20/03/2018 15:57

530	1	FRONT BONNET SEAL	DA6T56770	0%	CR	40.00*	✓
281	1	FRONT BUMPER	DA6J50031GBB	0%	R	450.00*	✓
431	1	FRONT MANUFACT BADGE	LD4751731	0%	CR	18.00*	✓
1009	1	FRONT PANEL	DA6V53110C	0%	CR	210.00*	✓
293	1	FRT BUMPER ABSORBER	DA6V50111	0%	nn	60.00*	7X
340	1	FRT BUMPER SUPPORT	D09H50070	0%	CRA	230.00*	7X
336	1	FRT CTR BUMPER REINF	DA6V500S0C	0%	nn	60.00*	7X
529	1	FRT ENGINE COMP SEAL	DA6T56750A	0%	nn	50.00*	7X
410	1	GRILLE	DA6B50712A	0%	CR	150.00*	✓
1000	1	H/LAMP LWR BRKTS X 2	Renew	0%	nn	20.00*	7X
9645	1	HORN	D09W6679Y	0%	CRA	80.00*	7X
475	1	L/BONNET HINGE	D09H52420	0%	CR	28.00*	✓
355	1	L/F BUMPER BRACKET	DA6J500U1B	0%	CR	14.00*	7X
317	1	L/F BUMPER GUIDE	DA6J50132A	0%	CR	18.00*	7X
561	1	L/F HEADLAMP	DA6J510L0A	0%	ngent	920.00*	✓
741	1	L/F WING	DA6V52211	0%	CR	145.00*	✓
365	1	L/GRILLE MOULDING	DA6B507K0	0%	CR	90.00*	✓
1018	1	LOCK CARR CTR SUPP	DA6V5215Y	0%	R	25.00*	✓
476	1	R/BONNET HINGE	D09H52410	0%	CR	28.00*	✓
356	1	R/F BUMPER BRACKET	DA6J500T1B	0%	DIS	14.00*	7X
318	1	R/F BUMPER GUIDE	DA6J50122A	0%	DD	18.00*	7X
562	1	R/F HEADLAMP	DA6J510K0A	0%	ngent	920.00*	✓
742	1	R/F WING	DA6V52111	0%	CR	145.00*	✓
366	1	R/GRILLE MOULDING	DA6B507J0	0%	CR	90.00*	✓
425	1	RAD GRILLE BRACKET	DA6B50717A	0%	CRA	55.00*	7X
7761	1	RADIATOR	P53W15200	0%	Hous CRA	430.00*	7X
7764	1	RADIATOR SHROUD CPL	P53W15025	0%	CRA	490.00*	7X
1021	1	UPP FRT PANEL COVER	DA6V53175	0%	CR	20.00*	✓
f: OEM Parts		Sub Total				\$5,923.00	
g: Original		Sundry Parts			(Fixed)	\$100.00	
h: Secondhand		Total Parts				\$6,023.00	
p: Parallel							
x: Exchange							

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
COOLANT	0%	\$20.00 ✓
AC GAS		\$50.00 ✓
FRT NO PLATE	0%	\$35.00 ✓
Total Extras		\$105.00

Final Calculation

Total Parts	\$6,023.00
Labour	
Total Panel/Mechanical	\$483.00 357
Total Paintwork	\$529.20 546 529.20
Total Labour	\$1,012.20
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$105.00
Total of Additional Costs	\$105.00
Total Paint/Material Costs	\$277.09

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSLK5079

Version: CHENGHOE/1

Date Calculated: 20/03/2018 06:21

Full Report - V1

Registration: SLK5079R

Printed: 20/03/2018 15:57

Grand Total Excludes GST

\$7,417.29

GST @ 7 %

\$519.21

Grand Total Includes GST

\$7,936.50

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Revert

Claim Reference: 18/1470
Assessment Number: CSLK5079
Version: CHINATAI/2
Date Calculated: 22/03/2018 06:15

Full Report - V1
Registration: SLK5079R
Printed: 22/03/2018 14:17

Summary Information



Claim			
Location:	Singapore (SG)	Currency:	SGD
Printed by:	MR LAU	Date of Incident:	19/03/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	18/1470	Estimated Repair Time:	8 day(s)
Policy Number:	DMHCSN1708051801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle		Model Specs	
Manufacturer:	MAZDA	FROM 04/2015	AIR CONDITIONING
Model:	2	COOLANT R134A	REAR ELECT WINDOWS
Sub Model:	BASE MODEL	CENTRAL LOCKING	ELECT FOLDING MIRROR
Model Sheet Number:	I2M 01	TOE ASSISTANCE	FOG LAMPS
Registration:	SLK5079R	AUTO HEADLAMP LEVEL	PAINTED DOOR MIRRORS
Registration Month:	January	ANTI-THEFT ALARM	REARVIEW CAMERA
Registration Year:	2017	1.5 LTR 85KW	AUTO GEARBOX 6 SPEED
VIN Number:	MM6DL2SAAGW191588	STABILITY PROGRAM	TYRES 185/65 TR 15
Manufacture Year:	2016	WHEELS 5.5J X 15 ALU	I-STOP SYSTEM
Odometer:	Not Known	PASS AIRBAG SWITCH	HEAD AIRBAG
Colour:	White	SIDE AIRBAGS	5-DOOR
Engine Number:		PREPARE OFF VEHICLE	TWO COAT PEARL/MICA
Fuel Level:	%		

Vehicle Condition

Vehicle Status		
Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	20/03/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

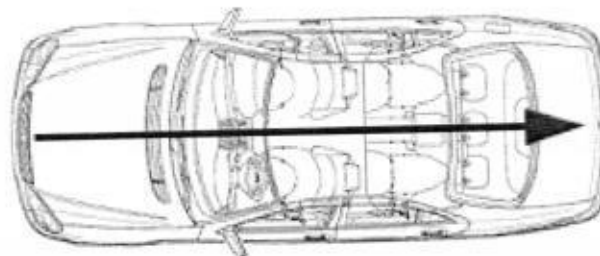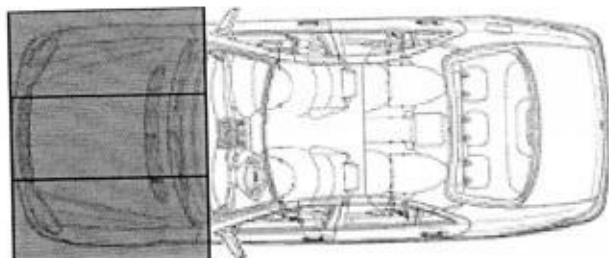

Addresses

Repairer

Name : CHENG HOE MOTOR PTE LTD (AMK)
 Address :
 10. ANG MO KIO IND PK 2A
 01-04
 Post Code : 568047

Cost Summary

Total Labour	\$903.00
Total Paint/Material	\$277.09
Total Parts	\$6,023.00
Total of Additional Costs	\$105.00
Repair Cost Exc GST:	\$7,308.09
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,000.00
After Deduction -	
Grand Total Exc GST:	\$6,308.09
7 % GST:	\$441.57
Grand Total Inc GST:	\$6,749.66

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
 Price/Dent = \$42.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
E0201A-R-X	R + R RADIATOR INCLUDES: R + R FAN	12.0	50.40
S0612X-R-X)	R + R FRONT PANEL	9.0	37.80
S0601B-R-X)	R + R LEFT FRONT WING	2.0	8.40
S0601B-R-X)	R + R RIGHT FRONT WING	2.0	8.40
S0201G-R-X	RENEW FRONT BUMPER INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS	9.0	37.80
T0301C-R-X)	R + R BOTH HEADLAMPS	2.0	8.40
S0503X-R-X	RENEW BONNET INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE	5.0	21.00
S0504B-R-X)	RENEW BONNET HINGE/S	3.0	12.60
F0105X-R-X	R + R AIR CLEANER	3.0	12.60
U0004X-R-X	DRAIN + REFILL AIR CONDITIONING	7.0	29.40
U0707X-R-X)	R + R CONDENSER	1.0	4.20
0245	PANEL WORK FRONT	10.0*	42.00
1111	REPAIR L/F SIDE MEMBER CPL	10.0*	42.00
1112	REPAIR R/F SIDE MEMBER CPL	10.0*	42.00

LABOUR COST

Total Work Units	85.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	8.5HRS	\$357.00
Paint Labour	13.0HRS	\$546.00
Total Labour	21.5HRS	\$903.00

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
340	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	22.0	
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
1018	LOCK CARR CTR SUPP SURFACE PAINT	4.0	
281	FRONT BUMPER NEW PART PAINT K1R	11.0	
410	GRILLE NEW PART PAINT K1R	4.0	
343	FRT TOWING EYE COVERSURFACE PAINT PLAST.	3.0	
1111	L/F SIDE MEMBER CPL SURFACE PAINT	10.0*	
1112	R/F SIDE MEMBER CPL SURFACE PAINT	6.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	8.0	
LABOUR COST - PAINT		100.0	
TIME(PAINT)		5.0	
Preparation Main Work Plastic		25.0	
Preparation Main Work Metal		0.0	
Preparation Work Multi Layer Paint		130.0	
Total Work Units (10WU/HR)		13.0HRS	\$546.00
Total Paintwork Labour			Cost Price
MATERIAL COST - PAINT			\$109.90
New Part Painting			\$61.99
New Part Painting - Plastic K1R			\$28.60
Material-Constant Main Work Metal			\$67.23
Surface-/Blend Paint			\$0.37
Surface Paint Plastic			\$9.00
Material-Const Main Work Plastic			\$277.09
Total Excluding Pearlescent Uplift			\$0.00
Pearlescent Uplift @ 0.0%			\$277.09
Total Paint Material Cost			

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
8402	1	AIR DUCT HOUSING	P53T133AY		0% 42.00*
8403	1	AIR FILTER RESONATOR	P53N13195		0% 70.00*
8401	1	AIR FILTER UPPER HSG	P53T133AX		0% 45.00*
471	1	BONNET	DAY05231X		0% 380.00*
493	1	BONNET LOCK	D09K56620		0% 80.00*
974	1	BONNET LOCK COVER	DA6T56627		0% 18.00*
4465	1	CONDENSER	DF7B61480A		0% 420.00*
7787	1	EXPANSION TANK	P53W15351A		0% 35.00*

7788	1	EXPANSION TANK CAP	P53W15355	0%	15.00*
530	1	FRONT BONNET SEAL	DA6T56770	0%	40.00*
281	1	FRONT BUMPER	DA6J50031GBB	0%	450.00*
431	1	FRONT MANUFACT BADGE	LD4751731	0%	18.00*
1009	1	FRONT PANEL	DA6V53110C	0%	210.00*
293	1	FRT BUMPER ABSORBER	DA6V50111	0%	60.00*
340	1	FRT BUMPER SUPPORT	D09H50070	0%	230.00*
336	1	FRT CTR BUMPER REINF	DA6V500S0C	0%	60.00*
529	1	FRT ENGINE COMP SEAL	DA6T56750A	0%	50.00*
410	1	GRILLE	DA6B50712A	0%	150.00*
1000	1	H/LAMP LWR BRKTS X 2	Renew	0%	20.00*
9645	1	HORN	D09W6679Y	0%	80.00*
475	1	L/BONNET HINGE	D09H52420	0%	28.00*
355	1	L/F BUMPER BRACKET	DA6J500U1B	0%	14.00*
317	1	L/F BUMPER GUIDE	DA6J50132A	0%	18.00*
561	1	L/F HEADLAMP	DA6J510L0A	0%	920.00*
741	1	L/F WING	DA6V52211	0%	145.00*
365	1	L/GRILLE MOULDING	DA6B507K0	0%	90.00*
1018	1	LOCK CARR CTR SUPP	DA6V5215Y	0%	25.00*
476	1	R/BONNET HINGE	D09H52410	0%	28.00*
356	1	R/F BUMPER BRACKET	DA6J500T1B	0%	14.00*
318	1	R/F BUMPER GUIDE	DA6J50122A	0%	18.00*
562	1	R/F HEADLAMP	DA6J510K0A	0%	920.00*
742	1	R/F WING	DA6V52111	0%	145.00*
366	1	R/GRILLE MOULDING	DA6B507J0	0%	90.00*
425	1	RAD GRILLE BRACKET	DA6B50717A	0%	55.00*
7761	1	RADIATOR	P53W15200	0%	430.00*
7764	1	RADIATOR SHROUD CPL	P53W15025	0%	490.00*
1021	1	UPP FRT PANEL COVER	DA6V53175	0%	20.00*
f: OEM Parts				Sub Total	\$5,923.00
g: Original				Sundry Parts	\$100.00
h: Secondhand				Total Parts	\$6,023.00
p: Parallel					
x: Exchange					

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras	Description	Betterment	Price
	COOLANT	SPECIALIST 0%	\$20.00
	AC GAS	SPECIALIST	\$50.00
	FRT NO PLATE	SPECIALIST 0%	\$35.00
	Total Extras		\$105.00

Final Calculation

Total Parts		\$6,023.00
Labour		
Total Panel/Mechanical	\$357.00	
Total Paintwork	\$546.00	
Total Labour		\$903.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$105.00	
Total of Additional Costs		\$105.00

Total Paint/Material Costs		\$277.09
Repair Costs Excludes GST		\$7,308.09
Deductions		
Deduction for Excess (Fixed)	-\$1,000.00	
Total Deductions		-\$1,000.00
Grand Total Excludes GST (After Deduction)		\$6,308.09
GST @ 7 %		\$441.57
Grand Total Includes GST (After Deduction)		\$6,749.66

Assessment Notes

**CHENG HOE MOTOR PTE
LTD
BLK 1019, YISHUN
INDUSTRIAL PARK A
#01-374/382
SINGAPORE 768761**

Claim Reference:
Assessment Number: CSLK5079
Version: CHENGHOE/1
Date Calculated: 31/03/2018 08:03

Full Report - V1
Registration: SLK5079R
Printed: 31/03/2018 15:05

Summary Information

Claim			
Location:	Singapore (SG)	Currency:	SGD
Printed by:	CHENG HOE MOTOR PTE LTD	Date of Incident:	19/03/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	8 day(s)
Policy Number:	DMHCSN1708051801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle		Model Specs	
Manufacturer:	MAZDA	FROM 04/2015	AIR CONDITIONING
Model:	2	COOLANT R134A	REAR ELECT WINDOWS
Sub Model:	BASE MODEL	CENTRAL LOCKING	ELECT FOLDING MIRROR
Model Sheet Number:	I2M 01	TOE ASSISTANCE	FOG LAMPS
Registration:	SLK5079R	AUTO HEADLAMP LEVEL	PAINTED DOOR MIRRORS
Registration Month:	January	ANTI-THEFT ALARM	REARVIEW CAMERA
Registration Year:	2017	1.5 LTR 85KW	AUTO GEARBOX 6 SPEED
VIN Number:	MM6DL2SAAGW191588	STABILITY PROGRAM	TYRES 185/65 TR 15
Manufacture Year:	2016	WHEELS 5.5J X 15 ALU	I-STOP SYSTEM
Odometer:	Not Known	PASS AIRBAG SWITCH	HEAD AIRBAG
Colour:	White	SIDE AIRBAGS	5-DOOR
Engine Number:		PREPARE OFF VEHICLE	TWO COAT PEARL/MICA
Fuel Level:	%		

Vehicle Condition

Vehicle Status		
Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
	Date of Inspection:	20/03/2018
Brakes Pedal Travel:		
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSLK5079



Version: CHENGHOE/1

Date Calculated: 31/03/2018 08:03

Full Report - V1

Registration: SLK5079R

Printed: 31/03/2018 15:05

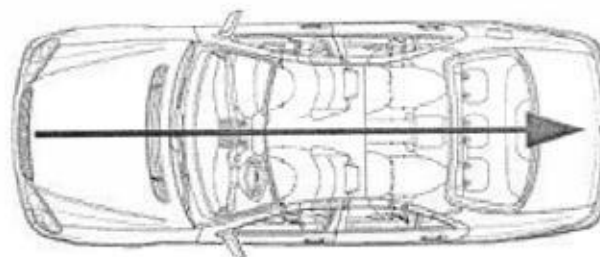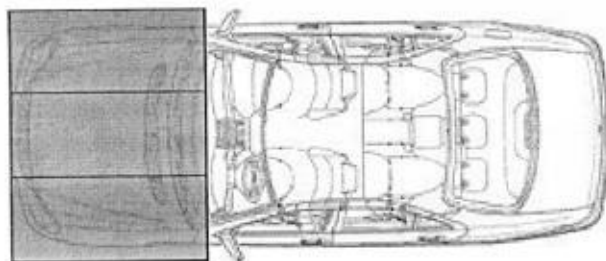**Addresses****Repairer**

Name : CHENG HOE MOTOR PTE LTD (AMK)

Address :

10, ANG MO KIO IND PK 2A

01-04

Post Code : 568047

Cost Summary

Total Labour	\$886.20
Total Paint/Material	\$277.09
Total Parts	\$5,833.00
Total of Additional Costs	\$105.00
Excess:	TBA
Grand Total Exc GST:	\$7,101.29
7 % GST:	\$497.09
Grand Total Inc GST:	\$7,598.38

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$42.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
E0201A-R-X	R + R RADIATOR INCLUDES: R + R FAN	12.0	50.40
S0612X-R-X)	R + R FRONT PANEL	9.0	37.80
S0601B-R-X)	R + R LEFT FRONT WING	2.0	8.40
S0601B-R-X)	R + R RIGHT FRONT WING	2.0	8.40
S0201G-R-X	RENEW FRONT BUMPER INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS	9.0	37.80
T0301C-R-X)	R + R BOTH HEADLAMPS	2.0	8.40
S0503X-R-X	RENEW BONNET INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE	5.0	21.00
S0504B-R-X)	RENEW BONNET HINGE/S	3.0	12.60
F0105X-R-X	R + R AIR CLEANER	3.0	12.60
U0004X-R-X	DRAIN + REFILL AIR CONDITIONING	7.0	29.40
U0707X-R-X)	R + R CONDENSER	1.0	4.20
0245	PANEL WORK FRONT	10.0*	42.00
1111	REPAIR L/F SIDE MEMBER CPL	10.0*	42.00
1112	REPAIR R/F SIDE MEMBER CPL	10.0*	42.00

LABOUR COST

CHENG HOE MOTOR PTE LTD

Claim Reference:
Assessment Number: CSLK5079
Version: CHENGHOE/1
Date Calculated: 31/03/2018 08:03

Full Report - V1
Registration: SLK5079R
Printed: 31/03/2018 15:05

Total Work Units	85.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	8.5HRS	\$357.00
Paint Labour	12.6HRS	\$529.20
Total Labour	21.1HRS	\$886.20

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
340	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	22.0	
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
1018	LOCK CARR CTR SUPP SURFACE PAINT	4.0	
281	FRONT BUMPER NEW PART PAINT K1R	11.0	
410	GRILLE NEW PART PAINT K1R	4.0	
343	FRT TOWING EYE COVERSURFACE PAINT PLAST.	3.0	
1111	L/F SIDE MEMBER CPL SURFACE PAINT	6.0	
1112	R/F SIDE MEMBER CPL SURFACE PAINT	6.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	8.0	
LABOUR COST - PAINT			
TIME(PAINT)		96.0	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		126.0	
Total Paintwork Labour		12.6HRS	\$529.20
MATERIAL COST - PAINT			Cost Price
New Part Painting			\$109.90
New Part Painting - Plastic K1R			\$61.99
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$67.23
Surface Paint Plastic			\$0.37
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$277.09
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$277.09

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Price (\$)
8402	1	AIR DUCT HOUSING	P53T133AY		0% 42.00*
8403	1	AIR FILTER RESONATOR	P53N13195		0% 70.00* ✓
8401	1	AIR FILTER UPPER HSG	P53T133AX		0% 45.00* ✓
471	1	BONNET	DAY05231X		0% 380.00*
493	1	BONNET LOCK	D09K56620		0% 80.00*
974	1	BONNET LOCK COVER	DA6T56627		0% 18.00*
4465	1	CONDENSER	DF7B61480A		0% 420.00* ✓
7787	1	EXPANSION TANK	P53W15351A		0% 35.00*
7788	1	EXPANSION TANK CAP	P53W15355		0% 15.00*

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSLK5079

Version: CHENGHOE/1

Date Calculated: 31/03/2018 08:03

Full Report - V1

Registration: SLK5079R

Printed: 31/03/2018 15:05

530	1	FRONT BONNET SEAL	DA6T56770	0%	40.00*
281	1	FRONT BUMPER	DA6J50031GBB	0%	450.00*
431	1	FRONT MANUFACT BADGE	LD4751731	0%	18.00*
1009	1	FRONT PANEL	DA6V53110C	0%	210.00*
340	1	FRT BUMPER SUPPORT	D09H50070	0%	cm 230.00* ✓
410	1	GRILLE	DA6B50712A	0%	150.00*
9645	1	HORN	D09W6679Y	0%	cm 80.00* ✓
475	1	L/BONNET HINGE	D09H52420	0%	28.00*
355	1	L/F BUMPER BRACKET	DA6J500U1B	0%	14.00*
317	1	L/F BUMPER GUIDE	DA6J50132A	0%	18.00*
561	1	L/F HEADLAMP	DA6J510L0A	0%	920.00*
741	1	L/F WING	DA6V52211	0%	145.00*
365	1	L/GRILLE MOULDING	DA6B507K0	0%	90.00*
1018	1	LOCK CARR CTR SUPP	DA6V5215Y	0%	25.00*
476	1	R/BONNET HINGE	D09H52410	0%	28.00*
356	1	R/F BUMPER BRACKET	DA6J500T1B	0%	n 14.00*
318	1	R/F BUMPER GUIDE	DA6J50122A	0%	n 18.00*
562	1	R/F HEADLAMP	DA6J510K0A	0%	920.00*
742	1	R/F WING	DA6V52111	0%	145.00*
366	1	R/GRILLE MOULDING	DA6B507J0	0%	90.00*
425	1	RAD GRILLE BRACKET	DA6B50717A	0%	cm 55.00* ✓
7761	1	RADIATOR	P53W15200	0%	1000 cm 430.00*
7764	1	RADIATOR SHROUD CPL	P53W15025	0%	cm 490.00* ✓
1021	1	UPP FRT PANEL COVER	DA6V53175	0%	20.00*
f: OEM Parts				Sub Total	\$5,733.00
g: Original				Sundry Parts	\$100.00
h: Secondhand				(Fixed)	
p: Parallel				Total Parts	\$5,833.00
x: Exchange					

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description		Betterment	Price
COOLANT	SPECIALIST	0%	\$20.00
AC GAS	SPECIALIST		\$50.00
FRT NO PLATE	SPECIALIST	0%	\$35.00
Total Extras			\$105.00

Final Calculation

Total Parts	\$5,833.00
Labour	
Total Panel/Mechanical	\$357.00
Total Paintwork	\$529.20
Total Labour	\$886.20
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$105.00
Total of Additional Costs	\$105.00
Total Paint/Material Costs	\$277.09
Grand Total Excludes GST	\$7,101.29
GST @ 7 %	\$497.09
Grand Total Includes GST	\$7,598.38

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSLK5079

Version: CHENGHOE/1

Date Calculated: 31/03/2018 08:03

Full Report - V1

Registration: SLK5079R

Printed: 31/03/2018 15:05

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference: 18/1470
Assessment Number: CSLK5079
Version: LKKAUTOC/4
Date Calculated: 06/04/2018 06:46

Full Report - V1
Registration: SLK5079R
Printed: 06/04/2018 13:47

Summary Information



Claim			
Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	19/03/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	18/1470	Estimated Repair Time:	8 day(s)
Policy Number:	DMHCSN1708051801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle		Model Specs	
Manufacturer:	MAZDA	FROM 04/2015	AIR CONDITIONING
Model:	2	COOLANT R134A	REAR ELECT WINDOWS
Sub Model:	BASE MODEL	CENTRAL LOCKING	ELECT FOLDING MIRROR
Model Sheet Number:	I2M 01	TOE ASSISTANCE	FOG LAMPS
Registration:	SLK5079R	AUTO HEADLAMP LEVEL	PAINTED DOOR MIRRORS
Registration Month:	January	ANTI-THEFT ALARM	REARVIEW CAMERA
Registration Year:	2017	1.5 LTR 85KW	AUTO GEARBOX 6 SPEED
VIN Number:	MM6DL2SAAGW191588	STABILITY PROGRAM	TYRES 185/65 TR 15
Manufacture Year:	2016	WHEELS 5.5J X 15 ALU	I-STOP SYSTEM
Odometer:	Not Known	PASS AIRBAG SWITCH	HEAD AIRBAG
Colour:	White	SIDE AIRBAGS	5-DOOR
Engine Number:		PREPARE OFF VEHICLE	TWO COAT PEARL/MICA
Fuel Level:	%		

Vehicle Condition

Vehicle Status		
Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
	Date of Inspection:	20/03/2018
Brakes Pedal Travel:		
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

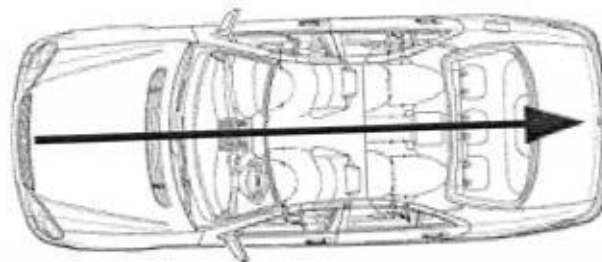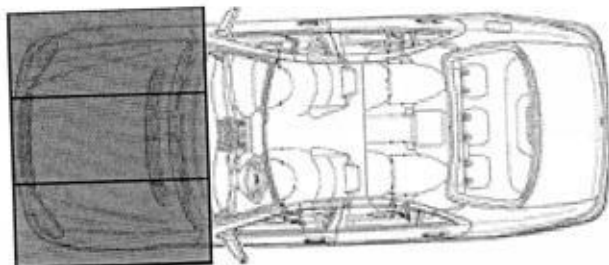

Addresses

Repairer

Name : CHENG HOE MOTOR PTE LTD (AMK)
Address :
10. ANG MO KIO IND PK 2A
01-04
Post Code : 568047

Cost Summary

Total Labour	\$886.20
Total Paint/Material	\$277.09
Total Parts	\$5,833.00
Total of Additional Costs	\$105.00
Repair Cost Exc GST:	\$7,101.29
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,000.00
After Deduction -	
Grand Total Exc GST:	\$6,101.29
7 % GST:	\$427.09
Grand Total Inc GST:	\$6,528.38

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$42.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
E0201A-R-X	R + R RADIATOR INCLUDES: R + R FAN	12.0	50.40
S0612X-R-X)	R + R FRONT PANEL	9.0	37.80
S0601B-R-X	R + R LEFT FRONT WING (BUMPER REMOVED) INCLUDES: LEFT HEADLAMP AND REQUIRED ATTACHED PARTS R + R	2.0	8.40
S0601B-R-X	R + R RIGHT FRONT WING (BUMPER REMOVED) INCLUDES: RIGHT HEADLAMP AND REQUIRED ATTACHED PARTS R + R	9.0	37.80
S0201G-R-X	RENEW FRONT BUMPER INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS	2.0	8.40
T0301C-R-X)	R + R BOTH HEADLAMPS	5.0	21.00
S0503X-R-X	RENEW BONNET INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE	3.0	12.60
S0504B-R-X)	RENEW BONNET HINGE/S	3.0	12.60
F0105X-R-X	R + R AIR CLEANER		

U0004X-R-X	DRAIN + REFILL AIR CONDITIONING	7.0	29.40
U0707X-R-X)	R + R CONDENSER	1.0	4.20
0245	PANEL WORK FRONT	10.0*	42.00
1111	REPAIR L/F SIDE MEMBER CPL	10.0*	42.00
1112	REPAIR R/F SIDE MEMBER CPL	10.0*	42.00
LABOUR COST		85.0	
Total Work Units		0.0HRS	0.00
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		8.5HRS	\$357.00
Sub Total		12.6HRS	\$529.20
Paint Labour		21.1HRS	\$886.20
Total Labour			

PAINT WORK Time Basis 10 WU = 1 HR. Price = \$42.00/HR
 Guide Number Description WU Cost Price (\$)

	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
340	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	22.0	
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
1018	LOCK CARR CTR SUPP SURFACE PAINT	4.0	
281	FRONT BUMPER NEW PART PAINT K1R	11.0	
410	GRILLE NEW PART PAINT K1R	4.0	
343	FRT TOWING EYE COVERSURFACE PAINT PLAST.	3.0	
1111	L/F SIDE MEMBER CPL SURFACE PAINT	6.0*	
1112	R/F SIDE MEMBER CPL SURFACE PAINT	6.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	8.0	

LABOUR COST - PAINT		96.0	
TIME(PAINT)		5.0	
Preparation Main Work Plastic		25.0	
Preparation Main Work Metal		0.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		126.0	
Total Paintwork Labour		12.6HRS	\$529.20

MATERIAL COST - PAINT			
New Part Painting			\$109.90
New Part Painting - Plastic K1R			\$61.99
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$67.23
Surface Paint Plastic			\$0.37
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$277.09
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$277.09

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
8402	1	AIR DUCT HOUSING	P53T133AY		0%	42.00*
8403	1	AIR FILTER RESONATOR	P53N13195		0%	70.00*

8401	1	AIR FILTER UPPER HSG	P53T133AX	0%	45.00*
471	1	BONNET	DAY05231X	0%	380.00*
493	1	BONNET LOCK	D09K56620	0%	80.00*
974	1	BONNET LOCK COVER	DA6T56627	0%	18.00*
4465	1	CONDENSER	DF7B61480A	0%	420.00*
7787	1	EXPANSION TANK	P53W15351A	0%	35.00*
7788	1	EXPANSION TANK CAP	P53W15355	0%	15.00*
530	1	FRONT BONNET SEAL	DA6T56770	0%	40.00*
281	1	FRONT BUMPER	DA6J50031GBB	0%	450.00*
431	1	FRONT MANUFACT BADGE	LD4751731	0%	18.00*
1009	1	FRONT PANEL	DA6V53110C	0%	210.00*
340	1	FRT BUMPER SUPPORT	D09H50070	0%	230.00*
410	1	GRILLE	DA6B50712A	0%	150.00*
1000	1	H/LAMP LWR BRKTS X 2	Renew	0%	0.00
9645	1	HORN	DB1L6679Y	0%	80.00*
475	1	L/BONNET HINGE	D09H52420	0%	28.00*
355	1	L/F BUMPER BRACKET	DA6J500U1B	0%	14.00*
317	1	L/F BUMPER GUIDE	DA6J50132A	0%	18.00*
561	1	L/F HEADLAMP	DA6J510L0A	0%	920.00*
741	1	L/F WING	DA6V52211	0%	145.00*
365	1	L/GRILLE MOULDING	DA6B507K0	0%	90.00*
1018	1	LOCK CARR CTR SUPP	DA6V5215Y	0%	25.00*
476	1	R/BONNET HINGE	D09H52410	0%	28.00*
356	1	R/F BUMPER BRACKET	DA6J500T1B	0%	14.00*
318	1	R/F BUMPER GUIDE	DA6J50122A	0%	18.00*
562	1	R/F HEADLAMP	DA6J510K0A	0%	920.00*
742	1	R/F WING	DA6V52111	0%	145.00*
366	1	R/GRILLE MOULDING	DA6B507J0	0%	90.00*
425	1	RAD GRILLE BRACKET	DA6B50717A	0%	55.00*
7761	1	RADIATOR	P53W15200	0%	430.00*
7764	1	RADIATOR SHROUD CPL	P53W15025	0%	490.00*
1021	1	UPP FRT PANEL COVER	DA6V53175	0%	20.00*
Sub Total					\$5,733.00
Sundry Parts				(Fixed)	\$100.00
Total Parts					\$5,833.00

f: OEM Parts
g: Original
h: Secondhand
p: Parallel
x: Exchange

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras	Description	SPECIALIST	Betterment	Price
	COOLANT	SPECIALIST	0%	\$20.00
	AC GAS	SPECIALIST		\$50.00
	FRT NO PLATE	SPECIALIST	0%	\$35.00
	Total Extras			\$105.00

Final Calculation

\$5,833.00

Total Parts

Labour

Total Panel/Mechanical
Total Paintwork

\$357.00
\$529.20

\$886.20

Total Labour

Additional Costs

Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$105.00	\$105.00
Total of Additional Costs		\$277.09
Total Paint/Material Costs		\$7,101.29
Repair Costs Excludes GST		
Deductions		
Deduction for Excess (Fixed)	-\$1,000.00	-\$1,000.00
Total Deductions		\$6,101.29
Grand Total Excludes GST (After Deduction)		\$427.09
GST @ 7 %		\$6,528.38
Grand Total Includes GST (After Deduction)		

Assessment Notes

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CT118005298/KVBN2

Date: 09/04/2018

REFERENCE

Insured/Claimant: KIRALY AUTOMOBILE PTE LTD Policy No: DMHCSN1708051801
Date of Loss: 19/03/2018 Nature of Claim: OD Claim No: SNM18D01470C01

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SLK5079R Engine No: P520347111
Make & Model: MAZDA 2, 1.5 SEDAN L SP.6EAT (A) Chassis No: MM6DL2SAAGW191588
Reg. Date: 18/01/2017 (Man. Year: 2016) Odometer: 83452 km
Colour: Metallic Pearl White
Engine Capacity: 1496 cc
Market Value/New Car Price: S\$70,000.00
Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/60R16 Rear Tyre Size: 195/60R16
Front Left Side: MAXIMUS 9 mm Rear Left Side: Dunlop 2 mm
Front Right Side: MAXIMUS 9 mm Rear Right Side: Dunlop 2 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	5,923.00	5,733.00	190.00	3.21
Miscellaneous Items	205.00	205.00	0.00	0.00
Labour	1,289.29	1,163.29	126.00	9.77
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	7,417.29	7,101.29	316.00	4.26
- Excess (S\$)	1,000.00	1,000.00	0.00	0.00
(S\$)	6,417.29	6,101.29	316.00	4.92
+ GST 7.00/7.00% (S\$)	449.21	427.09	22.12	4.92
Nett Amount (S\$)	6,866.50	6,528.38	338.12	4.92

INSPECTION

Date of Assignment: 21/03/2018 Present Location: Cheng Hoe Motor Pte Ltd (Yishun)
Date Inspected: 21/03/2018 Inspected At: Cheng Hoe Motor Pte Ltd (Yishun)
Blk 1019 #01-374/382, Yishun Industrial Park A
Singapore 768761

Estimated Period of Repair: 8.0 days

Adjuster: KENNETH KONG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 09 Apr 2018)
Parts: 143	MAZDA 2 1.5 SEDAN L SP.6EAT (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLK5079R)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*AIR DUCT HOUSING	Dented	42.00 F	*42.00 F
2	1	NA	*AIR FILTER RESONATOR	Cracked	70.00 F	*70.00 F
3	1	NA	*AIR FILTER UPPER HSG	Dented	45.00 F	*45.00 F
4	1	NA	*BONNET	Buckled	380.00 F	*380.00 F
5	1	NA	*BONNET LOCK	Distorted	80.00 F	*80.00 F
6	1	NA	*BONNET LOCK COVER	Dented	18.00 F	*18.00 F
7	1	NA	*CONDENSER	Bent	420.00 F	*420.00 F
8	1	NA	*EXPANSION TANK	Dented	35.00 F	*35.00 F
9	1	NA	*EXPANSION TANK CAP	Missing	15.00 F	*15.00 F
10	1	NA	*FRONT BONNET SEAL	Cut	40.00 F	*40.00 F
11	1	NA	*FRONT BUMPER	Bent	450.00 F	*450.00 F
12	1	NA	*FRONT MANUFACT BADGE	Necessary	18.00 F	*18.00 F
13	1	NA	*FRONT PANEL	Cracked	210.00 F	*210.00 F
14	1	NA	*FRT BUMPER ABSORBER	Not Necessary	60.00 F	*- F
15	1	NA	*FRT BUMPER SUPPORT	Cracked	230.00 F	*230.00 F
16	1	NA	*FRT CTR BUMPER REINF	Not Necessary	60.00 F	*- F
17	1	NA	*FRT ENGINE COMP SEAL	Not Necessary	50.00 F	*- F
18	1	NA	*GRILLE	Cracked	150.00 F	*150.00 F
19	1	NA	*H/LAMP LWR BRKTS X 2	Not Necessary	20.00 F	*- F
20	1	NA	*HORN	Cracked	80.00 F	*80.00 F
21	1	NA	*L/BONNET HINGE	Distorted	28.00 F	*28.00 F
22	1	NA	*L/F BUMPER BRACKET	Cracked	14.00 F	*14.00 F
23	1	NA	*L/F BUMPER GUIDE	Cracked	18.00 F	*18.00 F
24	1	NA	*L/F HEADLAMP	Mtg Cracked	920.00 F	*920.00 F
25	1	NA	*L/F WING	Buckled	145.00 F	*145.00 F
26	1	NA	*L/GRILLE MOULDING	Cracked	90.00 F	*90.00 F
27	1	NA	*LOCK CARR CTR SUPP	Bent	25.00 F	*25.00 F
28	1	NA	*R/BONNET HINGE	Distorted	28.00 F	*28.00 F
29	1	NA	*R/F BUMPER BRACKET	Distorted	14.00 F	*14.00 F
30	1	NA	*R/F BUMPER GUIDE	Dented	18.00 F	*18.00 F
31	1	NA	*R/F HEADLAMP	Mtg Cracked	920.00 F	*920.00 F
32	1	NA	*R/F WING	Buckled	145.00 F	*145.00 F
33	1	NA	*R/GRILLE MOULDING	Cracked	90.00 F	*90.00 F
34	1	NA	*RAD GRILLE BRACKET	Cracked	55.00 F	*55.00 F
35	1	NA	*RADIATOR	Housing Cracked	430.00 F	*430.00 F
36	1	NA	*RADIATOR SHROUD CPL	Cracked	490.00 F	*490.00 F
37	1	NA	*UPP FRT PANEL COVER	Cracked	20.00 F	*20.00 F
F=Franchise part.					Total Parts (\$\$)	5,923.00 5,733.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	SPECIALIST AC GAS	50.00	50.00
2	1	SPECIALIST COOLANT Necessary	20.00	20.00
3	1	SPECIALIST FRT NO PLATE Cracked	35.00	35.00
4	1	SUNDRY PARTS Necessary	100.00	100.00
Sub Total (S\$)			205.00	205.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	529.20	529.20
2	Total Paint Materials	New	277.09	277.09
3	Total Panel/Mechanical Labour	New	483.00	357.00
Gross Labour Cost (S\$)			1,289.29	1,163.29

Report was unsubmitted during this print-out.

< END OF ESTIMATES >